Alliance Geotechnical

Engineering | Environmental | Testing

Supplementary Contamination Assessment
Lot 3991 in DP1190132

Jordan Springs Boulevard, Jordan Springs, NSW

Prepared for: LLRL Management Services Pty Ltd as Trustee
of LLRL Management Services Trust

Report Number: 7161-ER-1-3
Report Date: 20 April 2018

Manage the earth, reduce the risk

We give you the right information to make the right decisions

Alliance Geotechnical Pty Ltd
10 Welder Road, Seven Hills, NSW
Phone: 1800 288 188 – Email: enviro@allgeo.com.au - Web: www.allgeo.com.au

NOTICE: The information in this report is privileged and confidential, intended only for the use of the person nominated. This publication may not, therefore, be lent, copied, photocopied, reproduced, translated or reduced to any electronic medium or machine readable form without the express written permission of the publisher.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TABLE OF CONTENTS

EXECUTIVE SUMMARY 6
1. INTRODUCTION 8
1.1. Background 8
1.2. Objectives 8
1.3. Scope of Work 8
2. SITE IDENTIFICATION 9
3. SITE HISTORY AND LAND USE 10
3.1. Aerial Imagery 10
3.2. Anecdotal Information 11
3.3. Incident Reports 11
3.4. Complaints History 11
3.5. Previous Contamination Assessments 11
3.5.1. URS (2008) 11
3.5.2. Douglas Partners (2017) 12
4. REGULATORY RECORDS 14
4.1. NSW EPA CLM Act Record of Notices 14
4.2. NSW EPA POEO Act Register of Licences, Applications and Notices 14
4.3. NSW EPA CLM Act Register of Notified Sites 14
4.4. Section 149 Planning Certificate 14
4.5. SafeWork NSW Stored Chemical Information Database (SCID) 14
5. GEOLOGY, ACID SULFATE SOILS, TOPOGRAPHY AND HYDROGEOLOGY 15
5.1. Geology 15
5.2. Acid Sulfate Soils 15
5.3. Topography 15
5.4. Hydrogeology 15
6. SITE WALKOVER 16
6.1. Current Land Use Activity 16
6.2. Buildings and General Infrastructure 16
6.3. Boundary Fencing 19
6.4. Adjacent Land Use Activities 19
6.5. Odours and Staining 19
6.6. Chemical Storage 19
6.7. Underground and Aboveground Storage Tanks 19
6.8. Filling Material 19
6.9. Wastes 25
6.10. Asbestos Containing Materials 26
6.11. Phytotoxicity 27
6.12. Site Drainage 28
7. CONCEPTUAL SITE MODEL 29
7.1. Areas of Environmental Concern and Contaminants of Potential Concern 29

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

7.2. Land Use Setting 29
7.3. Direct Contact – Human Health 29
7.4. Inhalation / Vapour Intrusion – Human Health 29
7.5. Management Limits for Petroleum Hydrocarbon Compounds 30
7.6. Aesthetics – Human Health 30
7.7. Ecological – Terrestrial Ecosystems 30
7.8. Groundwater 30
8. DATA QUALITY OBJECTIVES **31**
8.1. Step 1: State the problem **31**
8.2. Step 2: Identify the decision/goal of the study **31**
8.3. Step 3: Identify the information inputs **31**
8.4. Step 4: Define the boundaries of the study **32**
8.5. Step 5: Develop the analytical approach (or decision rule) **32**
8.6. Step 6: Specify the performance or acceptance criteria **33**
8.7. Step 7: Develop the plan for obtaining data **35**
8.7.1. Sampling Point Density and Locations 35
8.7.2. Sampling Methodology 36
8.7.3. Identification, Storage and Handling of Samples 36
8.7.4. Decontamination 36
8.7.5. Laboratory Selection 37
8.7.6. Laboratory Analytical Schedule 37
8.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting 37
9. FIELDWORK **39**
9.1. Service Locating **39**
9.2. Soil Sampling **39**
9.3. Geology **39**
9.4. Odours **40**
9.5. Staining **40**
10. LABORATORY **41**
11. DATA QUALITY INDICATOR ASSESSMENT **42**
11.1. Completeness **42**
11.2. Comparability **42**
11.3. Representativeness **43**
11.4. Precision **43**
11.5. Accuracy **45**
12. DISCUSSION **46**
12.1. Human Health - Direct Contact **46**
12.1.1. TRH 46
12.1.2. BTEX 46

12.1.3. PAH 46
12.1.4. OCP 46
12.1.5. PCB 46
12.1.6. Metals 46
12.1.7. Bonded Asbestos Containing Materials 46
12.1.8. Asbestos Fines and Friable Asbestos 47
12.2. Human Health – Inhalation / Vapour Intrusion (Soils) **47**
12.2.1. TRH 47
12.2.2. BTEX 48
12.2.3. PAH 48
12.3. TPH Management Limits (Residential) **48**
12.4. Aesthetics **48**
13. CONCLUSIONS **49**
14. STATEMENT OF LIMITATIONS **50**
15. REFERENCES **51**

FIGURES

Figure 1 Site Location
Figure 2 Site Layout
Figure 3 Areas of Environmental Concern
Figure 4 Sampling Point Layout Plan

TABLES

Table LAR1 Laboratory Analytical Results – Soils (Chemical)
Table LAR1 Laboratory Analytical Results – Soils (Asbestos)
Table LAR1 Laboratory Analytical Results - RPD

APPENDICES

A Survey
B Previous Reports
C NSW EPA
D Groundwater
E Laboratory

DOCUMENT CONTROL

Revision	Date	Author	Authorised
Rev 0	20 April 2018	Jake Walker / Craig Cowper	Craig Cowper

This report remains the property of Alliance Geotechnical subject to payment of all fees due for the assessment. The report shall not be reproduced except in full and with prior written permission by Alliance Geotechnical Pty Ltd.

EXECUTIVE SUMMARY

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust, to undertake a supplementary contamination assessment for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- a supplementary contamination assessment is required to provide updated information on site suitability for the proposed low to medium density residential land use setting for the site;
- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting; and
- the assessment needs to consider the suitability of 5 small soil stockpiles located on site, for reuse on site.

The objectives of this project were to:

- assess the potential for contamination to be present on the site as a result of past and current land use activities;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- limited soil sampling and laboratory analysis; and
- data assessment and reporting.

Within the context and objective of this project, an area of environmental concern (AEC) and contaminants of potential concern (COPC) have the potential to be present on site. The AEC identified are presented in attached **Figure 3** and associated COPC are presented in the table below.

ID	AEC	Land Use Activity	Contaminants of Potential Concern
AEC01	Combined stockpiles located adjacent to the carpark (<20m^3)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.
AEC02	Stockpile located in north eastern portion (<20m^3)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.
AEC03	Nine stockpiles located adjacent to western boundary (~10m^3 each)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the contamination status of the broader site is considered unlikely to have materially changed since the issue of a site audit statement in 1999;

- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable direct contact human health exposure risk;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;
- stockpile SP01 (in AEC01) would be suitable (in the context of human health and land contamination) for beneficial reuse on site;
- the estimated concentration of bonded asbestos in soil detected in AEC02 (stockpile SP02), may present an unacceptable human health exposure risk and unacceptable aesthetics risk;
- chemical contaminants of concern, asbestos fines and friable asbestos in AEC03 (stockpiles SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11) require further investigation, to assess whether they may present an unacceptable human health exposure risk;
- the site could be made suitable for the proposed land use setting (in the context of land contamination), subject to:
    - management and/or remediation of bonded asbestos in stockpile SP02;
    - further assessment, management and/or remediation of potential unacceptable human health exposure risks in SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11;
    - ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the sites; and
- Further assessment, management and/or remediation planning works should be undertaken by a suitably experienced environmental consultant.

This report, including its conclusions and recommendations, must be read in conjunction with the limitations presented in **Section 14**.

1. INTRODUCTION

1.1. Background

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust, to undertake a supplementary contamination assessment for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- a supplementary contamination assessment is required to provide updated information on site suitability for the proposed low to medium density residential land use setting for the site;
- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting; and
- the assessment needs to consider the suitability of 5 small soil stockpiles located on site, for reuse on site.

1.2. Objectives

The objectives of this project were to:

- assess the potential for contamination to be present on the site as a result of past and current land use activities;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

1.3. Scope of Work

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- limited soil sampling and laboratory analysis; and
- data assessment and reporting.

2. SITE IDENTIFICATION

The site is identified as Lot 3991 in DP1190132.

The approximate geographic coordinates of the middle of the site, inferred from Google Earth were 33°43'45" S and 150°43'23" E.

The locality of the site is set out in **Figure 1**.

The general layout and boundary of the site is set out in **Figure 2**.

The site covers an area of approximately 3.633 hectares.

A copy of a detail and level survey is presented in **Appendix A**.

3. SITE HISTORY AND LAND USE

3.1. Aerial Imagery

A review of selected historical aerial imagery of the site was undertaken. Imagery back to 2002 was reviewed, for the purpose of making an assessment of potential land contaminating activities being undertaken on the site, since issue of a site audit statement for the site in 1999. Observations made of the imagery considered relevant to this project, are presented in **Table 3.1**.

Table 3.1: Aerial Imagery Observations

Image Date	Site Features	Surrounding Land Use Settings
2002 Google Earth	Site appears primarily undeveloped and vegetated with a mix of trees, shrubs and grasses. A vehicle roadway appears to pass through the northern portion of the site.	Surrounding land is generally vacant
2006 Google Earth	No significant change from previous image.	No significant change from previous image.
2007 Google Earth	No significant change from previous image.	No significant change from previous image.
2009 Nearmap	No significant change from previous image.	No significant change from previous image.
2010 Nearmap	No significant change from previous image.	No significant change from previous image.
2011 Nearmap	The roadway passing through the northern portion of the site, while still present, appears to have been replaced by the alignment of the current Jordan Springs Boulevard. A square shaped excavation is apparent in the north eastern corner of the site, adjacent to the current Jordan Springs Boulevard. It appears to be associated with civil works being undertaken for the alignment of Jordan Springs Boulevard.	Low density residential development to the north.
2012 Nearmap	There are two circular features in the immediate vicinity of the square excavation observed in the 2011 image. There is a minor unsealed road in the north eastern corner of the site, potentially providing access for earthworks activities to the east of the site.	Civil earthworks to the east of the site.
2013 Nearmap	A square shaped asphalt car park (similar to current) is present adjacent to the central northern portion of the site, with access via Jordan Springs Boulevard.	Ongoing civil earthworks to the east of the site.

Image Date	Site Features	Surrounding Land Use Settings
2014 Nearmap	No significant change from previous image.	Lakeside Parade to the east of the site has been constructed. Commercial development to the north of the site (likely to be a shopping centre).
2015 Nearmap	No significant change from previous image.	No significant change from previous image.
2016 Nearmap	No significant change from previous image.	No significant change from previous image.
2017 Nearmap	Unsealed access road on the site, which appears to provide access to the drainage infrastructure being constructed to the south of the site.	Drainage infrastructure construction works to the south.

The aerial imagery review did not indicate a significant potential for land contaminating activities to have been undertaken at the site, between 2002 and 2017. These observations should be considered when assessing other historical information identified during this project and site walkover observations.

3.2. Anecdotal Information

There was no anecdotal information provided to AG during this project.

3.3. Incident Reports

There were no incident reports relevant to the site provided to AG during the project.

3.4. Complaints History

There was no complaints history provided to AG during the project.

3.5. Previous Contamination Assessments

A copy of the following report was made available to AG during this project:

- URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.
- Douglas Partners 2017, 'Site Walkover Contamination Report, Proposed Lots 3989, 3990 and 3991, DP1190132, Jordan Springs, NSW', dated 21 September 2017, ref: 92245.00

A summary of these reports is presented in **Section 3.5.1** and **3.5.2** of this report, and a copy of URS (2008) and Douglas Partners (2017) is presented in **Appendix B** of this report.

3.5.1. URS (2008)

The objective of URS (2008) was to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the nature environment.

URS (2008) was prepared for a parcel of land referred to as the Western Precinct. AG understands the Western Precinct fell within the former Australia Defence Industries (ADI) facility in St Marys.

An assessment by AG of Figure 2 in URS (2008) indicated that the subject site falls within the south western corner of the Western Precinct.

Section 1.2 of URS (2008) noted that the majority of the Western Precinct was assessed by a NSW EPA Accredited Site Auditor (Site Auditor), to pose a negligible risk to the public or the environment with regard to chemical contamination and/or explosive ordnance. A number of site audit statements (SASs) for parcels of land across the Western Precinct are included in Appendix A of URS (2008).

URS (2008) noted that:

- unexpected finds may occur in areas which, although searched extensively, contain remnant materials which were obscured by the local topography, the type of surface cover (e.g. building) or at a depth preventing detection; and
- the Site Auditor considered that, while explosive ordnance may be uncovered during earthworks, it is unlikely that these will present an unacceptable risk provided appropriate procedures for the safe handling and disposal of such material are adopted.

A copy of a Site Audit Statement (SAS), prepared by the Site Auditor (Mr Christopher Kidd of HLA-Envirosciences), dated 7 June 1999, reference CHK001/1 was presented in Appendix A of URS (2008). An assessment of the SAS by AG indicated that the subject site fell within the boundaries of the land that SAS CHK001/1 applied to. AG also found that the SAS certified that land as suitable for residential, including substantial vegetable garden and poultry, residential with minimal, opportunity for soil access including units, day care centre, preschool, primary schools, secondary school, park, recreational open space, playing field and commercial / industrial land use settings, subject to a number of conditions, including:

- the exclusion of specific parcels of land, as marked on the plan attached to the SAS; and
- an appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, being lodged prior to the commencement of development earthworks

AG assessed the plan attached to the SAS and considered that:

- the subject site did not appear to fall within the shaded areas excluded from SAS CHK001/1; and
- land located immediately adjacent to the subject site, did not appear to fall within the shaded areas excluded from SAS CHK001/1.

3.5.2. Douglas Partners (2017)

The objective of Douglas Partners (2017) was to identify additional activities or sources that have occurred/appeared on site since the sale of the property in June 2013.

The scope of work undertaken to address the project objective included a document review and site walkover.

Douglas Partners (2017) reported the following conclusions, considered relevant to the subject Lot 3990 and Lot 3991:

- Limited review of historical aerial imagery and site walkover completed on 19 September 2017, identified the following potential sources appearing onsite in recent years that have the potential for contamination of the site:
    - Five small stockpiles or soil observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark on Lot 3991. Given the small volume (15-20m^3) of the stockpiles, likely origins from bulk earthworks associated with the nearby carpark and observed contents, the soil within the stockpiles poses a low contamination risk to the site.

Douglas Partners (2017) recommended that:

- further investigations be completed within the soil stockpiles on Lot 3991, to confirm the absence/presence of contaminants of potential concern associated with fill of an unknown origin; and

- the recommended further assessment should build on the information presented in Douglas Partners (2017) with reference to NEPC (1999) and should include intrusive investigation, sampling and analysis.

4. REGULATORY RECORDS

4.1. NSW EPA CLM Act Record of Notices

A search of the publicly available online NSW EPA CLM Act Record of Notices was undertaken on 6 April 2018. The results indicated that the site was not the subject of any notifications under Section 58 of the *Contaminated Land Management Act 1997*.

A copy of the CLM Act Record of Notices search record is presented in **Appendix C**.

4.2. NSW EPA POEO Act Register of Licences, Applications and Notices

A search of the publicly available online NSW EPA Record of Notices was completed on 6 April 2018. The results indicated that the site was not the subject of any licences, applications, notices, audits or pollution studies or reduction programs under Section 308 of the *Protection of the Environment Operations Act 1997*.

A copy of the POEO Act Register of Licences, Applications and Notices search record is presented in **Appendix C**.

4.3. NSW EPA CLM Act Register of Notified Sites

A search of the publicly available online register of sites notified to the NSW EPA under Section 60 of the *Contaminated Land Management Act 1997*, was undertaken on 6 April 2018. The results indicated that the site was not listed on the register, nor were any properties located on adjacent land.

4.4. Section 149 Planning Certificate

Obtaining a copy of the planning certificate issued for the site under Section 149 of the Environmental Planning and Assessment Act was not within the scope of this project.

4.5. SafeWork NSW Stored Chemical Information Database (SCID)

A search of Safe Work NSW stored chemical information database (SCID) was not undertaken for the site. A review of recent historical aerial imagery site did not indicate a significant potential for licensable quantities of dangerous goods to have been stored on the site. The availability of a site audit statement for the site, also suggests that if licensable quantities of dangerous goods had been historically stored at the site, potential contamination risks associated with that storage would have been addressed during investigation and potential remediation / validation works for the broader parcel of land that the site is a part of.

AG considers that further assessment of storage of licensable quantities of dangerous goods on the site is not warranted.

5. GEOLOGY, ACID SULFATE SOILS, TOPOGRAPHY AND HYDROGEOLOGY

5.1. Geology

A review of the Sydney 1:100,000 Geological Series Sheet 9130 (Edition 1) 1983, indicated that the site is likely to be underlain by Middle Triassic, Wianamatta Group, Bringelly Shale, defined as shale, carbonaceous claystone, claystone, laminite, fine to medium grained lithic sandstone, rare coal and tuff.

5.2. Acid Sulfate Soils

The Australian Soil Resource Information System website (http://www.asris.csiro.au/mapping/viewer.htm) indicates that the site is in an area mapped as 'Extremely Low Probability / Low Confidence', with respect to acid sulfate soils.

Further assessment of acid sulphate soils in the context of this project is considered by AG as not warranted.

5.3. Topography

The site topography was generally flat, with some minor localised undulations, and some south east facing slopes.

A detail and level survey indicated that the site surface was located at an elevation of approximately 42m Australian Height Datum (AHD) in the north west, to approximately 35m AHD in the south east.

5.4. Hydrogeology

Surface water courses proximal to the site include an unnamed dam/lake located adjacent to central western boundary of the site, and a small dam located adjacent to the eastern boundary of the site. The Penrith Lakes precinct is located approximately 2.5km to the west of the site, and the Nepean River is located approximately 4km to the west of the site. South Creek is located approximately 3.6km to the east of the site, with minor tributaries to South Creek located between the site and South Creek.

A review of the NSW Office of Water groundwater database (www.http://allwaterdata.water.nsw.gov.au/water) indicated there were no registered groundwater features within a 500m radius of the site.

A copy of the NSW Office of Water search record is presented in **Appendix D**.

6. SITE WALKOVER

A site walkover was undertaken on 9 April 2018 by a suitably experienced AG environmental consultant (Mr Craig Cowper). The purpose of the site walkover was to make observations of land use activities on the site, and on properties immediately adjacent to the site.

6.1. Current Land Use Activity

There did not appear to be any land use activities being undertaken on the site at the time of the site walkover.

6.2. Buildings and General Infrastructure

There was an asphaltic paved car park located in the northern portion of the site. There was visual evidence observed of unsealed vehicle tracks across the site, located primarily in the northern and south eastern portion of the site. Lesser defined unsealed vehicle tracks were also observed in the western portion of the site.

Visual evidence of one groundwater monitoring wells was observed in the north eastern corner of the site, and two groundwater monitoring wells in the south western corner of the site.

The remainder of the site appeared to be vacant.

Image 6.2.1 View of asphalt car park in northern portion of the site



Image 6.2.2 View of north eastern portion of site



Image 6.2.3 Example of unsealed vehicle tracks on the site



Image 6.2.4 View of groundwater monitoring well in north eastern corner of the site



Image 6.2.5 View of two groundwater monitoring wells (PVC and metal) in south western corner of the site



6.3. Boundary Fencing

The site boundary was generally fenced along the northern and eastern boundaries.

6.4. Adjacent Land Use Activities

Observations made during the site walkover indicated the following land use activities adjacent to the site:

- North - Jordan Springs Boulevard then residential;
- East - Lakeside Parade, then vacant land;
- West - vacant land; and
- South - vacant land towards the south west, and drainage infrastructure to the south east.

6.5. Odours and Staining

There was no olfactory evidence of odours or visual evidence of staining observed on the surface of the site, during the site walkover.

6.6. Chemical Storage

There was no visual evidence observed of chemical storage on the site.

6.7. Underground and Aboveground Storage Tanks

There was no visual evidence observed of underground or aboveground storage tanks on the site.

6.8. Filling Material

There was no visual evidence to suggest the presence of significant or widespread filling at the site.

Observations were made of approximately five small soil stockpiles (joined together and labelled as SP01 by AG) located adjacent to the south eastern corner of the asphalt carpark. The combined stockpiles were partially vegetated. Observations made in the field by AG indicated an estimated volume of <20m3 of material.

Observations were made of a stockpile in the north eastern corner of the site (labelled as SP02 by AG). The stockpile was partially vegetated. Observations made in the field by AG indicated an estimated volume of <20m^3 of material.

Observations were made of nine stockpiles located towards the western boundary of Lot 3991 (labelled as SP03 to SP11) by AG. The stockpiles were estimated in the field to be approximately 10m^3 each in volume. Visual observations of the stockpiles indicated they were comprised of clay, sand, sandstone and building waste.

Observations were also made of one earth bund style feature in the south eastern portion of the site. The bund appeared to have been put in place to divert overland surface water. Observations made of the surfaces of the bund, and the land surface adjacent to the bund (which included depressions adjacent to the bund), indicated that the bund was formed using borrowed material from the depressions, rather than imported fill material. The soils observed on the surface of the bund were comparable to what appeared to be naturally occurring soils on the surface adjacent to the bund, and there was no visual evidence of anthropogenic materials observed on the surface of the bund.

Image 6.8.1 View of stockpile SP01 adjacent to asphalt carpark



Image 6.8.2 View of stockpile SP02 adjacent to north eastern boundary



Image 6.8.3 View of stockpile SP03 adjacent to western boundary of the site



Image 6.8.4 View of stockpile SP04 adjacent to western boundary of the site



Image 6.8.5 View of stockpile SP05 adjacent to western boundary of the site



Image 6.8.6 View of stockpile SP06 adjacent to western boundary of the site



Image 6.8.7 View of stockpile SP07 adjacent to western boundary of the site



Image 6.8.8 View of stockpile SP08 adjacent to western boundary of the site



Image 6.8.9 View of stockpile SP09 adjacent to western boundary of the site



Image 6.8.10 View of stockpile SP10 adjacent to western boundary of the site



Image 6.8.11 View of stockpile SP11 adjacent to western boundary of the site



Image 6.8.14 View of earth bund in south eastern portion of the site



6.9. Wastes

There was no visual evidence observed of significant wastes being stored inappropriately on the site. Observations were made of isolated occurrences of empty glass/plastic bottles and other domestic style refuse.

6.10. Asbestos Containing Materials

There was no visual evidence observed of potential asbestos containing materials on the surface of the site, with exception of fragments of fibrous cement sheeting (FCS) observed on the surface of the nine stockpiles reported in Section 6.8.

Image 6.10.1 View of example of fragment of FCS on surface of stockpile on site



Image 6.10.2 View of example of fragment of FCS on surface of stockpile on site



Image 6.10.3 View of example of fragment of FCS on surface of stockpile on site



Image 6.10.4 View of example of fragment of FCS on surface of stockpile on site



A hazardous building materials survey was not within the scope of this project.

6.11. Phytotoxicity

There was no visual evidence observed to suggest significant or widespread phytotoxic impact (in the form of dieback or plant stress) in vegetation at the site. Similar observations were made of visible vegetation on land adjacent to the site.

6.12. Site Drainage

Visual observations made in the context of site drainage during the walkover, indicated that drainage mechanisms on the site are likely to include:

- surficial overland flow following localised site topography; and
- infiltration into underlying soils, where soil permeability permits.

7. CONCEPTUAL SITE MODEL

7.1. Areas of Environmental Concern and Contaminants of Potential Concern

Within the context and objective of this project, an area of environmental concern (AEC) and contaminants of potential concern (COPC) have the potential to be present on site. The AEC identified are presented in attached **Figure 3** and associated COPC are presented in **Table 7.1**.

Table 7.1: AEC and COPC

ID	AEC	Land Use Activity	Contaminants of Potential Concern
AEC01	Combined stockpiles located adjacent to the carpark (<20m^3)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.
AEC02	Stockpile located in north eastern portion (<20m^3)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.
AEC03	Nine stockpiles located adjacent to western boundary (~10m^3 each)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.

7.2. Land Use Setting

AG understands that the site is proposed for a residential land use setting.

Based on the proposed land use scenario and guidance provided in Section 2.2 of NEPC (1999a), AG considers it reasonable to adopt the 'HIL A – residential with garden / accessible soil' land use setting, for the purpose of assessing land contamination exposure risks.

7.3. Direct Contact – Human Health

The proposed land use setting is likely to include accessible soils. In these areas, it is considered that a direct contact exposure pathway may be complete.

7.4. Inhalation / Vapour Intrusion – Human Health

In order for a potentially unacceptable inhalation / vapour intrusion human health exposure risk to exist, a primary vapour source (e.g. underground storage tank) or secondary vapour source (e.g. significantly contaminated soil or groundwater).

The historical evidence reviewed indicated a low likelihood for a potential primary source to be present on the site.

The same historical evidence indicated a potential land use activity to be uncontrolled filling. The excavation, transport, placement and spreading of imported (uncontrolled) fill material involves significant disturbance of soils which typically results in volatilisation of vapour producing contaminants. On that basis, the potential for vapours to be present in soils on site at concentrations which might present an unacceptable exposure risk, is considered to be low to negligible, and therefore does not warrant further assessment.

Potential sources of groundwater contamination in the immediate vicinity of the site (e.g. service stations) were not observed. A groundwater source of vapours was considered unlikely at the site.

Further assessment of the inhalation / vapour intrusion pathway is considered not warranted.

7.5. Management Limits for Petroleum Hydrocarbon Compounds

NEPC (1999a) notes that there are a number of policy considerations which reflect the nature and properties of petroleum hydrocarbons:

- formation of observable light non-aqueous phase liquids (LNAPL);
- fire and explosive hazards; and
- effects on buried infrastructure (e.g. penetration of or damage to, in-ground services by hydrocarbons).

NEPC (1999a) includes 'management limits' to avoid or minimise these potential effects. Application of the management limits requires consideration of site-specific factors such as the depth of building basements and services and depth to groundwater, to determine the maximum depth to which the limits should apply. NEPC (1999a) also notes that management limits may have less relevance at operating industrial sites which have no or limited sensitive receptors in the area of potential impact, and when management limits are exceeded, further site-specific assessment and management may enable any identified risk to be addressed.

7.6. Aesthetics – Human Health

Section 3.6.3 of NEPC (1999a) advises that there are no specific numeric aesthetic guidelines, however site assessment requires a balanced consideration of the quantity, type and distribution of foreign material or odours in relation to the specific land use and its sensitivity.

The potential presence of land contamination in the identified AEC, may create an aesthetics risk. Further assessment of this risk is considered warranted.

7.7. Ecological – Terrestrial Ecosystems

NEPC (1999) requires a pragmatic risk-based approach should be taken in applying ecological investigation and screening levels in residential and commercial / industrial land use settings.

It is noted that there was no visual evidence observed to suggest significant or widespread phytotoxic impact (in the form of dieback or plant stress) in onsite vegetation. Similar observations were made of visible vegetation on land adjacent to the site.

On this basis, AG considers further assessment of terrestrial ecosystems exposure risks, not warranted.

7.8. Groundwater

Assessment of contamination risks to groundwater, is not within the scope of this assessment. In the event that potential soil contamination is identified during this assessment, recommendations may be made for assessment of contamination risks to groundwater.

8. DATA QUALITY OBJECTIVES

Appendix B of NEPC (1999b) provides guidance on the development of data quality objectives (DQO) using a seven-step process.

The DQO for this project are set out in **Sections 8.1** to **8.7** of this report.

8.1. Step 1: State the problem

The first step involves summarising the contamination problem that requires new environmental data and identifying resources available to solve the problem.

The objectives of this project are to:

- assess the potential for contamination to be present on the site as a result of past and current land use activities;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The assessment is being undertaken because:

- a supplementary contamination assessment is required to provide updated information on site suitability for the proposed low to medium density residential land use setting for the site;
- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting; and
- the assessment needs to consider the suitability of 5 small soil stockpiles located on site, for reuse on site.

The project team identified for this project is comprised primarily of suitably experienced environmental consultants from Alliance Geotechnical Pty Ltd.

The regulatory authorities identified for this project include NSW EPA and the local Council.

8.2. Step 2: Identify the decision/goal of the study

The second step involves identifying decisions that need to be made about the contamination problem and the new environmental data required to make them.

The decisions that need to be made during this project include:

- Is the environmental data collected for the project, suitable for assessing relevant land contamination exposure risks?
- Do the concentrations of identified contaminants of potential concern (COPC) present an unacceptable exposure risk to identified receptors, for the proposed land use setting?
- Is the site suitable for the proposed land use setting, in the context of land contamination?

8.3. Step 3: Identify the information inputs

The third step involves identifying the information needed to support decisions and whether new environmental data will be needed.

The inputs required to make the decisions set out in Section 8.2 for this project, will include:

- the nature and extent of sampling at the site, including both density and distribution;
- samples of relevant site media;

- the measured physical and/or chemical parameters of the site media samples (including field screening and laboratory analysis, where relevant); and
- assessment criteria adopted for each of the media sampled.

Taking into consideration the objectives of this project, and the conceptual site model and land use setting presented in Section 7 of this project, the assessment criteria relevant to the proposed land use setting have been adopted for this project.

- Human health direct contact – HILs in Table 1A (1) in NEPC (1999a) and HSLs in Table B4 of Friebel, E & Nadebaum, P (2011);
- Human health inhalation/vapour intrusion – HSLs in Table 1 (A) in NEPC (1999a); and
- Aesthetics – no highly malodorous site media (e.g. strong residual petroleum hydrocarbon odours, hydrogen sulphide in site media, organosulfur compounds), no hydrocarbon sheen on surface water, no discoloured chemical deposits or soil staining with chemical waste other than of a very minor nature, no large monolithic deposits of otherwise low risk material (e.g. gypsum as powder or plasterboard, cement kiln dust), no presence of putrescible refuse including material that may generate hazardous levels of methane such as a deep-fill profile of green waste or large quantities of timber waste, and no soils containing residue from animal burial (e.g. former abattoir sites).

8.4. Step 4: Define the boundaries of the study

The fourth step involves specifying the spatial and temporal aspects of the environmental media that the data must represent to support decisions.

The spatial extent of the project will be limited to the site as defined by its boundaries.

The temporal boundaries of the project include

- the project timeframe presented in the AG proposal for this project,
- unacceptable weather conditions at the time of undertaking fieldwork, including rainfall, cold and/or heat;
- access availability of the site (to be defined by the site owner/representative); and
- availability of AG field staff (typically normal daylight working hours, Monday to Friday).

The lateral extent that contamination is expected to be distributed across, based on the conceptual site model, is defined by the inferred boundaries of the areas of environmental concern (AEC).

The vertical extent that contamination is expected to be distributed across, based on the conceptual site model and the project scope, is limited to the inferred base of the identified AEC.

The scale of the decisions required will be based on the entire site.

Constraints which may affect the carrying out of this project may include access limitations, presence of above and below ground infrastructure, and hazards creating health and safety risks.

8.5. Step 5: Develop the analytical approach (or decision rule)

The fifth step involves defining the parameter of interest, specifying the action level, and integrating information from Steps 1 to 4 into a single statement that gives a logical basis for choosing between alternative actions.

8.5.1. Rinsate Blanks

One rinsate blank will be collected and scheduled for analysis, for each day of sampling undertaken, if non-disposable sampling equipment was used on that day. The rinsate blank will be analysed for at least one of the analytes the sample/s collected that day are being scheduled for analysis for (with the exception of asbestos).

8.5.2. Trip Spikes and Trip Blank Samples

One trip spike and trip blank sample will be used and scheduled for analysis, for each day of sampling undertaken, if site samples being collected that day are being analysed for volatile contaminants of concern (typically BTEX and/or TRH C_6-C_{10}).

8.5.3. Field Duplicates and Field Triplicates

Field duplicate and field triplicates will be collected at a rate of one per twenty (5%) site samples collected. The duplicates and triplicates collected will be analysed for at least one of the analytes that the parent sample of the duplicate/triplicate is being scheduled for analysis for (with the exception of asbestos).

The relevant percent difference (RPD) of concentrations of relevant analytes, between the parent sample and the duplicate/triplicate will be calculated.

8.5.4. Laboratory Analysis Quality Assurance / Quality Control

The analytical laboratory QA/QC program will typically include laboratory method blank samples, matrix spike samples, surrogate spike samples, laboratory control samples, and laboratory duplicate samples.

8.5.5. If/Then Decision Rules

AG has adopted the following 'if/then' decision rules for this project:

- If the result of the assessment of field data and laboratory analytical data is considered acceptable, then that field data and laboratory analytical data is suitable for interpretation within the scope of this project; and
- If the field data and laboratory analytical data is within the constraints of the assessment criteria adopted for this project (refer **Section 8.3**), then the contamination exposure risks to identified receptors, are considered acceptable.

In the event the assessment of field data and/or laboratory analytical data results in the data being not suitable for interpretation, then AG will determine if additional data is required to allow interpretation to be undertaken.

In the event that field data and/or laboratory analytical data exceeds the assessment criteria adopted for this project (refer **Section 8.3**), AG will undertake an assessment of the exceedance in the context of the project objectives to determine if additional data is required and whether management and/or remediation is required.

8.6. Step 6: Specify the performance or acceptance criteria

The sixth step involves specifying the decision maker's acceptable limits on decision errors, which are used to establish performance goals for limiting uncertainties in the data. When assessing contaminated land, there are generally two types of errors in decision making:

- Contamination exposure risks for a specific land use setting are acceptable, when they are not; and
- Contamination exposure risks for a specific land use setting are not acceptable when they are.

AG will mitigate the risk of decision error by:

- Calculation of the 95% upper confidence limit (UCL) statistic to assess the mean concentration of relevant contaminants of potential concern;

- Assignment of fieldwork tasks to suitably experienced AG consulting staff, and suitably experienced contractors;
- Assignment of laboratory analytical tasks to reputable NATA accredited laboratories;
- Assignment of data interpretation tasks to suitably experienced AG consulting staff and outsourcing to technical experts where required.

AG will also adopt a range of data quality indicators (DQI) to facilitate assessment of the completeness, comparability, representativeness, precision and accuracy (bias).

Completeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Critical locations sampled	Refer **Section 8.7.1**	Critical samples analysed according to SAQP	Refer **Section 8.7.6**
Critical samples collected	Refer **Section 8.7.1**	Analytes analysed according to SAQP	Refer **Section 8.7.6**
SOPs appropriate and complied with	100%	Appropriate laboratory analytical methods and LORs	Refer **Section 8.7.6**
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	Sample documentation complete	All sample receipt advices, all certificates of analysis
		Sample extraction and holding times complied with	Refer **Section 8.7.7**
Comparability			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Same SOPs used on each occasion	100%	Same analytical methods used by primary laboratory	Refer **Section 8.7.7**
Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	Same LORs at primary laboratory	Refer **Section 8.7.7**
Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	Same laboratory for primary sample analysis	All primary samples to SGS Environmental
		Same analytical measurement units	Refer **Section 8.7.7**
Representativeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Appropriate media sampled according to SAQP	Refer Section 8.4	Samples analysed according to SAQP	Refer **Section 8.7.6**
Media identified in SAQP sampled	Refer Section 8.4		
Precision			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**

Field duplicate / triplicate RPD	Minimum 5% duplicates and triplicates No limit for analytical results <10 times LOR 50% for analytical results 10-20 times LOR 30% for analytical results >20 times LOR	Laboratory duplicates	No exceedances of laboratory acceptance criteria
SOPs appropriate and complied with	100%		
Accuracy (bias)			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Rinsate blanks	Less than laboratory limit of reporting	Laboratory method blank	No exceedances of laboratory acceptance criteria
Field trip spikes	Recoveries between 60% and 140%	Matrix spike recovery	No exceedances of laboratory acceptance criteria
Field trip blanks	Analyte concentration <LOR	Surrogate spike recovery	No exceedances of laboratory acceptance criteria
		Laboratory control sample recovery	No exceedances of laboratory acceptance criteria

8.7. Step 7: Develop the plan for obtaining data

The seventh step involves identifying the most resource effective sampling and analysis design for generating the data that is required to satisfy the DQOs.

8.7.1. Sampling Point Density and Locations

Table 4 in NSW NEPC (1999b) provides guidance on stockpile sampling for initial assessment. Further to this, Section 6.2.1 of NEPC (1999b) states that the number and location or sampling points is based on knowledge of the site and professional judgement. Sampling should be localised to known or potentially contaminated areas identified from knowledge of the site either from site history or an earlier phase of site investigation. Judgemental sampling can be used to investigate sub-surface contamination issues in site assessment.

Section 7.5.2 of NEPC (1999b) also provides guidance on the quantity of samples to be collected form stockpiles.

Given the combined volume of material estimated in each of the identified AEC, and the guidance provided above, AG proposes to establish three sampling points in AEC01 and three sampling points in AEC02. While each of the stockpiles observed in AEC03 could potentially warrant establish three sampling points in each stockpile, AG considers the size of the stockpiles cannot be adequately assessed within the approved scope of this assessment[1], and that only preliminary sampling of fragments of FCS on the surface of each stockpile in AEC03 will be undertaken.

8.7.2. Sampling Methodology

The sampling point methodology presented in **Table 8.7.2** will be used for this assessment. The methodology is based on a range of factors considered relevant to this project, including:

- the identified contaminants of potential concern;
- the suspected laydown mechanisms for those contaminants of concern;
- the suspected likely depth of contamination; and
- site specific constraints which affect the type of sampling techniques suited to the site.

Table 8.7.2 Proposed Sampling Methodology

AEC	Sampling Point ID	Method	Target Depth of Sampling Point (m bgs)
AEC01	SP01/01 to 03	Hand tools	Minimum of 0.3m below surface of stockpiled material
AEC02	SP02/01 to 03	Hand tools	Minimum of 0.3m below surface of stockpiled material
AEC03	SP03/FCS to SP11/FCS	Hand tools	Surface fragments of fibrous cement sheeting

8.7.3. Identification, Storage and Handling of Samples

Sample identifiers will be used for each sample collected, based on the sampling point number.

Project samples will be stored in laboratory prepared containers (and zip lock bags if collected for asbestos or acid sulfate soil assessment). Filled containers will be placed in insulated container/s with ice.

Samples will be transported to the relevant analytical laboratory, with chain of custody (COC) documentation that includes the following information:

AG project identification number

- Each sample identifier
- Date each sample was collected
- Sample type (e.g. soil or water)
- Container type/s for each sample collected
- Preservation method used for each sample (e.g. ice)
- Analytical requirements for each sample and turnaround times
- Date and time of dispatch and receipt of samples (including signatures)

8.7.4. Decontamination

[1] Sampling would ideally require mechanical earth moving equipment, however, the approved assessment scope was limited to use of hand tools, and the stockpiles were not identified by AG until the day of fieldwork.

In the event that non-disposable sampling equipment is used, that equipment will be decontaminated before and in between sampling events, to mitigate potential for cross contamination between samples collected. The decontamination methodology to be adopted for this project will include:

- Washing relevant sampling equipment using potable water with a phosphate free detergent (i.e. Decon 90 or similar) mixed into the water;
- Rinsing the washed non-disposable sampling equipment with distilled or de-ionised water; and
- Air drying as required.

8.7.5. Laboratory Selection

The analytical laboratories used for this project will be NATA accredited for the analysis undertaken.

8.7.6. Laboratory Analytical Schedule

Project samples will be scheduled for NATA accredited laboratory analysis, using a combination of:

- Observations made in the field of the media sampled;
- The contaminants of potential concern (COPC) identified for the area of environmental concern that the sample was collected from.

Based on site history, AG has adopted the laboratory analytical schedule (and associated upper limiting quantities) presented in **Table 8.7.6** for this project.

Table 8.7.6 Laboratory Analytical Schedule

AEC	Sampling Point ID	TRH/BTEX	PAH	OCP	PCB	Metals	Asbestos (0.001%)	Asbestos ID
AEC01	SP01/01 to 03	3	3	3	3	3	3	3
AEC02	SP02/01 to 03	3	3	3	3	3	3	3
AEC03	SP03/FCS to SP11/FCS	-	-	-	-	-	-	9

8.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting

The laboratory holding times, analytical methods and limits of reporting (LOR) being used for this project, are presented in **Table 8.7.7**.

Table 8.7.7 Laboratory Holding Times, Analytical Methods and Limits of Reporting

Analyte	Holding Time	Analytical Method	Limit of Reporting (mg/kg)
BTEX and TRH C_6-C_{10}	14 days	USEPA 5030, 8260B and 8020	0.2-0.5
TRH >C_{10}-C_{40}	14 days	USEPA 8015B & C	20-100
VOC	14 days	USEPA 8260	0.1-0.5
PAH	14 days	USEPA 8270	0.1-0.5
OCP	14 days	USEPA 8081	0.2
PCB	14 days	USEPA 8270	0.2
Metals	14 days	USEPA 8015B & C	0.05 – 2
Asbestos	No limit	AS4964:2004	Absence / presence

Analyte	Holding Time	Analytical Method	Limit of Reporting (mg/kg)
Asbestos	No limit	Inhouse Method	0.001% w/w

9. FIELDWORK

9.1. Service Locating

Given the nature and methodology of the fieldwork planned for this project, underground service locating was not undertaken.

9.2. Soil Sampling

Soil sampling was undertaken by AG on 9 April 2018.

A total of 15 sampling points (SP01/01-03, SP02/01-0.3 and SP03 to SP11) were established on site. Each sampling point was established using hand tools, as appropriate.

The locations of the sampling points established on site, are presented in **Figure 4**.

Bulk soil samples were screened for the presence of potential asbestos containing materials (ACM) greater than 7mm in size. Potential ACM greater than 7mm was weighed and placed in separate zip lock bags. Bulk samples were not collected from SP03 to SP11 (refer **Section 8.7.1** for further information), however, samples of fibrous cement sheeting fragments observed on the surface of stockpiles SP03 to SP11, were collected to facilitate preliminary characterisation of these stockpiles.

Sub samples (500mL) of the bulk samples were also collected from SP01 and SP02.

Collected samples were placed in labelled laboratory supplied acid-rinsed glass jars (with Teflon lined lids) and zip lock bags.

9.3. Geology

Observations were made of materials encountered during sampling work. A summary of these observations is presented in **Table 9.3.**

Table 9.3 Geology

Sampling Point	Sample ID	Observations
SP01	01	Silty CLAY, brown, firm, moist, some claystone gravels, some concrete gravels, trace igneous cobble, nil odour/staining/potential asbestos containing materials observed. Duplicate DUP01 and triplicate DUP01A collected.
	02	Gravelly CLAY, brown, hard, dry, trace ironstone gravels, trace sandstone gravels, nil odour/staining/potential asbestos containing materials observed.
	03	Gravelly CLAY, brown, firm to hard, moist, trace concrete brick, tile and sandstone gravels, trace igneous cobbles, nil odour/staining/potential asbestos containing materials observed.
SP02	01	Clayey SILT, brown, moist, trace sandstone and shale gravels, trace plastic, organics nil odour/staining/potential asbestos containing materials observed.
	02	Clayey SILT, brown, moist, trace sandstone, shale and claystone gravels, nil odour/staining observed, one fragment of fibrous cement sheeting observed (10.3 grams)
	03	Clayey SILT, brown, moist, trace sandstone and shale gravels, organics, nil odour/staining/potential asbestos containing materials observed.

Sampling Point	Sample ID	Observations
SP03	FCS	Fragment of fibrous cement sheeting (33.6 grams)
SP04	FCS	Fragment of fibrous cement sheeting (42.1 grams)
SP05	FCS	Fragment of fibrous cement sheeting (10.6 grams)
SP06	FCS	Fragment of fibrous cement sheeting (21.5 grams)
SP07	FCS	Fragment of fibrous cement sheeting (31.9 grams)
SP08	FCS	Fragment of fibrous cement sheeting (8.3 grams)
SP09	FCS	Fragment of fibrous cement sheeting (54.8 grams)
SP10	FCS	Fragment of fibrous cement sheeting (20.5 grams)
SP11	FCS	Fragment of fibrous cement sheeting (38.9 grams)

9.4. Odours

Olfactory evidence of odours was not detected in the soil samples collected.

9.5. Staining

Visual evidence of staining was not observed in the soil samples collected.

10. LABORATORY

The samples collected were transported to the analytical laboratory, using chain of custody (COC) protocols. A selection of these samples was scheduled for analysis, with reference to the relevant COPC identified for the AEC that the samples were collected from.

A copy of the analytical laboratory certificates of analysis, is presented in **Appendix E**.

The sample analytical results were tabulated and presented in the attached **Table LAR1**, **Table LAR2** and **Table LAR3**.

11. DATA QUALITY INDICATOR ASSESSMENT

11.1. Completeness

An assessment of the completeness of data collected was undertaken, and the results presented in **Table 11.1**.

Table 11.1 Completeness DQI

Field Considerations	Target	Actual	Comment
Critical locations sampled	15	15	Performance against indicator considered acceptable.
Critical samples collected	15	15	Performance against indicator considered acceptable.
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	All sampling point logs, calibration logs and chain of custody forms	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Critical samples analysed according to SAQP	Refer **Section 8.7.6**	100%	Performance against indicator considered acceptable.
Analytes analysed according to SAQP	Refer **Section 8.7.6**	100%	Performance against indicator considered acceptable.
Appropriate laboratory analytical methods and LORs	Refer **Section 8.7.7**	100%	Performance against indicator considered acceptable.
Sample documentation complete	All sample receipt advices, all certificates of analysis	100%	Performance against indicator considered acceptable.
Sample extraction and holding times complied with	Refer **Section 8.7.7**	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately complete.

11.2. Comparability

An assessment of the comparability of data collected was undertaken, and the results presented in **Table 11.2**.

Table 11.2 Comparability DQI

Field Considerations	Target	Actual	Comment
Same SOPs used on each occasion	100%	100%	Performance against indicator considered acceptable.

Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	100%	Performance against indicator considered acceptable.
Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Same analytical methods used by primary laboratory	Refer **Section 8.7.7**	100%	Performance against indicator considered acceptable.
Same LORs at primary laboratory	Refer **Section 8.7.7**	100%	Performance against indicator considered acceptable.
Same laboratory for primary sample analysis	All primary samples to SGS Environmental	100%	Performance against indicator considered acceptable.
Same analytical measurement units	Refer **Section 8.7.7**	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately comparable.

11.3. Representativeness

An assessment of the representativeness of data collected was undertaken, and the results presented in **Table 11.3**.

Table 11.3 Representativeness DQI

Field Considerations	**Target**	**Actual**	**Comment**
Appropriate media sampled according to SAQP	Refer **Section 8.7.2**	100%	Performance against indicator considered acceptable.
Media identified in SAQP sampled	Refer **Section 8.7.2**	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Samples analysed according to SAQP	Refer **Section 8.7.6**	100%	Acceptable Performance against indicator considered acceptable.

The data collected is considered to be adequately representative.

11.4. Precision

An assessment of the precision of data collected was undertaken, and the results presented in **Table 11.4**.

Table 11.4 Precision DQI

Field Considerations	Target	Actual	Comment
Field duplicate / triplicate RPD	Minimum 5% duplicates and triplicates	16.7% duplicates and 16.7% triplicates	Field duplicate DUP01 (parent sample SP01/01) had RPD exceedances for copper and zinc. Field duplicate DUP1A (parent sample SP01/01) had RPD exceedances for copper, nickel and zinc. AG considers these exceedances likely to be attributable to heterogeneity in each of the discrete soils samples, as the parent sample could not be homogenised prior to splitting, due to the potential for volatile and semi volatile contaminants to be present. As a conservative measure, the sample reporting the higher concentration of the relevant analyte should be used when making decisions regarding contamination risks on the site. Performance against indicator considered acceptable.
	No limit for analytical results <10 times LOR	Nil	
	50% for analytical results 10-20 times LOR	Nil	
	30% for analytical results >20 times LOR	5 exceedances	
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory duplicates	No exceedances of laboratory acceptance criteria	2 exceedances	SGS reported that the 2 laboratory duplicate exceedances in batch SE175866 failed RPD acceptance criteria due to sample heterogeneity. Performance against indicator considered acceptable.

The data collected is considered to be adequately precise.

11.5. Accuracy

An assessment of the precision of data collected was undertaken, and the results presented in **Table 11.5**.

Table 11.5 Accuracy DQI

Field Considerations	Target	Actual	Comment
Rinsate blanks	Less than laboratory limit of reporting	Not applicable.	Disposable sampling equipment used for each sampling point. Rinsate blank not collected. Performance against indicator considered acceptable.
Field trip spikes	Recoveries between 60% and 140%	Recoveries between 60% and 140%	Performance against indicator considered acceptable.
Field trip blanks	Analyte concentration <LOR	Analyte concentration <LOR	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory method blank	No exceedances of laboratory acceptance criteria	Nil	Acceptable
Matrix spike recovery	No exceedances of laboratory acceptance criteria	2 matrix spike recovery exceedances	SGS reported that the five matrix spike DQO exceedances in batch SE175866 failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeded the spike level). Performance against indicator considered acceptable.
Surrogate spike recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.
Laboratory control sample recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.

The data collected is considered to be adequately accurate.

12. DISCUSSION

A discussion on comparison of laboratory analytical results and field observations, in the context of the assessment criteria adopted for this project, is presented in **Sections 12.1** to **12.4**.

12.1. Human Health - Direct Contact

12.1.1. TRH

The concentrations of TRH C_6-C_{10}, >C_{10}-C_{16}, >C_{16}-C_{34} and >C_{34}-C_{40} detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.2. BTEX

The concentrations of benzene, toluene, ethyl benzene and xylenes detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.3. PAH

The concentrations of naphthalene, benzo(a)pyrene TEQ and total PAH (16) detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.4. OCP

The concentration of relevant OCP compounds detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.5. PCB

The concentration of relevant PCB compounds detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.6. Metals

The concentrations of lead detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

12.1.7. Bonded Asbestos Containing Materials

Fragments of fibrous cement sheeting (FCS) were encountered in AEC02 and AEC03. A total of 10 fragments of FCS were submitted for laboratory analysis for the presence of asbestos. Asbestos was identified in each of the samples analysed.

The gravimetric approach set out in Section 4.10 of NEPC (1999a) was used to assess asbestos in soil concentrations, including the assumed 15% asbestos by weight in cement bonded asbestos, and an assumed soil density of 1.65kg/L. These assumed values are considered to be adequately conservative within the context of this project, with the exception of soil density. The laboratory measured weights of 500mL sub samples collected from the 10L bulk samples across SP01 and SP02 indicated a soil density of closer to 1kg/L. Adopting a soil density of 1kg/L would produce a calculated % w/w asbestos in soil amount that is greater than if a soil density of 1.65kg/L was adopted. A soil density of 1kg/L is therefore considered adequately conservative in the context of this project for the purpose of comparing analytical results to adopted health screening levels (for SP01 and SP02). The sample size was 10L, based on guidance in Section 4.10 of NEPC (1999a).

As 10L bulk samples or 500mL sub samples were not collected from SP03 to SP11, AG considers it reasonable to adopt the published soil density guidance of 1.65kg/L, as a means of providing a preliminary assessment of estimated asbestos concentrations in soils for SP03 to SP11.

The estimation formula in Section 4.10 of NEPC (1999a) is:

$$\% \text{ w/w asbestos in soil} = \frac{\% \text{ asbestos content x bonded ACM (kg)}}{\text{soil volume (L) x soil density (kg/L)}}$$

The results of the calculations performed using this formula, are presented in **Table 12.1.7**.

Table 12.1.7 Results of Gravimetric Estimation of Asbestos Concentrations in Soil

Sample ID	Weight of Bonded ACM (kg)	% w/w Asbestos in Soil[2]
SP02/02-FRAG	0.0103	0.015
SP03/01-FCS	0.0336	0.031
SP04/01-FCS	0.0421	0.038
SP05/01-FCS	0.0106	0.010
SP06/01-FCS	0.0215	0.020
SP07/01-FCS	0.0319	0.029
SP08/01-FCS	0.0803	0.073
SP09/01-FCS	0.0548	0.050
SP10/01-FCS	0.0205	0.019
SP11/01-FCS	0.0389	0.035

The estimated concentrations of bonded asbestos in soil was not less than the adopted health screening level of 0.01% w/w, in each of the samples reported on, with the exception of sample SP05/01/FCS, which had a preliminary estimated asbestos concentration of asbestos in soil, equal to the adopted health screening level. Given the non-conventional sampling method for stockpile SP05, it is considered reasonable (and suitably conservative) to assume that, based on the presence of asbestos in the FCS sample, the potential for asbestos concentrations in SP05 to exceed to adopted health screening level should not be precluded.

12.1.8. Asbestos Fines and Friable Asbestos

The concentration of friable asbestos and asbestos fines (FA and AF) detected in the soil samples analysed from SP01 and SP02, were less than the applicable adopted health screening level.

The concentration of friable asbestos and asbestos fines (FA and AF) was not assessed for soils in SP03 to SP11.

12.2. Human Health – Inhalation / Vapour Intrusion (Soils)

12.2.1. TRH

The concentrations of TRH C_6-C_{10} (minus BTEX) and TRH >C_{10}-C_{16} (minus naphthalene) detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

[2] AG notes that the methodology adopted for estimation of asbestos concentration in soil for SP03 to SP11 is sufficiently conservative for providing preliminary advice on the presence of asbestos in the soils assessed.

12.2.2. BTEX

The concentrations of benzene, toluene, ethyl benzene and xylenes detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

12.2.3. PAH

The concentrations of naphthalene detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

12.3. TPH Management Limits (Residential)

The concentrations of TRH C_6-C_{10}, >C_{10}-C_{16}, >C_{16}-C_{34} and >C_{34}-C_{40} detected in the soil samples analysed, were less than the applicable adopted TRH management limits.

12.4. Aesthetics

There were no observations of odours, significant chemical deposits/wastes, large monolithic deposits of low risk material or putrescible waste in the soils sampled.

There were observations made of fragments of fibrous cement sheeting at sampling points SP02/02 and SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11.

13. CONCLUSIONS

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the contamination status of the broader site is considered unlikely to have materially changed since the issue of a site audit statement in 1999;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable direct contact human health exposure risk;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;
- stockpile SP01 (in AEC01) would be suitable (in the context of human health and land contamination) for beneficial reuse on site;
- the estimated concentration of bonded asbestos in soil detected in AEC02 (stockpile SP02), may present an unacceptable human health exposure risk and unacceptable aesthetics risk;
- chemical contaminants of concern, asbestos fines and friable asbestos in AEC03 (stockpiles SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11) require further investigation, to assess whether they may present an unacceptable human health exposure risk;
- the site could be made suitable for the proposed land use setting (in the context of land contamination), subject to:
    - management and/or remediation of bonded asbestos in stockpile SP02;
    - further assessment, management and/or remediation of potential unacceptable human health exposure risks in SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11;
    - ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the sites; and
- Further assessment, management and/or remediation planning works should be undertaken by a suitably experienced environmental consultant.

This report, including its conclusions and recommendations, must be read in conjunction with the limitations presented in **Section 14**.

14. STATEMENT OF LIMITATIONS

The findings presented in this report are based on specific searches of relevant, government historical databases and anecdotal information that were made available during the course of this project. To the best of our knowledge, these observations represent a reasonable interpretation of the general condition of the site at the time of report completion.

This report has been prepared solely for the use of the client to whom it is addressed and no other party is entitled to rely on its findings.

No warranties are made as to the information provided in this report. All conclusions and recommendations made in this report are of the professional opinions of personnel involved with the project and while normal checking of the accuracy of data has been conducted, any circumstances outside the scope of this report or which are not made known to personnel and which may impact on those opinions is not the responsibility of Alliance Geotechnical Pty Ltd. Should information become available regarding conditions at the site including previously unknown sources of contamination, AG reserves the right to review the report in the context of the additional information.

This report must be reviewed in its entirety and in conjunction with the objectives, scope and terms applicable to AG's engagement. The report must not be used for any purpose other than the purpose specified at the time AG was engaged to prepare the report.

Logs, figures, and drawings are generated for this report based on individual AG consultant interpretations of nominated data, as well as observations made at the time site walkover/s were completed.

Data and/or information presented in this report must not be redrawn for its inclusion in other reports, plans or documents, nor should that data and/or information be separated from this report in any way.

Should additional information that may impact on the findings of this report be encountered or site conditions change, AG reserves the right to review and amend this report.

15. REFERENCES

National Environment Protection Council (NEPC) 1999b, 'Schedule B(2) Guideline on Site Characterisation, National Environment Protection (Assessment of Site Contamination) Measure (NEPM) as amended in May 2013'.


NSW DEC 2006, 'Contaminated Sites: Guidelines for the NSW Site Auditor Scheme (2nd edition)'.

NSW OEH 2011, 'Contaminated Sites: Guidelines for Consultants Reporting on Contaminated Sites'.

NSW Office of Water Groundwater Database (www. http://allwaterdata.water.nsw.gov.au/water)


URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.

FIGURES

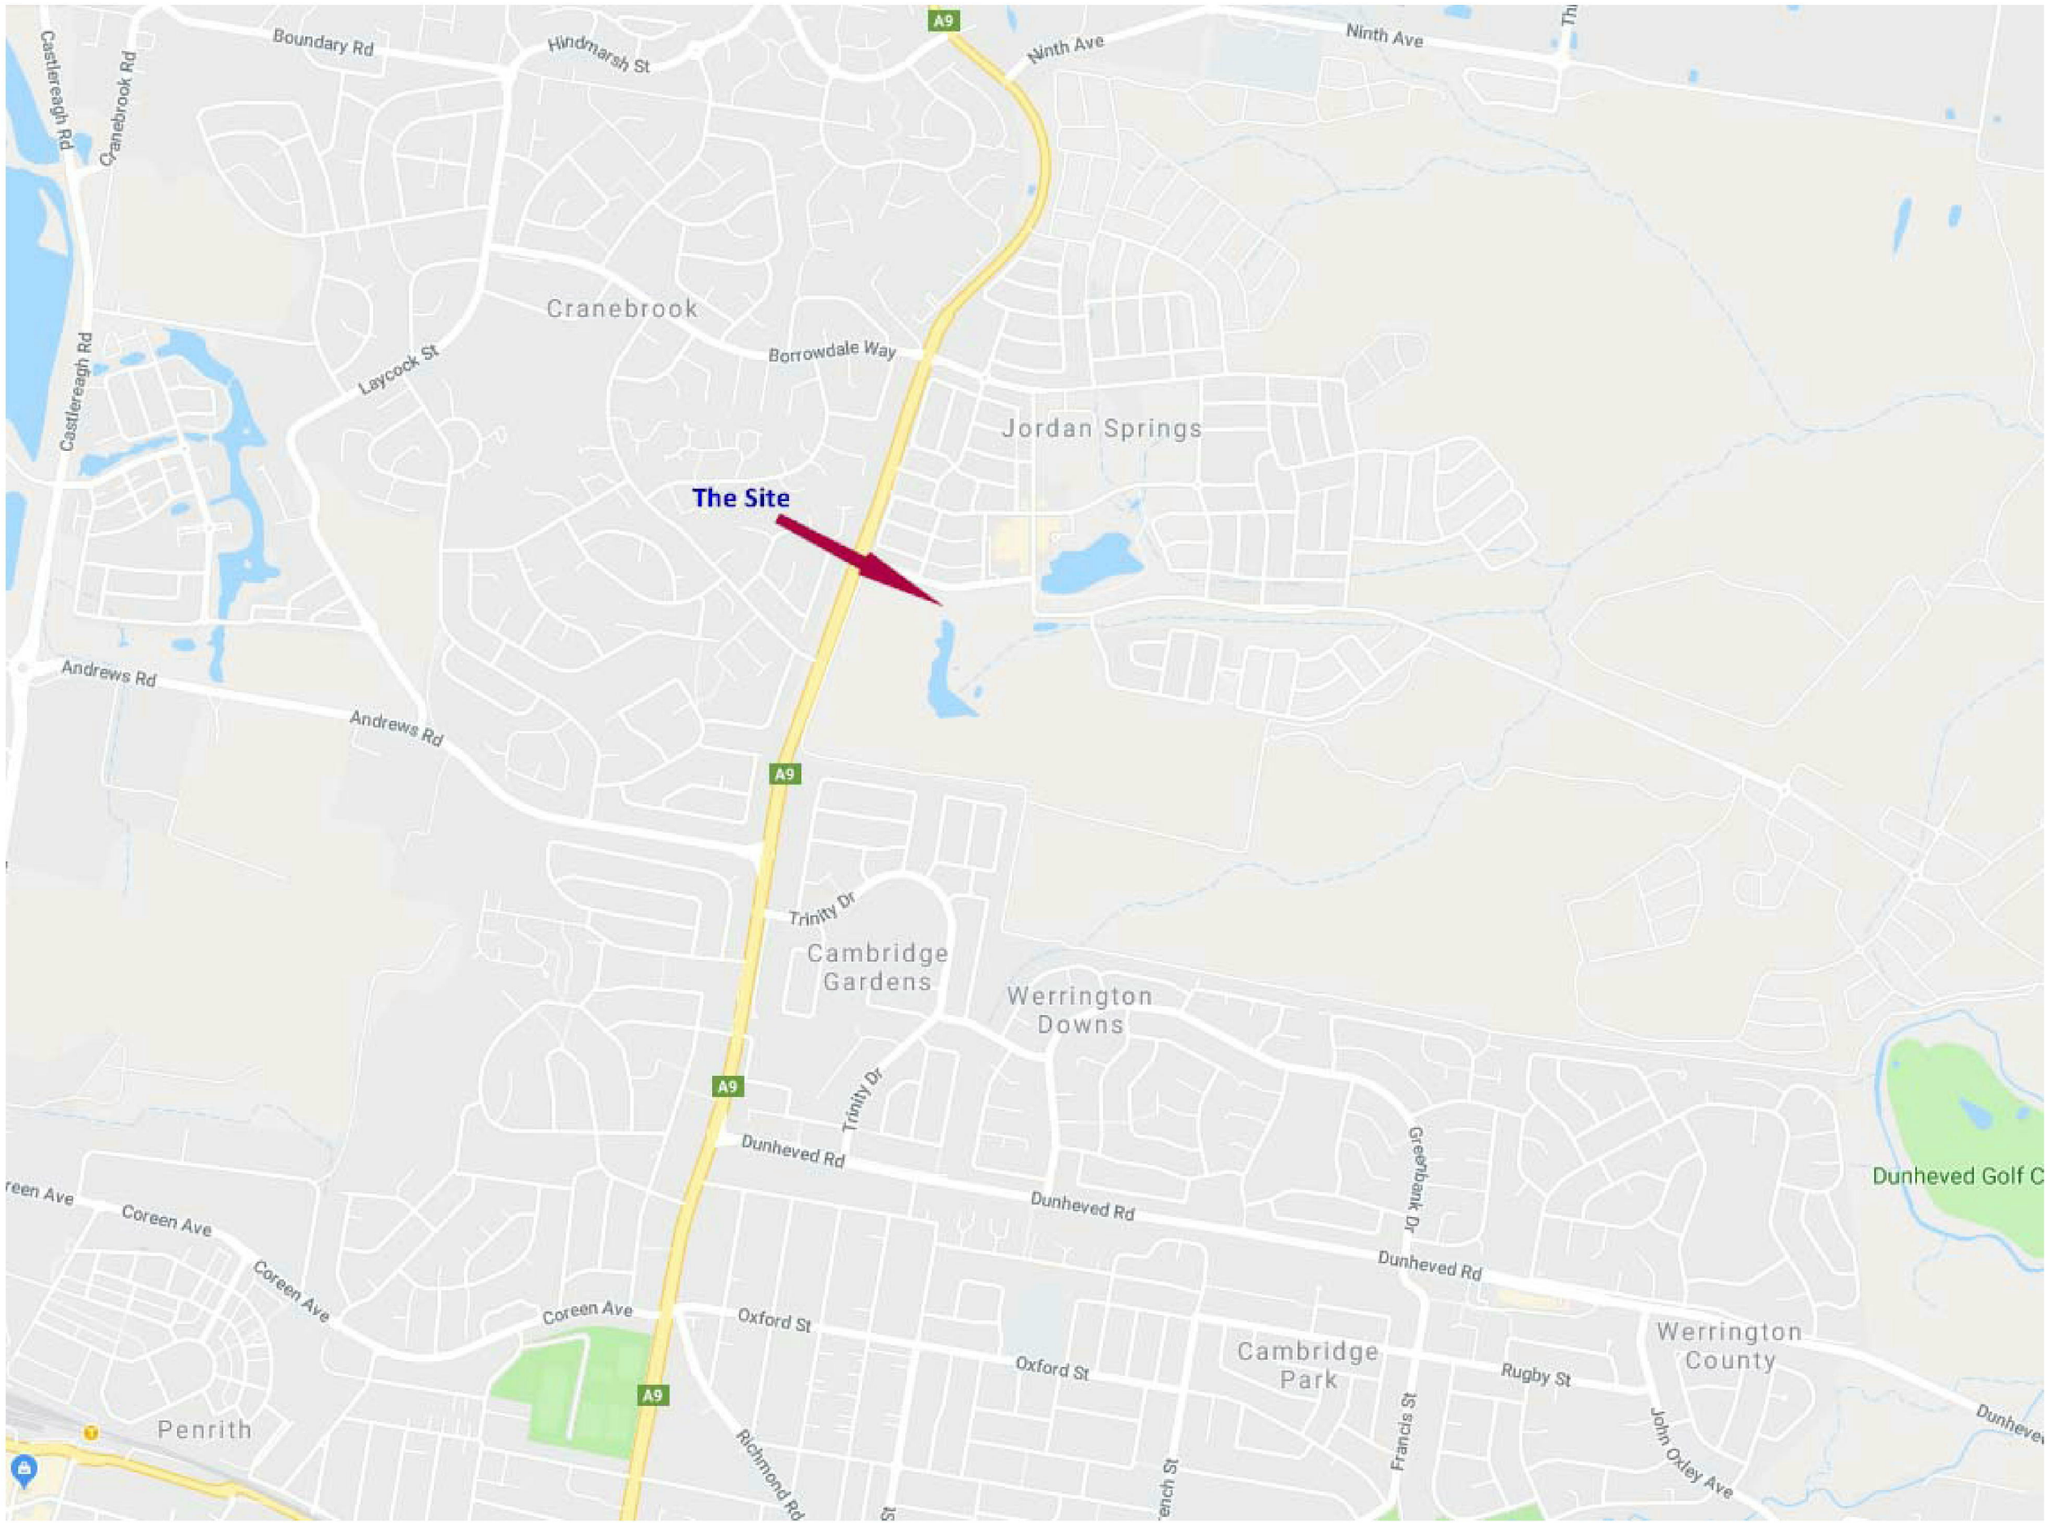


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Supplementary Contamination Assessment	Report No: 7161-ER-1-3 Figure Date: 20 April 2018	N	Figure No: 1	Figure Title: Site Locality Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

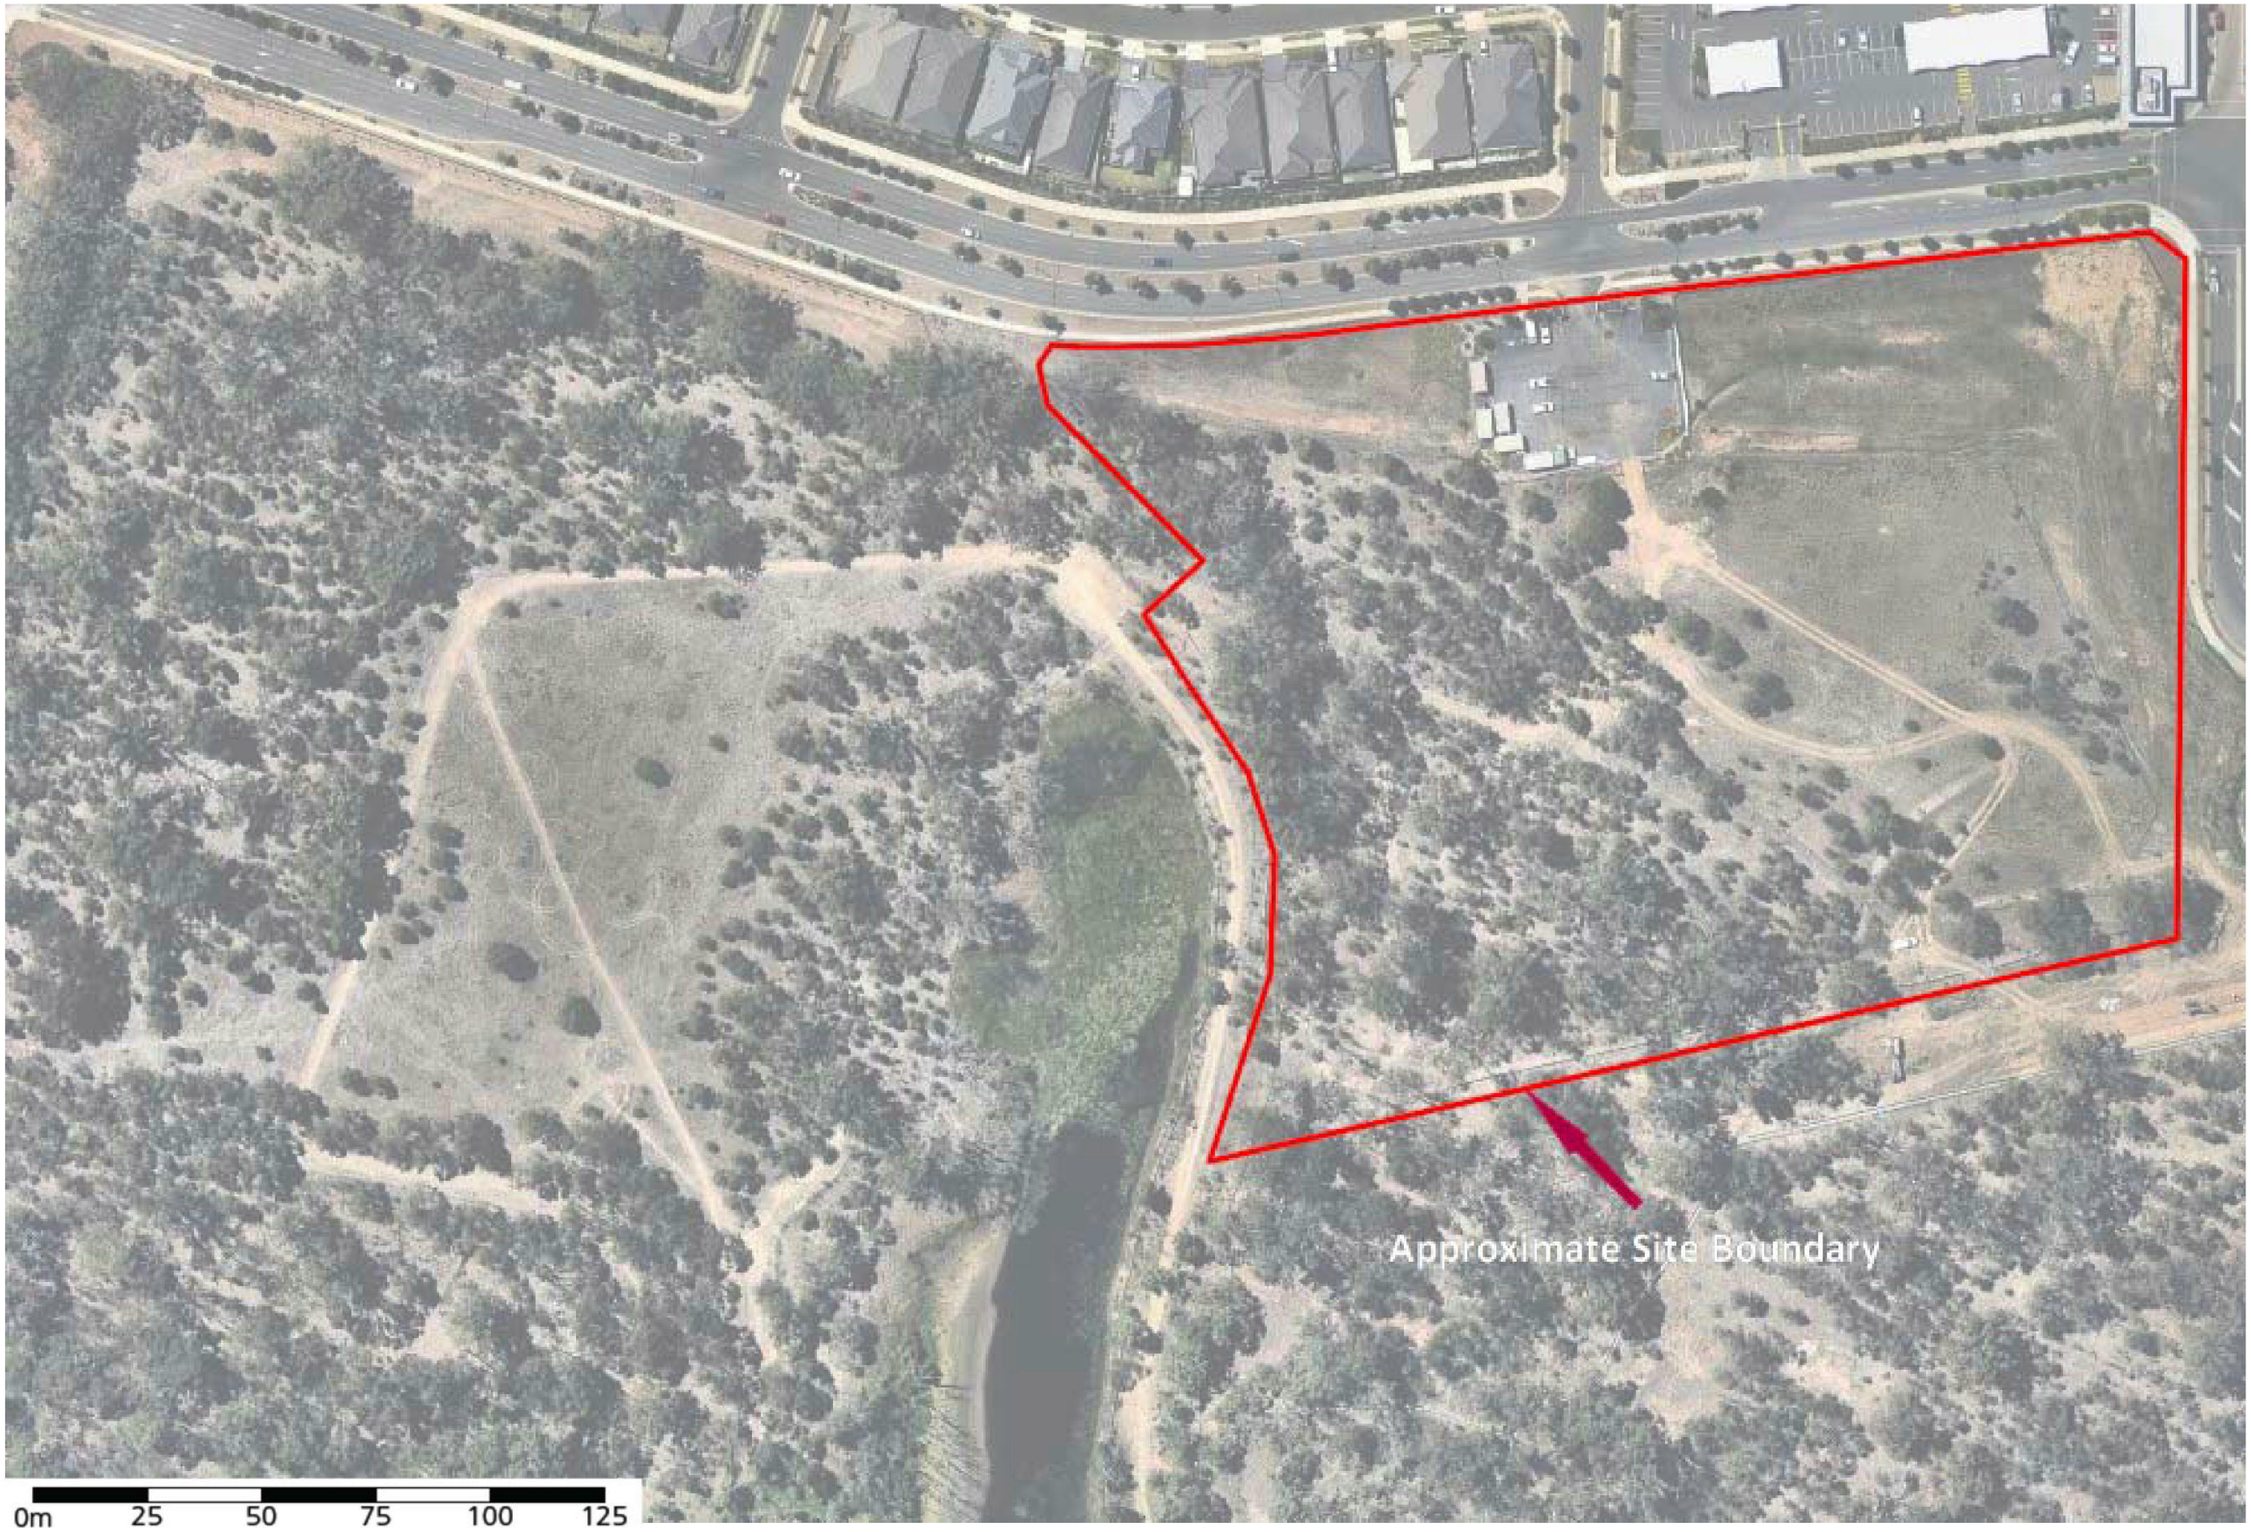


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Supplementary Contamination Assessment	Report No: 7161-ER-1-3 Figure Date: 20 April 2018	N	Figure No: 2	Figure Title: Site Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

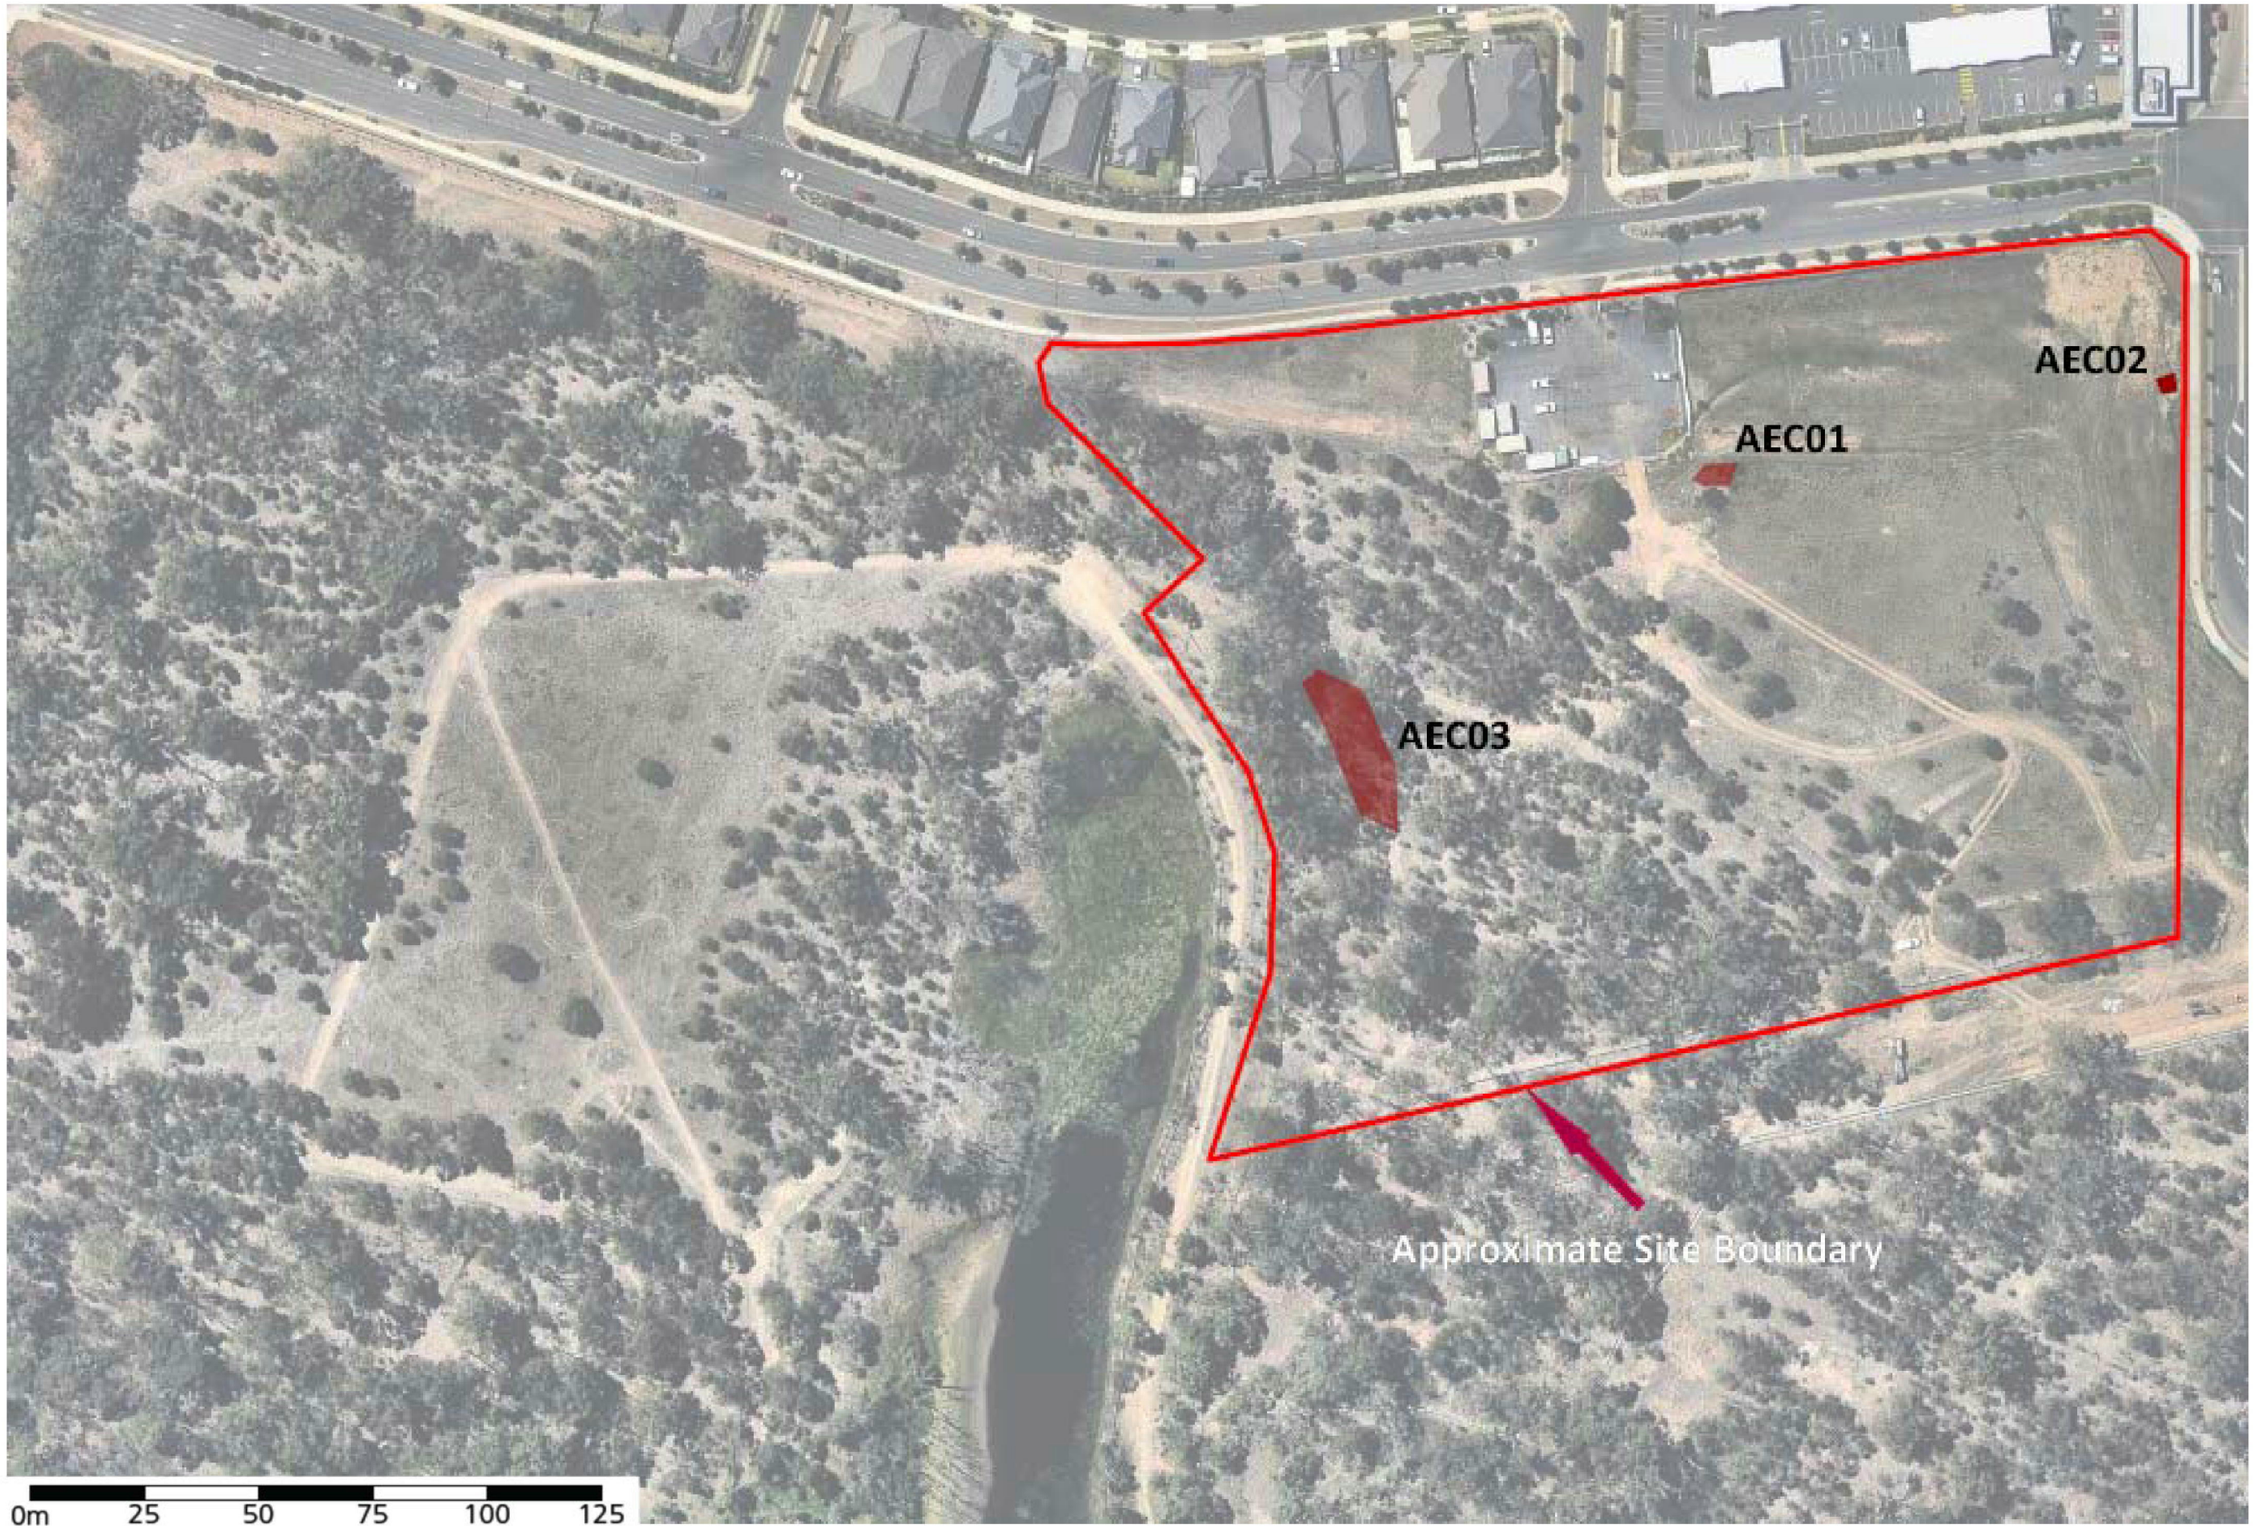

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Supplementary Contamination Assessment	Report No: 7161-ER-1-3 Figure Date: 20/04/2018	N	Figure No: 3	Figure Title: Areas of Environmental Concern

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

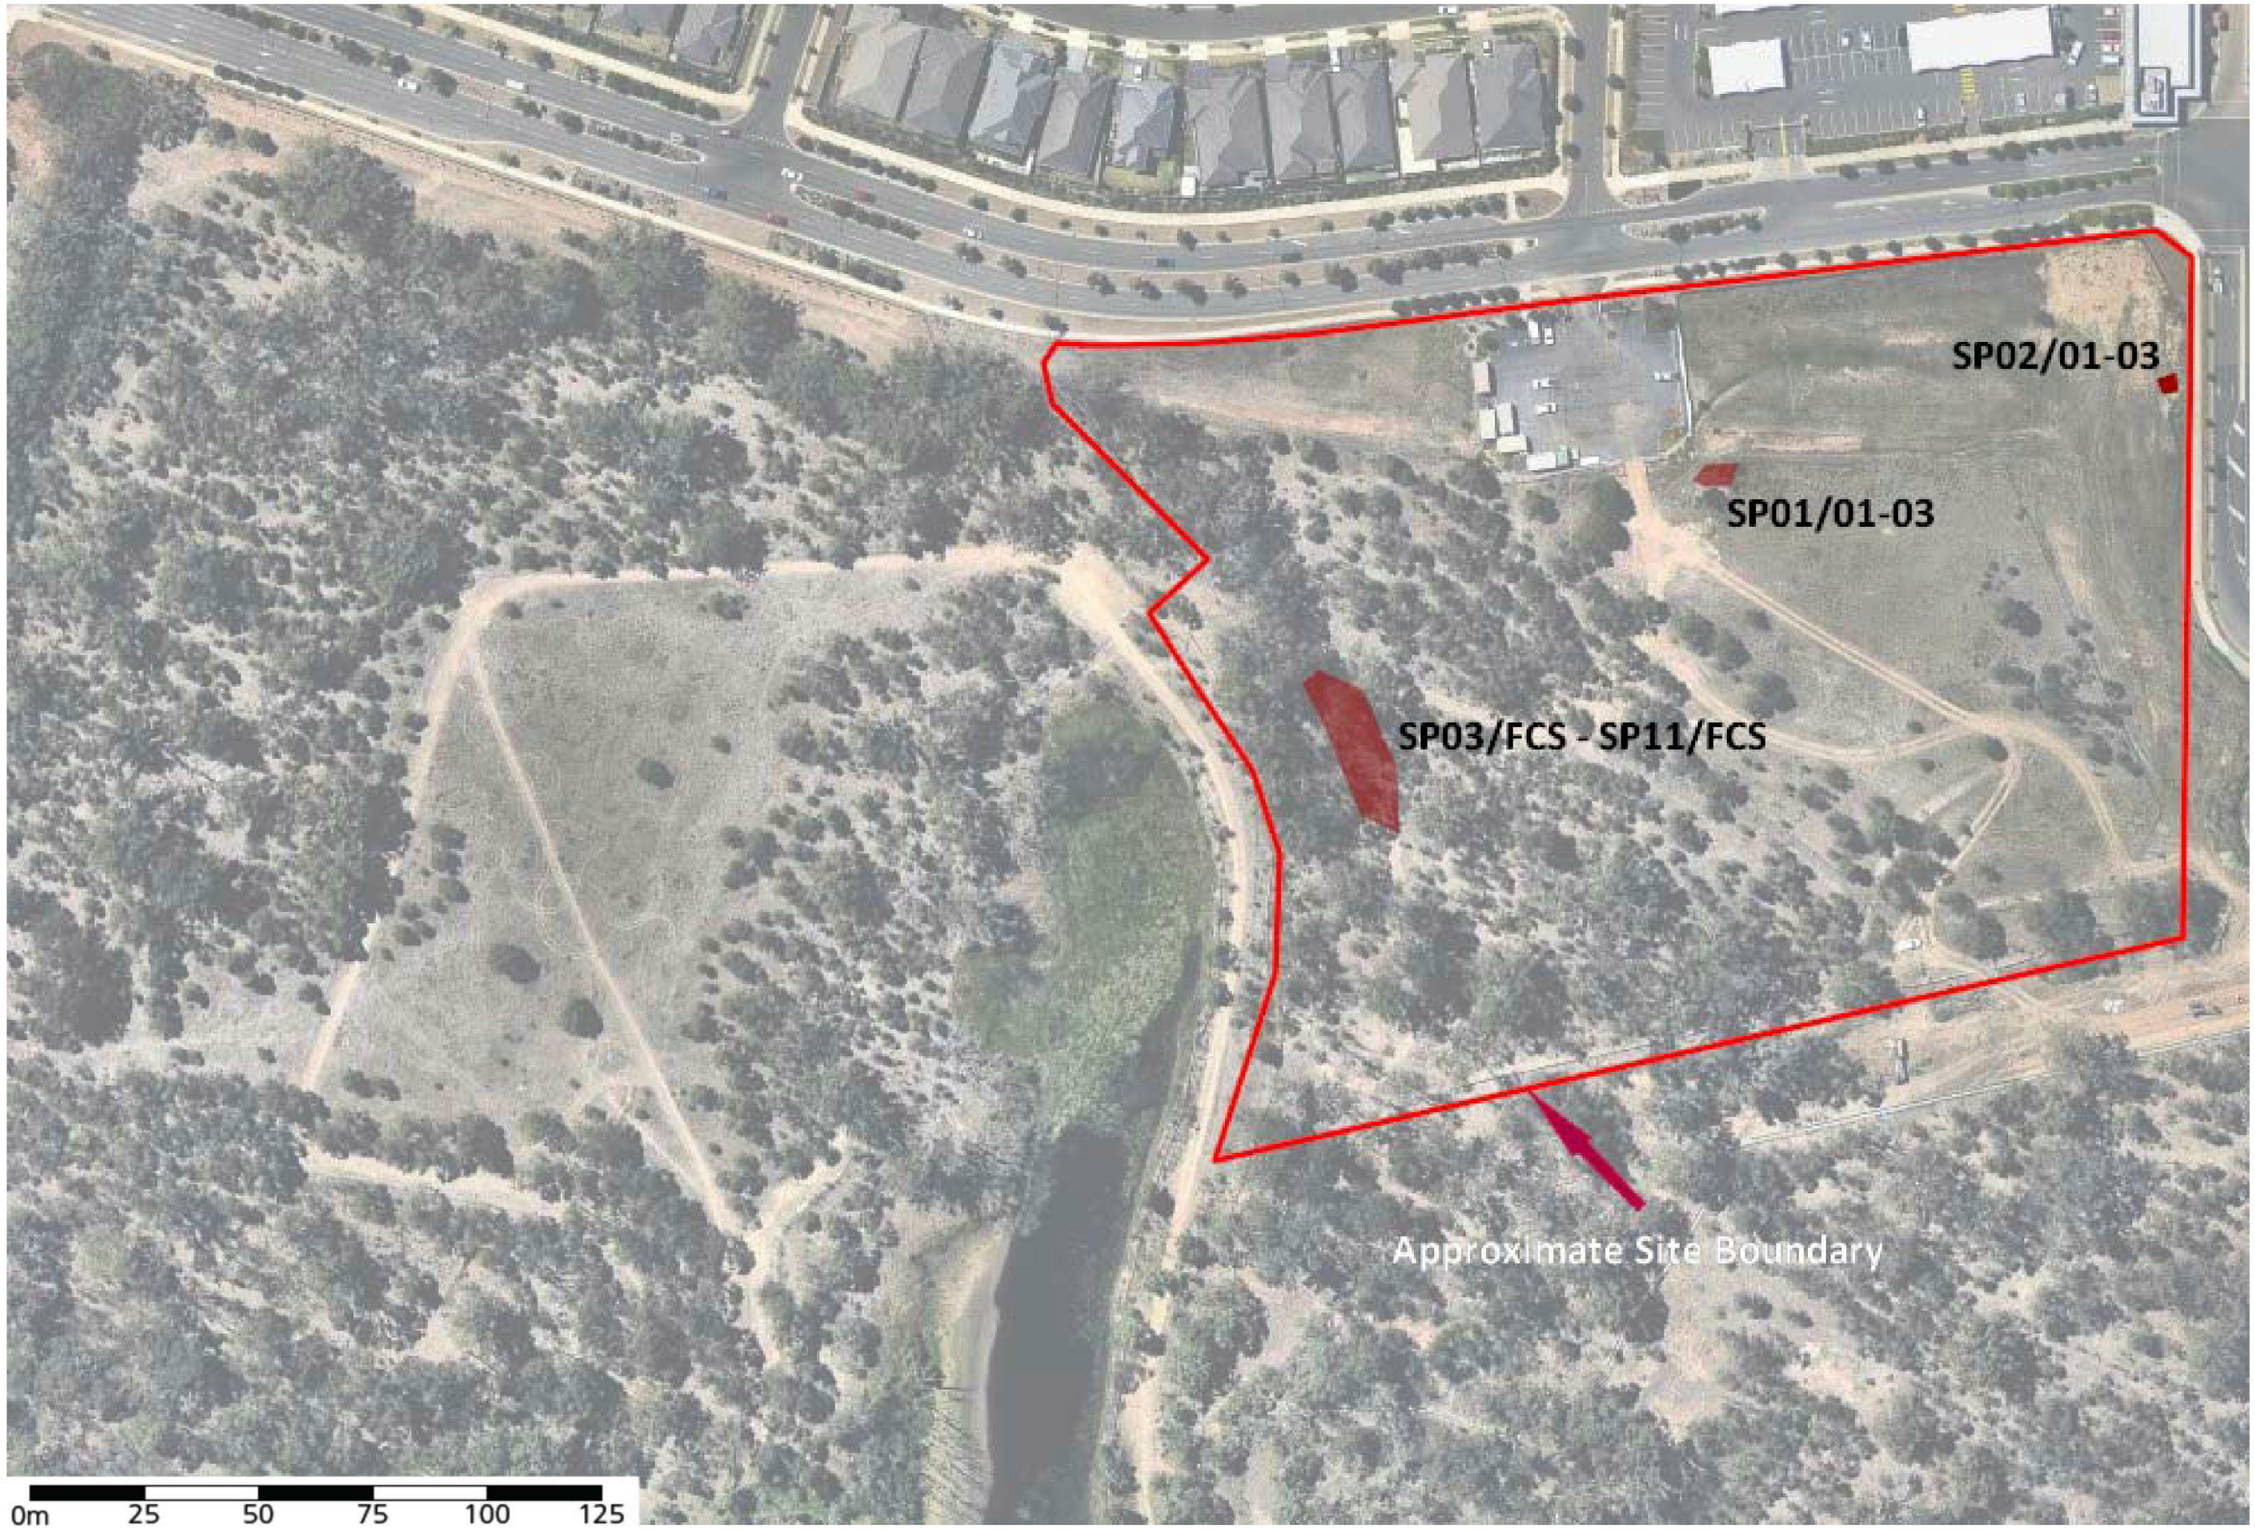

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Supplementary Contamination Assessment	Report No: 7161-ER-1-3 Figure Date: 20/04/2018	N	Figure No: 4	Figure Title: Sampling Point Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TABLES

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical Pty Ltd **Report No. 7161-ER-1-3**
Table LAR1 Laboratory Analytical Results - Soils
Supplementary Contamination Assessment
Lot 3990 and 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

Analyte Name	Units	Direct Contact HIL-A & HSL-A Residential (mg/kg)	Inhalation / Vapour Intrusion HSL A 0m to <1m (mg/kg)	Management Limits - Residential (mg/kg)	Reporting Limit	SE177801.001 Result	SE177801.002 Result	SE177801.003 Result	SE177801.004 Result	SE177801.005 Result	SE177801.007 Result	SE177801.017 Result
Sample Name						SE177801.001	SE177801.002	SE177801.003	SE177801.004	SE177801.005	SE177801.007	SE177801.017
Description						SP01/01	SP01/02	SP01/03	SP02/01	SP02/02	SP02/03	DUP01
Sample Date						9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018
Matrix						Soil	Soil	Soil	Soil	Soil	Soil	Soil
BTEXN in Soil												
Benzene	mg/kg	100	0.5		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Toluene	mg/kg	14000	160		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Ethylbenzene	mg/kg	4500	55		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Total Xylenes	mg/kg	12000	40		0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	N.A.
Naphthalene	mg/kg	1400	3		0.1	**0.4**	<0.1	<0.1	**0.4**	**0.3**	<0.1	N.A.
TRH in Soil												
Benzene (F0)	mg/kg	100			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
TRH C6-C10	mg/kg	4400		700	25	<25	<25	<25	<25	<25	<25	N.A.
TRH C6-C10 minus BTEX (F1)	mg/kg		45		25	<25	<25	<25	<25	<25	<25	N.A.
TRH >C10-C16	mg/kg	3300		1000	25	<25	<25	<25	<25	<25	<25	N.A.
TRH >C10-C16 - Naphthalene (F2)	mg/kg		110		25	<25	<25	<25	<25	<25	<25	N.A.
TRH >C16-C34 (F3)	mg/kg	4500		3500	90	<90	<90	<90	<90	<90	<90	N.A.
TRH >C34-C40 (F4)	mg/kg	6300		10000	120	<120	<120	<120	<120	<120	<120	N.A.
PAH in Soil												
Naphthalene	mg/kg	1400	3		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
2-methylnaphthalene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
1-methylnaphthalene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Acenaphthylene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Acenaphthene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Fluorene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Phenanthrene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.3**	<0.1	N.A.
Anthracene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Fluoranthene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.3**	<0.1	N.A.
Pyrene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.5**	<0.1	N.A.
Benzo(a)anthracene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.2**	<0.1	N.A.
Chrysene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.2**	<0.1	N.A.
Benzo(b&j)fluoranthene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.1**	<0.1	N.A.
Benzo(k)fluoranthene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Benzo(a)pyrene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.1**	<0.1	N.A.
Indeno(1,2,3-cd)pyrene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Dibenzo(ah)anthracene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Benzo(ghi)perylene	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	**0.1**	<0.1	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	3			0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)				0.2	<0.2	<0.2	<0.2	<0.2	**0.2**	<0.2	N.A.
Total PAH (18)	mg/kg				0.8	<0.8	<0.8	<0.8	<0.8	**1.9**	<0.8	N.A.
Total PAH (NEPM/WHO 16)	mg/kg	300			0.8	<0.8	<0.8	<0.8	<0.8	**1.9**	<0.8	N.A.
OCP in Soil												
Hexachlorobenzene (HCB)	mg/kg	10			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Alpha BHC	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Lindane	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Heptachlor	mg/kg	6			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Aldrin	mg/kg	6			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Dieldrin	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Beta BHC	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Delta BHC	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Heptachlor epoxide	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
o,p'-DDT	mg/kg	240			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
p,p'-DDT	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
o,p'-DDE	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
p,p'-DDE	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
o,p'-DDD	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
p,p'-DDD	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Alpha Endosulfan	mg/kg	270			0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Beta Endosulfan	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Gamma Chlordane	mg/kg	50			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Alpha Chlordane	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
trans-Nonachlor	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Endrin	mg/kg	10			0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Endosulfan sulphate	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Endrin Aldehyde	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Methoxychlor	mg/kg	300			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Endrin Ketone	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Isodrin	mg/kg				0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
Mirex	mg/kg	10			0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	N.A.
PCB in Soil												
Arochlor 1016	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1221	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1232	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1242	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1248	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1254	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1260	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1262	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Arochlor 1268	mg/kg				0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	N.A.
Total PCBs (Arochlors)	mg/kg	1			1	<1	<1	<1	<1	<1	<1	N.A.
Metals in Soil												
Arsenic, As	mg/kg	100			3	**6**	**7**	**5**	**7**	**7**	**5**	**4**
Cadmium, Cd	mg/kg	20			0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3
Chromium, Cr	mg/kg	100			0.3	**11**	**21**	**13**	**15**	**15**	**13**	**13**
Copper, Cu	mg/kg	6000			0.5	**14**	**20**	**24**	**43**	**55**	**34**	**22**
Lead, Pb	mg/kg	300			1	**14**	**19**	**14**	**45**	**68**	**40**	**15**
Nickel, Ni	mg/kg	400			0.5	**2.4**	**6.9**	**7.6**	**13**	**12**	**11**	**4.2**
Zinc, Zn	mg/kg	7400			0.5	**14**	**42**	**31**	**140**	**180**	**190**	**28**
Mercury	mg/kg	40			0.05	<0.05	<0.05	<0.05	<0.05	**0.05**	<0.05	<0.05

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical Pty Ltd **Report No. 7161-ER-1-3**

Table LAR2 - Laboratory Analytical Results - Soils (Asbestos)

Supplementary Contamination Assessment

Lot 3990 and 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

			Sample Name	SE177801A.001	SE177801A.002	SE177801A.003	SE177801A.004	SE177801A.005	SE177801A.006	SE177801A.007	SE177801A.008	SE177801A.009	SE177801A.010	SE177801A.011	SE177801A.012	SE177801A.013	SE177801A.014	SE177801A.015	SE177801A.016
			Description	SP01/01	SP01/02	SP01/03	SP02/01	SP02/02	SP02/02-FRAG	SP02/03	SP03/FCS	SP04/FCS	SP05/FCS	SP06/FCS	SP07/FCS	SP08/FCS	SP09/FCS	SP10/FCS	SP11/FCS
			Sample Date	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018	9/4/2018
			Matrix	Soil	Soil	Soil	Soil	Soil	Material	Soil	Material	Material	Material	Material	Material	Material	Material	Material	Material
Analyte Name	**Units**	**Health Screening Levels Residential A**	**Reporting Limit**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**	**Result**
Total Sample Weight	g		1	**576**	**532**	**501**	**537**	**503**	N.A.	**426**	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
ACM in >7mm Sample	g		0.01	<0.01	<0.01	<0.01	<0.01	<0.01	N.A.	<0.01	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
AF/FA in >2mm to <7mm Sample	g		0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
AF/FA in <2mm Sample	g		0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
Asbestos in soil (>7mm ACM)	%w/w	0.01	0.01	<0.01	<0.01	<0.01	<0.01	<0.01	N.A.	<0.01	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
Asbestos in soil (>2mm to <7mm AF/FA)	%w/w	0.001	0.001	<0.001	<0.001	<0.001	<0.001	<0.001	N.A.	<0.001	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
Asbestos in soil (<2mm AF/FA)	%w/w	0.001	0.001	<0.001	<0.001	<0.001	<0.001	<0.001	N.A.	<0.001	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
Asbestos in soil (<7mm AF/FA)	%w/w	0.001	0.001	<0.001	<0.001	<0.001	<0.001	<0.001	N.A.	<0.001	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.	N.A.
Fibre Type	No unit		-	ORG,NAD	ORG,NAD	NAD	ORG,NAD	ORG,NAD	Chrysotile	ORG,NAD	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite	Chrysotile & Crocidolite
Asbestos Detected	No unit	Yes	-	N.A.	N.A.	N.A.	N.A.	N.A.	**Yes**	N.A.	**Yes**	**Yes**	**Yes**	**Yes**	**Yes**	**Yes**	**Yes**	**Yes**	**Yes**

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical Pty Ltd **Report No. 7161-ER-1-3**

Table LAR3 - Laboratory Analytical Results - RPD

Supplementary Contamination Assessment


Lot 3990 and 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

		Sample Name	SE177801.001	SE177801.017	RPD %	S18-Ap12479	RPD %
		Description	SP01/01	DUP01		DUP1A	
		Sample Date	9/4/2018	9/4/2018		9/4/2018	
		Matrix	Soil	Soil		Soil	
Analyte Name	**Units**	**Reporting Limit**	**Result**	**Result**		**Result**	
Metals in Soil							
Arsenic, As	mg/kg	3	6	4	40	7.2	18
Cadmium, Cd	mg/kg	0.3	<0.3	<0.3	#VALUE!	<0.4	#VALUE!
Chromium, Cr	mg/kg	0.3	11	13	17	14	24
Copper, Cu	mg/kg	0.5	14	22	**44**	22	**44**
Lead, Pb	mg/kg	1	14	15	7	18	25
Nickel, Ni	mg/kg	0.5	2.4	4.2	55	6.8	**96**
Zinc, Zn	mg/kg	0.5	14	28	**67**	27	**63**
Mercury	mg/kg	0.05	<0.05	<0.05	#VALUE!	<0.1	#VALUE!

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX A

SURVEY

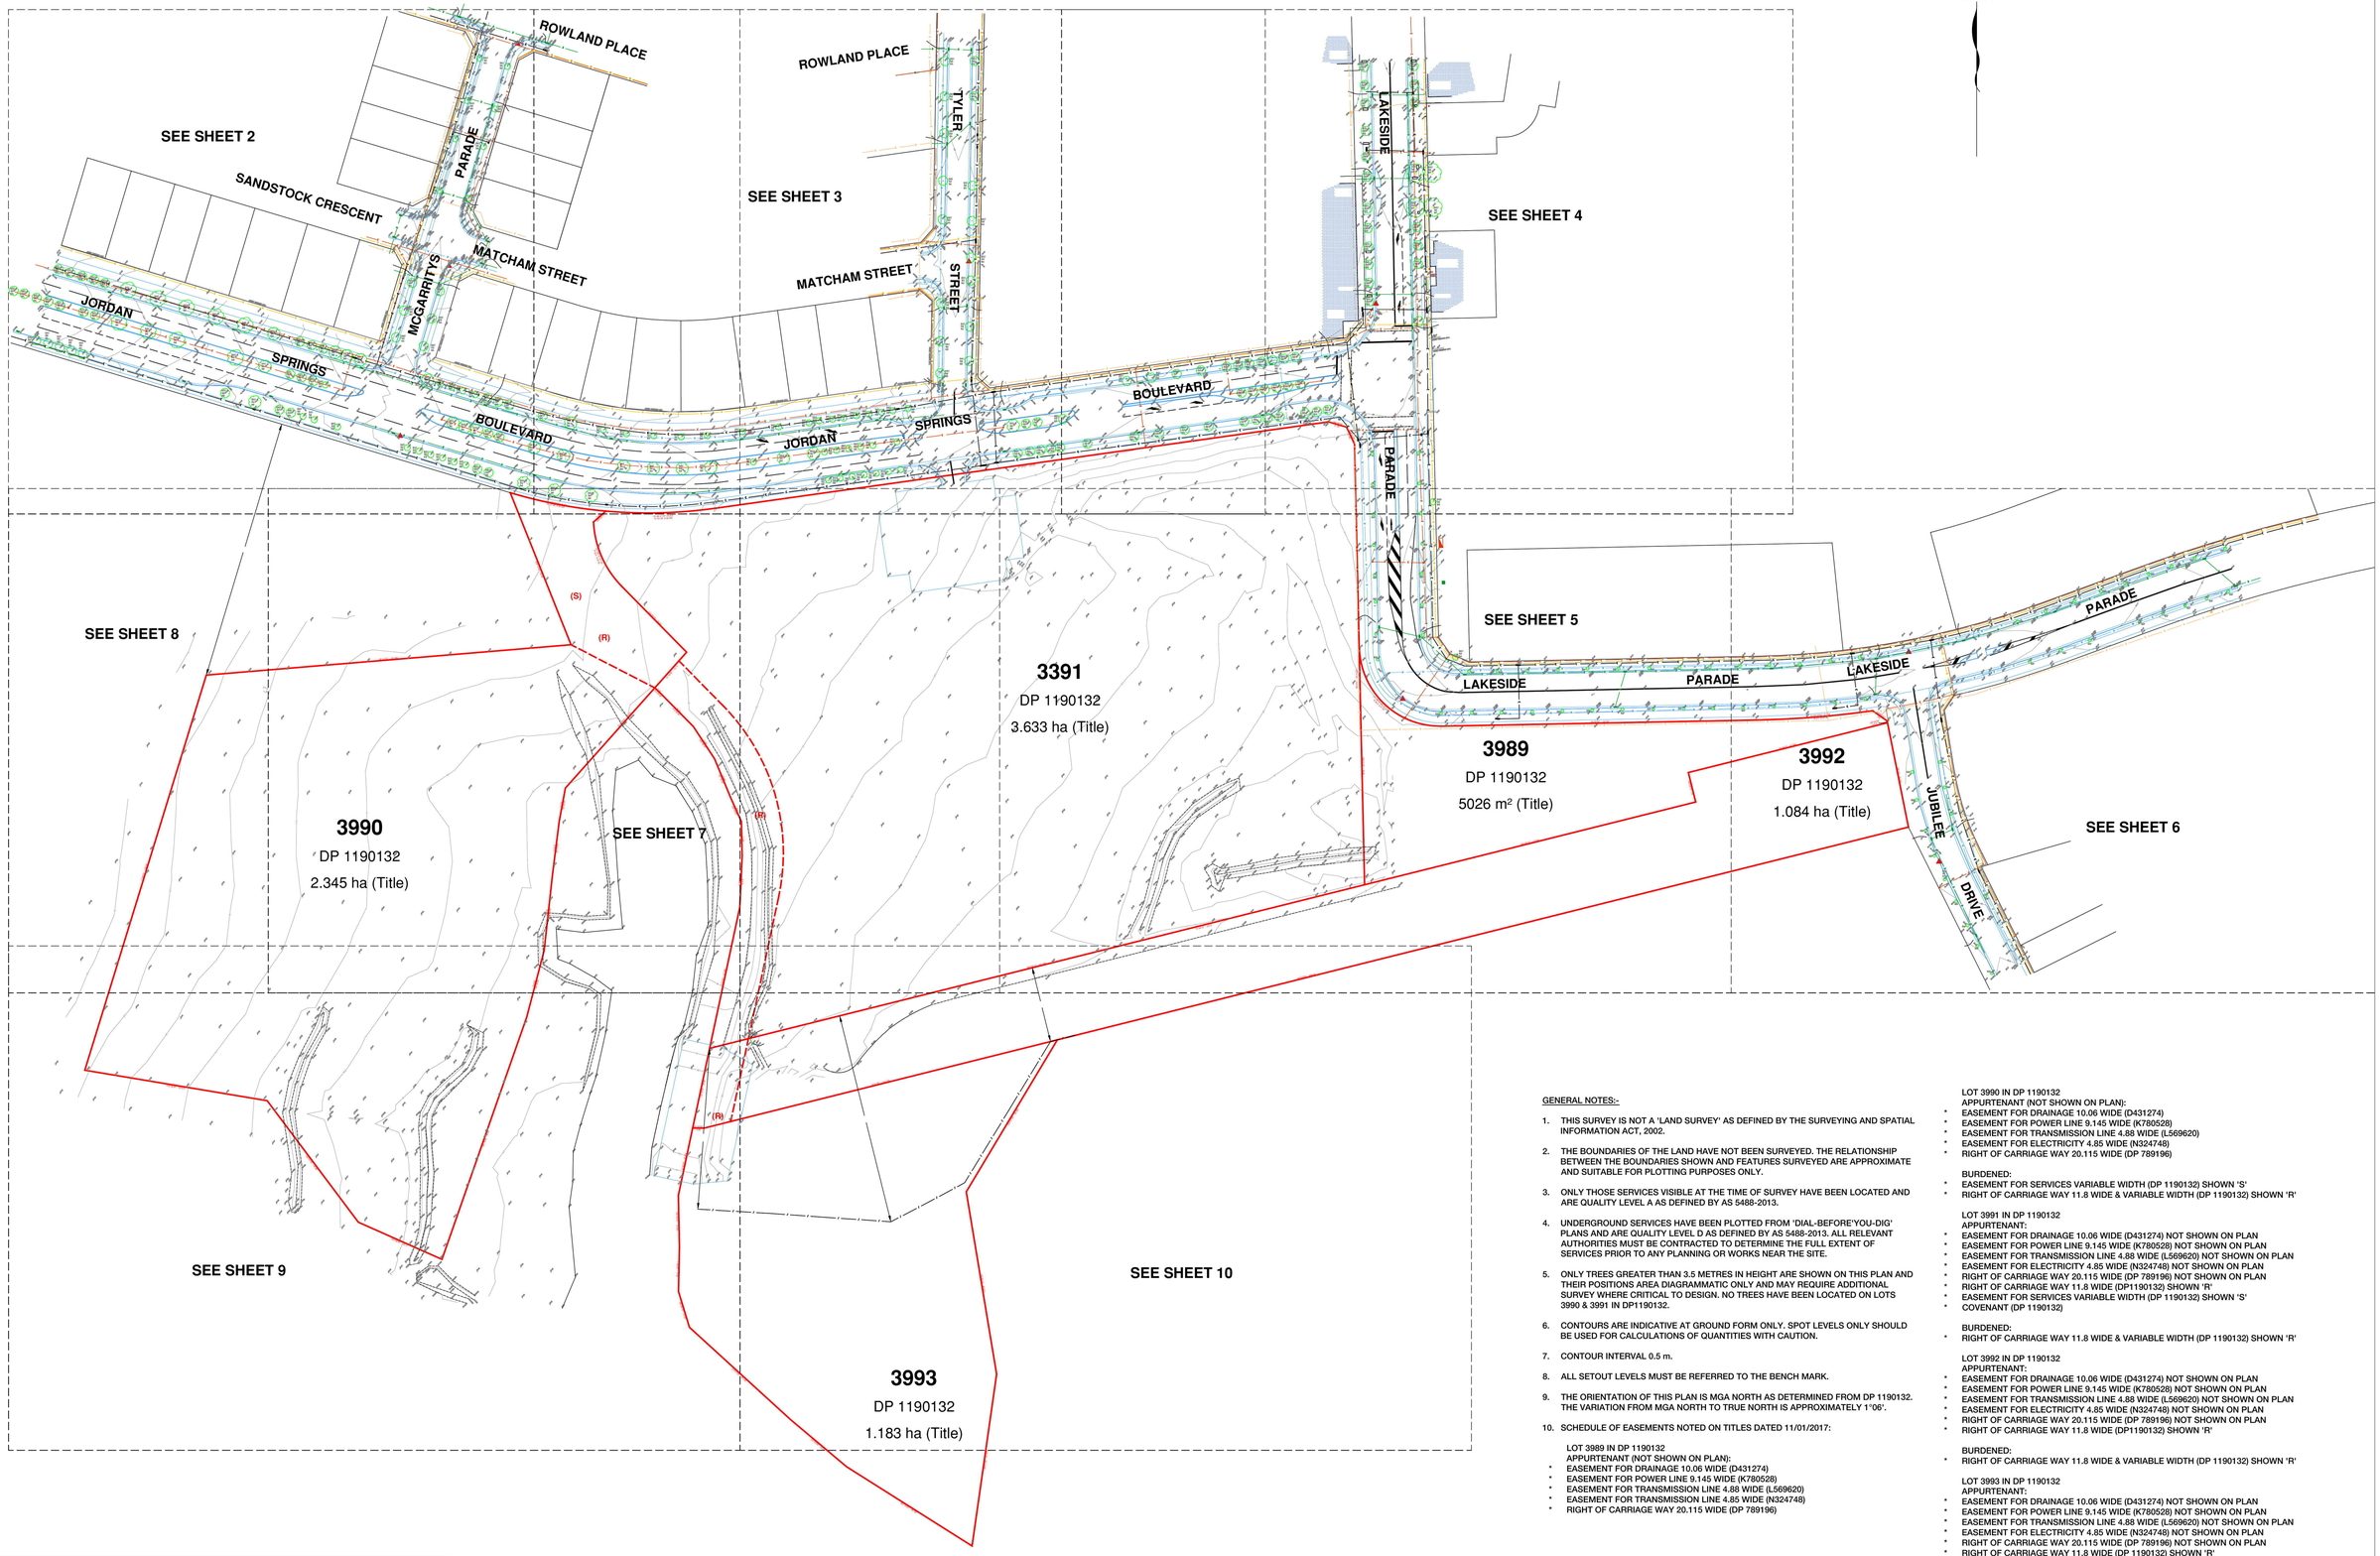

SEE SHEET 2 FOR LEGEND AND UNDERGROUND SERVICES

10 20 30 40 50 100

1:1000

GENERAL NOTES:-

1. THIS SURVEY IS NOT A 'LAND SURVEY' AS DEFINED BY THE SURVEYING AND SPATIAL INFORMATION ACT, 2002.
2. THE BOUNDARIES OF THE LAND HAVE NOT BEEN SURVEYED. THE RELATIONSHIP BETWEEN THE BOUNDARIES SHOWN AND FEATURES SURVEYED ARE APPROXIMATE AND SUITABLE FOR PLOTTING PURPOSES ONLY.
3. ONLY THOSE SERVICES VISIBLE AT THE TIME OF SURVEY HAVE BEEN LOCATED AND ARE QUALITY LEVEL A AS DEFINED BY AS 5488-2013.
4. UNDERGROUND SERVICES HAVE BEEN PLOTTED FROM 'DIAL-BEFORE'YOU-DIG' PLANS AND ARE QUALITY LEVEL D AS DEFINED BY AS 5488-2013. ALL RELEVANT AUTHORITIES MUST BE CONTRACTED TO DETERMINE THE FULL EXTENT OF SERVICES PRIOR TO ANY PLANNING OR WORKS NEAR THE SITE.
5. ONLY TREES GREATER THAN 3.5 METRES IN HEIGHT ARE SHOWN ON THIS PLAN AND THEIR POSITIONS AREA DIAGRAMMATIC ONLY AND MAY REQUIRE ADDITIONAL SURVEY WHERE CRITICAL TO DESIGN. NO TREES HAVE BEEN LOCATED ON LOTS 3990 & 3991 IN DP1190132.
6. CONTOURS ARE INDICATIVE AT GROUND FORM ONLY. SPOT LEVELS ONLY SHOULD BE USED FOR CALCULATIONS OF QUANTITIES WITH CAUTION.
7. CONTOUR INTERVAL 0.5 m.
8. ALL SETOUT LEVELS MUST BE REFERRED TO THE BENCH MARK.
9. THE ORIENTATION OF THIS PLAN IS MGA NORTH AS DETERMINED FROM DP 1190132. THE VARIATION FROM MGA NORTH TO TRUE NORTH IS APPROXIMATELY 1°06'.
10. SCHEDULE OF EASEMENTS NOTED ON TITLES DATED 11/01/2017:

LOT 3989 IN DP 1190132
APPURTENANT (NOT SHOWN ON PLAN):
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274)
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528)
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620)
* EASEMENT FOR TRANSMISSION LINE 4.85 WIDE (N324748)
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196)

LOT 3990 IN DP 1190132
APPURTENANT (NOT SHOWN ON PLAN):
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274)
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528)
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620)
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748)
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196)

BURDENED:
* EASEMENT FOR SERVICES VARIABLE WIDTH (DP 1190132) SHOWN 'S'
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3991 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP1190132) SHOWN 'R'
* EASEMENT FOR SERVICES VARIABLE WIDTH (DP 1190132) SHOWN 'S'
* COVENANT (DP 1190132)

BURDENED:
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3992 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP1190132) SHOWN 'R'

BURDENED:
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3993 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP 1190132) SHOWN 'R'

11. COVENANTS AND RESTRICTIONS ARE NOTED ON ALL TITLES. THESE HAVE NOT BEEN INVESTIGATED.
12. MGA COORDINATES ARE BASED ON SSM 175299 (CLASS C ORDER 3)

DIAL BEFORE YOU DIG www.1100.com.au

©COPYRIGHT
SDG is the owner of the copyright subsisting in these drawings, plans, designs and specifications. They must not be used, reproduced or copied in whole or in part without prior written consent of SDG

ISSUE	DATE	AMENDMENT
A	20/12/16	ORIGINAL ISSUE
B	15/02/17	ADDITIONAL INFORMATION LOT 3993 DP1190132
C	15/01/18	ADDITIONAL INFORMATION LOTS 3390 & 3391 DP1190132

CLIENT: LENDLEASE

SCALE 1:1000
ORIGIN OF LEVELS: SSM 80426 RL 47.288
DATUM: A.H.D.
REF.: 7202
DATE: 15/01/2018
SURV/CHK: SW/CT
SHEET 1 OF 10 SHEETS
PLAN A1
ISSUE C

DETAIL AND LEVEL SURVEY OF PART OF JORDAN SPRINGS BOULEVARD, LAKESIDE PARADE & JUBILEE DRIVE JORDAN SPRINGS

SDG LAND DEVELOPMENT SOLUTIONS A.B.N. 69 213 023 631
Suite 1 3 Railway Street BAULKHAM HILLS 2153
P.O.Box 2572 NORTH PARRAMATTA 1750
t: (02) 9630 7955
e: office@sdg.net.au
w: www.sdg.net.au

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX B

PREVIOUS REPORTS

Contamination Management Plan
Western Precinct
Development Phase

Prepared for

Maryland Development Company

Private Road
Off Forrester Road
St Marys 2760

JULY 2008

URS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Project Director:

Seth Molinari
Senior Principal

URS Australia Pty Ltd
Level 3, 116 Miller Street
North Sydney, NSW 2060 Australia
Tel: 61 2 8925 5500
Fax: 61 2 8925 5555

Author:

David Smith
Principal

Date: **7th July 2008**
Reference: 4321 7287
Status: Final

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Contents

Glossary of Abbreviations and Terms ii

1 Introduction ---------- 1-1

1.1 General Introduction 1-1
1.2 Introduction to the Contamination Management Plan 1-4
1.3 Contamination Management Plan Objectives 1-4

2 Contamination Management Plan ---------- 2-1

2.1 Potential Chemical Contamination 2-1
Extensive Contamination 2-2
2.2 Potential Explosive Ordnance Materials 2-2
Further Explosive Ordnance Surveys 2-3
2.3 Temporary Stockpiling of Materials 2-4
2.4 Contaminated Management Plan Flowchart 2-4

3 Summary of Roles & Responsibilities ---------- 3-1

4 Limitations ---------- 4-1

FIGURES

Figure 1 Aerial photograph of the St Marys Property 1-1
Figure 2 Western Precinct (with other developable areas) 1-3
Figure 3 Contamination Management Process 2-4

APPENDICES

Appendix A Site Audit Statements

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Glossary of Abbreviations and Terms

Abbreviation	Term	Definition
Ammunition	Ammunition	A device charged with explosives, propellants, pyrotechnics, initiating composition, or nuclear, biological or chemical material for use in connection with defence or offence including demolitions. Certain ammunition can be used for training, ceremonial or other non-operational purposes.
Category A	Category A ordnance items	An item clearly of a military nature and which might readily be recognised by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and containing explosive filling, but excluding small arms ammunition.
Category B	Category B ordnance items -	An item clearly of a military nature and which might readily be recognised by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and not containing explosive filling, but excluding small arms ammunition.
CMP (2003)	Contamination Management Plan for the Eastern Precinct	The Contamination Management Plan prepared in 2003 and submitted to Blacktown City Council and other authorities as required by the Site Audit Statements issued in the Stage 2 Decontamination Audit of ADI St Marys Munitions Factory, dated 7th June 1999.
CMP	Contamination Management Plan	The Contamination Management Plan issued to support Precinct Plan(s).
DPP	Dunheved Precinct Plan	The Dunheved Precinct Plans set out the future pattern of development for the Dunheved Precinct. The Plan was adopted by Penrith City Council on 11 December 2006 and by Blacktown City Council on 12 January 2007.
DUXOP	Defence Unexploded Ordnance Panel	The panel of contractors and consultants from whom the Department of Defence selects members for UXO related tasks.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Abbreviation	Term	Definition
EPP	Eastern Precinct Plan	The Eastern Precinct Plan sets out the future pattern of development for the Eastern Precinct. The Plan was adopted by Blacktown City Council on 4 February 2004.
Induction	Site Specific Induction	Section 8(2) of the OHS Act requires employers to ensure that persons other than their workers are not exposed to risks while in the employer's workplace. These persons include contractors, customers and visitors. If there are significant risks in the workplace, there may be a need for site induction training and procedures for managing people while on the premises.[1]
Property	Property	The whole of the landholding by St Marys Land Limited and which is sometimes called the St Marys Property for the purposes of its rezoning and redevelopment.
Site	Site	The subject area, where potential contamination has been found.
UXO	Unexploded Ordnance	Explosive ordnance that has been primed, fused, armed or otherwise prepared for action and which has been fired, dropped, launched, projected or placed in such a manner as to constitute a hazard to operations, installations, personnel or material but remains unexploded either by malfunction or design or for any cause. UXO includes items of military ammunition or explosives removed from their original resting-place for any reason, including souveniring.

[1] "http://www.workcover.nsw.gov.au/Employers/LegalResponsibility/default.htm" WorkCover's webpage on 18th September 2006

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

1.1 General Introduction

The former Australian Defence Industries (ADI) Property (the Property) at St Marys was endorsed by the NSW Government for inclusion on the Urban Development Program in 1993. The Property was seen to present an opportunity to provide housing for Sydney's growing population within an environmentally sustainable framework.

The Property is located approximately 45km west of the Sydney CBD, 5km north-east of the Penrith City Centre and 12km west of the Blacktown City Centre. The main western railway is located approximately 2.5km south of the Property. The Great Western Highway is located another 1 km south and the M4 Motorway a further 1.5km south.

The Property has an area of 1,545ha, and stretches roughly 7 kilometres from east to west and nearly 3 kilometres from north to south, from Forrester Road, St Marys in the east to The Northern Road, Cranebrook in the west, and is bounded by Llandilo and Willmot in the north and Cambridge Gardens / Werrington County and the Dunheved Industrial Area in the south. Figure 1, following, illustrates the location of the Property.

Figure 1 Aerial photograph of the St Marys Property



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Given that the Property straddles the boundary between two local government areas (Blacktown and Penrith), the NSW Government decided that a regional environmental plan should be prepared covering development of the Property. Technical investigations into the environmental values and development capability of the land were commenced in 1994, and the Regional Environmental Plan for St Marys (Sydney Regional Environmental Plan No. 30 (SREP 30)) was gazetted in January, 2001. SREP 30 zoned the land for a combination of "urban", "employment", "regional open space", and "regional park" uses.

A package of documents was prepared to guide and control development comprising SREP 30 (maps and a written instrument) and an Environmental Planning Strategy (EPS) which sets out performance objectives and strategies to address key constraints associated with the Property, including: conservation, cultural heritage, water and soils, transport, urban form, energy and waste, human services, employment and land contamination.

In December 2002, a Deed of Agreement was entered into between the landowner and developers of the land (a Joint Venture comprising ComLand and Lend Lease Development) and the NSW Government setting out the developer's and State Government's responsibilities in providing services and infrastructure.


SREP 30 identified six development "precincts" (known as the Western Precinct, Central Precinct, North and South Dunheved Precincts, Ropes Creek Precinct and Eastern Precinct) within the Property.

SREP 30 requires that a Precinct Plan, addressing the issues in SREP 30 and the EPS (including preparation of management plans for a range of key issues), be adopted by Council prior to any development taking place.

In March 2002, the Commonwealth Government advised that those areas of the Property listed on the Register of the National Estate should be excluded from urban development. This had the effect of changing the boundaries of the areas to be set aside for conservation. SREP 30 was subsequently amended in April 2006 to reflect these boundary changes. The precincts available for development are shown in Figure 2 below.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Figure 2 Western Precinct (with other developable areas)

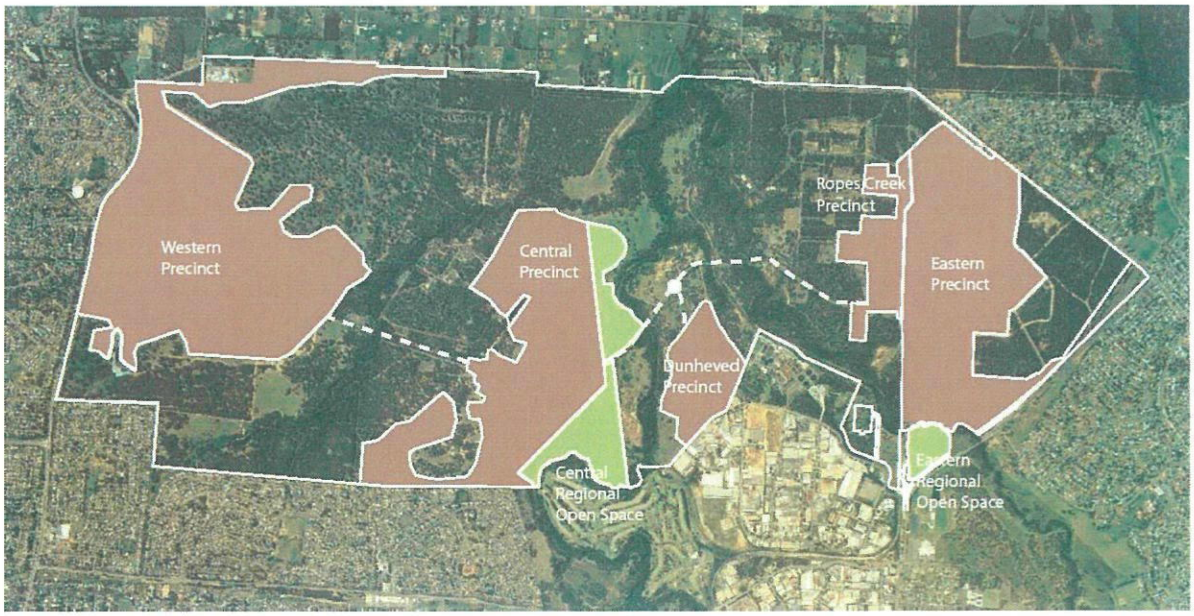

On 29 September 2006, the Minister for Planning declared the Western Precinct a Release Area, paving the way for the preparation of a Precinct Plan for this area. The Western Precinct, the subject of this CMP, occupies an area of approximately 229 hectares. Although currently zoned under SREP 30 for both Urban and Employment uses, there is a draft amendment to SREP 30 currently being prepared under which the entire Western Precinct is zoned Urban.

A Precinct Plan for the Eastern Precinct (FPP) was adopted by Blacktown City Council (BCC) on 4 February 2004. The EPP incorporated a Contamination Management Plan (CMP) prepared by URS in 2003, and other management plans, and an accompanying Development Control Strategy (DCS). The Dunheved Precinct Plans have since been adopted by Penrith City Council and Blacktown City Council.

Since completion of the CMP (2003), development of the Eastern Precinct Release Area has progressed and additional site investigations have been completed as required by Site Audit Statements.

In addition, the Department of Environment and Conservation (DEC) (incorporating the NSW Environment Protection Authority and now known as the NSW Department of Environment and Climate Change (DECC)) has provided advice to Site Auditors that "*auditors should be able to rely on expert opinion* [Department of Defence Unexploded Ordnance panel (DUXOP) consultants] *to form a view about site suitability*" when assessing a site for munitions contamination. Further deliberations by the DEC and Site Auditors have determined that the presence of munitions items on a site is not likely to be within the ambit purview of a Site Auditor accredited under the Contaminated Land Management Act (1997) – but rather a suitably qualified expert in procedures for the location, handling and disposal of munitions items. Such experts can be found in, but are not limited to, the DUXOP.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Notwithstanding this change in process, the 1999 Site Audit Statements for the St Marys property have addressed the issue of potential UXO contamination.

Bulk earthworks commenced in the Eastern Precinct on 8 December 2004. Development applications for the construction of the Ropes Creek Bridge and the Southern Entry Road into the site have been submitted to BCC and Penrith City Council.

Subsequently, CMPs have been prepared by URS for the North and South Dunheved Precincts (2004), Ropes Creek and Eastern Precincts (2006) and the Eastern Regional Park (2006).

This CMP (Western Precinct Contamination Management Plan) has been prepared to support the lodgement of the Western Precinct Plan and takes into account current site knowledge including and DECC guidance relating to the reliance on specialist consultants for use in the development phase prior to sub-division.

1.2 Introduction to the Contamination Management Plan

The Western Precinct was the subject of extensive investigation during the 1990s. The investigation work was undertaken with the full involvement of the EPA and subsequently an independent NSW EPA accredited Site Auditor who produced and issued Site Audit Statements for the whole of the St Marys Property (*Stage 2 Decontamination Audit of ADI St Marys Munitions Factory*, dated 7 June 1999).

The investigation and remediation programme for the Property commenced in 1990, with the objective of assessing the nature, degree of chemical contamination and remediating to a level suitable for redevelopment for a variety of land uses including residential. For the purposes of the remediation and validation, the Property was divided into nine sectors. The Western Precinct covers part of the following sectors as follows:

- Part Western Sector — Covered by SAS CHK001/1.
- Part Southern West Sector — Covered by SASs CHK001/1, CHK001/6 and CHK001/7.

The information presented in the remediation and validation reports for these sectors has been considered, along with other relevant information for the Property, to develop this CMP (Western Precinct).

The majority of the Western Precinct was assessed by the Site Auditor to pose a negligible risk to the public or the environment with regard to chemical contamination and/or explosive ordnance (See SASs as listed above in Appendix A). Conditions on the SASs required investigation and assessment of areas underlying roadways which had not been investigated at the date of the SASs.

1.3 Contamination Management Plan Objectives

The objective of this CMP is to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the natural environment.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Unexpected finds may occur in areas which, although searched extensively, contain remnant materials which were obscured by the local topography, the type of surface cover (e.g. building) or at a depth preventing detection. The Site Auditor considered that, while explosive ordnance may be uncovered during earthworks, it is unlikely that these will present an unacceptable risk provided appropriate procedures for the safe handling and disposal of such material are adopted.

The successful implementation of the CMP requires the appropriate briefing and Site Specific OHS Induction of Site Operatives who may uncover potential chemical contamination (including potential asbestos containing materials) and/or explosive ordnance. It is proposed this briefing will include the review of this CMP and the associated flow chart (Figure 3 on p2-4).

This CMP describes reporting procedures and lines of responsibility (See Section 3). These experts should include those with detailed knowledge of the remediation which has been undertaken at the Property and details on the location of, and access to, the supporting documents related to the assessment and remediation of the Western Precinct.

The Property has been remediated, audited and declared suitable for its intended land uses, and remnant contamination, if present, is most likely to be discovered during the development earthworks which will occur prior to subdivision.

The approaches included in this CMP are intended for use only during the site preparation phase of development, during which structures may be demolished and disposed of, land levels may be altered and redundant infrastructure is removed and new infrastructure is installed.

Subsequent plans, if required, will be administered through the relevant local government authority.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

The operation of the CMP is described in the attached flow-chart (Figure 3).

The objective of the CMP is to provide clear guidance on the safe and appropriate actions in the event of encountering potential chemical or explosive ordnance contamination during site development works. Where such material is uncovered the CMP prescribes the quarantining of the relevant area of concern, allowing other site works to proceed unhindered, while the area of concern is assessed and, if necessary, remediated and validated.

Where required, reference should be made to the extensive library of documents containing information on the historic assessment and remediation of the site. This library provides a valuable source of information which can be drawn on to provide support for development of remedial and/or assessment approaches.

Two classes of potential contamination are discussed separately below: chemical (including potential asbestos containing materials) and ordnance.

2.1 Potential Chemical Contamination

Potential chemical contamination may be indicated in the field by:

- Discoloured soils;
- Odorous soils;
- Potentially asbestos containing sheeting, fragments or insulation materials; or
- The presence of other foreign materials, such as drums, waste dumps or building rubble which could be a source of contamination.

If the Site Manager considers material to be potential chemical contamination the area will be quarantined and a suitably qualified Environmental Consultant will be contacted. The Environmental Consultant will be responsible for assessing the findings, taking samples to characterise and delineate the extent of the potential contamination and defining appropriate remedial actions, if required.

Suspected asbestos containing materials should be managed in accordance with relevant WorkCover requirements and a site specific Asbestos Management Plan.

If deemed necessary by the Environmental Consultant, the contamination will be removed for disposal at a suitably licensed facility in accordance with *Waste Classification Guidelines* (NSW DECC, April 2008). The resultant excavation will be validated by the Environmental Consultant and a report on the remediation and subsequent validation will be completed and, if appropriate, be reviewed and approved by an independent NSW EPA accredited Site Auditor. The quarantine barriers can be removed and the earthworks continued upon receipt of advice from the Environmental Consultant, issue of an SAS, or preliminary advice from the Site Auditor.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

If the area is determined by the Environmental Consultant to not be contaminated or the analyses meet the relevant site validation criteria, the Environmental Consultant should notify the Site Manager that the quarantine restrictions on the area can be lifted and the works in that area may resume. The Environmental Consultant will prepare a report on the investigation and the conclusions drawn.

Extensive Contamination

In the event that assessment by the Environmental Consultant identifies that the contamination is extensive[2] in its lateral and/or vertical extent, then the Environmental Consultant will prepare a sampling and analysis plan to delineate the contamination and assess the extent of any remediation required. The sampling and analysis plan must be reviewed by the independent Site Auditor, who would be engaged to review the works and issue a new SAS, on successful completion of the works.

2.2 Potential Explosive Ordnance Materials

Potential explosive ordnance material may be indicated in the field by:

- Munitions shells;
- Flares;
- Ammunition packaging;
- Grenade components; or
- Metal debris not identifiable as non-munitions or of uncertain origin.

Should potential ordnance material be uncovered, the earthworks will cease immediately and the Site Manager informed. The area should be quarantined, by means of some appropriate barrier to prevent access to the area to protect the workforce from potential injury.

The Site Manager will make a preliminary assessment of the find and determine whether it is some miscellaneous debris, a fragment of ordnance or a potentially explosive device.

Where the Site Manager can identify the item as non-ordnance debris or a minor harmless fragment of ordnance debris, the material should be removed from the excavation and disposed of appropriately.

Where it is considered to be a potentially explosive device, the Site Manager shall contact an appropriately qualified Ordnance Contractor, to assess the item and the area.

Should the Ordnance Contractor consider the object(s) to be non-ordnance or harmless fragments of ordnance, the object(s) can be removed and disposed of appropriately. The quarantine restrictions can be lifted and the earthworks continued.

[2] When the area is sufficiently large to warrant audit of the remediation and issue of a replacement Site Audit Statement, the Environmental Consultant will advise when to engage an Auditor reflecting contemporary industry practise. Less than 1000 m^2 would not immediately qualify.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

If the Ordnance Contractor identifies the object(s) as potential explosive ordnance, the Ordnance Contractor shall inform the Site Manager, and arrange disposal.

Based on the nature of find, it may be recommended that a geophysical survey of the area be undertaken to establish whether the item was an individual piece, one of a number of pieces or a disposal pit. The survey would be undertaken by the Ordnance Contractor using appropriate equipment. Further surveys are mandatory if the explosive ordnance is considered a Category A item or more than three readily identifiable Category B items are found at one location.

- **Category A** - An item clearly of a military nature and which might readily be recognized by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and containing explosive filling, but excluding small arms ammunition.

- **Category B - An item clearly of a military nature and which might readily be recognized by a** member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and not containing explosive filling, but excluding small arms ammunition.

This is in accordance with the validation procedures for the earlier site assessments, remediation and audit, and maintains the same level of confidence for the whole Property.

The Ordnance Contractor will prepare a report on the investigations undertaken, remediation works undertaken and validation surveys completed. Subject to review of the Ordnance Contractor's report by a suitably qualified consultant, the quarantine restrictions on the area can be removed and the earthworks resumed. The Site Auditor will be provided with a copy of the Clearance Report for the area issued by the Ordnance Consultant.

Further Explosive Ordnance Surveys

Any additional ordnance surveys should be designed to characterise the extent and character of the ordnance contamination and then (or concurrently) to remove the contaminant so that the area is safe for the development activities to resume. These surveys should be undertaken by an Ordnance Contractor, with the objective of characterising and delineating the extent of the explosive ordnance contamination. Such surveys may, as appropriate, utilise magnetic, electromagnetic or other diagnostic techniques.

In the event that further explosive ordnance is discovered the search area may need to be extended to ensure a suitable buffer zone is searched. A remediation and sampling strategy for the area is to be developed in consultation with the Ordnance Consultant.

All additional finds should be logged and disposed of appropriately. Once the investigation is complete a report on the scope of the investigation, remedial work and results should be produced by the Ordnance Contractor, approved by the Ordnance Consultant and provided to the independent Site Auditor. The quarantine restrictions on the area can be removed and the earthworks resumed.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

2.3 Temporary Stockpiling of Materials

Earthworks in the development phase are likely to, temporarily, generate excess material which may be stockpiled for re-use. Unless some event or observation indicates that the material excavated and placed into the stockpile is potentially contaminated, no particular treatment is required other than normal dust suppression, and erosion controls in accordance with relevant Council requirements.

If assessment by the Environmental Consultant or the Ordnance Contractor identifies contamination that is extensive in its lateral and/or vertical extent, or a stockpile is observed to be contaminated, then the Environmental Consultant will prepare a sampling and analysis or survey plan to delineate the contamination and assess the extent of remediation required. The sampling and analysis plan or survey plan should, as appropriate, be reviewed by the Site Auditor or the Ordnance Consultant.

Subject to the agreement of the relevant Consultant, it may be possible to move and stockpile the affected material. Where temporary stockpiling is permitted such stockpiles shall be installed and maintained to eliminate risk to workers and other people due to exposure to contaminants in dust or vapours and risk to the environment as a result of silt or contamination of stormwater.


Validation sampling or surveying of the contaminated area or stockpile would be required before earthworks continue in that area.

2.4 Contaminated Management Plan Flowchart

Figure 3, following, describes the decision processes in the implementation of this CMP.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

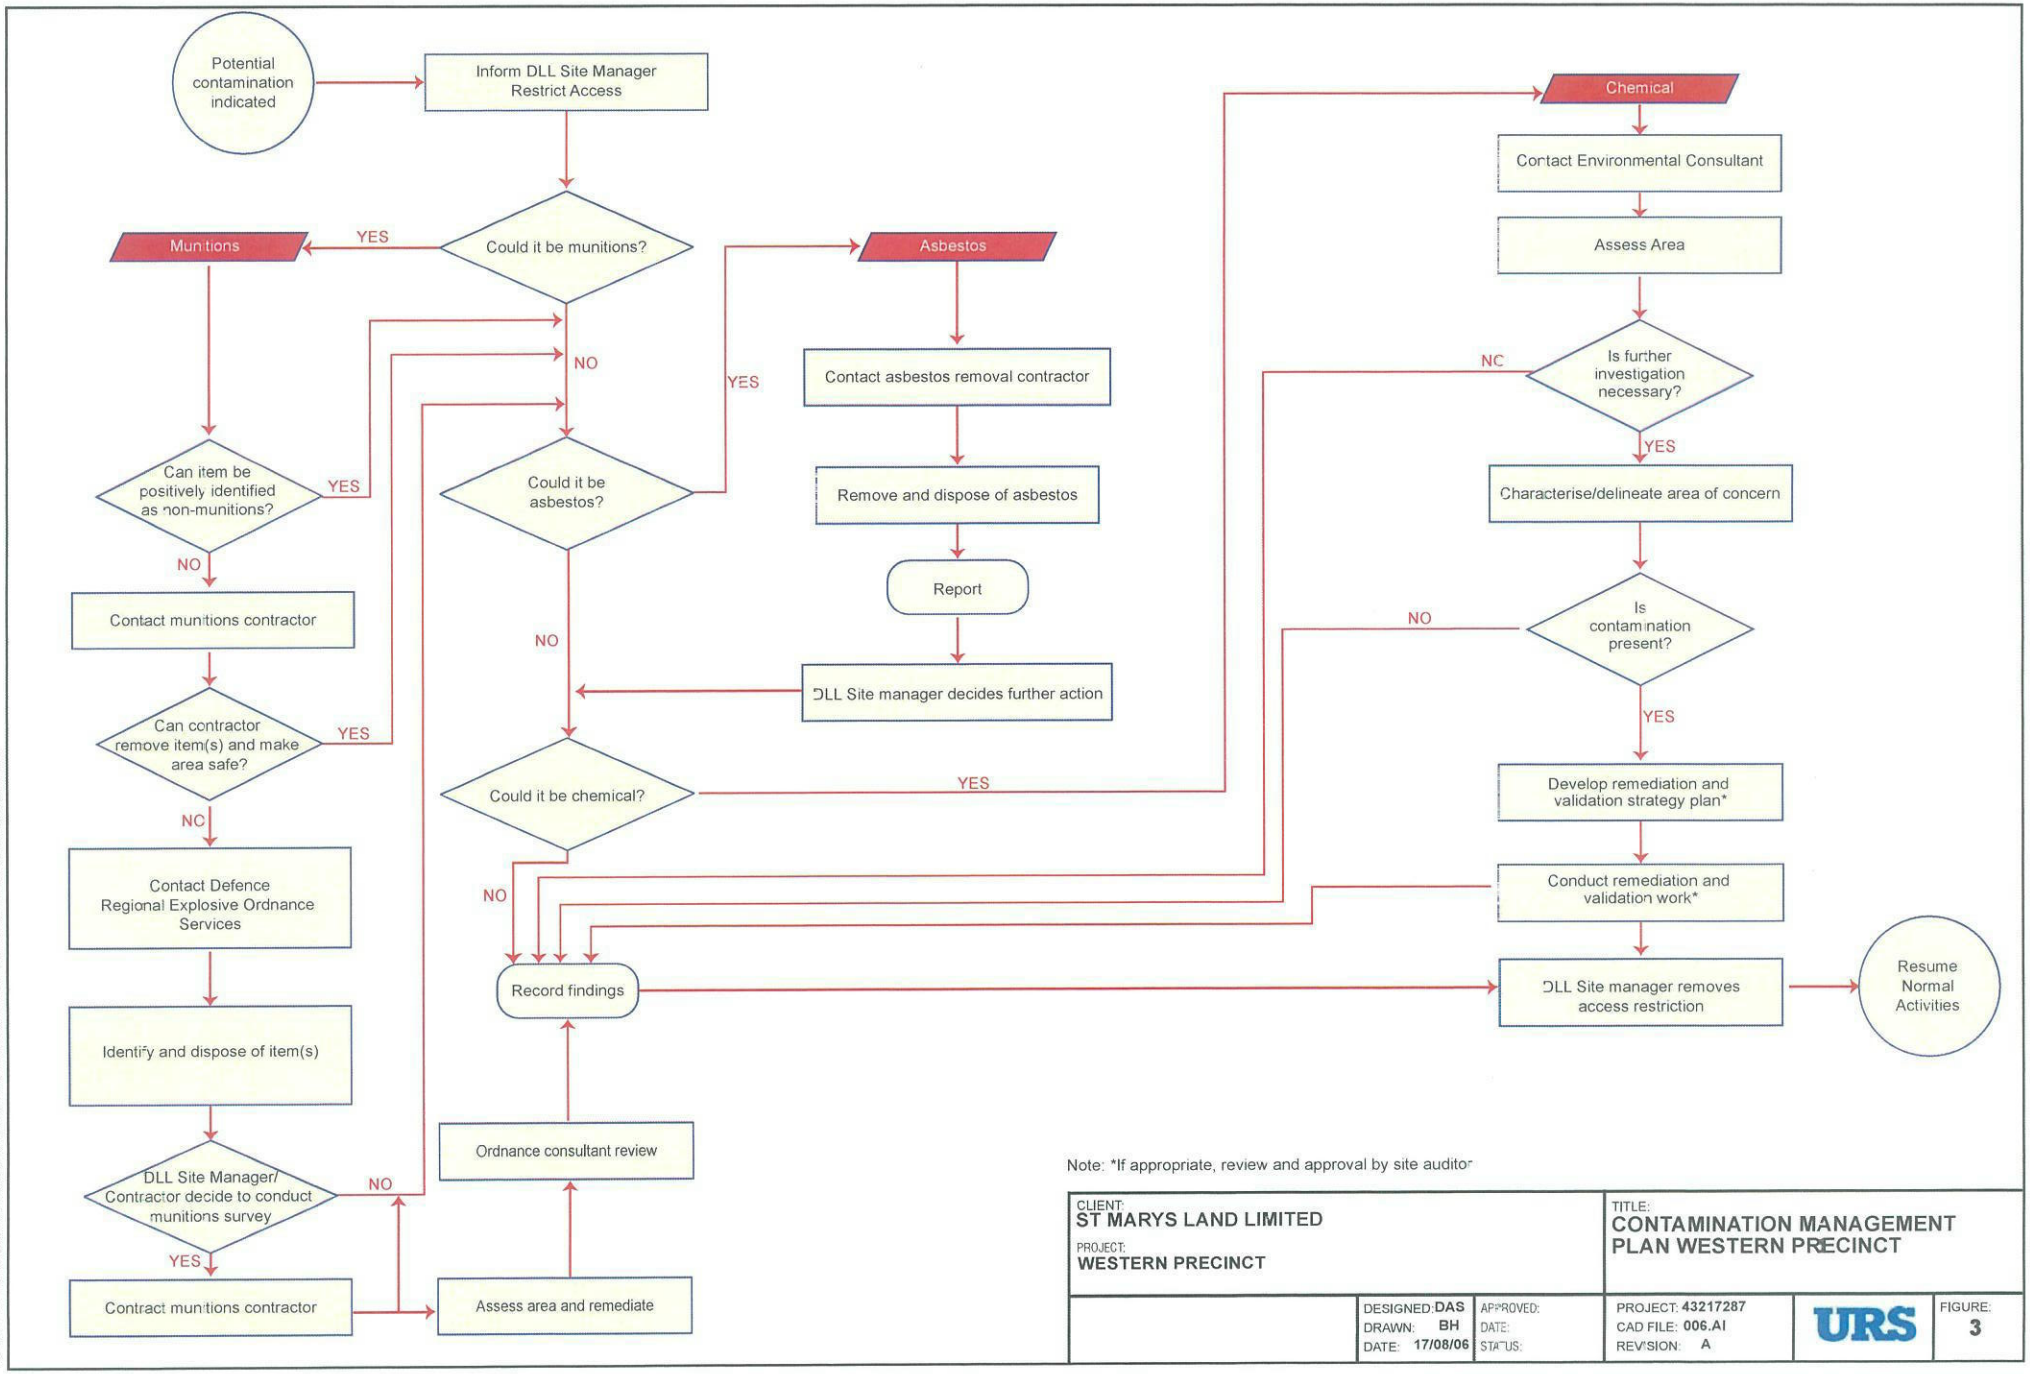

COPYRIGHT © This drawing remains the property of URS Australia Pty Ltd and may not be copied in any way, without prior written approval from URS Australia Pty Ltd

T:\JOBS\43217287

Summary of Roles & Responsibilities

SECTION 3

The key roles[3] and responsibilities with respect to this CMP are as follows:

Title	Role
Asbestos Consultant	Responsible for reviewing the assessment of areas contaminated by potential asbestos containing materials. The Asbestos Consultant will provide a brief report which certifies the subject area is free of asbestos and suitable for residential development.
Asbestos or Environmental Contractor	Responsible for removal or treatment of contaminated material in accordance with this procedure and direction by the Environmental Consultant and the Site Manager.
Environmental Consultant	Once called to the site, the Environmental Consultant will be responsible for assessing the potential chemical contamination find, undertaking any necessary sampling and delineation, if required, developing a remedial scope and validating remediation to render the site suitable for residential development. The Environmental Consultant may, as appropriate, have expertise in environmental assessment and/or asbestos assessment. All findings and conclusions will be reported, as appropriate, to the satisfaction of the Site Manager and/or the Site Auditor or asbestos consultant if a Site Audit is not required.
Site Manager:	Responsible for the preliminary assessment of potential contamination and/or ordnance materials discovered and assessing whether further action is required. The Site Manager is responsible for ensuring the induction of Site Operatives, assessing the adequacy of quarantine measures and contacting the relevant Consultant and/or Ordnance Contractors and Site Auditor where appropriate. Once an area is declared free of the contamination, the Site Manager's role will be to remove the quarantine and allow site works to proceed.
Ordnance Consultant	Responsible for reviewing the survey and assessment of areas contaminated by suspected ordnance which is undertaken either as a consequence of discovery of suspect materials or as a requirement of the Site Audit Statements. The Ordnance Consultant, who will be independent of the Ordnance Contractor and be a member of DUXOP, will, when satisfied with information provided by the Ordnance Contractor, provide a letter which confirms the site is suitable for recommencement of development activities.

[3] Contact details are updated as required and can be seen in Appendix A

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Title	Role
Ordnance Contractor	Once called to the site, the Ordnance Contractor will be responsible for assessing the ordnance find, undertaking any surveying sampling and delineation, developing any necessary remedial scope and validating any remediation necessary to render the site suitable for residential development. The Ordnance Contractor shall complete a clearance report on each area investigated and/or remediated and provide a copy for review by the Ordnance Consultant. As necessary, the Ordnance Contractor will conduct surveys of the site and complete reports to validate the remediation of areas where ordnance is discovered for review by the Ordnance Consultant.
Site Auditor	Responsible for reviewing the remediation and assessment of areas contaminated by chemicals which is undertaken either as a consequence of discovery of suspect materials or as a requirement of the Site Audit Statements. The Site Auditor, who will be independent of the Environmental Consultant and accredited by the NSW EPA, will then, when satisfied by the information provided and relying on clearance reports provided by the Ordnance Consultant, issue further Site Audit Statements which certify the site is suitable for residential development.
Site Operatives:	During the works, the Site Operative will be vigilant for potential contamination and/or ordnance. Where potential contamination and/or ordnance is identified, Site Operatives will quarantine the area and inform the Site Manager

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Limitations

SECTION 4

URS Australia Pty Ltd (URS) has prepared this report for the use of Maryland Development Company in accordance with the usual care and thoroughness of the consulting profession. It is based on generally accepted practices and standards at the time it was prepared. No other warranty, expressed or implied, is made as to the professional advice included in this report. It is prepared in accordance with the scope of work and for the purpose outlined in the Proposal dated 12 July 2007.

The methodology adopted and sources of Information used by URS are outlined in this report. URS has made no independent verification of this information beyond the agreed scope of works and URS assumes no responsibility for any inaccuracies or omissions. No indications were found during our investigations that information contained in this report as provided to URS was false.

This report was prepared in the period up to 7th 2008 and is based on the information reviewed at the time of preparation. URS disclaims responsibility for any changes that may have occurred after this time.

This report should be read in full. No responsibility is accepted for use of any part of this report in any other context or for any other purpose or by third parties. This report does not purport to give legal vice. Legal advice can only be given by qualified legal practitioners.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Appendix A
SITE AUDIT STATEMENTS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

NSW Environment Protection Authority
SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/1

Site Auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Envirosciences Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property – excluding Eastern Sector, QEL, Site 6 and Site 23, buildings and concrete stockpile.

Address: Forrester Road, St. Marys	Postcode: 2760
Lot and DP Number:	Lot 2 in DP803832 Lot 2 and 3 in DP223888 (part of) Lot 3 in DP789196 Lot 3 in DP598653 (see attached map for excluded areas)
Local Government Area:	Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton	Company: Department of Urban Affairs and Planning
Address:	Sydney Region West Level 8, Signature Tower 2-10 Wentworth Street Parramatta NSW 2150 Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

• ADI Limited	Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990 - 1999
• Mackie Martin & Associates	Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

1. Historical Report – St Marys Property, ADI Limited, 1996,
2. Validation Report for the Western Sector, ADI St Marys Facility, ADI Limited November 1994;
3. Validation Report for the North Western Sector of the ADI St Marys Facility, Report No. 498800, ADI Limited 1995;
4. Validation Report for the Southern Sector West of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

5. Validation Report for the Southern Sector East of the St Marys Property, Report No. 498810, ADI Limited 1996;
6. Validation Report for the Northern Sector of the ADI St Marys Property, Report No. 498820, ADI Limited 1996;
7. Validation Report for the Cental Sector East of the ADI St Marys Property, Report No. 498840, ADI Limited 1997;
8. Validation Report for the Central Sector West of the ADI St Marys Property, Report No 498840, ADI Limited 1996,
9. Validation Report for the North Eastern Sector of the ADI St Marys Property, Report No. 498850, ADI Limited 1996;
10. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Other Information reviewed:

1. Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
2. Remediation Action Plan for the Northern Sector, ADI St Marys Facility, Report No. 498820, ADI Limited 1996;
3. Remediation Action Plan for Central Eastern Sector, ADI St Marys Facility, Report No. 498840, ADI Limited 1996;
4. Remediation Action Plan for the Eastern Sector of the ADI St Marys Property, Report No. 498830, ADI Limited 1996;
5. Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick **all** appropriate boxes)

(a) **is suitable for the following use(s):**

- ✓ residential, including substantial vegetable garden and poultry;
- ~~☐ residential, including substantial vegetable garden, excluding poultry;~~
- ~~☐ residential with accessible soil, including garden (minimal home-grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ✓ residential with minimal opportunity for soil access including units;
- ✓ daycare centre, preschool, primary school;
- ✓ secondary school;
- ✓ park, recreational open space, playing field;
- ✓ commercial/industrial use;
- ~~☐ Other~~

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

subject to

✓ Conditions

1. Excludes Eastern Sector, QEL, Site 6 and Site 23 which are covered by separate site audit statements, namely CHK001/2, CHK001/3, CHK001/4 and CHK001/5.
2. Excludes areas not yet investigated including the footprint of original buildings, car parks and roads, mainly around former Administration Centre Buildings CHK001/6) and the concrete stockpile in Central Sector West. (Stockpile CHK001/7)
3. An appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, should be lodged prior to the commencement of development earthworks. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).

~~(b) is not suitable for any beneficial use due to risk of harm from contamination~~

~~☐ (comments):~~

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a site auditor (Accreditation No. 9813).

I Certify that:

(a) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and

(b) this statement is to the best of my knowledge, true, accurate and complete. and


(c) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

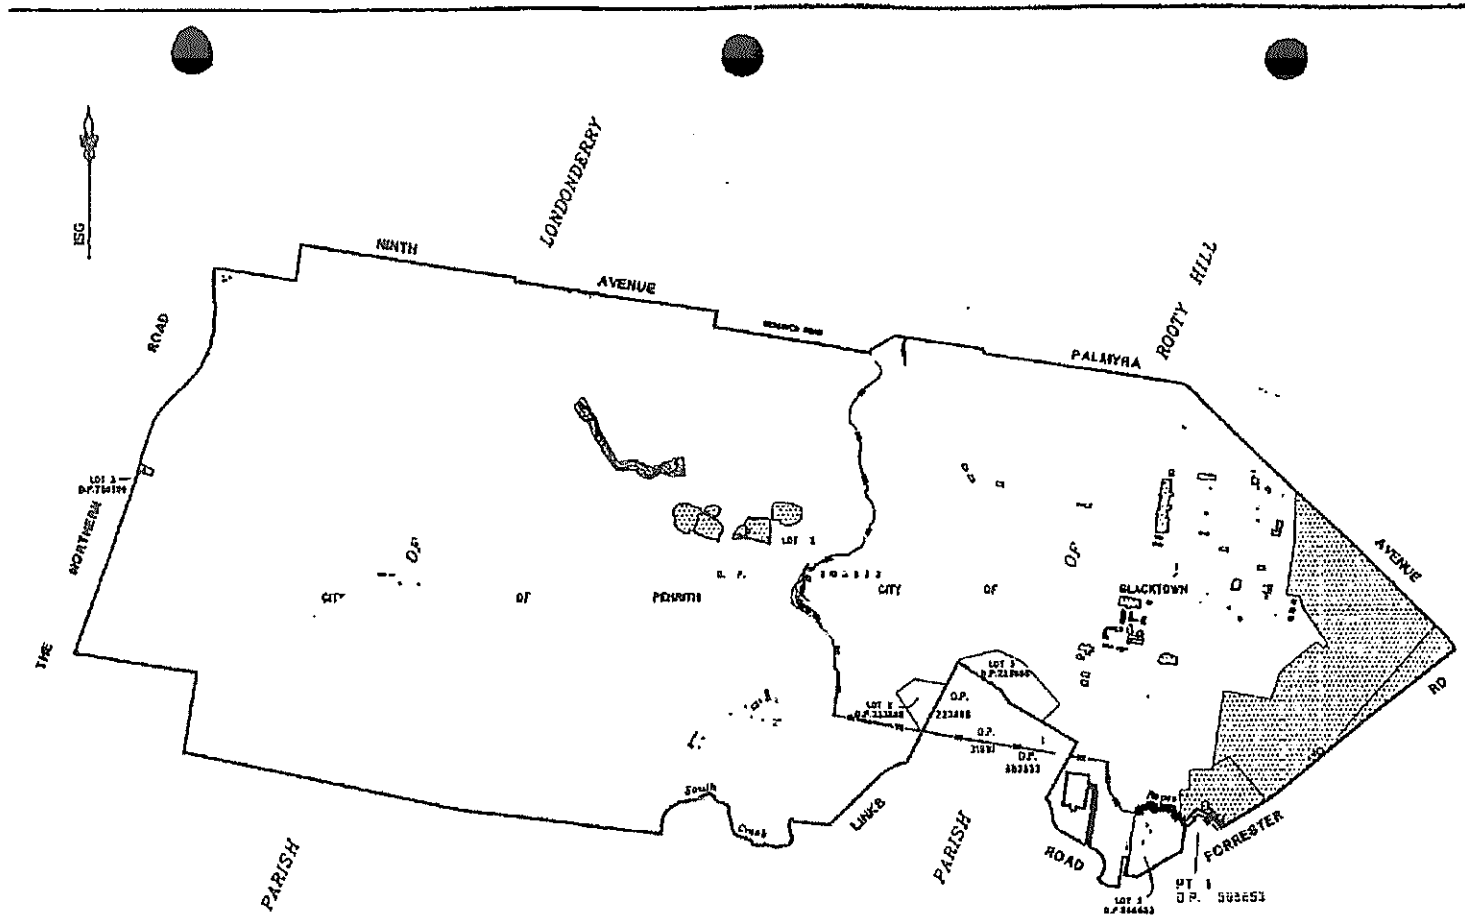

NOTE :

GEOMETRY SHOWN AS SUPPLIED BY ADI LIMITED TO DRW OFFICE 18.5.1999

FOR SITE DETAILS ON EXCLUDED AREAS PLEASE REFER TO DRAWINGS

5467-123
5467-125
5467-126
5467-127
5467-128
5467-129
5467-130
5467-131
5467-132
5467-133
5467-134
5467-135

SHADED AREAS ARE EXCLUDED FROM AUDIT STATEMENT CHK001/1

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans Surveyors Planners Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI Property

ADI ST MARYS PROPERTY PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/1

ORIGINAL SIZE:	A3		
SCALE HOR:	1 : 25 000	VERT:	-
CO-ORDS:	ISG	DATUM:	-
DATE OF SURVEY		DATE OF PLAN:	11 May 1999
SURVEY	-	DRAWN	Acad/MTB
CHECKED:	MTB	DATE	24.5.1999
APPROVED:	PW	DATE	24.5.1999
JOB REF:	8662		
CAD REF:	5467-122.DWG	SHEET 1	OF 13 SHEETS

NSW Environment Protection Authority
SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/6

Site Auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Envirosciences Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property – existing buildings and paved areas scattered about the site.
Address: Forrester Road, St. Marys Postcode: 2760
Lot and DP Number: Lot 2 in DP803832
Lot 2 and 3 in DP223888 (part of)
Lot 3 in DP789196
Lot 3 in DP598653
(see attached 7 maps)
Local Government Area: Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton Company: Department of Urban Affairs and Planning
Address: Sydney Region West
Level 8, Signature Tower
2-10 Wentworth Street
Parramatta NSW 2150
Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

- ADI Limited — Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990 - 1999
- Mackie Martin & Associates — Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

11. Historical Report St Marys Property, ADI Limited, 1996;
12. Validation Report for the Western Sector, ADI St Marys Facility, ADI Limited November 1994;
13. Validation Report for the North Western Sector of the ADI St Marys Facility, Report No. 498800, ADI Limited 1995;
14. Validation Report for the Southern Sector West of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

15. Validation Report for the Southern Sector East of the St Marys Property, Report No. 498810, ADI Limited 1996;
16. Validation Report for the Northern Sector of the ADI St Marys Property, Report No. 498820, ADI Limited 1996;
17. Validation Report for the Cental Sector East of the ADI St Marys Property, Report No. 498840, ADI Limited 1997;
18. Validation Report for the Central Sector West of the ADI St Marys Property, Report No. 498840, ADI Limited 1996;
19. Validation Report for the North Eastern Sector of the ADI St Marys Property, Report No. 498850, ADI Limited 1996;
20. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Other Information reviewed:

6. Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
7. Remediation Action Plan for the Northern Sector, ADI St Marys Facility, Report No. 498820, ADI Limited 1996;
8. Remediation Action Plan for Central Eastern Sector, ADI St Marys Facility, Report No. 498840, ADI Limited 1996;
9. Remediation Action Plan for the Eastern Sector of the ADI St Marys Property, Report No. 498830, ADI Limited 1996;
10. Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys.

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick all appropriate boxes)

(a) is suitable for the following use(s):

- ☐ ~~residential, including substantial vegetable garden and poultry;~~
- ☐ ~~residential, including substantial vegetable garden, excluding poultry;~~
- ☐ ~~residential with accessible soil, including garden (minimal home grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ☐ ~~residential with minimal opportunity for soil access including units;~~
- ☐ ~~daycare centre, preschool, primary school;~~
- ☐ ~~secondary school;~~
- ☐ ~~park, recreational open space, playing field;~~
- ✓ commercial/industrial use;
- ✓ Other – May continue to be used for existing commercial use and carparks, but underlying soils need to be tested for chemical and ordnance contamination after demolition.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

subject to

✓ Conditions

1. Soils under existing buildings, car parks, roads and the concrete stockpile shall be tested for ordnance and/or chemical contamination when these facilities are removed; site audits statements for these areas will also be required.
2. An appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, should be lodged prior to the commencement of development earthworks. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).

~~(b) is not suitable for any beneficial use due to risk of harm from contamination~~ ☐ ~~(comments):~~

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a Site Auditor (Accreditation No. 9813).

I Certify that:

(a) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and


(b) this statement is to the best of my knowledge, true, accurate and complete, and

(c) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

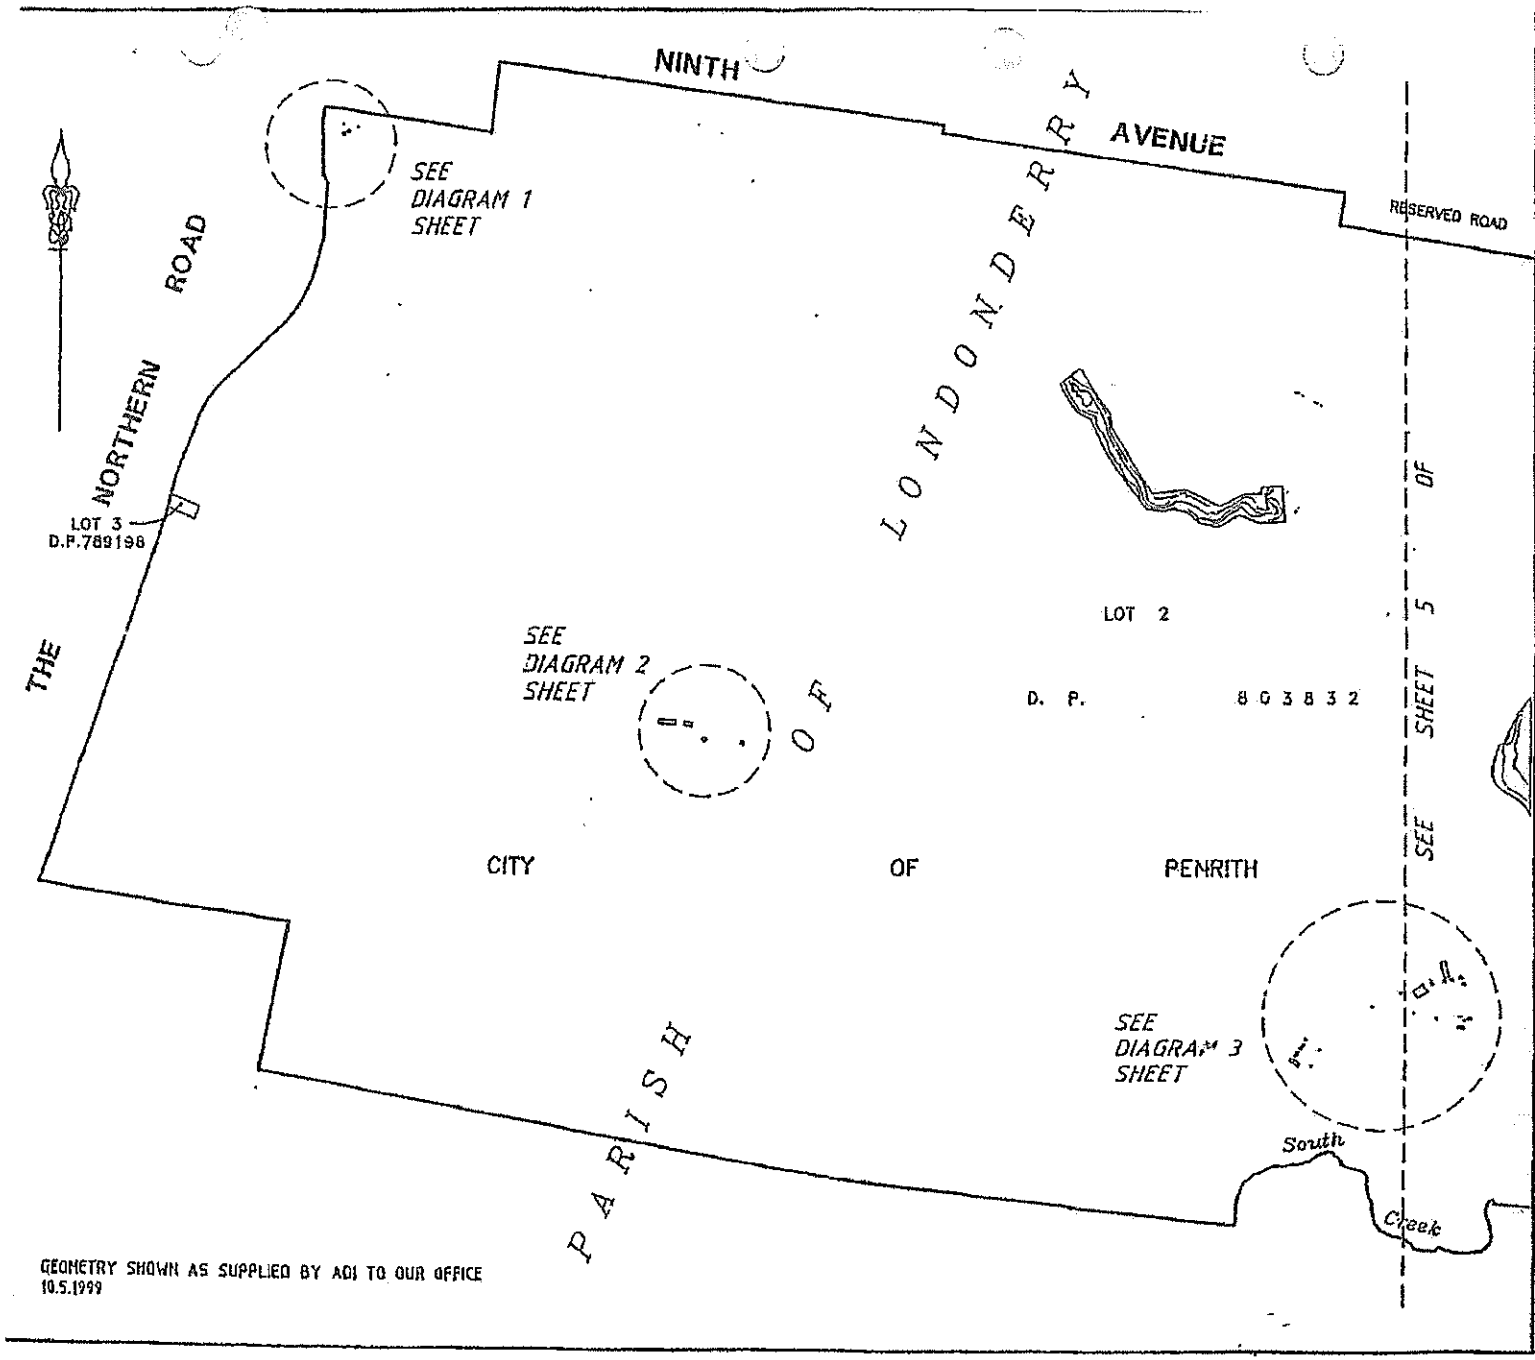

NOTES:

COPYRIGHT © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4133
Facsimile 02) 9630 4699


PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY
RETAINED BUILDINGS/PAVED AREA
PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 12500	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: 10 MAY 1999
SURVEY	DRAWN ODW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 8467-126	SHEET 7 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

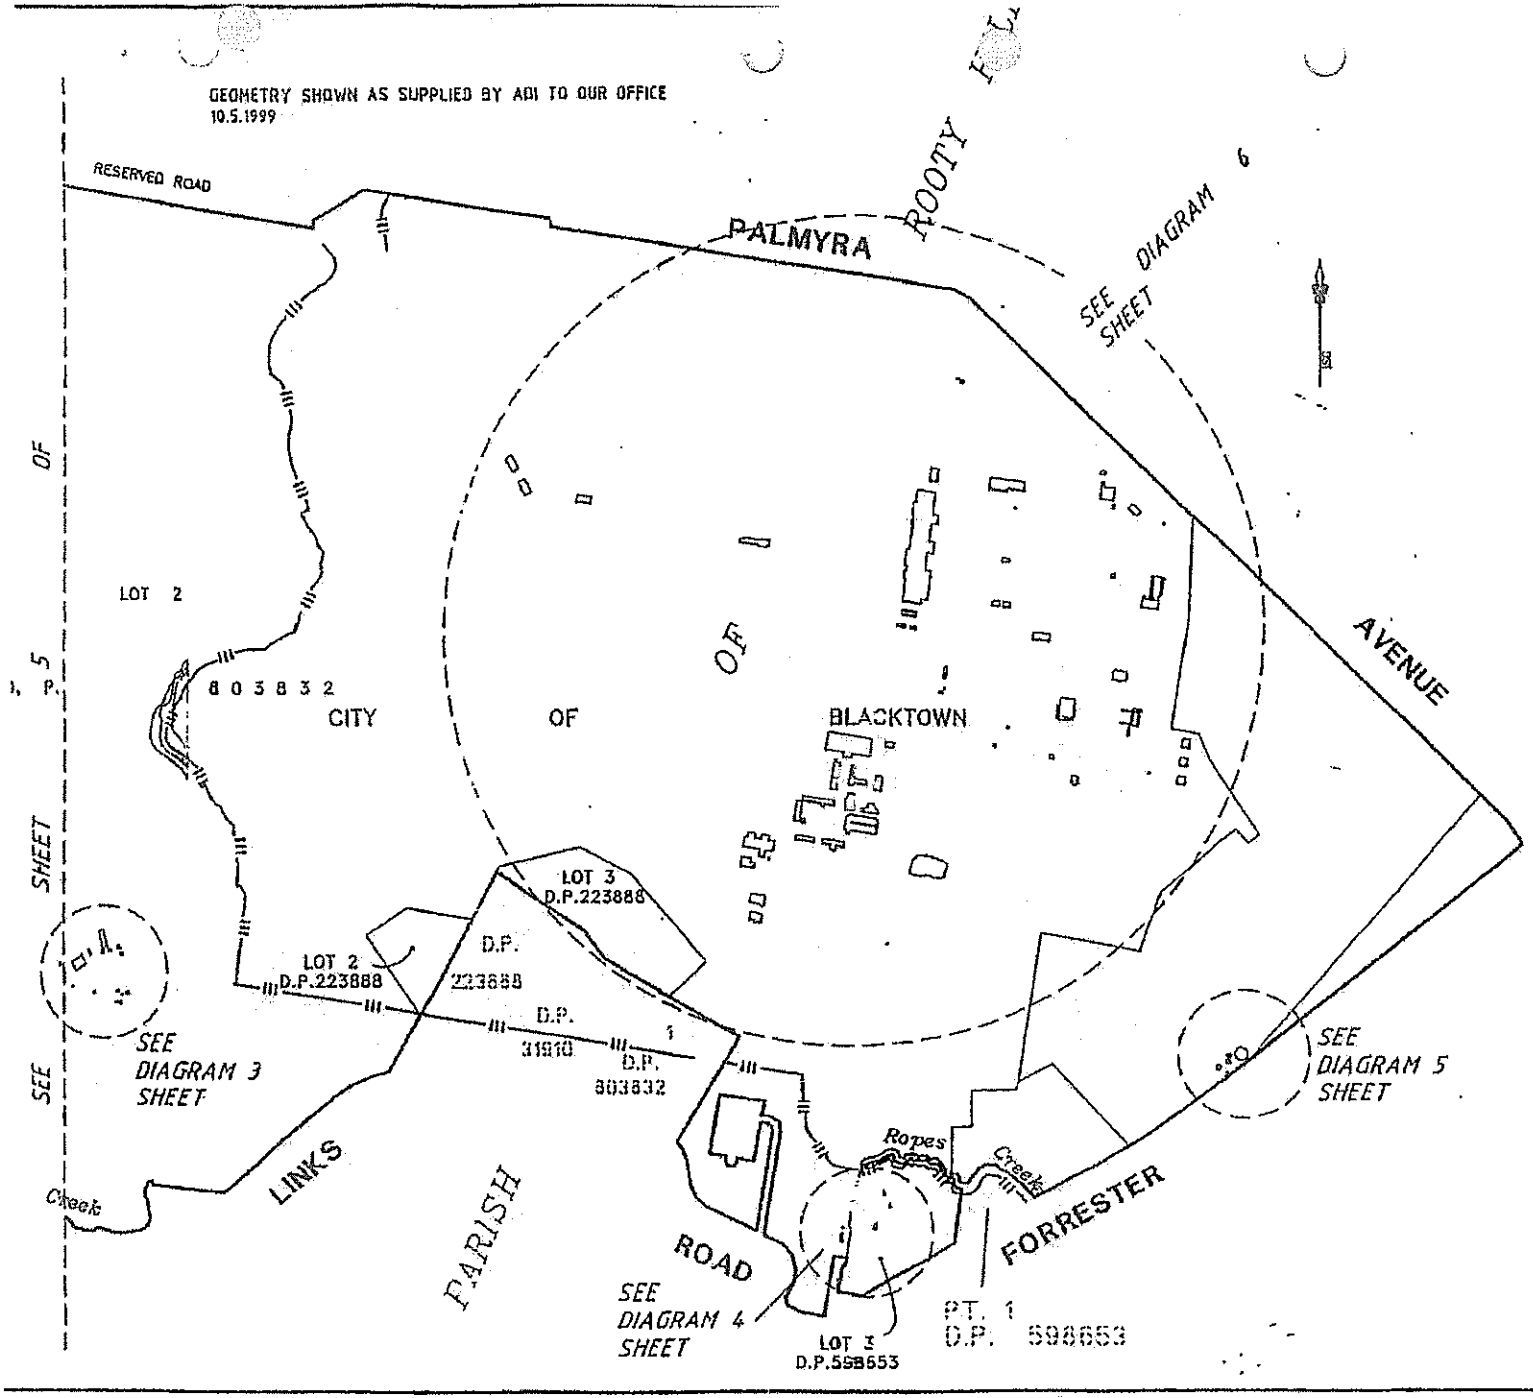

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatics Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 12500	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: 19 MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 0502	
CAD REF: 5467-125	SHEET 6 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

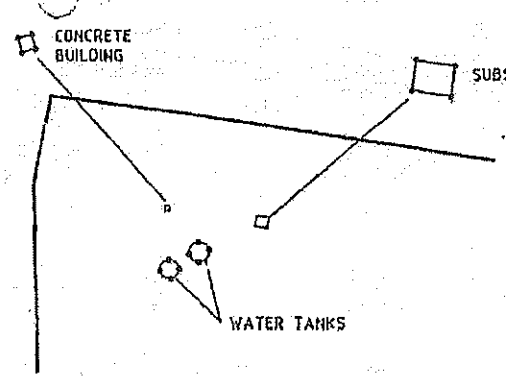


DIAGRAM 1



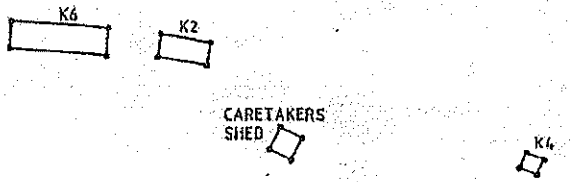


DIAGRAM 2

CONCRETE BUILDING	274588 1267987 274590 1267987 274590 1267985 274588 1267985
SUBSTATION	274625 1267979 274626 1267983 274631 1267982 274630 1267978
WATERTANK	274606 1267968 274603 1267964 274598 1267968 274602 1267972.
WATERTANK	274589 1267965 274586 1267960 274591 1267957 274594 1267960
K6	275465 1266407 275425 1266410 275426 1266422 275466 1266419
K2	275507 1266403 275487 1266407 275488 1266416 275508 1266413
CARETAKERS SHED	275532 1266368 275537 1266377 275546 1266373 275541 1266364
K4	275642 1266357 275635 1266360 275637 1266367 275645 1266364

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

NOTES:

COPYRIGHT © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3

SCALE HOR: 2000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8862	
CAD REF: 5467-127	SHEET 9 OF 13 SHEETS


Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

BOG No	EASTING	NORTHING
X7	277113	1265596
	277111	1265594
	277105	1265598
	277107	1265601
X6	277106	1265581
	277101	1265585
	277091	1265570
	277096	1265566
X4	277076	1265549
	277082	1265545
	277091	1265559
	277086	1265563
X3	277067	1265535
	277072	1265542
	277094	1265527
	277089	1265520
X9	277127	1265521
	277125	1265518
	277122	1265520
	277124	1265523
X5	277142	1265565
	277145	1265563
	277150	1265568
	277145	1265571

BOG No	EASTING	NORTHING
W01	277452	1265655
	277456	1265654
	277457	1265658
	277453	1265658
W04	277475	1265762
	277481	1265760
	277479	1265755
	277474	1265756
W05	277493	1265765
	277500	1265764
	277499	1265759
	277492	1265760
	277433	1265729
	277407	1265712
	277395	1265731
	277418	1265746
	277444	1265749
	277440	1265755
	277444	1265758
	277448	1265751
	277399	1265671
	277397	1265674
	277395	1265672
	277396	1265670
	277360	1265728
	277365	1265731
	277368	1265726
	277363	1265723

BOG No	EASTING	NORTHING
TOILET	277519	1265773
	277521	1265766
	277516	1265765
	277514	1265772
POWER	277283	1265688
	277285	1265686
	277287	1265689
	277286	1265691
W11	277477	1265767
	277468	1265809
	277480	1265811
	277489	1265770
SHED	277439	1265759
	277437	1265763
	277439	1265764
	277441	1265761
CONTROL TOWER	277453	1265658
	277511	1265634
	277527	1265632
	277526	1265626

BOG No	EASTING	NORTHING
W09	277529	1265648
	277530	1265651
	277524	1265652
	277524	1265650
W02	277513	1265658
	277513	1265661
	277520	1265662
	277520	1265659
	277453	1265658
	277511	1265634
	277527	1265632
	277526	1265626
	277536	1265658
	277536	1265652
	277546	1265653
	277546	1265659

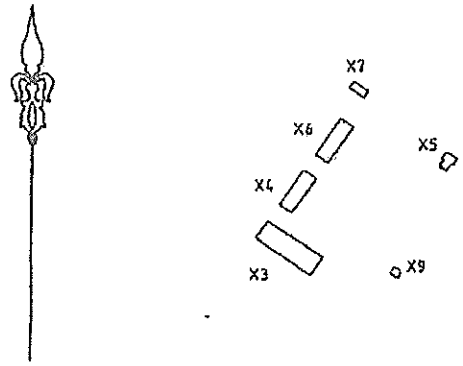

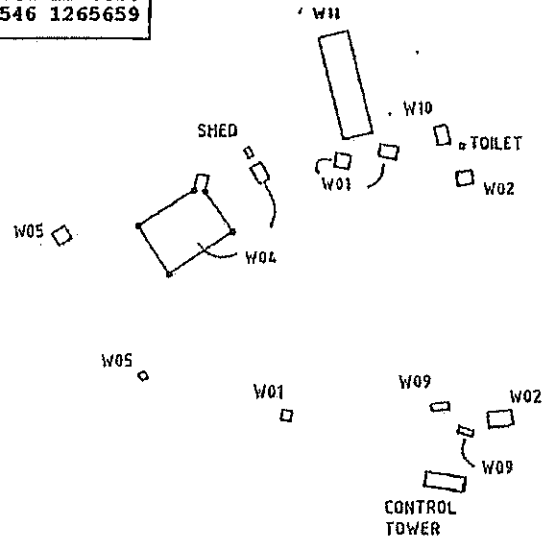


DIAGRAM 3

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Cromatia Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:
ADI PROPERTY

ADI ST MARYS PROPPERTY
RETAINED BUILDINGS & PAVED AREA
PLAN TO ACCOMPANY SITE
AUDIT STATEMENT CHK001/6 [illegible]

ORIGINAL SIZE:	A3
SCALE HOR: 2000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 5467-128	SHEET 10 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

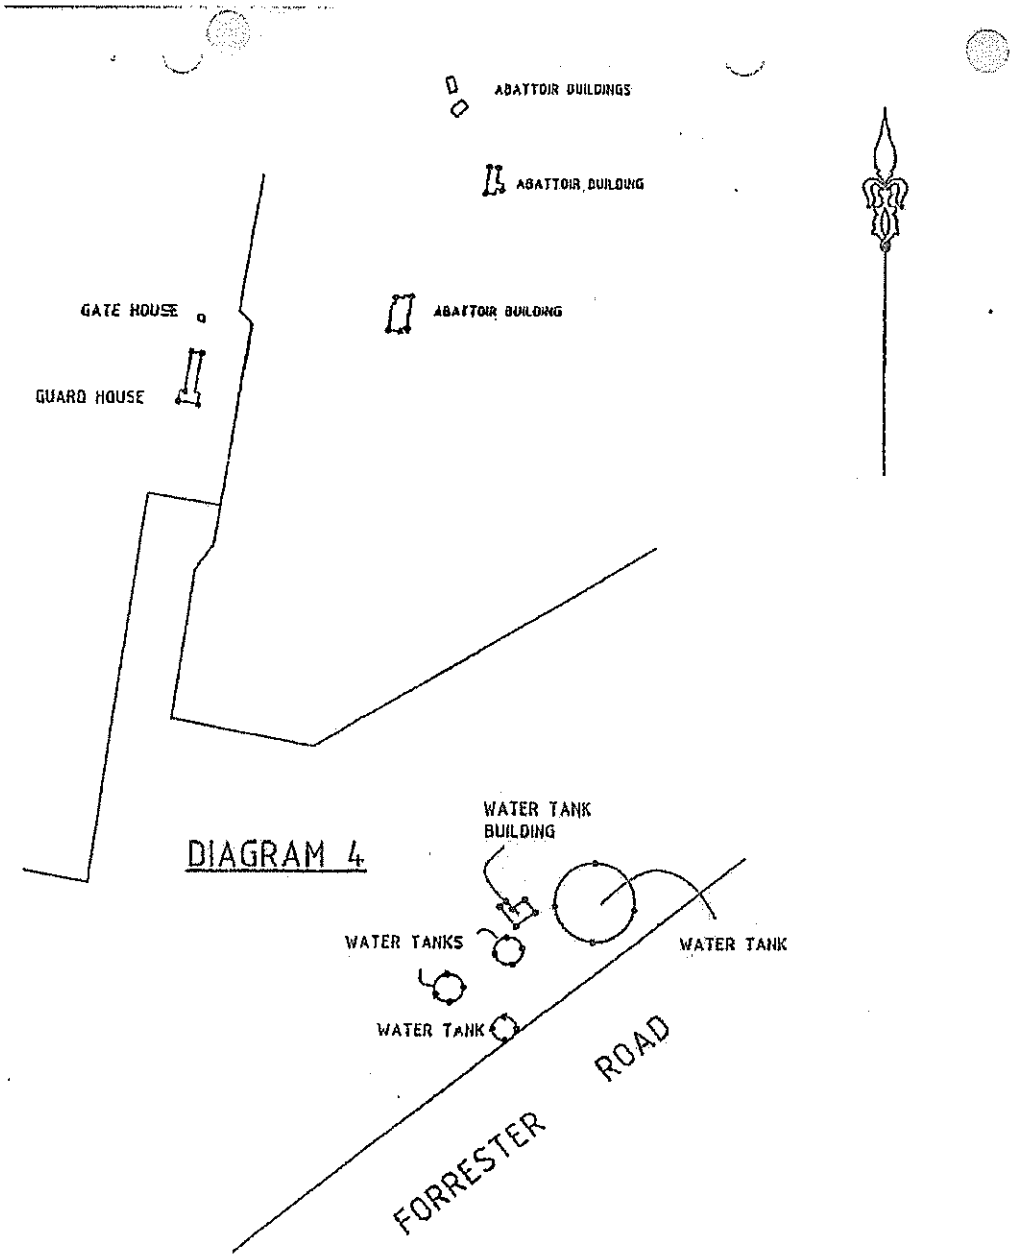


DIAGRAM 4

DIAGRAM 5

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

BDG No	EASTING	NORTHING
WATER TANK BUILDING	280345	1265484
	280349	1265492
	280351	1265494
	280354	1265491
	280359	1265495
WATER TANKS	280389	1265510
	280403	1265494
	280385	1265477
	280371	1265496
	280357	1265477
	280358	1265474
	280350	1265468
	280347	1265475
	280326	1265452
	280322	1265458
	280334	1265459
	280330	1265464
	280354	1265445
	280356	1265441
	280347	1265444
	280349	1265436
GATE HOUSE	279372	1265033
	279375	1265032
	279372	1265030
	279374	1265030
GUARD HOUSE	279369	1265017
	279374	1265016
	279372	1264995
	279364	1264997
	279366	1265001
ABATTOIR BUILDINGS	279459	1265041
	279453	1265040
	279450	1265027
	279454	1265026
	279457	1265027
	279491	1265094
	279495	1265093
	279489	1265083
	279496	1265084
	279473	1265130
	279476	1265131
	279478	1265125
	279475	1265124
	279475	1265117
	279480	1265121
	279482	1265118
	279478	1265114

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Cremalia Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales,
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:


ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3

SCALE HOR: 2000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN ACAD/DDW
CHECKED: DDW	DATE 21.6.1999
APPROVED: PW	DATE 21.6.1999
JOB REF: 0662	
CAD REF: 5407-129	SHEET 11 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

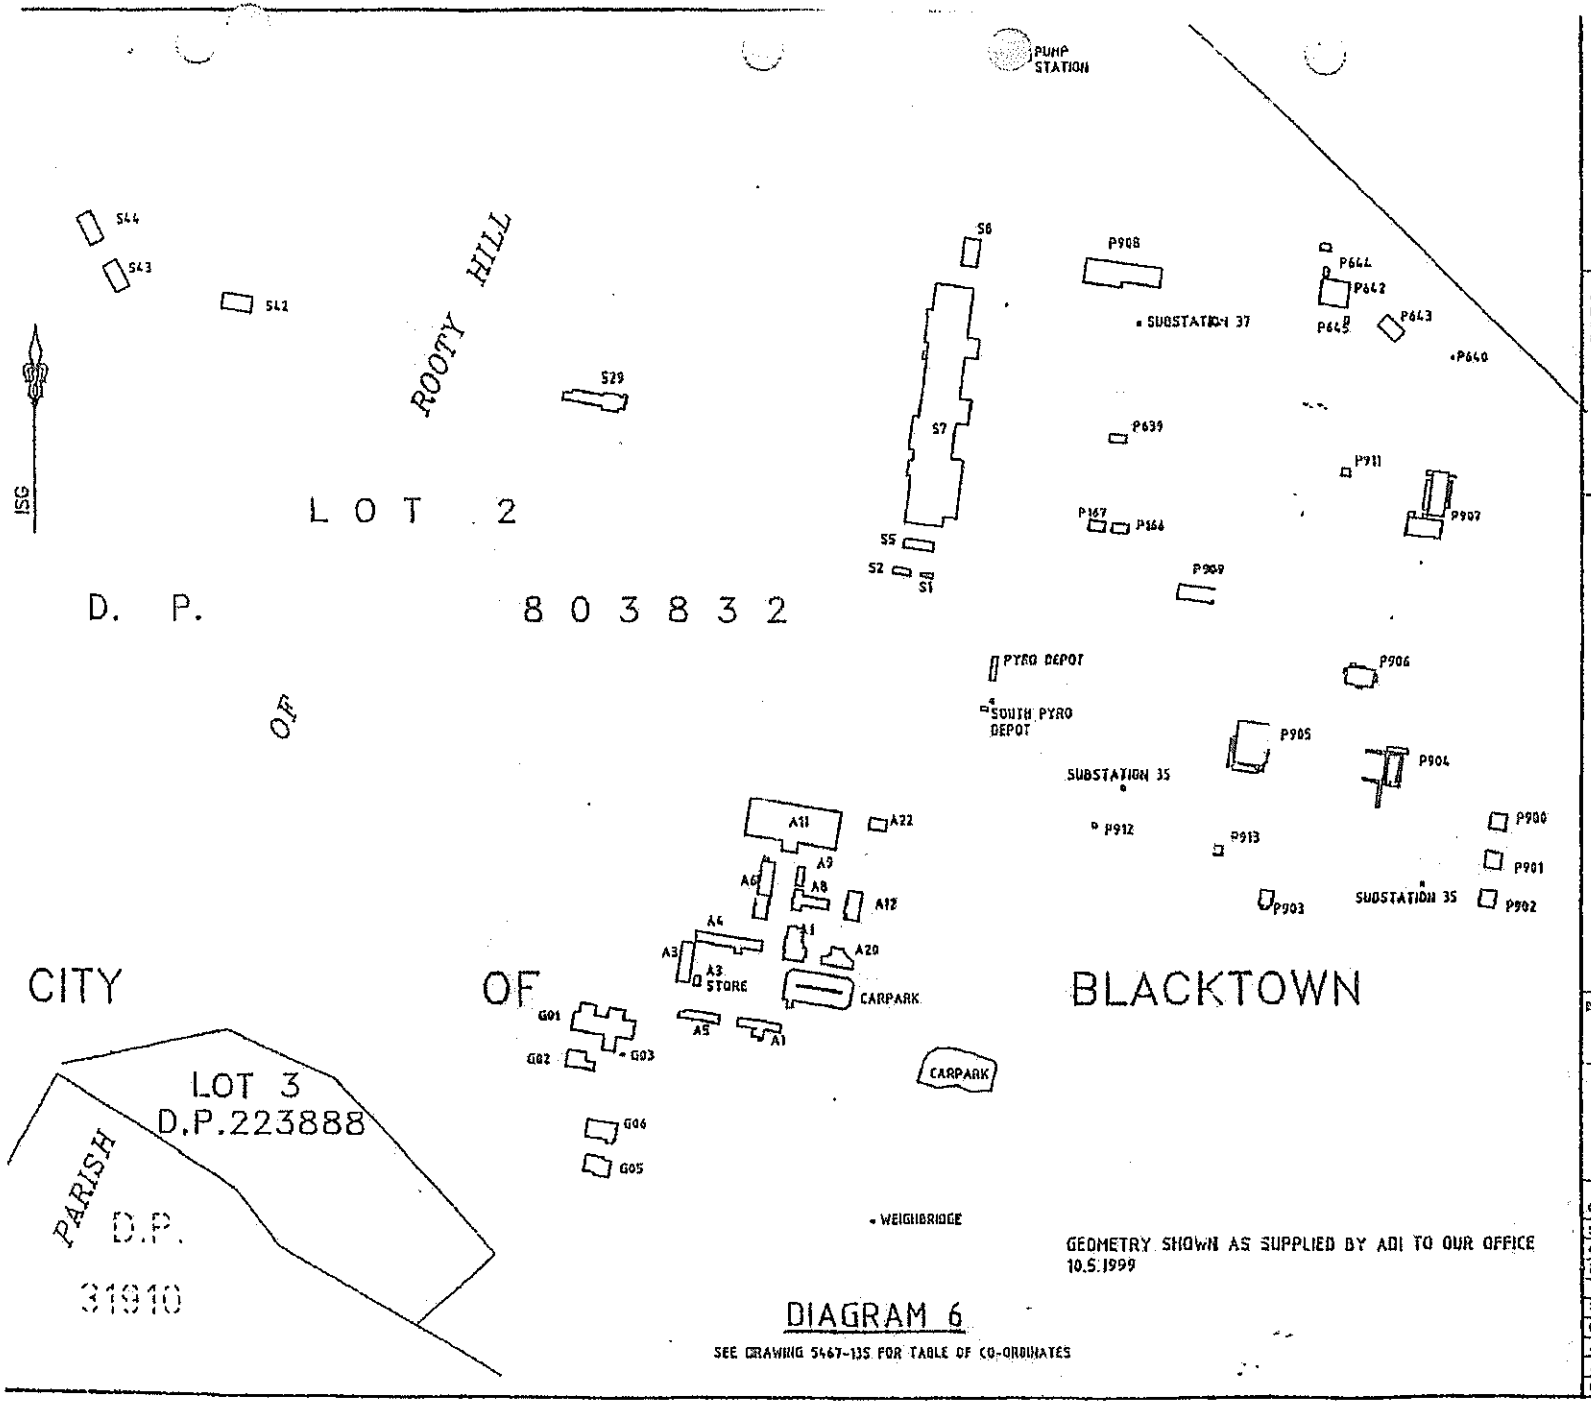

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

DIAGRAM 6

SEE DRAWING 5467-13S FOR TABLE OF CO-ORDINATES

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 6, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY
RETAINED BUILDINGS/PAVED AREA
PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 6000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN ACAD/DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 5467-13A	SHEET 12 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

BDG NO	EASTING NORTHING
A11	279334 1266254 279340 1266297 279449 1266279 279442 1266237
A22	279484 1266274 279505 1266270 279503 1266258 279482 1266261
A9	279398 1266217 279406 1266215 279403 1266194 279394 1266195
A8	279394 1266191 279435 1266178 279402 1266172 279390 1266168
A6	279344 1266158 279359 1266155 279370 1266222 279354 1266224
A4	279276 1266141 279274 1266129 279353 1266117 279355 1266128
A3	279260 1266128 279274 1266126 279266 1266077 279252 1266079
A3 STORE	279273 1266086 279271 1266074 279281 1266085 279279 1266073
A5	279302 1266026 279304 1266037 279262 1266043 279254 1266033
A1	279324 1266023 279326 1266033 279377 1266025 279357 1266017 279342 1266010
A7	279380 1266107 279404 1266108 279405 1266143 279387 1266146
A22	279454 1266162 279455 1266155 279470 1266153 279475 1266187
A12	279425 1266100 279462 1266094 279453 1266119 279437 1266113

BDG NO	EASTING NORTHING
CAR/ PARK	279567 1265995 279556 1265990 279542 1265953 279567 1265945 279606 1265940 279631 1265942 279640 1265975 279609 1265990
CAR/ PARK	279391 1266093 279384 1266089 279379 1266056 279383 1266046 279453 1266044 279464 1266076
G01	279203 1266029 279200 1266006 279178 1265991 279126 1266018 279138 1266052
G02	279144 1265979 279145 1265989 279122 1265993 279119 1265972 279153 1265966
G06	279142 1265881 279146 1265903 279182 1265897 279177 1265871
G05	279174 1265850 279171 1265829 279141 1265838 279144 1265854
S42	278527 1267007 278511 1266998 278529 1266966 278545 1266974
S43	278570 1266916 278560 1266949 278544 1266939 278562 1266907
S44	278729 1266884 278732 1266983 278696 1266909 278693 1266890
S29	279324 1266023 279326 1266033 279377 1266025 279376 1266015
S8	279618 1266979 279614 1266941 279595 1266944 279600 1266976
S7	279564 1266923 279611 1266916 279524 1266631 279588 1266635

BDG NO	EASTING NORTHING
S5	279525 1266609 279523 1266598 279560 1266592 279561 1266604
S2	279533 1266570 279511 1266573 279510 1266565 279531 1266562
S1	279192 1266788 279189 1266769 279114 1266781 279115 1266791
RAIL/ WAY	279599 1266565 279580 1266465 279575 1266466 279605 1266652
P908	279750 1266952 279746 1266923 279837 1266917 279840 1266939
SUB/ ST 37	279010 1266872 279014 1266872 279814 1266876 279814 1266876
P639	279593 1266784 279608 1266782 279604 1266751 279589 1266753
P167	279772 1266631 279770 1266618 279752 1266621 279753 1266634
P166	279799 1266627 279798 1266615 279779 1266617 279781 1266630
P909	279860 1266592 279858 1266533 279900 1266528 279902 1266546
P900	280258 1266276 280239 1266278 280236 1266259 280255 1266257
P901	280251 1266231 280232 1266234 280229 1266215 280248 1266212
P902	280245 1266186 280242 1266167 280223 1266170 280226 1266189
P903	279973 1266187 279959 1266189 279971 1266170 279957 1266172

NO	EASTING NORTHING
SUBSTATION 35	280151 1266194 280155 1266193 280156 1266197 280152 1266198
P913	279792 1266307 279792 1266311 279796 1266310 279796 1266306
P912	279910 1266231 279902 1266231 279903 1266241 279913 1266240
P904	279763 1266268 279763 1266262 279757 1266263 279758 1266268
P905	280136 1266352 280111 1266355 280105 1266311 280125 1266309
P906	279931 1266385 279967 1266380 279924 1266329 279960 1266327
P907	280063 1266452 280096 1266448 280093 1266427 280060 1266431
P911	280186 1266690 280135 1266636 280178 1266637 280178 1266637 280135 1266636 280177 1266631 280174 1266609 280165 1266681
P640	280056 1266698 280066 1266697 280065 1266687 280055 1266689
P642	280192 1266831 280190 1266832 280189 1266831 280190 1266829
P643	280063 1266923 280032 1266927 280028 1266896 280058 1266892
P644	280111 1266883 280133 1266862 280120 1266850 280099 1266870
	280039 1266929 280032 1266930 280034 1266940 280040 1266939 280041 1266958 280029 1266960 280030 1266966 280031 1266966

NO	EASTING NORTHING
P645	280059 1266871 280060 1266881 280065 1266880 279799 1266627
PYRO DEPOT	279634 1266465 279630 1266436 279637 1266435 279641 1266464
SOUTH PYRO DEPOT	279634 1266408 279631 1266408 279631 1266413 279635 1266412 279619 1266399 279628 1266398 279629 1266402 279619 1266404
WEIGH/ BRIDGE	279487 1265773 279484 1265774 279485 1265777 279488 1265776

TABLE OF CO-ORDINATES OF RETAINED BUILDINGS AND PAVED AREA

COORDINATES ARE APPROXIMATE ONLY

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Civil & Structural Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4133
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE:	A3		
SCALE HOR:		VERT:	
CO-ORDS:		DATUM:	
DATE OF SURVEY		DATE OF PLAN: MAY 1999	
SURVEY		DRAWN ACAD/DDW	
CHECKED: DDW		DATE 24.5.1999	
APPROVED: PW		DATE 24.5.1999	
JOB REF: 8002			
CAD REF: 5467-13S		SHEET 13 OF 13 SHEETS	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

NSW Environment Protection Authority

SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/7

Site auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Enviroscience Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property –Concrete Stockpile
Address: Forrester Road, St. Marys Postcode: 2760
Lot and DP Number: Lot 2 in DP803832 (part of)
(see attached map)
Local Government Area: Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton Company: Department of Urban Affairs and Planning
Address: Sydney Region West
Level 8, Signature Tower
2-10 Wentworth Street
Parramatta NSW 2150
Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

- ADI Limited — Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990-1999
- Mackie Martin & Associates — Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

4. Historical Report – St Marys Property, ADI Limited, 1996;
5. Validation Report for the Central Sector West of the ADI St Marys Property, Report No. 498840, ADI Limited 1996;
6. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Other Information reviewed:

3 Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
4 Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys.

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick all appropriate boxes)

(a) is suitable for the following use(s):

- ~~☐ residential, including substantial vegetable garden and poultry;~~
- ~~☐ residential, including substantial vegetable garden, excluding poultry;~~
- ~~☐ residential with accessible soil, including garden (minimal home-grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ~~☐ residential with minimal opportunity for soil access including units;~~
- ~~☐ daycare centre, preschool, primary school;~~
- ~~☐ secondary school;~~
- ~~☐ parks, recreational open space, playing field;~~
- ~~☐ commercial/industrial use;~~
- ✓ Other – May continue to be used as stockpile for crushed concrete, but underlying soils need to be tested for chemical and ordnance contamination after stockpile removed.

subject to

- ✓ Conditions

1. On removal of all or part of the stockpile the underlying ground should be tested for both chemical and ordnance contamination. The testing should follow similar methods and levels of quality assurance as other parts of the ADI St Marys site. Appropriate remediation and validation should be performed (if necessary) the work reviewed by a site auitor.
3. Appropriate management plan including procedures for the safe handling and disposal of any items of explosive ordnance, shall be in place before development earthworks commences and shall remain in place to cover any excavation on the site during its ongoing use. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).
4. The final surface of any earthworks in areas which are to be used for active recreational land uses, e.g. sports grounds, school grounds and picnic areas, or low density residential use, should, on completion of the earthworks, be surveyed with a metal detector by appropriately qualified and experienced personnel and the work reviewed by an independent site auditor.

~~(c) is not suitable for any beneficial use due to risk of harm from contamination~~

~~☐ (comments): ...~~

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a Site Auditor (Accreditation No. 9813).

I Certify that:

(g) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and


(h) this statement is to the best of my knowledge, true, accurate and complete, and

(i) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

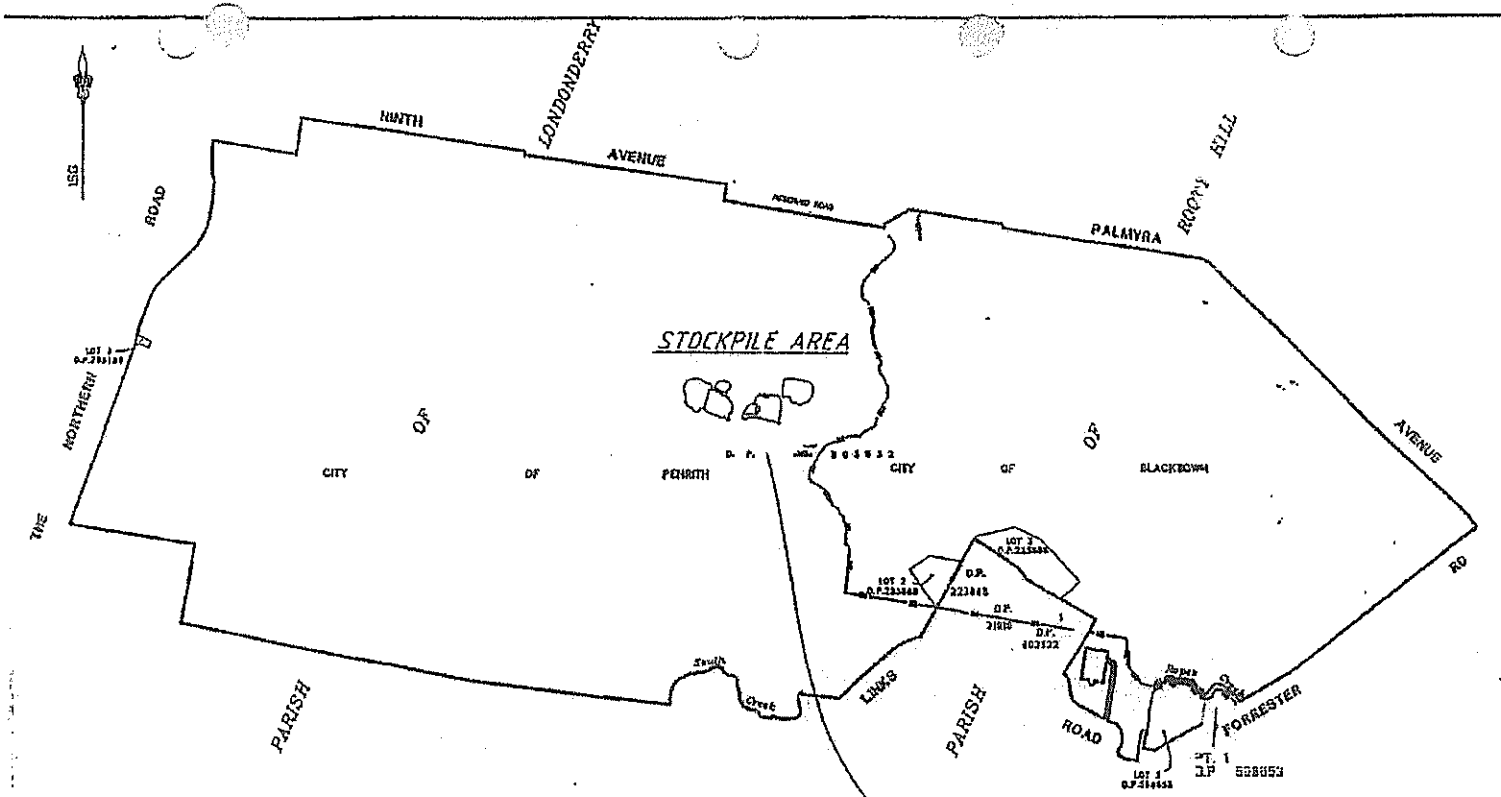


No	EASTING	NORTHING
	277 000	1 266 663
	277 000	1 266 664
	277 003	1 266 687
	276 991	1 266 727
	277 005	1 266 779
	277 056	1 266 793
	277 098	1 266 775
	277 133	1 266 759
	277 140	1 266 738
	277 127	1 266 730
	277 101	1 266 639
	277 078	1 266 639
	277 060	1 266 626
	277 039	1 266 635
	277 151	1 266 751
	277 184	1 266 744
	277 208	1 266 715
	277 220	1 266 733
	277 235	1 266 764
	277 222	1 266 744
	277 188	1 266 780
	277 123	1 266 730
	277 201	1 266 704
	277 245	1 266 656
	277 254	1 266 602
	277 254	1 266 602
	277 219	1 266 583
	277 204	1 266 599
	277 186	1 266 595
	277 115	1 266 627

No	EASTING	NORTHING
31	277 099	1 266 642
32	277 109	1 266 632
33	277 126	1 266 657
34	277 144	1 266 668
35	277 158	1 266 664
36	277 168	1 266 647
37	277 162	1 266 636
38	277 171	1 266 661
39	277 171	1 266 613
40	277 212	1 266 614
41	277 299	1 266 620
42	277 298	1 266 624
43	277 315	1 266 709
44	277 385	1 266 709
45	277 447	1 266 711
46	277 456	1 266 711
47	277 479	1 266 706
48	277 493	1 266 691
49	277 492	1 266 664
50	277 484	1 266 562
51	277 456	1 266 501
52	277 410	1 266 588
53	277 324	1 266 600
54	277 315	1 266 590
55	277 303	1 266 591
56	277 297	1 266 599
57	277 271	1 266 613
58	277 285	1 266 650
59	277 256	1 266 670
60	277 480	1 266 703

No	EASTING	NORTHING
61	277 504	1 266 725
62	277 504	1 266 757
63	277 514	1 266 793
64	277 523	1 266 797
65	277 530	1 266 793
66	277 528	1 266 791
67	277 652	1 266 766
68	277 655	1 266 717
69	277 603	1 266 670
70	277 598	1 266 664
71	277 544	1 266 691
72	277 534	1 266 700
73	277 528	1 266 701
74	277 506	1 266 699
75	277 499	1 266 716

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

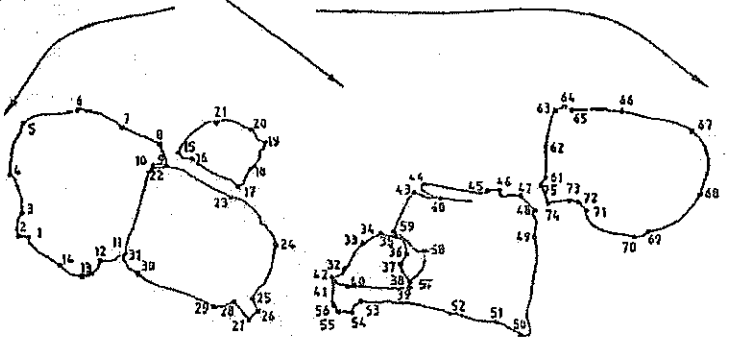

STOCKPILE AREA
NOT TO SCALE

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans Surveyors Planners Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI Property

ADI ST MARYS PROPERTY STOCKPILE AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/7

ORIGINAL SIZE: A3

SCALE HOR:	1 : 25,000	VERT:	–
CO-ORDS:	ISG	DATUM:	–
DATE OF SURVEY		DATE OF PLAN:	11 May 1999
SURVEY	–	DRAWN	Acad/DW
CHECKED:	DDW	DATE	24.5.1999
APPROVED:	PW	DATE	24.5.1999
JOB REF:	8662		
CAD REF:	8662-133.DWG	SHEET 6 OF 13 SHEETS	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Douglas Partners
Geotechnics / Environment / Groundwater

Douglas Partners Pty Ltd
ABN 75 053 980 117
www.douglaspartners.com.au
18 Waler Crescent
Smeaton Grange NSW 2567
Phone (02) 4647 0075
Fax (02) 4646 1886

Lend Lease Communities (Australia) Pty Ltd
Level 2, 88 Phillip Street
PARRAMATTA NSW 21254

Project 92245.00
21 September 2017
R.001.Rev0
GAR

Attention: Mr Paul Thomspon

Email: paul.thompson@lendlease.com

Dear Sirs

Site Walkover Contamination Report
Proposed Residential Subdivision
Proposed Lots 3989, 3990 and 3991, DP 1190132, Jordan Springs, NSW

1. Introduction

Douglas Partners Pty Ltd (DP) was commissioned by Lend Lease Communities (Australia) Pty Ltd (LLC) to complete a Site Walkover Contamination Report for the property comprising Lots 3989, 3990 and 3991 in Deposited Plan (DP) 1190132 at Jordan Springs NSW (the site). It is understood that the site, part of the Western Precinct of the former Australian Defence Industries (ADI) property, was subject to extensive investigations during the 1990s which included assessing the suitability of the land for residential redevelopment. A site audit statement produced in 1999 considered that the majority of the western precinct posed a negligible risk to the public with regard to contamination and /or explosive ordinance.

It is also understood that having previously developed and then sold the site in June 2013 to another developer, LLC are considering re-purchasing the site. A site walkover was required as part of due diligence investigations to identify additional activities or sources that have occurred/appeared on site since the sale of the property with the potential for land contamination. DP have not undertaken review of works associated with land whilst in LLC's ownership.

A plan of showing the subject site is attached.

2. Scope of Works

The scope completed for site walkover was as follows:

- Review of a Contamination Management Plan (CMP) produced by URS Australia Pty Ltd in 2008. The report was provided by LLC. The CMP included the 1999 Site Audit Statement. The review of CMP was completed to ascertain the contamination status of the site at time of site audit;
- Limited review of historical aerial imagery (from 2013) to identify additional areas on site where potential contamination may have occurred since the sale of the property;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

- Inspection of the site to assess the potential for contamination;
- Photographing of the site for recording purposes;
- Preparation of this Site Walkover Contamination report.

3. Summary of Reviewed Documentation

3.1 URS (2008) Contamination Management Plan

A CMP was completed for the Western Precinct, which included the site, by URS Australia Pty Ltd in July 2008 to support lodgement of the Western Precinct Plan. The objective of the CMP was to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the natural environment.

The CMP described that the site had been subject to extensive investigations during the 1990s which included a site audit statement issued in 1999 for the western precinct. The investigation and remediation programs for the property were undertaken with the objective of assessing the nature, degree of chemical contamination and remediation to a level suitable for redevelopment for a variety of land uses including residential. The majority of the western precinct was assessed by the site auditor to pose a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance.

3.2 Other Documents

DP are aware that there is a large body of pre-existing work on the site. DP were not provided any other documents to review and due to the timeframe were unable to obtain any further documents for review.

4. Limited Historical Aerial Review

A limited review of recent Nearmap Aerial Photography (from May 2013 onwards) was undertaken to identify areas onsite where potential for site contamination may have occurred in recent years. A summary of the review of historical aerial photography is detailed below.

May 2013 – The site appears to be vacant land which is partially covered by remnant bushland. A large grass covered area cleared of native vegetation is evident in the western portion of the site (Lot 3990) and another grass covered cleared area evident in the north eastern portion of the site (Lot 3989). An asphalt sealed car park has been developed in the central northern portion (Lot 3991) of the site adjacent to the site's northern boundary. An unsealed track runs from the carpark through the central portion of the site in a north - south. A long soil stockpile of limited height is located in the south eastern portion of the site that appears to be used for erosion control and likely created from reworked natural soils. The central portion of the site is generally covered by bushland. A large dam is located in the eastern portion of the site (Lot 3989). Areas in the far north eastern and eastern portions of the site appear to be used as a compound for nearby subdivision works on adjacent properties to the east of the site.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Areas to the north and northeast of the site beyond Jordan Springs Boulevard appear to be undergoing residential development. Areas to the south and immediate west of the site appear to be covered by bushland. A large wetland is evident to the immediate south of the central portion of the site. Areas to the far west of the site have been developed as residential.

June 2014 – The site and immediate surrounds appear similar to the previous aerial image.

March 2015 – The site and immediate surrounds appear similar to the previous aerial image.

May 2016 – The site and immediate surrounds appear similar to the previous aerial image.

February 2016 – An unsealed track running diagonally from the central northern portion of the site towards the south eastern portion of the site appears. The remainder of the site and immediate surrounds appear similar to the previous aerial image.

May 2017 – The unsealed track running diagonally through the site to the south eastern portion appears to have been increased in size and there appears to have been increased disturbance to sites soils in the central eastern portion of the site. The dam in the eastern portion (Lot 3989) of the site appears to have been filled. Bulk earthworks are occurring to the immediate south of the site which appear to be for a drainage system associated with the nearby developments to the east of the site and wetlands to the immediate south of the site. The unsealed track in the central eastern portion of the site appears to have been used as an access track for the bulk earthworks occurring for the drainage system.

September 2017 – The drainage system to the immediate south of the site appears to have been completed. The remainder of the site and immediate surrounds appear similar to the previous aerial image.

6. Site Walkover

The following site description is based on a site walkover completed on 19 September 2017. Photographs taken during the Site walkover and field works are presented in attached Photographic Plates 1 to 4.

The site is an irregular shaped property. At the time of inspection the site was vacant and partially covered with bushland and unsealed dirt tracks. The site is accessed via an asphalt sealed driveway in the central northern portion of Lot 3991 that leads from Jordan Springs Boulevard to the north of the site. The driveway leads to an asphalt/spray sealed carpark in the central northern portion of Lot 3991. An unsealed dirt track leads from the southern portion of the carpark towards the central and southern portions of the site. Five small stockpiles of soil were observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark. The stockpiles, with an approximate total volume of 15 - 20 m^3, were partially grass covered and appeared to be comprised of soil and small amounts of crushed sandstone and concrete.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

The unsealed driveway branches to the immediate south of the stockpiles with one arm of the driveway heading towards the western portion of the site (Lot 3990) and the other heading towards the eastern portion (Lot 3989). The western track leads through bushland to a grass covered cleared area in the western portion of the site (Lot 3990). Minor refuse was noted (an abandoned shopping trolley was observed half way along the track and a several abandoned beer bottles were observed beneath a tree in the mostly cleared area). No other visible signs of anthropogenic material were observed in the western portion of the site.

The eastern track leads to a large cleared area in the eastern portion of the site (Lot 3989). A long soil stockpile of limited height was observed in the south eastern portion of the site that appeared to be comprised of reworked natural material. The stockpile appeared to be used for former erosion control by diverting water. To the east of the stockpile was an area of filling which covered an approximate area of 3000 m^2. The filling was observed to contain sand, clay, crushed sandstone and minor fragments of crushed concrete. With the exception crushed concrete no further anthropogenic material was observed within the fill.

6. Potential Sources of Contamination

Area of Filling in the Eastern Portion of the site (Lot 3989)

An area of filling was identified during site inspection in the eastern portion of the site. The filling covered an approximate area of 3000 m^2. The surface of the filling was observed to contain sand, clay, crushed sandstone and minor fragments of crushed concrete. Review of Nearmap Imagery indicates that the filling arrived on site to fill a dam in the eastern portion of the site sometime between November 2016 and May 2017. Correspondence (attached) with representatives of LLC has identified that the source of the material is the result of bulk earthworks associated with the drainage system located to the immediate south of the site. Given the site audit statement that the site and immediate surrounds pose a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance the potential for contamination to filling in the eastern portion of the site is considered to be low.

Small Soil Stockpiles in the central Northern Portion of the Site (Lot 3991)

Five small stockpiles of soil were observed during site walkover on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark which were partially grass covered and appeared to be comprised of soil and small amounts of crushed sandstone and concrete. The stockpiles had an approximate total volume of 15 - 20 m^3. Review of Nearmap imagery indicates that the stockpiles arrived on site sometime between August and December 2012 at a similar time as the construction of the carpark.

Whilst the stockpiles were likely created by earthworks associated with the car park the potential that the stockpiles were created as a result of illegal dumping or flytipping cannot be ruled out. Although potential for contamination of the soil within stockpiles exists given the volume the potential for widespread gross contamination of the site is considered to be low.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

7. Conclusions and Recommendations

The previous 1999 site audit statement produced for the western precinct, which included the site, considered the area poses a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance. Limited review of historical aerial imagery and site walkover completed on 19 September 2017 has identified the following potential sources appearing onsite in recent years that have the potential for contamination of the site:

- An area of filling identified on Lot 3989 which covered an approximate total area of 3000 m^2 in the location of a former dam. Given correspondence with LLC stating that the material was sourced from nearby bulk earth works for the drainage basin to the south of the site the potential for contamination is therefore considered to be low; and
- Five small stockpiles of soil observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt car park on Lot 3991. Given the small volume (15 - 20 m^3) of the stockpiles, likely origins from bulk earthworks associated with the nearby carpark and observed contents the soil within the stockpile poses a low contamination risk to the site.

It is recommended that further investigations be completed in due course of the filling on Lot 3989 and within the soil stockpiles on Lot 3991 to confirm the absence/presence of contaminants of potential concern associated with fill of an unknown origin.

With respect to site contamination the recommended further assessment should build on the information provided in this report with reference to National Environment Protection Council (NEPC, 1999) National Environment Protection Council (Assessment of Site Contamination) Measure 1999 (amended 2013) (NEPC, 2013). Further assessment should include intrusive investigations, sampling, analysis and assessment to determine land use suitability.

We trust that this meets your present requirements, please do not hesitate to contact the undersigned should you have any further enquiries.

Based on our walkover assessment the identified potential sources present a low risk of contamination and no significant source of contamination have been identified on the site since the sale of the property in June 2013. DP have not undertaken review of works associated with land whilst in LLC's ownership.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

8. Limitations

Douglas Partners Pty Ltd (DP) has prepared this report for this project at Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW in accordance with DP's proposal dated 15 September 2017 and acceptance received from Paul Thompson dated 15 September 2017. The work was carried out under DP's Conditions of Engagement. This report is provided for the exclusive use of Lend Lease Communities Ltd for this project only and for the purposes as described in the report. It should not be used by or relied upon for other projects or purposes on the same or other site or by a third party. Any party so relying upon this report beyond its exclusive use and purpose as stated above, and without the express written consent of DP, does so entirely at its own risk and without recourse to DP for any loss or damage. In preparing this report DP has necessarily relied upon information provided by the client and/or their agents.

The results provided in the report are indicative of the conditions on the site only at the time of works carried out. Conditions can change abruptly due to variable geological processes and also as a result of human influences. Such changes may occur after DP's field testing has been completed.

DP's advice is based upon the conditions encountered during the reviewed investigations. The accuracy of the advice provided by DP in this report may be affected by undetected variations in ground conditions across the site between and beyond the sampling and/or testing locations. The advice may also be limited by budget constraints imposed by others or by site accessibility.

This report must be read in conjunction with all of the attached and should be kept in its entirety without separation of individual pages or sections. DP cannot be held responsible for interpretations or conclusions made by others unless they are supported by an expressed statement, interpretation, outcome or conclusion stated in this report.

The limitations and notes included in the previous investigations are also relevant to this review.

Please contact the undersigned if you have any questions on this matter

Yours faithfully
Douglas Partners Pty Ltd

Grant Russell
Environmental Scientist

Reviewed by

Christopher Kline
Principal

Attachments: Subject Site Plan
Photographic Plates
Correspondence with Lend Lease Communities

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Subject site:

Lot 3989
5,026m2

Lot 3990
2.345ha

Lot 3991
3.6ha

DP 1190132

Jordans Springs, (Penrith)



Photograph 1 - Asphalt sealed carpark in northern portion of site



Photograph 2 - Small soil stockpiles adjacent to south east corner of carpark

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW	PROJECT: 92245.00 PLATE No. 1 REV: A
	CLIENT: Lend Lease Communities Pty Ltd	DATE: Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 3 - Native bushland covering central portion of site



Photograph 4 - Cleared grassed area in western portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs	PROJECT:	92245.00
	Site Walkover	PLATE No.	2
	Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW	REV:	A
	CLIENT: Lend Lease Communities Pty Ltd	DATE:	Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 5 - Engineered drainage system located to the south of the site



Photograph 6 - Central eastern portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs	PROJECT:	92245.00
	Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW	PLATE No:	3
		REV:	A
	CLIENT: Lend Lease Communities Pty Ltd	DATE:	Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 7 - Filling in eastern portion of site



Photograph 8 - Filling observed in eastern portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW CLIENT: Lend Lease Communities Pty Ltd	PROJECT: 92245.00 PLATE No: 4 REV: A DATE: Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Grant Russell

From: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Sent: Thursday, 21 September 2017 1:23 PM
To: Grant Russell
Subject: RE: [EXT]:RE: Jordan Springs -

Grant,

Burton for Lendlease.

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

From: Grant Russell [mailto:Grant.Russell@douglaspartners.com.au]
Sent: Thursday, 21 September 2017 1:21 PM
To: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Subject: RE: [EXT]:RE: Jordan Springs -

Nirmal,
Was the work undertaken by Burton for lend lease or previous owners CID?
Regards
Grant

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Grant Russell | Environmental Scientist
Douglas Partners Pty Ltd | ABN 75 053 980 117 | www.douglaspartners.com.au
18 Waler Crescent Smeaton Grange NSW 2567
P: 02 4647 0075 | F: 02 4646 1886 | E: Grant.Russell@douglaspartners.com.au

FINANCIAL REVIEW
CLIENT CHOICE AWARDS 2017
WINNER beaton

This email is confidential. If you are not the intended recipient, please notify us immediately and be aware that any disclosure, copying, distribution or use of the contents of this information is prohibited. Please note that the company does not make any commitment through emails not confirmed by fax or letter.

From: Srinivas, Nirmal [mailto:Nirmal.Srinivas@lendlease.com]
Sent: Thursday, 21 September 2017 1:12 PM
To: Grant Russell
Cc: Chris Kline
Subject: RE: [EXT]:RE: Jordan Springs -

Hi Grant,

The basin was filled up using cut and fill material on site and the works were carried out by Burton Contractor. Basically when new channel was built, soil from there was used for filling up the basin – see image below.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

From: Grant Russell [mailto:Grant.Russell@douglaspartners.com.au]
Sent: Thursday, 21 September 2017 10:58 AM
To: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Cc: Chris Kline <Chris.Kline@douglaspartners.com.au>
Subject: [EXT]:RE: Jordan Springs -

Hi Nirmal,
Yes that is dam Im talking about that has recently been filled. We neec to find out who filled the dam and with what materials?
Regards
Grant

Grant Russell | Environmental Scientist
Douglas Partners Pty Ltd | ABN 75 053 980 117 | www.douglaspartners.com.au
18 Waler Crescent Smeaton Grange NSW 2567
P: 02 4647 0075 | F: 02 4646 1886 | E: Grant.Russell@douglaspartners.com.au

FINANCIAL REVIEW
CLIENT CHOICE AWARDS 2017
WINNER beaton

This email is confidential. If you are not the intended recipient, please notify us immediately and be aware that any disclosure, copying, distribution or use of the contents of this information is prohibited. Please note that the company does not make any commitment through emails not confirmed by fax or letter.

From: Srinivas, Nirmal [mailto:Nirmal.Srinivas@lendlease.com]
Sent: Thursday, 21 September 2017 10:54 AM

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

To: Grant R.ıssell
Subject: RE: Jordan Springs -

Hi Grant,

Are you talk ng about this portion cf land – see image below?

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com



From: Srinivas, Nirmal
Sent: Tuesday, 19 September 2017 3:58 PM
To: 'grant.russell@douglaspartners.com.au' <grant.russell@douglaspartners.com.au>
Cc: Chris Kline <Chris.Kline@douglaspartners.com.au>
Subject: Jordan Springs - Site Audit Statements/CMP

Hi Grant,

As requested please see attached information relating to contamination.

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com



"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000""> This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

Disclaimer

The information contained in this communication from the sender is confidential. It is intended solely for use by the recipient and others authorized to receive it. If you are not the recipient, you are hereby notified that any disclosure, copying, distribution or taking action in relation of the contents of this information is strictly prohibited and may be unlawful.

This email has been scanned for viruses and malware, and may have been automatically archived by **Mimecast Ltd**, an innovator in Software as a Service (SaaS) for business. Providing a **safer** and **more useful** place for your human generated data. Specializing in: Security, archiving and compliance. To find out more Click Here.

"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000"">

This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

Disclaimer

The information contained in this communication from the sender is confidential. It is intended solely for use by the recipient and others authorized to receive it. If you are not the recipient, you are hereby notified that any disclosure, copying, distribution or taking action in relation of the contents of this information is strictly prohibited and may be unlawful.

This email has been scanned for viruses and malware, and may have been automatically archived by **Mimecast Ltd**, an innovator in Software as a Service (SaaS) for business. Providing a **safer** and **more useful** place for your human generated data. Specializing in: Security, archiving and compliance. To find out more Click Here.

"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000"">

This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to **conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised** access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

APPENDIX C

NSW EPA

Search results

Your search for:Suburb: JORDAN SPRINGS

Search Again
Refine Search

did not find any records in our database.

If a site does not appear on the record it may still be affected by contamination. For example:

- Contamination may be present but the site has not been regulated by the EPA under the Contaminated Land Management Act 1997 or the Environmentally Hazardous Chemicals Act 1985.
- The EPA may be regulating contamination at the site through a licence or notice under the Protection of the Environment Operations Act 1997 (POEO Act).
- Contamination at the site may be being managed under the planning process.

Search TIP

To search for a specific site, search by LGA (local government area) and carefully review all sites listed.

... more search tips

More information about particular sites may be available from:

- The POEO public register
- The appropriate planning authority: for example, on a planning certificate issued by the local council under section 149 of the Environmental Planning and Assessment Act.

See What's in the record and What's not in the record.

If you want to know whether a specific site has been the subject of notices issued by the EPA under the CLM Act, we suggest that you search by Local Government Area only and carefully review the sites that are listed.
This public record provides information about sites regulated by the EPA under the Contaminated Land Management Act 1997, including sites currently and previously regulated under the Environmentally Hazardous Chemicals Act 1985. Your inquiry using the above search criteria has not matched any record of current or former regulation. You should consider searching again using different criteria. The fact that a site does not appear on the record does not necessarily mean that it is not affected by contamination. The site may have been notified to the EPA but not yet assessed, or contamination may be present but the site is not yet being regulated by the EPA. Further information about particular sites may be available from the appropriate planning authority, for example, on a planning certificate issued by the local council under section 149 of the Environmental Planning and Assessment Act. In addition the EPA may be regulating contamination at the site through a licence under the Protection of the Environment Operations Act 1997. You may wish to search the POEO public register.POEO public register

6 April 2018

For business and industry ()

For local government ()

Contact us

131 555 (tel:131555)

Online (http://www.epa.nsw.gov.au/about-us/contact-us/feedback/feedback-form)

info@epa.nsw.gov.au (mailto:info@epa.nsw.gov.au)

EPA Office Locations (http://www.epa.nsw.gov.au/about-us/contact-us/locations)

Accessibility (http://www.epa.nsw.gov.au/about-us/contact-us/website-service-standards/help-index)
Disclaimer (http://www.epa.nsw.gov.au/about-us/contact-us/website-service-standards/disclaimer)
Privacy (http://www.epa.nsw.gov.au/about-us/contact-us/website-service-standards/privacy)
Copyright (http://www.epa.nsw.gov.au/about-us/contact-us/website-service-standards/copyright)

Find us on (https://

Document Set ID: 3938349
Version: 1, Version Date: 25/11/2019

Search results

Your search for: **General Search** with the following criteria

Suburb - JORDAN SPRINGS

returned 2 results

Export to excel 1 of 1 Pages Search Again

Number	Name	Location	Type	Status	Issued date
20310	Maryland Development Company Pty Ltd	Corner of Lakeside Parade and Jubilee Drive, JORDAN SPRINGS, NSW 2747	POEO licence	Surrendered	05 Sep 2013
1526557	Maryland Development Company Pty Ltd	Corner of Lakeside Parade and Jubilee Drive, JORDAN SPRINGS, NSW 2747	s.58 Licence Variation	Issued	06 Jan 2015

06 April 2018

Document Set ID: 3938849
Version: 1, Version Date: 25/11/2019

APPENDIX D

GROUNDWATER

Department of Primary Industries
Office of Water

Home | About us | Water Management | Water Licensing | Urban Water

Real-time data

home · help · login · contact · customise

All Groundwater

find a site

- All Groundwater Map
  - North Coast Region
  - Hunter Region
  - Greater Sydney Region
    - **Hawkesbury Riv...**
    - Georges River Basin
    - Wollongong Basin
  - South Coast Region
  - Northwest Region
  - Central West Region
  - Southwest Region
  - Far West Region
  - Great Artesian Basin
  - Coal Basins

bandwidth (•) high ( ) low

glossary and metadata


All Groundwater » All Groundwater Map » Greater Sydney Region

Hawkesbury River Basin

bookmark this page

All data times are Eastern Standard Time

Map

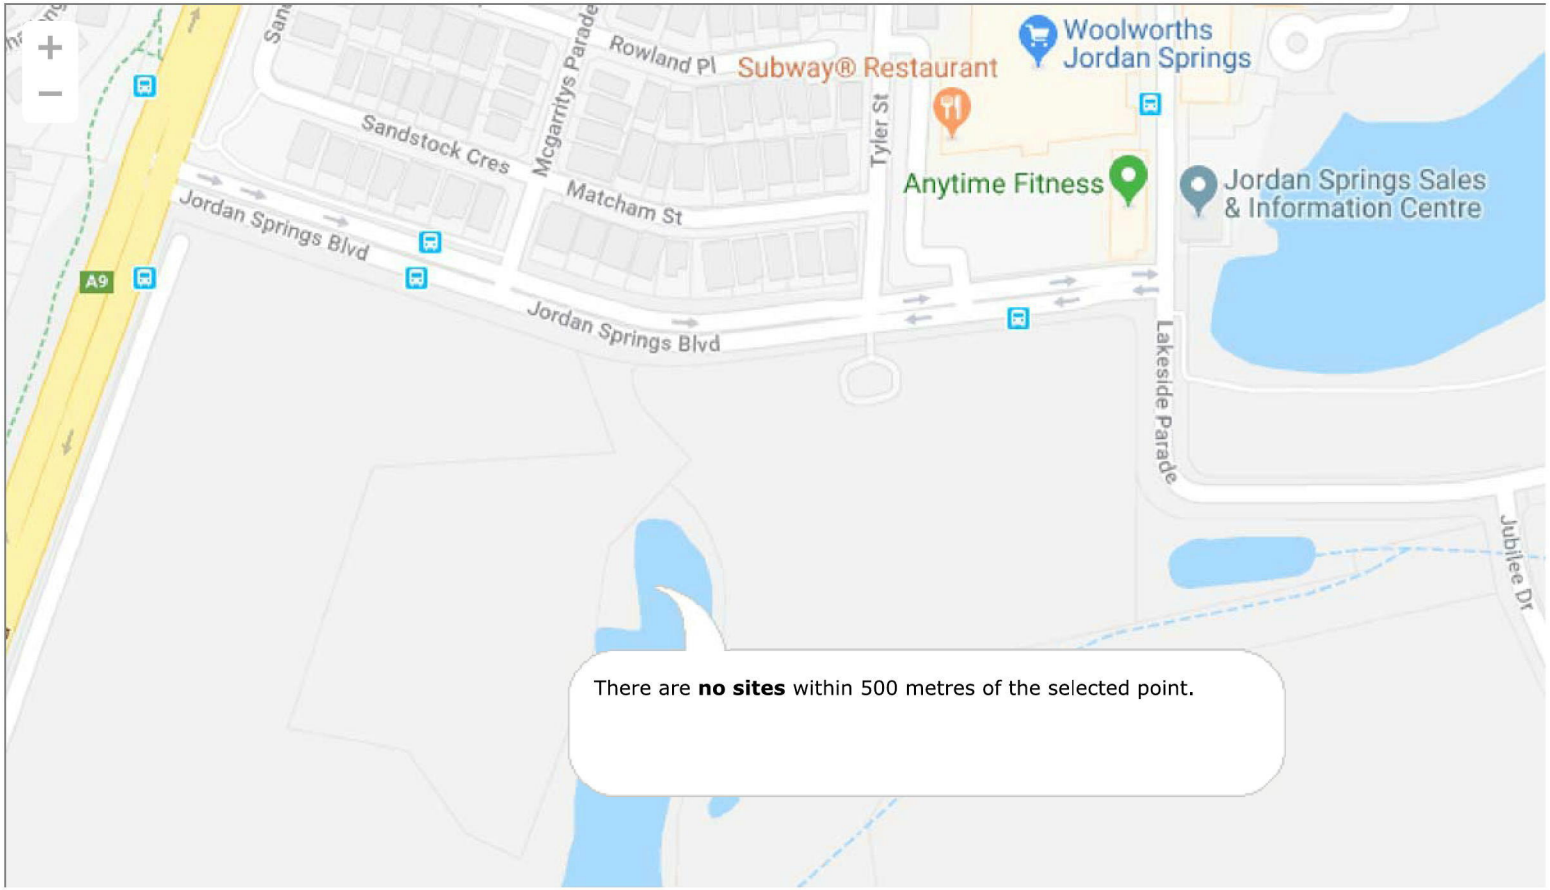

Document Set ID: 8933845
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX E

LABORATORY

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS		LABORATORY DETAILS	
Contact	Craig Cowper	Manager	Huong Crawford
Client	ALLIANCE GEOTECHNICAL PTY LTD	Laboratory	SGS Alexandria Environmental
Address	10 Welder Road Seven Hills NSW 2147	Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	0407 989 885	Telephone	+61 2 8594 0400
Facsimile	02 9675 1888	Facsimile	+61 2 8594 0499
Email	c.cowper@allgeo.com.au	Email	au.environmental.sydney@sgs.com
Project	**7161 Jordan Springs**	SGS Reference	**SE177801 R1**
Order Number	**P1054**	Date Received	10 Apr 2018
Samples	17	Date Reported	17 Apr 2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

This report cancels and supersedes the report No.SE177801 R0 dated 13th April 2018 issued by SGS Environment, Health and Safety due to addition of PAH results #5.

SIGNATORIES

Akheeqar Beniameen
Chemist

Bennet Lo
Senior Organic Chemist/Metals Chemis

Kamrul Ahsan
Senior Chemist

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
VOC's in Soil Method: AN433 Tested: 12/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	**0.4**	<0.1	<0.1	**0.4**
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	**89**	**81**	**73**	**86**
d4-1,2-dichloroethane (Surrogate)	%	-	**110**	**108**	**118**	**115**
d8-toluene (Surrogate)	%	-	**126**	**118**	**114**	**109**
Bromofluorobenzene (Surrogate)	%	-	**76**	**82**	**82**	**72**
Totals						
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 12/4/2018						
TRH C6-C10	mg/kg	25	<25	<25	<25	<25
TRH C6-C9	mg/kg	20	<20	<20	<20	<20
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	**89**	**81**	**73**	**86**
d4-1,2-dichloroethane (Surrogate)	%	-	**110**	**108**	**118**	**115**
d8-toluene (Surrogate)	%	-	**126**	**118**	**114**	**109**
Bromofluorobenzene (Surrogate)	%	-	**76**	**82**	**82**	**72**
VPH F Bands						
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.001 Soil 09 Apr 2018 SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
TRH (Total Recoverable Hydrocarbons) in Soil Method: AN403 Tested: 12/4/2018						
TRH C10-C14	mg/kg	20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	<45	<45	<45	<45
TRH C29-C36	mg/kg	45	<45	<45	<45	<45
TRH C37-C40	mg/kg	100	<100	<100	<100	<100
TRH C10-C36 Total	mg/kg	110	<110	<110	<110	<110
TRH C10-C40 Total (F bands)	mg/kg	210	<210	<210	<210	<210
TRH F Bands						
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	<90	<90	<90	<90
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 12/4/2018						
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Phenanthrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Chrysene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Total PAH (18)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	**78**	**74**	**74**	**72**
2-fluorobiphenyl (Surrogate)	%	-	**96**	**104**	**102**	**104**
d14-p-terphenyl (Surrogate)	%	-	**108**	**114**	**114**	**114**
OC Pesticides in Soil Method: AN420 Tested: 12/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
OC Pesticides in Soil Method: AN420 Tested: 12/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	**105**	**105**	**89**	**98**
PCBs in Soil Method: AN420 Tested: 12/4/2018						
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	**105**	**105**	**89**	**98**
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018						
Arsenic, As	mg/kg	3	**6**	**7**	**5**	**7**
Cadmium, Cd	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	**11**	**21**	**13**	**15**
Copper, Cu	mg/kg	0.5	**14**	**20**	**24**	**43**
Nickel, Ni	mg/kg	0.5	**2.4**	**6.9**	**7.6**	**13**
Lead, Pb	mg/kg	1	**14**	**19**	**14**	**45**
Zinc, Zn	mg/kg	0.5	**14**	**42**	**31**	**140**
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	<0.05	<0.05	<0.05	<0.05

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	**10**	**5.9**	**9.2**	**10**

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
VOC's in Soil Method: AN433 Tested: 12/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	<0.1	-	<0.1	-
Toluene	mg/kg	0.1	<0.1	-	<0.1	-
Ethylbenzene	mg/kg	0.1	<0.1	-	<0.1	-
m/p-xylene	mg/kg	0.2	<0.2	-	<0.2	-
o-xylene	mg/kg	0.1	<0.1	-	<0.1	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	**0.3**	-	<0.1	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	**83**	-	**72**	-
d4-1,2-dichloroethane (Surrogate)	%	-	**103**	-	**103**	-
d8-toluene (Surrogate)	%	-	**115**	-	**116**	-
Bromofluorobenzene (Surrogate)	%	-	**73**	-	**79**	-
Totals						
Total Xylenes	mg/kg	0.3	<0.3	-	<0.3	-
Total BTEX	mg/kg	0.6	<0.6	-	<0.6	-
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 12/4/2018						
TRH C6-C10	mg/kg	25	<25	-	<25	-
TRH C6-C9	mg/kg	20	<20	-	<20	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	**83**	-	**72**	-
d4-1,2-dichloroethane (Surrogate)	%	-	**103**	-	**103**	-
d8-toluene (Surrogate)	%	-	**115**	-	**116**	-
Bromofluorobenzene (Surrogate)	%	-	**73**	-	**79**	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	<0.1	-	<0.1	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	-	<25	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.005 Soil 09 Apr 2018 SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
TRH (Total Recoverable Hydrocarbons) in Soil Method: AN403 Tested: 12/4/2018						
TRH C10-C14	mg/kg	20	<20	-	<20	-
TRH C15-C28	mg/kg	45	<45	-	<45	-
TRH C29-C36	mg/kg	45	<45	-	<45	-
TRH C37-C40	mg/kg	100	<100	-	<100	-
TRH C10-C36 Total	mg/kg	110	<110	-	<110	-
TRH C10-C40 Total (F bands)	mg/kg	210	<210	-	<210	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	<25	-	<25	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	-	<25	-
TRH >C16-C34 (F3)	mg/kg	90	<90	-	<90	-
TRH >C34-C40 (F4)	mg/kg	120	<120	-	<120	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 12/4/2018						
Naphthalene	mg/kg	0.1	<0.1	-	<0.1	-
2-methylnaphthalene	mg/kg	0.1	<0.1	-	<0.1	-
1-methylnaphthalene	mg/kg	0.1	<0.1	-	<0.1	-
Acenaphthylene	mg/kg	0.1	<0.1	-	<0.1	-
Acenaphthene	mg/kg	0.1	<0.1	-	<0.1	-
Fluorene	mg/kg	0.1	<0.1	-	<0.1	-
Phenanthrene	mg/kg	0.1	**0.3**	-	<0.1	-
Anthracene	mg/kg	0.1	<0.1	-	<0.1	-
Fluoranthene	mg/kg	0.1	**0.3**	-	<0.1	-
Pyrene	mg/kg	0.1	**0.5**	-	<0.1	-
Benzo(a)anthracene	mg/kg	0.1	**0.2**	-	<0.1	-
Chrysene	mg/kg	0.1	**0.2**	-	<0.1	-
Benzo(b&j)fluoranthene	mg/kg	0.1	**0.1**	-	<0.1	-
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	-	<0.1	-
Benzo(a)pyrene	mg/kg	0.1	**0.1**	-	<0.1	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	-	<0.1	-
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	-	<0.1	-
Benzo(ghi)perylene	mg/kg	0.1	**0.1**	-	<0.1	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	-	<0.2	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	-	<0.3	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	**0.2**	-	<0.2	-
Total PAH (18)	mg/kg	0.8	**1.9**	-	<0.8	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	**1.9**	-	<0.8	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	**78**	-	**76**	-
2-fluorobiphenyl (Surrogate)	%	-	**106**	-	**86**	-
d14-p-terphenyl (Surrogate)	%	-	**114**	-	**98**	-
OC Pesticides in Soil Method: AN420 Tested: 12/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	-	<0.1	-
Alpha BHC	mg/kg	0.1	<0.1	-	<0.1	-
Lindane	mg/kg	0.1	<0.1	-	<0.1	-
Heptachlor	mg/kg	0.1	<0.1	-	<0.1	-
Aldrin	mg/kg	0.1	<0.1	-	<0.1	-
Beta BHC	mg/kg	0.1	<0.1	-	<0.1	-
Delta BHC	mg/kg	0.1	<0.1	-	<0.1	-
Heptachlor epoxide	mg/kg	0.1	<0.1	-	<0.1	-
o,p'-DDE	mg/kg	0.1	<0.1	-	<0.1	-
Alpha Endosulfan	mg/kg	0.2	<0.2	-	<0.2	-
Gamma Chlordane	mg/kg	0.1	<0.1	-	<0.1	-
Alpha Chlordane	mg/kg	0.1	<0.1	-	<0.1	-
trans-Nonachlor	mg/kg	0.1	<0.1	-	<0.1	-
p,p'-DDE	mg/kg	0.1	<0.1	-	<0.1	-
Dieldrin	mg/kg	0.2	<0.2	-	<0.2	-
Endrin	mg/kg	0.2	<0.2	-	<0.2	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	<0.1	-	<0.1	-
o,p'-DDT	mg/kg	0.1	<0.1	-	<0.1	-
Beta Endosulfan	mg/kg	0.2	<0.2	-	<0.2	-
p,p'-DDD	mg/kg	0.1	<0.1	-	<0.1	-
p,p'-DDT	mg/kg	0.1	<0.1	-	<0.1	-
Endosulfan sulphate	mg/kg	0.1	<0.1	-	<0.1	-
Endrin Aldehyde	mg/kg	0.1	<0.1	-	<0.1	-
Methoxychlor	mg/kg	0.1	<0.1	-	<0.1	-
Endrin Ketone	mg/kg	0.1	<0.1	-	<0.1	-
Isodrin	mg/kg	0.1	<0.1	-	<0.1	-
Mirex	mg/kg	0.1	<0.1	-	<0.1	-
Total CLP OC Pesticides	mg/kg	1	<1	-	<1	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	**104**	-	**70**	-
PCBs in Soil Method: AN420 Tested: 12/4/2018						
Arochlor 1016	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1221	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1232	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1242	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1248	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1254	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1260	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1262	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1268	mg/kg	0.2	<0.2	-	<0.2	-
Total PCBs (Arochlors)	mg/kg	1	<1	-	<1	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	**104**	-	**70**	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018						
Arsenic, As	mg/kg	3	**7**	-	**5**	-
Cadmium, Cd	mg/kg	0.3	<0.3	-	<0.3	-
Chromium, Cr	mg/kg	0.3	**15**	-	**13**	-
Copper, Cu	mg/kg	0.5	**55**	-	**34**	-
Nickel, Ni	mg/kg	0.5	**12**	-	**11**	-
Lead, Pb	mg/kg	1	**68**	-	**40**	-
Zinc, Zn	mg/kg	0.5	**180**	-	**190**	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	**0.05**	-	<0.05	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name	SE177801.005 Soil 09 Apr 2018 SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
Moisture Content Method: AN002 Tested: 12/4/2018							
% Moisture	%w/w	0.5		**9.6**	-	**8.3**	-

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
VOC's in Soil Method: AN433 Tested: 13/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	-	-	-	-
Toluene	mg/kg	0.1	-	-	-	-
Ethylbenzene	mg/kg	0.1	-	-	-	-
m/p-xylene	mg/kg	0.2	-	-	-	-
o-xylene	mg/kg	0.1	-	-	-	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
Totals						
Total Xylenes	mg/kg	0.3	-	-	-	-
Total BTEX	mg/kg	0.6	-	-	-	-
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 13/4/2018						
TRH C6-C10	mg/kg	25	-	-	-	-
TRH C6-C9	mg/kg	20	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	-	-	-	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-	-	-	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
TRH (Total Recoverable Hydrocarbons) in Soil Method: AN403 Tested: 13/4/2018						
TRH C10-C14	mg/kg	20	-	-	-	-
TRH C15-C28	mg/kg	45	-	-	-	-
TRH C29-C36	mg/kg	45	-	-	-	-
TRH C37-C40	mg/kg	100	-	-	-	-
TRH C10-C36 Total	mg/kg	110	-	-	-	-
TRH C10-C40 Total (F bands)	mg/kg	210	-	-	-	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	-	-	-	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-	-	-	-
TRH >C16-C34 (F3)	mg/kg	90	-	-	-	-
TRH >C34-C40 (F4)	mg/kg	120	-	-	-	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018						
Naphthalene	mg/kg	0.1	-	-	-	-
2-methylnaphthalene	mg/kg	0.1	-	-	-	-
1-methylnaphthalene	mg/kg	0.1	-	-	-	-
Acenaphthylene	mg/kg	0.1	-	-	-	-
Acenaphthene	mg/kg	0.1	-	-	-	-
Fluorene	mg/kg	0.1	-	-	-	-
Phenanthrene	mg/kg	0.1	-	-	-	-
Anthracene	mg/kg	0.1	-	-	-	-
Fluoranthene	mg/kg	0.1	-	-	-	-
Pyrene	mg/kg	0.1	-	-	-	-
Benzo(a)anthracene	mg/kg	0.1	-	-	-	-
Chrysene	mg/kg	0.1	-	-	-	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(k)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(a)pyrene	mg/kg	0.1	-	-	-	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-	-	-	-
Dibenzo(ah)anthracene	mg/kg	0.1	-	-	-	-
Benzo(ghi)perylene	mg/kg	0.1	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-	-	-	-
Total PAH (18)	mg/kg	0.8	-	-	-	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-	-	-	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	-	-	-	-
2-fluorobiphenyl (Surrogate)	%	-	-	-	-	-
d14-p-terphenyl (Surrogate)	%	-	-	-	-	-
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	-	-	-	-
Alpha BHC	mg/kg	0.1	-	-	-	-
Lindane	mg/kg	0.1	-	-	-	-
Heptachlor	mg/kg	0.1	-	-	-	-
Aldrin	mg/kg	0.1	-	-	-	-
Beta BHC	mg/kg	0.1	-	-	-	-
Delta BHC	mg/kg	0.1	-	-	-	-
Heptachlor epoxide	mg/kg	0.1	-	-	-	-
o,p'-DDE	mg/kg	0.1	-	-	-	-
Alpha Endosulfan	mg/kg	0.2	-	-	-	-
Gamma Chlordane	mg/kg	0.1	-	-	-	-
Alpha Chlordane	mg/kg	0.1	-	-	-	-
trans-Nonachlor	mg/kg	0.1	-	-	-	-
p,p'-DDE	mg/kg	0.1	-	-	-	-
Dieldrin	mg/kg	0.2	-	-	-	-
Endrin	mg/kg	0.2	-	-	-	-

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	-	-	-	-
o,p'-DDT	mg/kg	0.1	-	-	-	-
Beta Endosulfan	mg/kg	0.2	-	-	-	-
p,p'-DDD	mg/kg	0.1	-	-	-	-
p,p'-DDT	mg/kg	0.1	-	-	-	-
Endosulfan sulphate	mg/kg	0.1	-	-	-	-
Endrin Aldehyde	mg/kg	0.1	-	-	-	-
Methoxychlor	mg/kg	0.1	-	-	-	-
Endrin Ketone	mg/kg	0.1	-	-	-	-
Isodrin	mg/kg	0.1	-	-	-	-
Mirex	mg/kg	0.1	-	-	-	-
Total CLP OC Pesticides	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
PCBs in Soil Method: AN420 Tested: 13/4/2018						
Arochlor 1016	mg/kg	0.2	-	-	-	-
Arochlor 1221	mg/kg	0.2	-	-	-	-
Arochlor 1232	mg/kg	0.2	-	-	-	-
Arochlor 1242	mg/kg	0.2	-	-	-	-
Arochlor 1248	mg/kg	0.2	-	-	-	-
Arochlor 1254	mg/kg	0.2	-	-	-	-
Arochlor 1260	mg/kg	0.2	-	-	-	-
Arochlor 1262	mg/kg	0.2	-	-	-	-
Arochlor 1268	mg/kg	0.2	-	-	-	-
Total PCBs (Arochlors)	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 13/4/2018						
Arsenic, As	mg/kg	3	-	-	-	-
Cadmium, Cd	mg/kg	0.3	-	-	-	-
Chromium, Cr	mg/kg	0.3	-	-	-	-
Copper, Cu	mg/kg	0.5	-	-	-	-
Nickel, Ni	mg/kg	0.5	-	-	-	-
Lead, Pb	mg/kg	1	-	-	-	-
Zinc, Zn	mg/kg	0.5	-	-	-	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	-	-	-	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name	SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
Moisture Content Method: AN002 Tested: 12/4/2018							
% Moisture	%w/w	0.5		-	-	-	-

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.013 Material 09 Apr 2018 SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
VOC's in Soil Method: AN433 Tested: 13/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	-	-	-	-
Toluene	mg/kg	0.1	-	-	-	-
Ethylbenzene	mg/kg	0.1	-	-	-	-
m/p-xylene	mg/kg	0.2	-	-	-	-
o-xylene	mg/kg	0.1	-	-	-	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
Totals						
Total Xylenes	mg/kg	0.3	-	-	-	-
Total BTEX	mg/kg	0.6	-	-	-	-
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 13/4/2018						
TRH C6-C10	mg/kg	25	-	-	-	-
TRH C6-C9	mg/kg	20	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	-	-	-	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
TRH (Total Recoverable Hydrocarbons) in Soil Method: AN403 Tested: 13/4/2018						
TRH C10-C14	mg/kg	20	-	-	-	-
TRH C15-C28	mg/kg	45	-	-	-	-
TRH C29-C36	mg/kg	45	-	-	-	-
TRH C37-C40	mg/kg	100	-	-	-	-
TRH C10-C36 Total	mg/kg	110	-	-	-	-
TRH C10-C40 Total (F bands)	mg/kg	210	-	-	-	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	-	-	-	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-	-	-	-
TRH >C16-C34 (F3)	mg/kg	90	-	-	-	-
TRH >C34-C40 (F4)	mg/kg	120	-	-	-	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018						
Naphthalene	mg/kg	0.1	-	-	-	-
2-methylnaphthalene	mg/kg	0.1	-	-	-	-
1-methylnaphthalene	mg/kg	0.1	-	-	-	-
Acenaphthylene	mg/kg	0.1	-	-	-	-
Acenaphthene	mg/kg	0.1	-	-	-	-
Fluorene	mg/kg	0.1	-	-	-	-
Phenanthrene	mg/kg	0.1	-	-	-	-
Anthracene	mg/kg	0.1	-	-	-	-
Fluoranthene	mg/kg	0.1	-	-	-	-
Pyrene	mg/kg	0.1	-	-	-	-
Benzo(a)anthracene	mg/kg	0.1	-	-	-	-
Chrysene	mg/kg	0.1	-	-	-	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(k)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(a)pyrene	mg/kg	0.1	-	-	-	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-	-	-	-
Dibenzo(ah)anthracene	mg/kg	0.1	-	-	-	-
Benzo(ghi)perylene	mg/kg	0.1	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-	-	-	-
Total PAH (18)	mg/kg	0.8	-	-	-	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-	-	-	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	-	-	-	-
2-fluorobiphenyl (Surrogate)	%	-	-	-	-	-
d14-p-terphenyl (Surrogate)	%	-	-	-	-	-
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	-	-	-	-
Alpha BHC	mg/kg	0.1	-	-	-	-
Lindane	mg/kg	0.1	-	-	-	-
Heptachlor	mg/kg	0.1	-	-	-	-
Aldrin	mg/kg	0.1	-	-	-	-
Beta BHC	mg/kg	0.1	-	-	-	-
Delta BHC	mg/kg	0.1	-	-	-	-
Heptachlor epoxide	mg/kg	0.1	-	-	-	-
o,p'-DDE	mg/kg	0.1	-	-	-	-
Alpha Endosulfan	mg/kg	0.2	-	-	-	-
Gamma Chlordane	mg/kg	0.1	-	-	-	-
Alpha Chlordane	mg/kg	0.1	-	-	-	-
trans-Nonachlor	mg/kg	0.1	-	-	-	-
p,p'-DDE	mg/kg	0.1	-	-	-	-
Dieldrin	mg/kg	0.2	-	-	-	-
Endrin	mg/kg	0.2	-	-	-	-

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.013 Material 09 Apr 2018 SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	-	-	-	-
o,p'-DDT	mg/kg	0.1	-	-	-	-
Beta Endosulfan	mg/kg	0.2	-	-	-	-
p,p'-DDD	mg/kg	0.1	-	-	-	-
p,p'-DDT	mg/kg	0.1	-	-	-	-
Endosulfan sulphate	mg/kg	0.1	-	-	-	-
Endrin Aldehyde	mg/kg	0.1	-	-	-	-
Methoxychlor	mg/kg	0.1	-	-	-	-
Endrin Ketone	mg/kg	0.1	-	-	-	-
Isodrin	mg/kg	0.1	-	-	-	-
Mirex	mg/kg	0.1	-	-	-	-
Total CLP OC Pesticides	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
PCBs in Soil Method: AN420 Tested: 13/4/2018						
Arochlor 1016	mg/kg	0.2	-	-	-	-
Arochlor 1221	mg/kg	0.2	-	-	-	-
Arochlor 1232	mg/kg	0.2	-	-	-	-
Arochlor 1242	mg/kg	0.2	-	-	-	-
Arochlor 1248	mg/kg	0.2	-	-	-	-
Arochlor 1254	mg/kg	0.2	-	-	-	-
Arochlor 1260	mg/kg	0.2	-	-	-	-
Arochlor 1262	mg/kg	0.2	-	-	-	-
Arochlor 1268	mg/kg	0.2	-	-	-	-
Total PCBs (Arochlors)	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 13/4/2018						
Arsenic, As	mg/kg	3	-	-	-	-
Cadmium, Cd	mg/kg	0.3	-	-	-	-
Chromium, Cr	mg/kg	0.3	-	-	-	-
Copper, Cu	mg/kg	0.5	-	-	-	-
Nickel, Ni	mg/kg	0.5	-	-	-	-
Lead, Pb	mg/kg	1	-	-	-	-
Zinc, Zn	mg/kg	0.5	-	-	-	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
VOC's in Soil Method: AN433 Tested: 13/4/2018			
Monocyclic Aromatic Hydrocarbons			
Benzene	mg/kg	0.1	-
Toluene	mg/kg	0.1	-
Ethylbenzene	mg/kg	0.1	-
m/p-xylene	mg/kg	0.2	-
o-xylene	mg/kg	0.1	-
Polycyclic VOCs			
Naphthalene	mg/kg	0.1	-
Surrogates			
Dibromofluoromethane (Surrogate)	%	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-
d8-toluene (Surrogate)	%	-	-
Bromofluorobenzene (Surrogate)	%	-	-
Totals			
Total Xylenes	mg/kg	0.3	-
Total BTEX	mg/kg	0.6	-
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 13/4/2018			
TRH C6-C10	mg/kg	25	-
TRH C6-C9	mg/kg	20	-
Surrogates			
Dibromofluoromethane (Surrogate)	%	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-
d8-toluene (Surrogate)	%	-	-
Bromofluorobenzene (Surrogate)	%	-	-

Parameter	Units	LOR	Sample Number SE177801.017 Sample Matrix Soil Sample Date 09 Apr 2018 Sample Name DUP01
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 13/4/2018 (continued)			
VPH F Bands			
Benzene (F0)	mg/kg	0.1	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-
TRH (Total Recoverable Hydrocarbons) in Soil Method: AN403 Tested: 13/4/2018			
TRH C10-C14	mg/kg	20	-
TRH C15-C28	mg/kg	45	-
TRH C29-C36	mg/kg	45	-
TRH C37-C40	mg/kg	100	-
TRH C10-C36 Total	mg/kg	110	-
TRH C10-C40 Total (F bands)	mg/kg	210	-
TRH F Bands			
TRH >C10-C16	mg/kg	25	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-
TRH >C16-C34 (F3)	mg/kg	90	-
TRH >C34-C40 (F4)	mg/kg	120	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018			
Naphthalene	mg/kg	0.1	-
2-methylnaphthalene	mg/kg	0.1	-
1-methylnaphthalene	mg/kg	0.1	-
Acenaphthylene	mg/kg	0.1	-
Acenaphthene	mg/kg	0.1	-
Fluorene	mg/kg	0.1	-
Phenanthrene	mg/kg	0.1	-
Anthracene	mg/kg	0.1	-
Fluoranthene	mg/kg	0.1	-
Pyrene	mg/kg	0.1	-
Benzo(a)anthracene	mg/kg	0.1	-
Chrysene	mg/kg	0.1	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-
Benzo(k)fluoranthene	mg/kg	0.1	-
Benzo(a)pyrene	mg/kg	0.1	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-
Dibenzo(ah)anthracene	mg/kg	0.1	-
Benzo(ghi)perylene	mg/kg	0.1	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-
Total PAH (18)	mg/kg	0.8	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018 (continued)			
Surrogates			
d5-nitrobenzene (Surrogate)	%	-	-
2-fluorobiphenyl (Surrogate)	%	-	-
d14-p-terphenyl (Surrogate)	%	-	-
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018			
Hexachlorobenzene (HCB)	mg/kg	0.1	-
Alpha BHC	mg/kg	0.1	-
Lindane	mg/kg	0.1	-
Heptachlor	mg/kg	0.1	-
Aldrin	mg/kg	0.1	-
Beta BHC	mg/kg	0.1	-
Delta BHC	mg/kg	0.1	-
Heptachlor epoxide	mg/kg	0.1	-
o,p'-DDE	mg/kg	0.1	-
Alpha Endosulfan	mg/kg	0.2	-
Gamma Chlordane	mg/kg	0.1	-
Alpha Chlordane	mg/kg	0.1	-
trans-Nonachlor	mg/kg	0.1	-
p,p'-DDE	mg/kg	0.1	-
Dieldrin	mg/kg	0.2	-
Endrin	mg/kg	0.2	-
o,p'-DDD	mg/kg	0.1	-
o,p'-DDT	mg/kg	0.1	-
Beta Endosulfan	mg/kg	0.2	-
p,p'-DDD	mg/kg	0.1	-
p,p'-DDT	mg/kg	0.1	-
Endosulfan sulphate	mg/kg	0.1	-
Endrin Aldehyde	mg/kg	0.1	-
Methoxychlor	mg/kg	0.1	-
Endrin Ketone	mg/kg	0.1	-
Isodrin	mg/kg	0.1	-
Mirex	mg/kg	0.1	-
Total CLP OC Pesticides	mg/kg	1	-
Surrogates			
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
PCBs in Soil Method: AN420 Tested: 13/4/2018			
Arochlor 1016	mg/kg	0.2	-
Arochlor 1221	mg/kg	0.2	-
Arochlor 1232	mg/kg	0.2	-
Arochlor 1242	mg/kg	0.2	-
Arochlor 1248	mg/kg	0.2	-
Arochlor 1254	mg/kg	0.2	-
Arochlor 1260	mg/kg	0.2	-
Arochlor 1262	mg/kg	0.2	-
Arochlor 1268	mg/kg	0.2	-
Total PCBs (Arochlors)	mg/kg	1	-
Surrogates			
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018			
Arsenic, As	mg/kg	3	**4**
Cadmium, Cd	mg/kg	0.3	<0.3
Chromium, Cr	mg/kg	0.3	**13**
Copper, Cu	mg/kg	0.5	**22**
Nickel, Ni	mg/kg	0.5	**4.2**
Lead, Pb	mg/kg	1	**15**
Zinc, Zn	mg/kg	0.5	**28**
Mercury in Soil Method: AN312 Tested: 12/4/2018			
Mercury	mg/kg	0.05	<0.05

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
Moisture Content Method: AN002 Tested: 12/4/2018			
% Moisture	%w/w	0.5	**8.8**

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

Mercury in Soil **Method: ME-(AU)-[ENV]AN312**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Mercury	LB145441	mg/kg	0.05	<0.05	0%	106%	95%

Moisture Content **Method: ME-(AU)-[ENV]AN002**

Parameter	QC Reference	Units	LOR	DUP %RPD
% Moisture	LB145459	%w/w	0.5	0%

OC Pesticides in Soil **Method: ME-(AU)-[ENV]AN420**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Hexachlorobenzene (HCB)	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha BHC	LB145485	mg/kg	0.1	<0.1	0%	NA
Lindane	LB145485	mg/kg	0.1	<0.1	0%	NA
Heptachlor	LB145485	mg/kg	0.1	<0.1	0%	97%
Aldrin	LB145485	mg/kg	0.1	<0.1	0%	94%
Beta BHC	LB145485	mg/kg	0.1	<0.1	0%	NA
Delta BHC	LB145485	mg/kg	0.1	<0.1	0%	90%
Heptachlor epoxide	LB145485	mg/kg	0.1	<0.1	0%	NA
o,p'-DDE	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha Endosulfan	LB145485	mg/kg	0.2	<0.2	0%	NA
Gamma Chlordane	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha Chlordane	LB145485	mg/kg	0.1	<0.1	0%	NA
trans-Nonachlor	LB145485	mg/kg	0.1	<0.1	0%	NA
p,p'-DDE	LB145485	mg/kg	0.1	<0.1	0%	NA
Dieldrin	LB145485	mg/kg	0.2	<0.2	0%	93%
Endrin	LB145485	mg/kg	0.2	<0.2	0%	95%
o,p'-DDD	LB145485	mg/kg	0.1	<0.1	0%	NA
o,p'-DDT	LB145485	mg/kg	0.1	<0.1	0%	NA
Beta Endosulfan	LB145485	mg/kg	0.2	<0.2	0%	NA
p,p'-DDD	LB145485	mg/kg	0.1	<0.1	0%	NA
p,p'-DDT	LB145485	mg/kg	0.1	<0.1	0%	89%
Endosulfan sulphate	LB145485	mg/kg	0.1	<0.1	0%	NA
Endrin Aldehyde	LB145485	mg/kg	0.1	<0.1	0%	NA
Methoxychlor	LB145485	mg/kg	0.1	<0.1	0%	NA
Endrin Ketone	LB145485	mg/kg	0.1	<0.1	0%	NA
Isodrin	LB145485	mg/kg	0.1	<0.1	0%	NA
Mirex	LB145485	mg/kg	0.1	<0.1	0%	NA
Total CLP OC Pesticides	LB145485	mg/kg	1	<1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Tetrachloro-m-xylene (TCMX) (Surrogate)	LB145485	%	-	107%	14%	95%

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil **Method: ME-(AU)-[ENV]AN420**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Naphthalene	LB145485	mg/kg	0.1	<0.1	0%	103%
2-methylnaphthalene	LB145485	mg/kg	0.1	<0.1	0%	NA
1-methylnaphthalene	LB145485	mg/kg	0.1	<0.1	0%	NA
Acenaphthylene	LB145485	mg/kg	0.1	<0.1	0%	96%
Acenaphthene	LB145485	mg/kg	0.1	<0.1	0%	107%
Fluorene	LB145485	mg/kg	0.1	<0.1	0%	NA
Phenanthrene	LB145485	mg/kg	0.1	<0.1	0%	104%
Anthracene	LB145485	mg/kg	0.1	<0.1	0%	101%
Fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	104%
Pyrene	LB145485	mg/kg	0.1	<0.1	0%	101%
Benzo(a)anthracene	LB145485	mg/kg	0.1	<0.1	0%	NA
Chrysene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(b&j)fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(k)fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(a)pyrene	LB145485	mg/kg	0.1	<0.1	0%	112%
Indeno(1,2,3-cd)pyrene	LB145485	mg/kg	0.1	<0.1	0%	NA
Dibenzo(ah)anthracene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(ghi)perylene	LB145485	mg/kg	0.1	<0.1	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=0	LB145485	TEQ (mg/kg)	0.2	<0.2	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR	LB145485	TEQ (mg/kg)	0.3	<0.3	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	LB145485	TEQ (mg/kg)	0.2	<0.2	0%	NA
Total PAH (18)	LB145485	mg/kg	0.8	<0.8	0%	NA
Total PAH (NEPM/WHO 16)	LB145485	mg/kg	0.8	<0.8		

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
d5-nitrobenzene (Surrogate)	LB145485	%	-	86%	0%	96%
2-fluorobiphenyl (Surrogate)	LB145485	%	-	92%	4%	88%
d14-p-terphenyl (Surrogate)	LB145485	%	-	100%	0%	86%

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

PCBs in Soil Method: ME-(AU)-[ENV]AN420

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Arochlor 1016	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1221	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1232	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1242	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1248	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1254	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1260	LB145485	mg/kg	0.2	<0.2	0%	105%
Arochlor 1262	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1268	LB145485	mg/kg	0.2	<0.2	0%	NA
Total PCBs (Arochlors)	LB145485	mg/kg	1	<1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Tetrachloro-m-xylene (TCMX) (Surrogate)	LB145485	%	-	97%	14%	92%

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: ME-(AU)-[ENV]AN040/AN320

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Arsenic, As	LB145473	mg/kg	3	<3	26 - 61%	111%	100%
Cadmium, Cd	LB145473	mg/kg	0.3	<0.3	0 - 18%	112%	111%
Chromium, Cr	LB145473	mg/kg	0.3	<0.3	1 - 14%	100%	101%
Copper, Cu	LB145473	mg/kg	0.5	<0.5	3 - 51%	111%	109%
Nickel, Ni	LB145473	mg/kg	0.5	<0.5	10 - 12%	106%	107%
Lead, Pb	LB145473	mg/kg	1	<1	5 - 13%	103%	5%
Zinc, Zn	LB145473	mg/kg	0.5	<0.5	8 - 23%	108%	34%

TRH (Total Recoverable Hydrocarbons) in Soil Method: ME-(AU)-[ENV]AN403

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH C10-C14	LB145485	mg/kg	20	<20	0%	88%	120%
TRH C15-C28	LB145485	mg/kg	45	<45	0%	100%	113%
TRH C29-C36	LB145485	mg/kg	45	<45	0%	75%	113%
TRH C37-C40	LB145485	mg/kg	100	<100	0%	NA	NA
TRH C10-C36 Total	LB145485	mg/kg	110	<110	0%	NA	NA
TRH C10-C40 Total (F bands)	LB145485	mg/kg	210	<210	0%	NA	NA

TRH F Bands

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH >C10-C16	LB145485	mg/kg	25	<25	0%	75%	120%
TRH >C10-C16 - Naphthalene (F2)	LB145485	mg/kg	25	<25	0%	NA	NA
TRH >C16-C34 (F3)	LB145485	mg/kg	90	<90	0%	78%	98%
TRH >C34-C40 (F4)	LB145485	mg/kg	120	<120	0%	90%	NA

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

VOC's in Soil Method: ME-(AU)-[ENV]AN433

Monocyclic Aromatic Hydrocarbons

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Benzene	LB145431	mg/kg	0.1	<0.1	0%	96%
Toluene	LB145431	mg/kg	0.1	<0.1	0%	113%
Ethylbenzene	LB145431	mg/kg	0.1	<0.1	0%	113%
m/p-xylene	LB145431	mg/kg	0.2	<0.2	0%	122%
o-xylene	LB145431	mg/kg	0.1	<0.1	0%	112%

Polycyclic VOCs

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Naphthalene	LB145431	mg/kg	0.1	<0.1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Dibromofluoromethane (Surrogate)	LB145431	%	-	104%	5 - 15%	85%
d4-1,2-dichloroethane (Surrogate)	LB145431	%	-	111%	14 - 15%	85%
d8-toluene (Surrogate)	LB145431	%	-	110%	1 - 7%	93%
Bromofluorobenzene (Surrogate)	LB145431	%	-	104%	3 - 6%	105%

Totals

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Total Xylenes	LB145431	mg/kg	0.3	<0.3	0%	NA
Total BTEX	LB145431	mg/kg	0.6	<0.6	0%	NA

Volatile Petroleum Hydrocarbons in Soil Method: ME-(AU)-[ENV]AN433

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH C6-C10	LB145431	mg/kg	25	<25	0%	82%	87%
TRH C6-C9	LB145431	mg/kg	20	<20	0%	78%	80%

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Dibromofluoromethane (Surrogate)	LB145431	%	-	101%	5 - 15%	80%	85%
d4-1,2-dichloroethane (Surrogate)	LB145431	%	-	110%	14 - 15%	79%	85%
d8-toluene (Surrogate)	LB145431	%	-	109%	1 - 7%	80%	108%
Bromofluorobenzene (Surrogate)	LB145431	%	-	88%	3 - 6%	96%	80%

VPH F Bands

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Benzene (F0)	LB145431	mg/kg	0.1	<0.1	0%	NA	NA
TRH C6-C10 minus BTEX (F1)	LB145431	mg/kg	25	<25	0%	92%	120%

METHOD SUMMARY

METHOD	METHODOLOGY SUMMARY
AN002	The test is carried out by drying (at either 40°C or 105°C) a known mass of sample in a weighed evaporating basin. After fully dry the sample is re-weighed. Samples such as sludge and sediment having high percentages of moisture will take some time in a drying oven for complete removal of water.
AN040	A portion of sample is digested with Nitric acid to decompose organic matter and Hydrochloric acid to complete the digestion of metals and then filtered for analysis by ASS or ICP as per USEPA Method 200.8.
AN040/AN320	A portion of sample is digested with nitric acid to decompose organic matter and hydrochloric acid to complete the digestion of metals. The digest is then analysed by ICP OES with metals results reported on the dried sample basis. Based on USEPA method 200.8 and 6010C.
AN312	Mercury by Cold Vapour AAS in Soils: After digestion with nitric acid, hydrogen peroxide and hydrochloric acid, mercury ions are reduced by stannous chloride reagent in acidic solution to elemental mercury. This mercury vapour is purged by nitrogen into a cold cell in an atomic absorption spectrometer or mercury analyser. Quantification is made by comparing absorbances to those of the calibration standards. Reference APHA 3112/3500
AN403	Total Recoverable Hydrocarbons: Determination of Hydrocarbons by gas chromatography after a solvent extraction. Detection is by flame ionisation detector (FID) that produces an electronic signal in proportion to the combustible matter passing through it. Total Recoverable Hydrocarbons (TRH) are routinely reported as four alkane groupings based on the carbon chain length of the compounds: C6-C9, C10-C14, C15-C28 and C29-C36 and in recognition of the NEPM 1999 (2013), >C10-C16 (F2), >C16-C34 (F3) and >C34-C40 (F4). F2 is reported directly and also corrected by subtracting Naphthalene (from VOC method AN433) where available.
AN403	Additionally, the volatile C6-C9 fraction may be determined by a purge and trap technique and GC/MS because of the potential for volatiles loss. Total Petroleum Hydrocarbons (TPH) follows the same method of analysis after silica gel cleanup of the solvent extract. Aliphatic/Aromatic Speciation follows the same method of analysis after fractionation of the solvent extract over silica with differential polarity of the eluent solvents .
AN403	The GC/FID method is not well suited to the analysis of refined high boiling point materials (ie lubricating oils or greases) but is particularly suited for measuring diesel, kerosene and petrol if care to control volatility is taken. This method will detect naturally occurring hydrocarbons, lipids, animal fats, phenols and PAHs if they are present at sufficient levels, dependent on the use of specific cleanup/fractionation techniques. Reference USEPA 3510B, 8015B.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN420	SVOC Compounds: Semi-Volatile Organic Compounds (SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN433	VOCs and C6-C9 Hydrocarbons by GC-MS P&T: VOC`s are volatile organic compounds. The sample is presented to a gas chromatograph via a purge and trap (P&T) concentrator and autosampler and is detected with a Mass Spectrometer (MSD). Solid samples are initially extracted with methanol whilst liquid samples are processed directly. References: USEPA 5030B, 8020A, 8260.

FOOTNOTES

IS	Insufficient sample for analysis.	LOR	Limit of Reporting
LNR	Sample listed, but not received.	↑↓	Raised or Lowered Limit of Reporting
*	NATA accreditation does not cover the performance of this service.	QFH	QC result is above the upper tolerance
		QFL	QC result is below the lower tolerance
**	Indicative data, theoretical holding time exceeded.	-	The sample was not analysed for this analyte
		NVL	Not Validated

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calcuated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the " Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

STATEMENT OF QA/QC PERFORMANCE

SE177801 R1

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801 R1**
Date Received	10 Apr 2018
Date Reported	17 Apr 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met with the exception of the following:

Duplicate	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	2 items
Matrix Spike	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	2 items

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	8 Soil, 9 Material
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Three Days		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE177801 R1

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
DUP01	SE177801.017	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018

Moisture Content

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP01/02	SE177801.002	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP01/03	SE177801.003	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/01	SE177801.004	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/02	SE177801.005	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/03	SE177801.007	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
DUP01	SE177801.017	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	17 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP01/02	SE177801.002	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP01/03	SE177801.003	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/01	SE177801.004	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/02	SE177801.005	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/03	SE177801.007	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
DUP01	SE177801.017	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE177801 R1

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS “Field Sampling Guide for Containers and Holding Time” (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	105
	SP01/02	SE177801.002	%	60 - 130%	105
	SP01/03	SE177801.003	%	60 - 130%	89
	SP02/01	SE177801.004	%	60 - 130%	98
	SP02/02	SE177801.005	%	60 - 130%	104
	SP02/03	SE177801.007	%	60 - 130%	70

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	96
	SP01/02	SE177801.002	%	70 - 130%	104
	SP01/03	SE177801.003	%	70 - 130%	102
	SP02/01	SE177801.004	%	70 - 130%	104
	SP02/02	SE177801.005	%	70 - 130%	106
	SP02/03	SE177801.007	%	70 - 130%	86
d14-p-terphenyl (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	108
	SP01/02	SE177801.002	%	70 - 130%	114
	SP01/03	SE177801.003	%	70 - 130%	114
	SP02/01	SE177801.004	%	70 - 130%	114
	SP02/02	SE177801.005	%	70 - 130%	114
	SP02/03	SE177801.007	%	70 - 130%	98
d5-nitrobenzene (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	78
	SP01/02	SE177801.002	%	70 - 130%	74
	SP01/03	SE177801.003	%	70 - 130%	74
	SP02/01	SE177801.004	%	70 - 130%	72
	SP02/02	SE177801.005	%	70 - 130%	78
	SP02/03	SE177801.007	%	70 - 130%	76

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	105
	SP01/02	SE177801.002	%	60 - 130%	105
	SP01/03	SE177801.003	%	60 - 130%	89
	SP02/01	SE177801.004	%	60 - 130%	98
	SP02/02	SE177801.005	%	60 - 130%	104
	SP02/03	SE177801.007	%	60 - 130%	70

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	76
	SP01/02	SE177801.002	%	60 - 130%	82
	SP01/03	SE177801.003	%	60 - 130%	82
	SP02/01	SE177801.004	%	60 - 130%	72
	SP02/02	SE177801.005	%	60 - 130%	73
	SP02/03	SE177801.007	%	60 - 130%	79
d4-1,2-dichloroethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	110
	SP01/02	SE177801.002	%	60 - 130%	108
	SP01/03	SE177801.003	%	60 - 130%	118
	SP02/01	SE177801.004	%	60 - 130%	115
	SP02/02	SE177801.005	%	60 - 130%	103
	SP02/03	SE177801.007	%	60 - 130%	103
d8-toluene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	126
	SP01/02	SE177801.002	%	60 - 130%	118
	SP01/03	SE177801.003	%	60 - 130%	114
	SP02/01	SE177801.004	%	60 - 130%	109
	SP02/02	SE177801.005	%	60 - 130%	115
	SP02/03	SE177801.007	%	60 - 130%	116
Dibromofluoromethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	89
	SP01/02	SE177801.002	%	60 - 130%	81
	SP01/03	SE177801.003	%	60 - 130%	73
	SP02/01	SE177801.004	%	60 - 130%	86
	SP02/02	SE177801.005	%	60 - 130%	83

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil (continued) — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Dibromofluoromethane (Surrogate)	SP02/03	SE177801.007	%	60 - 130%	72

Volatile Petroleum Hydrocarbons in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	76
	SP01/02	SE177801.002	%	60 - 130%	82
	SP01/03	SE177801.003	%	60 - 130%	82
	SP02/01	SE177801.004	%	60 - 130%	72
	SP02/02	SE177801.005	%	60 - 130%	73
	SP02/03	SE177801.007	%	60 - 130%	79
d4-1,2-dichloroethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	110
	SP01/02	SE177801.002	%	60 - 130%	108
	SP01/03	SE177801.003	%	60 - 130%	118
	SP02/01	SE177801.004	%	60 - 130%	115
	SP02/02	SE177801.005	%	60 - 130%	103
	SP02/03	SE177801.007	%	60 - 130%	103
d8-toluene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	126
	SP01/02	SE177801.002	%	60 - 130%	118
	SP01/03	SE177801.003	%	60 - 130%	114
	SP02/01	SE177801.004	%	60 - 130%	109
	SP02/02	SE177801.005	%	60 - 130%	115
	SP02/03	SE177801.007	%	60 - 130%	116
Dibromofluoromethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	89
	SP01/02	SE177801.002	%	60 - 130%	81
	SP01/03	SE177801.003	%	60 - 130%	73
	SP02/01	SE177801.004	%	60 - 130%	86
	SP02/02	SE177801.005	%	60 - 130%	83
	SP02/03	SE177801.007	%	60 - 130%	72

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result
LB145441.001	Mercury	mg/kg	0.05	<0.05

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1
		Alpha BHC	mg/kg	0.1	<0.1
		Lindane	mg/kg	0.1	<0.1
		Heptachlor	mg/kg	0.1	<0.1
		Aldrin	mg/kg	0.1	<0.1
		Beta BHC	mg/kg	0.1	<0.1
		Delta BHC	mg/kg	0.1	<0.1
		Heptachlor epoxide	mg/kg	0.1	<0.1
		Alpha Endosulfan	mg/kg	0.2	<0.2
		Gamma Chlordane	mg/kg	0.1	<0.1
		Alpha Chlordane	mg/kg	0.1	<0.1
		p,p'-DDE	mg/kg	0.1	<0.1
		Dieldrin	mg/kg	0.2	<0.2
		Endrin	mg/kg	0.2	<0.2
		Beta Endosulfan	mg/kg	0.2	<0.2
		p,p'-DDD	mg/kg	0.1	<0.1
		p,p'-DDT	mg/kg	0.1	<0.1
		Endosulfan sulphate	mg/kg	0.1	<0.1
		Endrin Aldehyde	mg/kg	0.1	<0.1
		Methoxychlor	mg/kg	0.1	<0.1
		Endrin Ketone	mg/kg	0.1	<0.1
		Isodrin	mg/kg	0.1	<0.1
		Mirex	mg/kg	0.1	<0.1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	107

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Naphthalene	mg/kg	0.1	<0.1
		2-methylnaphthalene	mg/kg	0.1	<0.1
		1-methylnaphthalene	mg/kg	0.1	<0.1
		Acenaphthylene	mg/kg	0.1	<0.1
		Acenaphthene	mg/kg	0.1	<0.1
		Fluorene	mg/kg	0.1	<0.1
		Phenanthrene	mg/kg	0.1	<0.1
		Anthracene	mg/kg	0.1	<0.1
		Fluoranthene	mg/kg	0.1	<0.1
		Pyrene	mg/kg	0.1	<0.1
		Benzo(a)anthracene	mg/kg	0.1	<0.1
		Chrysene	mg/kg	0.1	<0.1
		Benzo(a)pyrene	mg/kg	0.1	<0.1
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1
		Benzo(ghi)perylene	mg/kg	0.1	<0.1
		Total PAH (18)	mg/kg	0.8	<0.8
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	86
		2-fluorobiphenyl (Surrogate)	%	-	92
		d14-p-terphenyl (Surrogate)	%	-	100

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result
LB145485.001	Arochlor 1016	mg/kg	0.2	<0.2
	Arochlor 1221	mg/kg	0.2	<0.2
	Arochlor 1232	mg/kg	0.2	<0.2
	Arochlor 1242	mg/kg	0.2	<0.2
	Arochlor 1248	mg/kg	0.2	<0.2
	Arochlor 1254	mg/kg	0.2	<0.2

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PCBs in Soil (continued) — Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Arochlor 1260	mg/kg	0.2	<0.2
		Arochlor 1262	mg/kg	0.2	<0.2
		Arochlor 1268	mg/kg	0.2	<0.2
		Total PCBs (Arochlors)	mg/kg	1	<1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	97

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES — Method: ME-(AU)-[ENV]AN040/AN320

Sample Number		Parameter	Units	LOR	Result
LB145473.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5

TRH (Total Recoverable Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result
LB145485.001		TRH C10-C14	mg/kg	20	<20
		TRH C15-C28	mg/kg	45	<45
		TRH C29-C36	mg/kg	45	<45
		TRH C37-C40	mg/kg	100	<100
		TRH C10-C36 Total	mg/kg	110	<110

VOC's in Soil — Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB145431.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	104
		d4-1,2-dichloroethane (Surrogate)	%	-	111
		d8-toluene (Surrogate)	%	-	110
		Bromofluorobenzene (Surrogate)	%	-	104
	Totals	Total BTEX	mg/kg	0.6	<0.6

Volatile Petroleum Hydrocarbons in Soil — Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB145431.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	101
		d4-1,2-dichloroethane (Surrogate)	%	-	110
		d8-toluene (Surrogate)	%	-	109

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177640.004	LB145441.024	Mercury	mg/kg	0.05	<0.05	<0.05	200	0
SE177801.002	LB145441.014	Mercury	mg/kg	0.05	<0.05	<0.05	200	0

Moisture Content

Method: ME-(AU)-[ENV]AN002

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177693.004	LB145459.022	% Moisture	%w/w	0.5	2.2	2.2	75	0
SE177801.001	LB145459.033	% Moisture	%w/w	0.5	10	10	40	0
SE177801.017	LB145459.040	% Moisture	%w/w	0.5	8.8	8.8	41	0

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014	Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Lindane	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor	mg/kg	0.1	<0.1	<0.1	200	0
		Aldrin	mg/kg	0.1	<0.1	<0.1	200	0
		Beta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Delta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Dieldrin	mg/kg	0.2	<0.2	<0.2	200	0
		Endrin	mg/kg	0.2	<0.2	<0.2	200	0
		o,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		p,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	200	0
		Methoxychlor	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Ketone	mg/kg	0.1	<0.1	<0.1	200	0
		Isodrin	mg/kg	0.1	<0.1	<0.1	200	0
		Mirex	mg/kg	0.1	<0.1	<0.1	200	0
		Total CLP OC Pesticides	mg/kg	1	<1	<1	200	0
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.15	0.17	30	14

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Acenaphthylene	mg/kg	0.1	<0.1	<0.1	200	0
		Acenaphthene	mg/kg	0.1	<0.1	<0.1	200	0
		Fluorene	mg/kg	0.1	<0.1	<0.1	200	0
		Phenanthrene	mg/kg	0.1	<0.1	<0.1	200	0
		Anthracene	mg/kg	0.1	<0.1	<0.1	200	0
		Fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	197	0
		Chrysene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	200	0

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	134	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	175	0
			Total PAH (18)	mg/kg	0.8	<0.8	<0.8	200	0
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.4	30	0
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	0.5	30	4
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.6	0.6	30	0

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		Arochlor 1016	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1221	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1232	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1242	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1248	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1254	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1260	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1262	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1268	mg/kg	0.2	<0.2	<0.2	200	0
			Total PCBs (Arochlors)	mg/kg	1	<1	<1	200	0
		Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0	0	30	14

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177662.015	LB145473.014		Arsenic, As	mg/kg	3	13	7	40	61 ②
			Cadmium, Cd	mg/kg	0.3	0.4	<0.3	134	18
			Chromium, Cr	mg/kg	0.3	13	12	34	14
			Copper, Cu	mg/kg	0.5	67	40	31	51 ②
			Nickel, Ni	mg/kg	0.5	4.7	5.3	40	12
			Lead, Pb	mg/kg	1	16	14	36	13
			Zinc, Zn	mg/kg	0.5	26	21	38	23
SE177801.017	LB145473.024		Arsenic, As	mg/kg	3	4	5	51	26
			Cadmium, Cd	mg/kg	0.3	<0.3	<0.3	200	0
			Chromium, Cr	mg/kg	0.3	13	12	34	1
			Copper, Cu	mg/kg	0.5	22	22	32	3
			Nickel, Ni	mg/kg	0.5	4.2	4.7	41	10
			Lead, Pb	mg/kg	1	15	15	37	5
			Zinc, Zn	mg/kg	0.5	28	26	37	8

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		TRH C10-C14	mg/kg	20	<20	<20	200	0
			TRH C15-C28	mg/kg	45	<45	<45	200	0
			TRH C29-C36	mg/kg	45	<45	<45	200	0
			TRH C37-C40	mg/kg	100	<100	<100	200	0
			TRH C10-C36 Total	mg/kg	110	<110	<110	200	0
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	<210	200	0
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	<25	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	200	0
			TRH >C16-C34 (F3)	mg/kg	90	<90	<90	200	0
			TRH >C34-C40 (F4)	mg/kg	120	<120	<120	200	0

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.3	50	5
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.9	50	15

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil (continued)

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014	Surrogates	d8-toluene (Surrogate)	mg/kg	-	5.4	5.3	50	1
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.6	3.8	50	6
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE177797.001	LB145431.023	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.8	50	15
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.6	4.9	50	14
			d8-toluene (Surrogate)	mg/kg	-	6.1	5.7	50	7
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	4.1	50	3
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.3	30	5
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.9	30	15
			d8-toluene (Surrogate)	mg/kg	-	5.4	5.3	30	1
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.6	3.8	30	6
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE177797.001	LB145431.023		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.8	30	15
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.6	4.9	30	14
			d8-toluene (Surrogate)	mg/kg	-	6.1	5.7	30	7
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	4.1	30	3
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145441.002	Mercury	mg/kg	0.05	0.21	0.2	70 - 130	106

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		Heptachlor	mg/kg	0.1	0.2	0.2	60 - 140	97
		Aldrin	mg/kg	0.1	0.2	0.2	60 - 140	94
		Delta BHC	mg/kg	0.1	0.2	0.2	60 - 140	90
		Dieldrin	mg/kg	0.2	<0.2	0.2	60 - 140	93
		Endrin	mg/kg	0.2	<0.2	0.2	60 - 140	95
		p,p'-DDT	mg/kg	0.1	0.2	0.2	60 - 140	89
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.14	0.15	40 - 130	95

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		Naphthalene	mg/kg	0.1	4.1	4	60 - 140	103
		Acenaphthylene	mg/kg	0.1	3.8	4	60 - 140	96
		Acenaphthene	mg/kg	0.1	4.3	4	60 - 140	107
		Phenanthrene	mg/kg	0.1	4.2	4	60 - 140	104
		Anthracene	mg/kg	0.1	4.0	4	60 - 140	101
		Fluoranthene	mg/kg	0.1	4.2	4	60 - 140	104
		Pyrene	mg/kg	0.1	4.1	4	60 - 140	101
		Benzo(a)pyrene	mg/kg	0.1	4.5	4	60 - 140	112
	Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.5	0.5	40 - 130	96
		2-fluorobiphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	88
		d14-p-terphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	86

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002	Arochlor 1260	mg/kg	0.2	0.4	0.4	60 - 140	105

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145473.002	Arsenic, As	mg/kg	3	370	336.32	79 - 120	111
	Cadmium, Cd	mg/kg	0.3	470	416.6	69 - 131	112
	Chromium, Cr	mg/kg	0.3	35	35.2	80 - 120	100
	Copper, Cu	mg/kg	0.5	410	370.46	80 - 120	111
	Nickel, Ni	mg/kg	0.5	220	210.88	79 - 120	106
	Lead, Pb	mg/kg	1	110	107.87	79 - 120	103
	Zinc, Zn	mg/kg	0.5	320	301.27	80 - 121	108

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		TRH C10-C14	mg/kg	20	35	40	60 - 140	88
		TRH C15-C28	mg/kg	45	<45	40	60 - 140	100
		TRH C29-C36	mg/kg	45	<45	40	60 - 140	75
	TRH F Bands	TRH >C10-C16	mg/kg	25	30	40	60 - 140	75
		TRH >C16-C34 (F3)	mg/kg	90	<90	40	60 - 140	78
		TRH >C34-C40 (F4)	mg/kg	120	<120	20	60 - 140	90

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145431.002	Monocyclic	Benzene	mg/kg	0.1	2.8	2.9	60 - 140	96
	Aromatic	Toluene	mg/kg	0.1	3.3	2.9	60 - 140	113
		Ethylbenzene	mg/kg	0.1	3.3	2.9	60 - 140	113
		m/p-xylene	mg/kg	0.2	7.1	5.8	60 - 140	122
		o-xylene	mg/kg	0.1	3.3	2.9	60 - 140	112
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.3	5	60 - 140	85
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.3	5	60 - 140	85
		d8-toluene (Surrogate)	mg/kg	-	4.7	5	60 - 140	93
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.2	5	60 - 140	105

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145431.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	82
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	78
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.0	5	60 - 140	80
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.0	5	60 - 140	79
		d8-toluene (Surrogate)	mg/kg	-	4.0	5	60 - 140	80
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.8	5	60 - 140	96
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	92

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177783.008	LB145441.004	Mercury	mg/kg	0.05	0.27	0.08	0.2	95

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177783.004	LB145473.004	Arsenic, As	mg/kg	3	57	7	50	100
		Cadmium, Cd	mg/kg	0.3	56	0.6	50	111
		Chromium, Cr	mg/kg	0.3	69	19	50	101
		Copper, Cu	mg/kg	0.5	110	58	50	109
		Nickel, Ni	mg/kg	0.5	64	11	50	107
		Lead, Pb	mg/kg	1	490	490	50	5 ⑤
		Zinc, Zn	mg/kg	0.5	240	220	50	34 ⑥

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177720.001	LB145485.018		TRH C10-C14	mg/kg	20	48	0	40	120
			TRH C15-C28	mg/kg	45	53	8	40	113
			TRH C29-C36	mg/kg	45	45	0	40	113
			TRH C37-C40	mg/kg	100	<100	0	-	-
			TRH C10-C36 Total	mg/kg	110	150	0	-	-
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	0	-	-
		TRH F Bands	TRH >C10-C16	mg/kg	25	48	0	40	120
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	48	0	-	-
			TRH >C16-C34 (F3)	mg/kg	90	<90	14	40	98
			TRH >C34-C40 (F4)	mg/kg	120	<120	0	-	-

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177720.001	LB145431.004		TRH C6-C10	mg/kg	25	<25	0	24.65	87
			TRH C6-C9	mg/kg	20	<20	0	23.2	80
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	4.05	-	85
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.56	-	85
			d8-toluene (Surrogate)	mg/kg	-	5.4	4.7	-	108
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	3.55	-	80
		VPH F	Benzene (F0)	mg/kg	0.1	2.0	0.02	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	-0.04	7.25	120

MATRIX SPIKE DUPLICATES

SE177801 R1

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Tue 10/4/2018
Report Due	Fri 13/4/2018
SGS Reference	**SE177801**

SUBMISSION DETAILS

This is to confirm that 17 samples were received on Tuesday 10/4/2018. Results are expected to be ready by COB Friday 13/4/2018. Please quote SGS reference SE177801 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	8 Soil, 9 Material
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Three Days		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

Results for asbestos analysis will be reported in SE177801A, on a standard TAT.
DUP01A has been forwarded to Eurofins.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) in Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
001	SP01/01	29	26	11	7	10	12	8
002	SP01/02	29	26	11	7	10	12	8
003	SP01/03	29	26	11	7	10	12	8
004	SP02/01	29	26	11	7	10	12	8
005	SP02/02	29	26	11	7	10	12	8
007	SP02/03	29	26	11	7	10	12	8
017	DUP01	-	-	-	7	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Mercury in Soil	Moisture Content
001	SP01/01	1	1
002	SP01/02	1	1
003	SP01/03	1	1
004	SP02/01	1	1
005	SP02/02	1	1
007	SP02/03	1	1
017	DUP01	1	1

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: ALX_EHS_OFFICE_X585_20180411161003.pdf page: 1 SGS Ref: SE177801_COC

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)
SP01/01	09/04/18	1		X	Ice	2	X	X	X	X	X	X	
SP01/02	09/04/18	2		X	Ice	2	X	X	X	X	X	X	
SP01/03	09/04/18	3		X	Ice	2	X	X	X	X	X	X	
SP02/01	09/04/18	4		X	Ice	2	X	X	X	X	X	X	
SP02/02	09/04/18	5		X	Ice	2	X	X	X	X	X	X	
SP02/02-FRAG	09/04/18	6	X		Ice	1							X
SP02/03	09/04/18	7		X	Ice	2	X	X	X	X	X	X	
SP03/FCS	09/04/18	8	X		Ice	1							X
SP04/FCS	09/04/18	9	X		Ice	1							X
SP05/FCS	09/04/18	10	X		Ice	1							X

SGS EHS Alexandria Laboratory
SE177801 COC
Received: 10 – Apr – 2018

Relinquished By: Craig Cowper — Date/Time: 06/03/18 @ 1300hrs — Received By: A. Odisho — Date/Time 10/4/18 @ 2:05pm
Relinquished By: — Date/Time: — Received By: — Date/Time
Samples Intact: (Yes)/ No — Temperature: Ambient / (Chilled) — Sample Cooler Sealed: Yes/ No — Laboratory Quotation No:
Comments:

Uncontrolled template when printed

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 Jordan Springs
Address:	10 Welder Road, Seven Hills NSW	Purchase Order No:	SGS – P1054 Eurofins – P1055
		Results Required By:	3 day turnaround
Contact Name:	Craig Cowper	Telephone:	0407 989 885
		Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	
SP06/FCS	09/04/18	11	X		Ice	1						X	
SP07/FCS	09/04/18	12	X		Ice	1						X	
SP08/FCS	09/04/18	13	X		Ice	1						X	
SP09/FCS	09/04/18	14	X		Ice	1						X	
SP10/FCS	09/04/18	15	X		Ice	2						X	
SP11/FCS	09/04/18	16	X		Ice	1						X	
DUP01	09/04/18	17		X	Ice	1				X			
DUP01A	09/04/18			X	Ice	1				X			
													Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 10/04/18 @ 12:00pm	Received By: A. Odisho	Date/Time 10/4/18 @ 2:05pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801A R0**
Date Received	10/4/2018
Date Reported	17/4/2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam.

SIGNATORIES

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Gravimetric Determination of Asbestos in Soil [AN605] Tested: 13/4/2018

PARAMETER	UOM	LOR	SP01/01 SOIL - 9/4/2018 SE177801A.001	SP01/02 SOIL - 9/4/2018 SE177801A.002	SP01/03 SOIL - 9/4/2018 SE177801A.003	SP02/01 SOIL - 9/4/2018 SE177801A.004	SP02/02 SOIL - 9/4/2018 SE177801A.005
Total Sample Weight*	g	1	**576**	**532**	**501**	**537**	**503**
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP02/03 SOIL - 9/4/2018 SE177801A.007
Total Sample Weight*	g	1	**426**
ACM in >7mm Sample*	g	0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Fibre ID in bulk materials [AN602] Tested: 17/4/2018

PARAMETER	UOM	LOR	SP02/02-FRAG MATERIAL - 9/4/2018 SE177801A.006	SP03/FCS MATERIAL - 9/4/2018 SE177801A.008	SP04/FCS MATERIAL - 9/4/2018 SE177801A.009	SP05/FCS MATERIAL - 9/4/2018 SE177801A.010	SP06/FCS MATERIAL - 9/4/2018 SE177801A.011
Asbestos Detected	No unit	-	Yes	Yes	Yes	Yes	Yes

PARAMETER	UOM	LOR	SP07/FCS MATERIAL - 9/4/2018 SE177801A.012	SP08/FCS MATERIAL - 9/4/2018 SE177801A.013	SP09/FCS MATERIAL - 9/4/2018 SE177801A.014	SP10/FCS MATERIAL - 9/4/2018 SE177801A.015	SP11/FCS MATERIAL - 9/4/2018 SE177801A.016
Asbestos Detected	No unit	-	Yes	Yes	Yes	Yes	Yes

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

METHOD	METHODOLOGY SUMMARY
AN602	Qualitative identification of chrysotile, amosite and crocidolite in bulk samples by polarised light microscopy (PLM) in conjunction with dispersion staining (DS). AS4964 provides the basis for this document. Unequivocal identification of the asbestos minerals present is made by obtaining sufficient diagnostic `clues`, which provide a reasonable degree of certainty, dispersion staining is a mandatory `clue` for positive identification. If sufficient `clues` are absent, then positive identification of asbestos is not possible. This procedure requires removal of suspect fibres/bundles from the sample which cannot be returned.
AN602	Fibres/material that cannot be unequivocably identified as one of the three asbestos forms, will be reported as unknown mineral fibres (umf). The fibres detected may or may not be asbestos fibres.
AN605	This technique gravimetrically determines the mass of Asbestos Containing Material retained on a 7mm Sieve and assumes that 15% of this ACM is asbestos. This calculated asbestos weight is then calculated as a percentage of the total sample weight.
AN605	This technique also gravimetrically determines the mass of Fibrous Asbestos (FA) and Asbestos Fines (AF) Containing Material retained on and passing a 2mm sieve post 7mm sieving. Assumes that FA and AF are 100% asbestos containing. This calculated asbestos weight is then calculated as a percentage of the total sample weight. This does not include free fibres which are only observed by standard trace analysis as per AN 602.
AN605	AMO = Amosite Detected CRY = Chrysotile Detected CRO = Crocidolite Detected ORG = Organic Fibres Detected SMF = Synthetic Mineral Fibres Detected UMF = Unknown Mineral Fibres Detected NAD = No Asbestos Detected
AN605	Insofar as is technically feasible, this report is consistent with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment Remediation and Management of Asbestos - Contaminated Sites in Western Australia - May 2009.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

FOOTNOTES

*	NATA accreditation does not cover the performance of this service.	-	Not analysed.	UOM	Unit of Measure.
		NVL	Not validated.	LOR	Limit of Reporting.
**	Indicative data, theoretical holding time exceeded.	IS	Insufficient sample for analysis.	↑↓	Raised/lowered Limit of Reporting.
		LNR	Sample listed, but not received.		

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calculated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the " Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/ Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	10

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801A R0**
Date Received	10 Apr 2018
Date Reported	17 Apr 2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam.

SIGNATORIES

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

RESULTS

Fibre ID in bulk materials — Method AN602

Laboratory Reference	Client Reference	Matrix	Sample Description	Date Sampled	Fibre Identification	Est.%w/w*
SE177801A.006	SP02/02-FRAG	Other	35x30x4mm Cement Sheet Fragment	09 Apr 2018	Chrysotile Asbestos Detected	
SE177801A.008	SP03/FCS	Other	80x65x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.009	SP04/FCS	Other	60x50x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.010	SP05/FCS	Other	35x20x5mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.011	SP06/FCS	Other	40x30x8mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.012	SP07/FCS	Other	50x40x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.013	SP08/FCS	Other	20x20x7mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.014	SP09/FCS	Other	90x50x8mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.015	SP10/FCS	Other	40x30x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile Asbestos Detected	
SE177801A.016	SP11/FCS	Other	65x30x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	

METHOD SUMMARY

SE177801A R0

METHOD	METHODOLOGY SUMMARY
AN602	Qualitative identification of chrysotile, amosite and crocidolite in bulk samples by polarised light microscopy (PLM) in conjunction with dispersion staining (DS). AS4964 provides the basis for this document. Unequivocal identification of the asbestos minerals present is made by obtaining sufficient diagnostic `clues`, which provide a reasonable degree of certainty, dispersion staining is a mandatory `clue` for positive identification. If sufficient `clues` are absent, then positive identification of asbestos is not possible. This procedure requires removal of suspect fibres/bundles from the sample which cannot be returned.
AN602	Fibres/material that cannot be unequivocably identified as one of the three asbestos forms, will be reported as unknown mineral fibres (umf). The fibres detected may or may not be asbestos fibres.

FOOTNOTES

Amosite	-	Brown Asbestos	NA	-	Not Analysed
Chrysotile	-	White Asbestos	LNR	-	Listed, Not Required
Crocidolite	-	Blue Asbestos	*	-	NATA accreditation does not cover the performance of this service.
Amphiboles	-	Amosite and/or Crocidolite	**	-	Indicative data, theoretical holding time exceeded.

(In reference to soil samples only) This report does not comply with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment and Remediation and Management of Asbestos Contaminated sites in Western Australia - May 2009.

Sampled by the client.

Where reported: 'Asbestos Detected': Asbestos detected by polarised light microscopy, including dispersion staining.
Where reported: 'No Asbestos Found': No Asbestos Found by polarised light microscopy, including dispersion staining.
Where reported: 'UMF Detected': Mineral fibres of unknown type detected by polarised light microscopy, including dispersion staining. Confirmation by another independent analytical technique may be necessary.

Even after disintegration it can be very difficult, or impossible, to detect the presence of asbestos in some asbestos-containing bulk materials using polarised light microscopy. This is due to the low grade or small length or diameter of asbestos fibres present in the material, or to the fact that very fine fibres have been distributed intimately throughout the materials.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801A

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Tue 10/4/2018
Report Due	Mon 16/4/2018
SGS Reference	**SE177801A**

SUBMISSION DETAILS

This is to confirm that 17 samples were received on Tuesday 10/4/2018. Results are expected to be ready by COB Monday 16/4/2018. Please quote SGS reference SE177801A when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	16 Soil
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

SAMPLE RECEIPT ADVICE

SE177801A

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs - Asbestos

SUMMARY OF ANALYSIS

No.	Sample ID	Fibre ID in bulk materials	Gravimetric Determination of Asbestos in Soil
001	SP01/01	-	9
002	SP01/02	-	9
003	SP01/03	-	9
004	SP02/01	-	9
005	SP02/02	-	9
006	SP02/02-FRAG	1	-
007	SP02/03	-	9
008	SP03/FCS	1	-
009	SP04/FCS	1	-
010	SP05/FCS	1	-
011	SP06/FCS	1	-
012	SP07/FCS	1	-
013	SP08/FCS	1	-
014	SP09/FCS	1	-
015	SP10/FCS	1	-
016	SP11/FCS	1	-

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: ALX_EHS_OFFICE_X585_20180411183516.pdf page: 5 SGS Ref: SE177801A_COC

SGS

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

CHAIN OF CUSTODY & ANALYSIS REQUEST

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)
SP01/01	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP01/02	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP01/03	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/01	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/02	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/02-FRAG	09/04/18		X		Ice	1							X
SP02/03	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP03/FCS	09/04/18		X		Ice	1							X
SP04/FCS	09/04/18		X		Ice	1							X
SP05/FCS	09/04/18		X		Ice	1							X

SGS EHS Alexandria Laboratory
SE177801A COC
Received: 10 – Apr – 2018

Relinquished By: Craig Cowper
Date/Time: 06/03/18 @ 1300hrs
Received By: A. Odisho
Date/Time 10/4/18 @ 2:05pm

Relinquished By:
Date/Time:
Received By:
Date/Time

Samples Intact: Yes/ No
Temperature: Ambient / Chilled
Sample Cooler Sealed: Yes/ No
Laboratory Quotation No:

Comments:

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)
SP06/FCS	09/04/18		X		Ice	1						X
SP07/FCS	09/04/18		X		Ice	1						X
SP08/FCS	09/04/18		X		Ice	1						X
SP09/FCS	09/04/18		X		Ice	1						X
SP10/FCS	09/04/18		X		Ice	2						X
SP11/FCS	09/04/18		X		Ice	1						X
DUP01	09/04/18			X	Ice	1				X		
DUP01A	09/04/18			X	Ice	1				X		

Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 10/04/18 @ 12:00pm	Received By: A. Odisho	Date/Time 6/4/18 @ 2:05pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

30 years Testing For Life 1987–2017
Celebrating 30 years Testing and Protecting Human Health

Certificate of Analysis

NATA Accredited
Accreditation Number 1261
Site Number 18217

Accredited for compliance with ISO/IEC 17025 – Testing
The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.

Alliance Geotechnical
10 Welder Road
Seven Hills
NSW 2147

Attention: **Craig Cowper**

Report **593593-S**
Project name JORDAN SPRINGS
Project ID 7161
Received Date Apr 12, 2018

Client Sample ID			**DUP01A**
Sample Matrix			**Soil**
Eurofins | mgt Sample No.			**S18-Ap12479**
Date Sampled			**Apr 09, 2018**
Test/Reference	LOR	Unit	
Heavy Metals			
Arsenic	2	mg/kg	7.2
Cadmium	0.4	mg/kg	< 0.4
Chromium	5	mg/kg	14
Copper	5	mg/kg	22
Lead	5	mg/kg	18
Mercury	0.1	mg/kg	< 0.1
Nickel	5	mg/kg	6.8
Zinc	5	mg/kg	27
% Moisture	1	%	11

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Sample History

Where samples are submitted/analysed over several days, the last date of extraction and analysis is reported.
A recent review of our LIMS has resulted in the correction or clarification of some method identifications. Due to this, some of the method reference information on reports has changed. However, no substantive change has been made to our laboratory methods, and as such there is no change in the validity of current or previous results (regarding both quality and NATA accreditation).

If the date and time of sampling are not provided, the Laboratory will not be responsible for compromised results should testing be performed outside the recommended holding time.

Description	Testing Site	Extracted	Holding Time
Metals M8	Sydney	Apr 13, 2018	28 Day
- Method: LTM-MET-3040 Metals in Waters, Soils & Sediments by ICP-MS			
% Moisture	Sydney	Apr 12, 2018	14 Day
- Method: LTM-GEN-7080 Moisture			

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

ABN– 50 005 085 521
e.mail : EnviroSales@eurofins.com
web : www.eurofins.com.au

Melbourne
2-5 Kingston Town Close
Oakleigh VIC 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261
Site # 23736

Company Name:	Alliance Geotechnical	**Order No.:**	P1055	**Received:**	Apr 12, 2018 2:43 PM
Address:	10 Welder Road Seven Hills NSW 2147	**Report #:**	593593	**Due:**	Apr 17, 2018
		Phone:	1800 288 188	**Priority:**	3 Day
		Fax:	02 9675 1888	**Contact Name:**	Craig Cowper
Project Name:	JORDAN SPRINGS				
Project ID:	7161				

Eurofins | mgt Analytical Services Manager : Nibha Vaidya

Sample Detail						Metals M8	Moisture Set
Melbourne Laboratory - NATA Site # 1254 & 14271							
Sydney Laboratory - NATA Site # 18217						X	X
Brisbane Laboratory - NATA Site # 20794							
Perth Laboratory - NATA Site # 23736							
External Laboratory							
No	**Sample ID**	**Sample Date**	**Sampling Time**	**Matrix**	**LAB ID**		
1	DUP01A	Apr 09, 2018		Soil	S18-Ap12479	X	X
Test Counts						1	1

Internal Quality Control Review and Glossary

General

1. Laboratory QC results for Method Blanks, Duplicates, Matrix Spikes, and Laboratory Control Samples are included in this QC report where applicable. Additional QC data may be available on request.
2. All soil results are reported on a dry basis, unless otherwise stated.
3. All biota/food results are reported on a wet weight basis on the edible portion, unless otherwise stated.
4. Actual LORs are matrix dependant. Quoted LORs may be raised where sample extracts are diluted due to interferences.
5. Results are uncorrected for matrix spikes or surrogate recoveries except for PFAS compounds.
6. SVOC analysis on waters are performed on homogenised, unfiltered samples, unless noted otherwise.
7. Samples were analysed on an 'as received' basis.
8. This report replaces any interim results previously issued.

Holding Times

Please refer to 'Sample Preservation and Container Guide' for holding times (QS3001).

For samples received on the last day of holding time, notification of testing requirements should have been received at least 6 hours prior to sample receipt deadlines as stated on the SRA.

If the Laboratory did not receive the information in the required timeframe, and regardless of any other integrity issues, suitably qualified results may still be reported.

Holding times apply from the date of sampling, therefore compliance to these may be outside the laboratory's control.

For VOCs containing vinyl chloride, styrene and 2-chloroethyl vinyl ether the holding time is 7 days however for all other VOCs such as BTEX or C6-10 TRH then the holding time is 14 days.

****NOTE:** pH duplicates are reported as a range NOT as RPD

Units

mg/kg: milligrams per kilogram

mg/L: milligrams per litre

ug/L: micrograms per litre

ppm: Parts per million

ppb: Parts per billion

%: Percentage

org/100mL: Organisms per 100 millilitres

NTU: Nephelometric Turbidity Units

MPN/100mL: Most Probable Number of organisms per 100 millilitres

Terms

Dry	Where a moisture has been determined on a solid sample the result is expressed on a dry basis.
LOR	Limit of Reporting.
SPIKE	Addition of the analyte to the sample and reported as percentage recovery.
RPD	Relative Percent Difference between two Duplicate pieces of analysis.
LCS	Laboratory Control Sample - reported as percent recovery.
CRM	Certified Reference Material - reported as percent recovery.
Method Blank	In the case of solid samples these are performed on laboratory certified clean sands and in the case of water samples these are performed on de-ionised water.
Surr - Surrogate	The addition of a like compound to the analyte target and reported as percentage recovery.
Duplicate	A second piece of analysis from the same sample and reported in the same units as the result to show comparison.
USEPA	United States Environmental Protection Agency
APHA	American Public Health Association
TCLP	Toxicity Characteristic Leaching Procedure
COC	Chain of Custody
SRA	Sample Receipt Advice
QSM	Quality Systems Manual ver 5.1 US Department of Defense
CP	Client Parent - QC was performed on samples pertaining to this report
NCP	Non-Client Parent - QC performed on samples not pertaining to this report, QC is representative of the sequence or batch that client samples were analysed within.
TEQ	Toxic Equivalency Quotient

QC - Acceptance Criteria

RPD Duplicates: Global RPD Duplicates Acceptance Criteria is 30% however the following acceptance guidelines are equally applicable:

Results <10 times the LOR : No Limit

Results between 10-20 times the LOR : RPD must lie between 0-50%

Results >20 times the LOR : RPD must lie between 0-30%

Surrogate Recoveries: Recoveries must lie between 50-150%-Phenols & PFASs

PFAS field samples that contain surrogate recoveries in excess of the QC limit designated in QSM 5.1 where no positive PFAS results have been reported have been reviewed and no data was affected.

QC Data General Comments

1. Where a result is reported as a less than (<), higher than the nominated LOR, this is due to either matrix interference, extract dilution required due to interferences or contaminant levels within the sample, high moisture content or insufficient sample provided.
2. Duplicate data shown within this report that states the word "BATCH" is a Batch Duplicate from outside of your sample batch, but within the laboratory sample batch at a 1:10 ratio. The Parent and Duplicate data shown is not data from your samples.
3. Organochlorine Pesticide analysis - where reporting LCS data, Toxaphene & Chlordane are not added to the LCS.
4. Organochlorine Pesticide analysis - where reporting Spike data, Toxaphene is not added to the Spike.
5. Total Recoverable Hydrocarbons - where reporting Spike & LCS data, a single spike of commercial Hydrocarbon products in the range of C12-C30 is added and it's Total Recovery is reported in the C10-C14 cell of the Report.
6. pH and Free Chlorine analysed in the laboratory - Analysis on this test must begin within 30 minutes of sampling.Therefore laboratory analysis is unlikely to be completed within holding time. Analysis will begin as soon as possible after sample receipt.
7. Recovery Data (Spikes & Surrogates) - where chromatographic interference does not allow the determination of Recovery the term "INT" appears against that analyte.
8. Polychlorinated Biphenyls are spiked only using Aroclor 1260 in Matrix Spikes and LCS.
9. For Matrix Spikes and LCS results a dash " -" in the report means that the specific analyte was not added to the QC sample.
10. Duplicate RPDs are calculated from raw analytical data thus it is possible to have two sets of data.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

Quality Control Results

Test	Units	Result 1			Acceptance Limits	Pass Limits	Qualifying Code
Method Blank							
Heavy Metals							
Arsenic	mg/kg	< 2			2	Pass	
Cadmium	mg/kg	< 0.4			0.4	Pass	
Chromium	mg/kg	< 5			5	Pass	
Copper	mg/kg	< 5			5	Pass	
Lead	mg/kg	< 5			5	Pass	
Mercury	mg/kg	< 0.1			0.1	Pass	
Nickel	mg/kg	< 5			5	Pass	
Zinc	mg/kg	< 5			5	Pass	
LCS - % Recovery							
Heavy Metals							
Arsenic	%	94			70-130	Pass	
Cadmium	%	101			70-130	Pass	
Chromium	%	107			70-130	Pass	
Copper	%	113			70-130	Pass	
Lead	%	96			70-130	Pass	
Mercury	%	114			70-130	Pass	
Nickel	%	115			70-130	Pass	
Zinc	%	108			70-130	Pass	

Test	Lab Sample ID	QA Source	Units	Result 1			Acceptance Limits	Pass Limits	Qualifying Code
Spike - % Recovery									
Heavy Metals				Result 1					
Arsenic	S18-Ap14616	NCP	%	96			70-130	Pass	
Cadmium	S18-Ap14616	NCP	%	95			70-130	Pass	
Chromium	S18-Ap14616	NCP	%	73			70-130	Pass	
Copper	S18-Ap14616	NCP	%	82			70-130	Pass	
Lead	S18-Ap12327	NCP	%	81			70-130	Pass	
Mercury	S18-Ap14616	NCP	%	100			70-130	Pass	
Nickel	S18-Ap14616	NCP	%	77			70-130	Pass	
Zinc	S18-Ap12327	NCP	%	111			70-130	Pass	

Test	Lab Sample ID	QA Source	Units	Result 1	Result 2	RPD	Acceptance Limits	Pass Limits	Qualifying Code
Duplicate									
Heavy Metals				Result 1	Result 2	RPD			
Arsenic	S18-Ap13016	NCP	mg/kg	7.2	6.8	5.0	30%	Pass	
Cadmium	S18-Ap13016	NCP	mg/kg	< 0.4	< 0.4	<1	30%	Pass	
Chromium	S18-Ap13016	NCP	mg/kg	12	11	4.0	30%	Pass	
Copper	S18-Ap13016	NCP	mg/kg	20	22	7.0	30%	Pass	
Lead	S18-Ap13016	NCP	mg/kg	17	17	2.0	30%	Pass	
Mercury	S18-Ap13016	NCP	mg/kg	< 0.1	< 0.1	<1	30%	Pass	
Nickel	S18-Ap13016	NCP	mg/kg	5.3	< 5	18	30%	Pass	
Zinc	S18-Ap13016	NCP	mg/kg	23	21	7.0	30%	Pass	
Duplicate									
				Result 1	Result 2	RPD			
% Moisture	S18-Ap12479	CP	%	11	9.6	11	30%	Pass	

Comments

Sample Integrity

Custody Seals Intact (if used)	N/A
Attempt to Chill was evident	Yes
Sample correctly preserved	Yes
Appropriate sample containers have been used	Yes
Sample containers for volatile analysis received with minimal headspace	Yes
Samples received within HoldingTime	Yes
Some samples have been subcontracted	No

Authorised By

Nibha Vaidya Analytical Services Manager



Glenn Jackson
National Operations Manager

Final report - this Report replaces any previously issued Report

- Indicates Not Requested

* Indicates NATA accreditation does not cover the performance of this service

Measurement uncertainty of test data is available on request or please click here.

Eurofins | mgt shall not be liable for loss, cost, damages or expenses incurred by the client, or any other person or company, resulting from the use of any information or interpretation given in this report. In no case shall Eurofins | mgt be liable for consequential damages including, but not limited to, lost profits, damages for failure to meet deadlines and lost production arising from this report. This document shall not be reproduced except in full and relates only to the items tested. Unless indicated otherwise, the tests were performed on the samples as received.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

ABN– 50 005 085 521
e.mail : EnviroSales@eurofins.com
web : www.eurofins.com.au

Melbourne
2-5 Kingston Town Close
Oakleigh VIC 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261
Site # 23736

Company Name: Alliance Geotechnical
Address: 10 Welder Road
Seven Hills
NSW 2147

Project Name: JORDAN SPRINGS
Project ID: 7161

Order No.: P1055
Report #: 593593
Phone: 1800 288 188
Fax: 02 9675 1888

Received: Apr 12, 2018 2:43 PM
Due: Apr 17, 2018
Priority: 3 Day
Contact Name: Craig Cowper

Eurofins | mgt Analytical Services Manager : Nibha Vaidya

Sample Detail						Metals M8	Moisture Set
Melbourne Laboratory - NATA Site # 1254 & 14271							
Sydney Laboratory - NATA Site # 18217						X	X
Brisbane Laboratory - NATA Site # 20794							
Perth Laboratory - NATA Site # 23736							
External Laboratory							
No	**Sample ID**	**Sample Date**	**Sampling Time**	**Matrix**	**LAB ID**		
1	DUP01A	Apr 09, 2018		Soil	S18-Ap12479	X	X
Test Counts						1	1

eurofins | mgt

Melbourne
3-5 Kingston Town Close
Oakleigh Vic 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261 Site # 23736

ABN – 50 005 085 521 e.mail : EnviroSales@eurofins.com web : www.eurofins.com.au

Sample Receipt Advice

Company name:	**Alliance Geotechnical**
Contact name:	Craig Cowper
Project name:	JORDAN SPRINGS
Project ID:	7161
COC number:	Not provided
Turn around time:	3 Day
Date/Time received:	Apr 12, 2018 2:43 PM
Eurofins | mgt reference:	**593593**

Sample information

☑ A detailed list of analytes logged into our LIMS, is included in the attached summary table.

☑ All samples have been received as described on the above COC.

☑ COC has been completed correctly.

☑ Attempt to chill was evident.

☑ Appropriately preserved sample containers have been used.

☑ All samples were received in good condition.

☑ Samples have been provided with adequate time to commence analysis in accordance with the relevant holding times.

☑ Appropriate sample containers have been used.

☒ Split sample sent to requested external lab.

☒ Some samples have been subcontracted.

N/A Custody Seals intact (if used).

Contact notes

If you have any questions with respect to these samples please contact:

Nibha Vaidya on Phone : +61 (2) 9900 8400 or by e.mail: NibhaVaidya@eurofins.com

Results will be delivered electronically via e.mail to Craig Cowper - c.cowper@allgeo.com.au.

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	
SP06/FCS	09/04/18		X		Ice	1						X	
SP07/FCS	09/04/18		X		Ice	1						X	
SP08/FCS	09/04/18		X		Ice	1						X	
SP09/FCS	09/04/18		X		Ice	1						X	
SP10/FCS	09/04/18		X		Ice	2						X	
SP11/FCS	09/04/18		X		Ice	1						X	
DUP01	09/04/18			X	Ice	1				X			
DUP01A	09/04/18			X	Ice	1				X			Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 10/04/18 @ 12:00pm	Received By: A. Odisho	Date/Time 10/4/18 @ 2:05pm
Relinquished By:	Date/Time:	Received By:	Date/Time 12/04/18 2:43pm
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No: #593593.
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical

Engineering | Environmental | Testing

Stockpile Contamination Assessment
Lot 3991 in DP1190132

Jordan Springs Boulevard, Jordan Springs, NSW

Prepared for: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust

Report Number: 7161-ER-1-4
Report Date: 17 May 2018

Manage the earth, reduce the risk

We give you the right information to make the right decisions

Alliance Geotechnical Pty Ltd
10 Welder Road, Seven Hills, NSW
Phone: 1800 288 188 – Email: enviro@allgeo.com.au - Web: www.allgeo.com.au

NOTICE: The information in this report is privileged and confidential, intended only for the use of the person nominated. This publication may not, therefore, be lent, copied, photocopied, reproduced, translated or reduced to any electronic medium or machine readable form without the express written permission of the publisher.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TABLE OF CONTENTS

EXECUTIVE SUMMARY 5
1. INTRODUCTION 7
1.1. Background 7
1.2. Objectives 7
1.3. Scope of Work 7
2. SITE IDENTIFICATION 8
3. PREVIOUS CONTAMINATION ASSESSMENTS 9
3.1. URS (2008) 9
3.2. Douglas Partners (2017) 10
3.3. AG (2018) 10
4. CONCEPTUAL SITE MODEL 12
4.1. Areas of Environmental Concern and Contaminants of Potential Concern 12
4.2. Land Use Setting 12
4.3. Direct Contact – Human Health 12
4.4. Inhalation / Vapour Intrusion – Human Health 12
4.5. Management Limits for Petroleum Hydrocarbon Compounds 12
4.6. Aesthetics – Human Health 13
5. DATA QUALITY OBJECTIVES 14
5.1. Step 1: State the problem 14
5.2. Step 2: Identify the decision/goal of the study 14
5.3. Step 3: Identify the information inputs 14
5.4. Step 4: Define the boundaries of the study 15
5.5. Step 5: Develop the analytical approach (or decision rule) 15
5.6. Step 6: Specify the performance or acceptance criteria 16
5.7. Step 7: Develop the plan for obtaining data 18
5.7.1. Sampling Point Density and Locations 18
5.7.2. Sampling Methodology 18
5.7.3. Identification, Storage and Handling of Samples 19
5.7.4. Decontamination 19
5.7.5. Laboratory Selection 19
5.7.6. Laboratory Analytical Schedule 19
5.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting 20
6. FIELDWORK 21
6.1. Service Locating 21
6.2. Soil Sampling 21
6.3. Geology 21
6.4. Odours 21
6.5. Staining 21

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

7. LABORATORY 22
8. DATA QUALITY INDICATOR ASSESSMENT 23
8.1. Completeness 23
8.2. Comparability 23
8.3. Representativeness 24
8.4. Precision 24
8.5. Accuracy 26
9. DISCUSSION 28
9.1. Human Health - Direct Contact 28
9.1.1. TRH 28
9.1.2. BTEX 28
9.1.3. PAH 28
9.1.4. OCP 28
9.1.5. PCB 28
9.1.6. Metals 28
9.1.7. Bonded Asbestos Containing Materials 28
9.1.8. Asbestos Fines and Friable Asbestos 29
9.2. Human Health – Inhalation / Vapour Intrusion (Soils) 29
9.2.1. TRH 29
9.2.2. BTEX 29
9.2.3. PAH 29
9.3. TPH Management Limits (Residential) 29
9.4. Aesthetics 29
10. CONCLUSIONS AND RECOMMENDATIONS 30
11. STATEMENT OF LIMITATIONS 31
12. REFERENCES 32

FIGURES

Figure 1 Site Location
Figure 2 Site Layout
Figure 3 Areas of Environmental Concern
Figure 4 Stockpile Layout in AEC03 Plan

TABLES

Table LAR1 Laboratory Analytical Results – Soils
Table LAR2 Laboratory Analytical Results - RPD

APPENDICES

A Survey
B Logs
C Laboratory

DOCUMENT CONTROL

Revision	Date	Author	Authorised
Rev 0	17 May 2018	Jake Walker / Craig Cowper	Craig Cowper

This report remains the property of Alliance Geotechnical subject to payment of all fees due for the assessment. The report shall not be reproduced except in full and with prior written permission by Alliance Geotechnical Pty Ltd.

EXECUTIVE SUMMARY

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust, to undertake a stockpile contamination assessment for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting; and
- nine stockpiles of soil were identified towards the western boundary of the site; and
- a stockpile contamination assessment is required to provide advice on the contamination status of nine stockpiles identified on the site.

The objectives of this project were to:

- assess the nature and extent of contamination to be present in nine stockpiles on the site;
- provide advice on whether the stockpiles be suitable (in the context human health exposure risks) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- stockpile soil sampling and laboratory analysis; and
- data assessment and reporting.

Within the context and objective of this project, an area of environmental concern (AEC) and contaminants of potential concern (COPC) have the potential to be present on site. The AEC identified are presented in attached **Figure 3** and associated COPC are presented in **Table 4.1**. The layout of

Table 4.1: AEC and COPC

ID	AEC	Land Use Activity	Contaminants of Potential Concern
AEC01	Nine stockpiles located adjacent to western boundary (~10m^3 each)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.

The layout of the stockpiles within AEC03, is presented in the attached **Figure 4**.

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the concentrations of identified contaminants of potential concern in stockpile SP03 to SP11 are considered unlikely to present an unacceptable direct contact human health exposure risk, with the exception of benzo(a)pyrene TEQ in stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11;

- the concentrations of identified contaminants of potential concern in stockpiles SP03 to SP11 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;

- the concentrations of bonded asbestos in soil in stockpiles SP03 to SP11 may present an unacceptable human health exposure risk;

- the visible presence of asbestos containing materials in SP03 to SP11 may present an unacceptable aesthetics risk; and

- management and/or remediation of stockpiles SP03 to SP11 is required.

Based on these conclusions, AG makes the following recommendations:

- stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11 should be excavated, transported and disposed of to a suitably licensed landfill facility. The excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;

- stockpiles SP04 and SP05 could be either remediated to remove the identified bonded asbestos human health and aesthetics risks, or excavated, transported and disposed of to a suitably licensed landfill facility. The remediation and/or excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;

- a waste classification should be prepared for materials proposed for offsite disposal, with reference to relevant NSW EPA waste classification guidelines. The waste classification should be prepared by a suitably experienced environmental consultant; and

- a validation report should be prepared following removal and/or remedial works, that assesses whether the identified human health and aesthetics risks have been appropriate managed and/or remediated. The validation report should be prepared by a suitably experienced environmental consultant.

This report, including its conclusions and recommendations, must be read in conjunction with the limitations presented in **Section 11.**

1. INTRODUCTION

1.1. Background

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust, to undertake a stockpile contamination assessment for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting; and
- nine stockpiles of soil were identified towards the western boundary of the site; and
- a stockpile contamination assessment is required to provide advice on the contamination status of nine stockpiles identified on the site.

1.2. Objectives

The objectives of this project were to:

- assess the nature and extent of contamination to be present in nine stockpiles on the site;
- provide advice on whether the stockpiles be suitable (in the context human health exposure risks) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

1.3. Scope of Work

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- stockpile soil sampling and laboratory analysis; and
- data assessment and reporting.

2. SITE IDENTIFICATION

The site is identified as the stockpiles located in Lot 3991 in DP1190132.

The approximate geographic coordinates of the middle of the Lot 3991, inferred from Google Earth were 33°43'45" S and 150°43'23" E.

The locality of the site is set out in **Figure 1.**

The general layout and boundary of Lot 3991 is set out in **Figure 2.**

Lot3991 covers an area of approximately 3.633 hectares.

A copy of a detail and level survey covering Lot 3991, is presented in **Appendix A.**

3. PREVIOUS CONTAMINATION ASSESSMENTS

A copy of the following reports was made available to AG during this project:

- URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.
- Douglas Partners 2017, 'Site Walkover Contamination Report, Proposed Lots 3989, 3990 and 3991, DP1190132, Jordan Springs, NSW', dated 21 September 2017, ref: 92245.00.
- AG 2018, 'Supplementary Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 20 April 2018, ref: 7161-ER-1-3.

A summary of these reports is presented in **Section 3.1** to **3.3** of this report.

3.1. URS (2008)

The objective of URS (2008) was to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the nature environment.

URS (2008) was prepared for a parcel of land referred to as the Western Precinct. AG understands the Western Precinct fell within the former Australia Defence Industries (ADI) facility in St Marys.

An assessment by AG of Figure 2 in URS (2008) indicated that the subject site falls within the south western corner of the Western Precinct.

Section 1.2 of URS (2008) noted that the majority of the Western Precinct was assessed by a NSW EPA Accredited Site Auditor (Site Auditor), to pose a negligible risk to the public or the environment with regard to chemical contamination and/or explosive ordnance. A number of site audit statements (SASs) for parcels of land across the Western Precinct were included in Appendix A of URS (2008).

URS (2008) noted that:

- unexpected finds may occur in areas which, although searched extensively, contain remnant materials which were obscured by the local topography, the type of surface cover (e.g. building) or at a depth preventing detection; and
- the Site Auditor considered that, while explosive ordnance may be uncovered during earthworks, it is unlikely that these will present an unacceptable risk provided appropriate procedures for the safe handling and disposal of such material are adopted.

A copy of a Site Audit Statement (SAS), prepared by the Site Auditor (Mr Christopher Kidd of HLA-Envirosciences), dated 7 June 1999, reference CHK001/1 was presented in Appendix A of URS (2008). An assessment of the SAS by AG indicated that the subject site fell within the boundaries of the land that SAS CHK001/1 applied to. AG also found that the SAS certified that land as suitable for residential, including substantial vegetable garden and poultry, residential with minimal, opportunity for soil access including units, day care centre, preschool, primary schools, secondary school, park, recreational open space, playing field and commercial / industrial land use settings, subject to a number of conditions, including:

- the exclusion of specific parcels of land, as marked on the plan attached to the SAS; and
- an appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, being lodged prior to the commencement of development earthworks

AG assessed the plan attached to the SAS and considered that:

- the subject site did not appear to fall within the shaded areas excluded from SAS CHK001/1; and

- land located immediately adjacent to the subject site, did not appear to fall within the shaded areas excluded from SAS CHK001/1.

3.2. Douglas Partners (2017)

The objective of Douglas Partners (2017) was to identify additional activities or sources that have occurred/appeared on site since the sale of the property in June 2013.

The scope of work undertaken to address the project objective included a document review and site walkover.

Douglas Partners (2017) reported the following conclusions, considered relevant to the subject Lot 3990 and Lot 3991:

- Limited review of historical aerial imagery and site walkover completed on 19 September 2017, identified the following potential sources appearing onsite in recent years that have the potential for contamination of the site:
    - Five small stockpiles or soil observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark on Lot 3991. Given the small volume (15-20m^3) of the stockpiles, likely origins from bulk earthworks associated with the nearby carpark and observed contents, the soil within the stockpiles poses a low contamination risk to the site.

Douglas Partners (2017) recommended that:

- further investigations be completed within the soil stockpiles on Lot 3991, to confirm the absence/presence of contaminants of potential concern associated with fill of an unknown origin; and
- the recommended further assessment should build on the information presented in Douglas Partners (2017) with reference to NEPC (1999) and should include intrusive investigation, sampling and analysis.

3.3. AG (2018)

The objectives of this project were to:

- assess the potential for contamination to be present on the site as a result of past and current land use activities;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- limited soil sampling and laboratory analysis; and
- data assessment and reporting.

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the contamination status of the broader site is considered unlikely to have materially changed since the issue of a site audit statement in 1999;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable direct contact human health exposure risk;

- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;
- stockpile SP01 (in AEC01) would be suitable (in the context of human health and land contamination) for beneficial reuse on site;
- the estimated concentration of bonded asbestos in soil detected in AEC02 (stockpile SP02), may present an unacceptable human health exposure risk and unacceptable aesthetics risk;
- chemical contaminants of concern, asbestos fines and friable asbestos in AEC03 (stockpiles SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11) require further investigation, to assess whether they may present an unacceptable human health exposure risk;
- the site could be made suitable for the proposed land use setting (in the context of land contamination), subject to:
  - management and/or remediation of bonded asbestos in stockpile SP02;
  - further assessment, management and/or remediation of potential unacceptable human health exposure risks in SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11;
  - ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the sites; and
- Further assessment, management and/or remediation planning works should be undertaken by a suitably experienced environmental consultant.

4. CONCEPTUAL SITE MODEL

4.1. Areas of Environmental Concern and Contaminants of Potential Concern

Within the context and objective of this project, an area of environmental concern (AEC) and contaminants of potential concern (COPC) have the potential to be present on site. The AEC identified are presented in attached **Figure 3** and associated COPC are presented in **Table 4.1**. The layout of

Table 4.1: AEC and COPC

ID	AEC	Land Use Activity	Contaminants of Potential Concern
AEC01	Nine stockpiles located adjacent to western boundary (~10m^3 each)	Uncontrolled filling	Hydrocarbons, pesticides, polychlorinated biphenyl, metals and asbestos.

The layout of the stockpiles within AEC03, is presented in the attached **Figure 4**.

4.2. Land Use Setting

AG understands that the site is proposed for a residential land use setting.

Based on the proposed land use scenario and guidance provided in Section 2.2 of NEPC (1999a), AG considers it reasonable to adopt the 'HIL A – residential with garden / accessible soil' land use setting, for the purpose of assessing land contamination exposure risks.

4.3. Direct Contact – Human Health

The proposed land use setting is likely to include accessible soils. In these areas, it is considered that a direct contact exposure pathway may be complete.

4.4. Inhalation / Vapour Intrusion – Human Health

In order for a potentially unacceptable inhalation / vapour intrusion human health exposure risk to exist, a primary vapour source (e.g. underground storage tank) or secondary vapour source (e.g. significantly contaminated soil or groundwater).

The historical evidence reviewed indicated a low likelihood for a potential primary source to be present in the stockpiles.

The same historical evidence indicated that the stockpiles comprise uncontrolled fill material. The excavation, transport and placement of imported (uncontrolled) fill material involves significant disturbance of soils which typically results in volatilisation of vapour producing contaminants. On that basis, the potential for vapours to be present in soils in the stockpiles at concentrations which might present an unacceptable exposure risk, is considered to be low.

However, given the limited data available on the source and nature of the stockpiles, and as a conservative measure, further assessment of the inhalation / vapour intrusion pathway is considered warranted.

4.5. Management Limits for Petroleum Hydrocarbon Compounds

NEPC (1999a) notes that there are a number of policy considerations which reflect the nature and properties of petroleum hydrocarbons:

- formation of observable light non-aqueous phase liquids (LNAPL);
- fire and explosive hazards; and
- effects on buried infrastructure (e.g. penetration of or damage to, in-ground services by hydrocarbons).

NEPC (1999a) includes 'management limits' to avoid or minimise these potential effects. Application of the management limits requires consideration of site-specific factors such as the depth of building basements and services and depth to groundwater, to determine the maximum depth to which the limits should apply. NEPC (1999a) also notes that management limits may have less relevance at operating industrial sites which have no or limited sensitive receptors in the area of potential impact, and when management limits are exceeded, further site-specific assessment and management may enable any identified risk to be addressed.

4.6. Aesthetics – Human Health

Section 3.6.3 of NEPC (1999a) advises that there are no specific numeric aesthetic guidelines, however site assessment requires a balanced consideration of the quantity, type and distribution of foreign material or odours in relation to the specific land use and its sensitivity.

The potential presence of foreign materials in the identified AEC, may create an aesthetics risk. Further assessment of this risk is considered warranted.

5. DATA QUALITY OBJECTIVES

Appendix B of NEPC (1999b) provides guidance on the development of data quality objectives (DQO) using a seven-step process.

The DQO for this project are set out in **Sections 5.1** to **5.7** of this report.

5.1. Step 1: State the problem

The first step involves summarising the contamination problem that requires new environmental data and identifying resources available to solve the problem.

The objectives of this project are to:

- assess the nature and extent of contamination to be present in nine stockpiles on the site;
- provide advice on whether the stockpiles be suitable (in the context of human health exposure risks) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The assessment is being undertaken because:

- advice is required on the suitability of the stockpiles in the context of land contamination and human health exposure risks) for the proposed land use setting.

The project team identified for this project is comprised primarily of suitably experienced environmental consultants from Alliance Geotechnical Pty Ltd.

The regulatory authorities identified for this project include NSW EPA and the local Council.

5.2. Step 2: Identify the decision/goal of the study

The second step involves identifying decisions that need to be made about the contamination problem and the new environmental data required to make them.

The decisions that need to be made during this project include:

- Is the environmental data collected for the project, suitable for assessing relevant human health exposure risks?
- Do the concentrations of identified contaminants of potential concern (COPC) present an unacceptable exposure risk to identified receptors, for the proposed land use setting?
- Are the stockpiles suitable for the proposed land use setting, in the context of human health exposure risks?

5.3. Step 3: Identify the information inputs

The third step involves identifying the information needed to support decisions and whether new environmental data will be needed.

The inputs required to make the decisions set out in **Section 5.2** for this project, will include:

- the nature and extent of sampling at the site, including both density and distribution;
- samples of relevant site media;
- the measured physical and/or chemical parameters of the site media samples (including field screening and laboratory analysis, where relevant); and
- assessment criteria adopted for each of the media sampled.

Taking into consideration the objectives of this project, and the conceptual site model and land use setting presented in Section 4 of this project, the assessment criteria relevant to the proposed land use setting have been adopted for this project.

- Human health direct contact – HILs in Table 1A (1) in NEPC (1999a) and HSLs in Table B4 of Friebel, E & Nadebaum, P (2011);
- Human health inhalation/vapour intrusion – HSLs in Table 1 (A) in NEPC (1999a); and
- Human health (asbestos) – HSLs in Table 7 of NEPC (1999a);
- Petroleum hydrocarbon compounds (management limits) – Table 1 B(7) of NEPC (1999a);
- Aesthetics – no highly malodorous site media (e.g. strong residual petroleum hydrocarbon odours, hydrogen sulphide in site media, organosulfur compounds), no hydrocarbon sheen on surface water, no discoloured chemical deposits or soil staining with chemical waste other than of a very minor nature, no large monolithic deposits of otherwise low risk material (e.g. gypsum as powder or plasterboard, cement kiln dust), no presence of putrescible refuse including material that may generate hazardous levels of methane such as a deep-fill profile of green waste or large quantities of timber waste, and no soils containing residue from animal burial (e.g. former abattoir sites).

5.4. Step 4: Define the boundaries of the study

The fourth step involves specifying the spatial and temporal aspects of the environmental media that the data must represent to support decisions.

The spatial extent of the project will be limited to the stockpiles.

The lateral extent that contamination is expected to be distributed across, based on the conceptual site model, is defined by the inferred boundaries of the areas of environmental concern (AEC).

The vertical extent that contamination is expected to be distributed across, based on the conceptual site model and the project scope, is limited to the inferred base of the identified AEC.

The scale of the decisions required will be based on the stockpiles.

The temporal boundaries of the project include

- the project timeframe presented in the AG proposal for this project,
- unacceptable weather conditions at the time of undertaking fieldwork, including rainfall, cold and/or heat;
- access availability of the site (to be defined by the site owner/representative); and
- availability of AG field staff (typically normal daylight working hours, Monday to Friday).

Constraints which may affect the carrying out of this project may include access limitations, presence of above and below ground infrastructure, and hazards creating health and safety risks.

5.5. Step 5: Develop the analytical approach (or decision rule)

The fifth step involves defining the parameter of interest, specifying the action level, and integrating information from Steps 1 to 4 into a single statement that gives a logical basis for choosing between alternative actions.

5.5.1. Rinsate Blanks

One rinsate blank will be collected and scheduled for analysis, for each day of sampling undertaken, if non-disposable sampling equipment was used on that day. The rinsate blank will be analysed for at least one of the analytes the sample/s collected that day are being scheduled for analysis for (with the exception of asbestos).

5.5.2. Trip Spikes and Trip Blank Samples

One trip spike and trip blank sample will be used and scheduled for analysis, for each day of sampling undertaken, if site samples being collected that day are being analysed for volatile contaminants of concern (typically BTEX and/or TRH C_6-C_{10}).

5.5.3. Field Duplicates and Field Triplicates

Field duplicate and field triplicates will be collected at a rate of one per twenty (5%) site samples collected. The duplicates and triplicates collected will be analysed for at least one of the analytes that the parent sample of the duplicate/triplicate is being scheduled for analysis for (with the exception of asbestos).

The relevant percent difference (RPD) of concentrations of relevant analytes, between the parent sample and the duplicate/triplicate will be calculated.

5.5.4. Laboratory Analysis Quality Assurance / Quality Control

The analytical laboratory QA/QC program will typically include laboratory method blank samples, matrix spike samples, surrogate spike samples, laboratory control samples, and laboratory duplicate samples.

5.5.5. If/Then Decision Rules

AG has adopted the following 'if/then' decision rules for this project:

- If the result of the assessment of field data and laboratory analytical data is considered acceptable, then that field data and laboratory analytical data is suitable for interpretation within the scope of this project; and
- If the field data and laboratory analytical data is within the constraints of the assessment criteria adopted for this project (refer **Section 5.3**), then the contamination exposure risks to identified receptors, are considered acceptable.

In the event the assessment of field data and/or laboratory analytical data results in the data being not suitable for interpretation, then AG will determine if additional data is required to allow interpretation to be undertaken.

In the event that field data and/or laboratory analytical data exceeds the assessment criteria adopted for this project (refer **Section 5.3**), AG will undertake an assessment of the exceedance in the context of the project objectives to determine if additional data is required and whether management and/or remediation is required.

5.6. Step 6: Specify the performance or acceptance criteria

The sixth step involves specifying the decision maker's acceptable limits on decision errors, which are used to establish performance goals for limiting uncertainties in the data. When assessing contaminated land, there are generally two types of errors in decision making:

- Contamination exposure risks for a specific land use setting are acceptable, when they are not; and
- Contamination exposure risks for a specific land use setting are not acceptable when they are.

AG will mitigate the risk of decision error by:

- Calculation of the 95% upper confidence limit (UCL) statistic to assess the mean concentration of relevant contaminants of potential concern;
- Assignment of fieldwork tasks to suitably experienced AG consulting staff, and suitably experienced contractors;
- Assignment of laboratory analytical tasks to reputable NATA accredited laboratories;

- Assignment of data interpretation tasks to suitably experienced AG consulting staff and outsourcing to technical experts where required.

AG will also adopt a range of data quality indicators (DQI) to facilitate assessment of the completeness, comparability, representativeness, precision and accuracy (bias).

Completeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Critical locations sampled	Refer **Section 5.7.1**	Critical samples analysed according to SAQP	Refer **Section 5.7.6**
Critical samples collected	Refer **Section 5.7.1**	Analytes analysed according to SAQP	Refer **Section 5.7.6**
SOPs appropriate and complied with	100%	Appropriate laboratory analytical methods and LORs	Refer **Section 5.7.6**
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	Sample documentation complete	All sample receipt advices, all certificates of analysis
		Sample extraction and holding times complied with	Refer **Section 5.7.7**
Comparability			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Same SOPs used on each occasion	100%	Same analytical methods used by primary laboratory	Refer **Section 5.7.7**
Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	Same LORs at primary laboratory	Refer **Section 5.7.7**
Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	Same laboratory for primary sample analysis	All primary samples to SGS Environmental
		Same analytical measurement units	Refer **Section 5.7.7**
Representativeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Appropriate media sampled according to SAQP	Refer Section 5.4	Samples analysed according to SAQP	Refer **Section 5.7.6**
Media identified in SAQP sampled	Refer Section 5.4		
Precision			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**

Field duplicate / triplicate RPD	Minimum 5% duplicates and triplicates No limit for analytical results <10 times LOR 50% for analytical results 10-20 times LOR 30% for analytical results >20 times LOR	Laboratory duplicates	No exceedances of laboratory acceptance criteria
SOPs appropriate and complied with	100%		
Accuracy (bias)			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Rinsate blanks	Less than laboratory limit of reporting	Laboratory method blank	No exceedances of laboratory acceptance criteria
Field trip spikes	Recoveries between 60% and 140%	Matrix spike recovery	No exceedances of laboratory acceptance criteria
Field trip blanks	Analyte concentration <LOR	Surrogate spike recovery	No exceedances of laboratory acceptance criteria
		Laboratory control sample recovery	No exceedances of laboratory acceptance criteria

5.7. Step 7: Develop the plan for obtaining data

The seventh step involves identifying the most resource effective sampling and analysis design for generating the data that is required to satisfy the DQOs.

5.7.1. Sampling Point Density and Locations

Section 6.2.1 of NEPC (1999b) states that the number and location or sampling points is based on knowledge of the site and professional judgement. Sampling should be localised to known or potentially contaminated areas identified from knowledge of the site either from site history or an earlier phase of site investigation. Judgemental sampling can be used to investigate sub-surface contamination issues in site assessment. Section 7.5.2 of NEPC (1999b) provides guidance on the quantity of samples to be collected form stockpiles.

Given the combined volume of material estimated in each of the identified AEC, and the guidance provided above, AG proposes to establish one sampling point in each stockpile, with three samples collected from each sampling point.

5.7.2. Sampling Methodology

The sampling point methodology presented in **Table 5.7.2** will be used for this assessment. The methodology is based on a range of factors considered relevant to this project, including:

- the identified contaminants of potential concern;
- the suspected laydown mechanisms for those contaminants of concern;

- the suspected likely depth of contamination; and
- site specific constraints which affect the type of sampling techniques suited to the site.

Table 5.7.2 Proposed Sampling Methodology

AEC	Sampling Point ID	Method	Target Depth of Sampling Point (m bgs)
AEC03	SP03 to SP11	Excavator	Minimum of 0.3m below surface of stockpiled material

5.7.3. Identification, Storage and Handling of Samples

Sample identifiers will be used for each sample collected, based on the sampling point number and the depth the sample was collected from.

Project samples will be stored in laboratory prepared containers (and zip lock bags if collected for asbestos or acid sulfate soil assessment). Filled containers will be placed in insulated container/s with ice.

Samples will be transported to the relevant analytical laboratory, with chain of custody (COC) documentation that includes the following information:

AG project identification number
- Each sample identifier
- Date each sample was collected
- Sample type (e.g. soil or water)
- Container type/s for each sample collected
- Preservation method used for each sample (e.g. ice)
- Analytical requirements for each sample and turnaround times
- Date and time of dispatch and receipt of samples (including signatures)

5.7.4. Decontamination

In the event that non-disposable sampling equipment is used, that equipment will be decontaminated before and in between sampling events, to mitigate potential for cross contamination between samples collected. The decontamination methodology to be adopted for this project will include:
- Washing relevant sampling equipment using potable water with a phosphate free detergent (i.e. Decon 90 or similar) mixed into the water;
- Rinsing the washed non-disposable sampling equipment with distilled or de-ionised water; and
- Air drying as required.

5.7.5. Laboratory Selection

The analytical laboratories used for this project will be NATA accredited for the analysis undertaken.

5.7.6. Laboratory Analytical Schedule

Project samples will be scheduled for NATA accredited laboratory analysis, using a combination of:
- Observations made in the field of the media sampled;
- The contaminants of potential concern (COPC) identified for the area of environmental concern that the sample was collected from.

Based on site history, AG has adopted the laboratory analytical schedule (and associated upper limiting quantities) presented in **Table 5.7.6** for this project.

Table 5.7.6 Laboratory Analytical Schedule

AEC	Sampling Point ID	TRH/BTEX	PAH	OCP	PCB	Metals	Asbestos (0.001%)	Asbestos ID
AEC03	SP03 to SP11	9	18	9	9	18	18	-

5.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting

The laboratory holding times, analytical methods and limits of reporting (LOR) being used for this project, are presented in **Table 5.7.7**.

Table 5.7.7 Laboratory Holding Times, Analytical Methods and Limits of Reporting

Analyte	Holding Time	Analytical Method	Limit of Reporting (mg/kg)
BTEX and TRH C_6-C_{10}	14 days	USEPA 5030, 8260B and 8020	0.2-0.5
TRH >C_{10}-C_{40}	14 days	USEPA 8015B & C	20-100
VOC	14 days	USEPA 8260	0.1-0.5
PAH	14 days	USEPA 8270	0.1-0.5
OCP	14 days	USEPA 8081	0.2
PCB	14 days	USEPA 8270	0.2
Metals	14 days	USEPA 8015B & C	0.05 – 2
Asbestos	No limit	AS4964:2004	Absence / presence
Asbestos	No limit	Inhouse Method	0.001% w/w

6. FIELDWORK

6.1. Service Locating

Given the nature and methodology of the fieldwork planned for this project, underground service locating was not undertaken.

6.2. Soil Sampling

Soil sampling of was undertaken by AG on 9 May 2018.

A total of 9 (nine) sampling points (one from each stockpile, SP03 to SP11) were established on site. Each sampling point was excavated using a 3.5T track mounted excavator. The locations of the sampling points established on site, are presented in **Figure 4**.

Collected samples were placed in labelled laboratory supplied acid-rinsed glass jars (with Teflon lined lids) and zip lock bags.

6.3. Geology

Observations were made of soils encountered during sampling work. These observations were recorded on test pit logs, which are presented in **Appendix B**.

6.4. Odours

Olfactory evidence of odours was not detected in the soil samples collected.

6.5. Staining

Visual evidence of staining was not observed in the soil samples collected.

7. LABORATORY

The samples collected were transported to the analytical laboratory, using chain of custody (COC) protocols. A selection of these samples was scheduled for analysis, with reference to the relevant COPC identified for the AEC that the samples were collected from.

A copy of the analytical laboratory certificates of analysis, is presented in **Appendix C**.

The sample analytical results were tabulated and presented in the attached **Table LAR1** and **Table LAR2.**

8. DATA QUALITY INDICATOR ASSESSMENT

8.1. Completeness

An assessment of the completeness of data collected was undertaken, and the results presented in **Table 8.1**.

Table 8.1 Completeness DQI

Field Considerations	Target	Actual	Comment
Critical locations sampled	9	9	Performance against indicator considered acceptable.
Critical samples collected	27	27	Performance against indicator considered acceptable.
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	All sampling point logs, calibration logs and chain of custody forms	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Critical samples analysed according to SAQP	Refer **Section 5.7.6**	100%	Performance against indicator considered acceptable.
Analytes analysed according to SAQP	Refer **Section 5.7.6**	100%	Performance against indicator considered acceptable.
Appropriate laboratory analytical methods and LORs	Refer **Section 5.7.7**	100%	Performance against indicator considered acceptable.
Sample documentation complete	All sample receipt advices, all certificates of analysis	100%	Performance against indicator considered acceptable.
Sample extraction and holding times complied with	Refer **Section 5.7.7**	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately complete.

8.2. Comparability

An assessment of the comparability of data collected was undertaken, and the results presented in **Table 8.2**.

Table 8.2 Comparability DQI

Field Considerations	Target	Actual	Comment
Same SOPs used on each occasion	100%	100%	Performance against indicator considered acceptable.

Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	100%	Performance against indicator considered acceptable.
Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Same analytical methods used by primary laboratory	Refer **Section 5.7.7**	100%	Performance against indicator considered acceptable.
Same LORs at primary laboratory	Refer **Section 5.7.7**	100%	Performance against indicator considered acceptable.
Same laboratory for primary sample analysis	All primary samples to SGS Environmental	100%	Performance against indicator considered acceptable.
Same analytical measurement units	Refer **Section 5.7.7**	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately comparable.

8.3. Representativeness

An assessment of the representativeness of data collected was undertaken, and the results presented in **Table 8.3**.

Table 8.3 Representativeness DQI

Field Considerations	**Target**	**Actual**	**Comment**
Appropriate media sampled according to SAQP	Refer **Section 5.7.2**	100%	Performance against indicator considered acceptable.
Media identified in SAQP sampled	Refer **Section 5.7.2**	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Samples analysed according to SAQP	Refer **Section 5.7.6**	100%	Acceptable Performance against indicator considered acceptable.

The data collected is considered to be adequately representative.

8.4. Precision

An assessment of the precision of data collected was undertaken, and the results presented in **Table 8.4**.

Table 8.4 Precision DQI

Field Considerations	Target	Actual	Comment
Field duplicate / triplicate RPD	Minimum 5% duplicates and triplicates	7.4% duplicates and 7.7% triplicates collected. 3.7% duplicates and 7.4% triplicates analysed.	The duplicate analytical rate is marginally below the target criterion, due to an administrative error when scheduling laboratory analysis for the parent sample of DUP1. It is noted that the analytical results of DUP1A were generally comparable with that of DUP1. This is minor non-conformance is not considered not to have a material impact on the precision of the laboratory data. As a conservative measure, the sample reporting the higher concentration of the relevant analyte (between DUP1 and DUP1A) should be used when making decisions regarding human health exposure risks. Field duplicate DUP01 (parent sample SP01/01) had RPD exceedances for copper and zinc. Field duplicate DUP1A (interim parent sample DUP1) had RPD exceedances for copper, lead, nickel and zinc. Field duplicate DUP2 (parent sample SP05-0.6) had RPD exceedances for lead and zinc. Field duplicate DUP2A (parent sample SP05-0.6) had RPD exceedances for chromium, lead, nickel, zinc and mercury. AG considers these exceedances likely to be attributable to
	No limit for analytical results <10 times LOR	Nil	
	50% for analytical results 10-20 times LOR	Nil	
	30% for analytical results >20 times LOR	11 exceedances	

			heterogeneity in each of the discrete soils samples, as the parent sample could not be homogenised prior to splitting, due to the potential for volatile and semi volatile contaminants to be present. As a conservative measure, the sample reporting the higher concentration of the relevant analyte should be used when making decisions regarding contamination risks on the site. Performance against indicator considered acceptable.
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory duplicates	No exceedances of laboratory acceptance criteria	3 exceedances	SGS reported that the 3 laboratory duplicate exceedances in batch SE178910 failed RPD acceptance criteria due to sample heterogeneity. Performance against indicator considered acceptable.

The data collected is considered to be adequately precise.

8.5. Accuracy

An assessment of the precision of data collected was undertaken, and the results presented in **Table 8.5**.

Table 8.5 Accuracy DQI

Field Considerations	Target	Actual	Comment
Rinsate blanks	Less than laboratory limit of reporting	Not applicable.	Disposable sampling equipment used for each sampling point. Rinsate blank not collected. Performance against indicator considered acceptable.

Field trip spikes	Recoveries between 60% and 140%	Recoveries between were 89%to 96%.	Performance against indicator considered acceptable.
Field trip blanks	Analyte concentration <LOR	Analyte concentration was <LOR	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory method blank	No exceedances of laboratory acceptance criteria	Nil	Acceptable
Matrix spike recovery	No exceedances of laboratory acceptance criteria	3 matrix spike recovery exceedances	SGS reported that the five matrix spike DQO exceedances in batch SE175866 failed acceptance criteria due to matrix interference and sample heterogeneity. Performance against indicator considered acceptable.
Surrogate spike recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.
Laboratory control sample recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.

The data collected is considered to be adequately accurate.

9. DISCUSSION

A discussion on comparison of laboratory analytical results and field observations, in the context of the assessment criteria adopted for this project, is presented in **Sections 9.1** to **9.4**.

9.1. Human Health - Direct Contact

9.1.1. TRH

The concentrations of TRH C_6-C_{10}, >C_{10}-C_{16}, >C_{16}-C_{34} and >C_{34}-C_{40} detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

9.1.2. BTEX

The concentrations of benzene, toluene, ethyl benzene and xylenes detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

9.1.3. PAH

The concentrations of naphthalene, benzo(a)pyrene TEQ and total PAH (16) detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria, with the exception of benzo(a)pyrene TEQ in samples SP03-0.3, SP03-0.6, SP06-0.6, SP06-0.9, SP07-0.3, SP07-0.6, SP08-0.6, SP08-0.9, SP09-0.3, SP10-0.6, SP10-0.3, SP10-0.6, SP10-0.9, SP11-0.3 and SP11-0.6.

9.1.4. OCP

The concentration of relevant OCP compounds detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

9.1.5. PCB

The concentration of relevant PCB compounds detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

9.1.6. Metals

The concentrations of lead detected in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

9.1.7. Bonded Asbestos Containing Materials

AG (2018) reported that the estimated concentrations of bonded asbestos in soil in stockpiles SP03 to SP11 was not less than the adopted health screening level of 0.01% w/w, with the exception of sample SP05 which had a preliminary estimated asbestos concentration of asbestos in soil, equal to the adopted health screening level. AG (2018) considered that the potential for asbestos concentrations in SP05 to exceed to adopted health screening level should not be precluded.

The laboratory analytical results for sample SP05-0.3 detected a concentration of asbestos in a fragment of fibrous cement sheeting in the >7mm fraction, of 0.01% w/w, which is not less than the adopted health screening level of 0.01% w/w.

The visual presence of fragments of asbestos containing materials in the form of fibrous cement sheeting fragments, is considered likely to exceed the adopted 'no visible asbestos for surface soil' health screening level.

9.1.8. Asbestos Fines and Friable Asbestos

The concentration of friable asbestos and asbestos fines (FA and AF) detected in the soil samples analysed from SP03 to SP11, were less than the applicable adopted health screening level.

9.2. Human Health – Inhalation / Vapour Intrusion (Soils)

9.2.1. TRH

The concentrations of TRH C_6-C_{10} (minus BTEX) and TRH >C_{10}-C_{16} (minus naphthalene) detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

9.2.2. BTEX

The concentrations of benzene, toluene, ethyl benzene and xylenes detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

9.2.3. PAH

The concentrations of naphthalene detected in the soil samples analysed, were less than the applicable adopted inhalation / vapour intrusion human health exposure criteria.

9.3. TPH Management Limits (Residential)

The concentrations of TRH C_6-C_{10}, >C_{10}-C_{16}, >C_{16}-C_{34} and >C_{34}-C_{40} detected in the soil samples analysed, were less than the applicable adopted TRH management limits.

9.4. Aesthetics

There were no observations of odours, significant chemical deposits, large monolithic deposits of low risk material or putrescible waste in the soils sampled. There were observations made of building/demolition waste in stockpiles SP03 to SP11.

AG (2018) reported observations of fragments of fibrous cement sheeting in stockpiles SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11.

The visible presence of fragments of asbestos containing materials in the form of fibrous cement sheeting fragments, in stockpiles SP03 to SP11, is considered to exceed the adopted aesthetics assessment criteria.

10. CONCLUSIONS AND RECOMMENDATIONS

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the concentrations of identified contaminants of potential concern in stockpile SP03 to SP11 are considered unlikely to present an unacceptable direct contact human health exposure risk, with the exception of benzo(a)pyrene TEQ in stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11;
- the concentrations of identified contaminants of potential concern in stockpiles SP03 to SP11 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;
- the concentrations of bonded asbestos in soil in stockpiles SP03 to SP11 may present an unacceptable human health exposure risk;
- the visible presence of asbestos containing materials in SP03 to SP11 may present an unacceptable aesthetics risk; and
- management and/or remediation of stockpiles SP03 to SP11 is required.

Based on these conclusions, AG makes the following recommendations:

- stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11 should be excavated, transported and disposed of to a suitably licensed landfill facility. The excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;
- stockpiles SP04 and SP05 could be either remediated to remove the identified bonded asbestos human health and aesthetics risks, or excavated, transported and disposed of to a suitably licensed landfill facility. The remediation and/or excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;
- a waste classification should be prepared for materials proposed for offsite disposal, with reference to relevant NSW EPA waste classification guidelines. The waste classification should be prepared by a suitably experienced environmental consultant; and
- a validation report should be prepared following removal and/or remedial works, that assesses whether the identified human health and aesthetics risks have been appropriate managed and/or remediated. The validation report should be prepared by a suitably experienced environmental consultant.

This report, including its conclusions and recommendations, must be read in conjunction with the limitations presented in **Section 11**.

11. STATEMENT OF LIMITATIONS

The findings presented in this report are based on specific searches of relevant, government historical databases and anecdotal information that were made available during the course of this project. To the best of our knowledge, these observations represent a reasonable interpretation of the general condition of the site at the time of report completion.

This report has been prepared solely for the use of the client to whom it is addressed and no other party is entitled to rely on its findings.

No warranties are made as to the information provided in this report. All conclusions and recommendations made in this report are of the professional opinions of personnel involved with the project and while normal checking of the accuracy of data has been conducted, any circumstances outside the scope of this report or which are not made known to personnel and which may impact on those opinions is not the responsibility of Alliance Geotechnical Pty Ltd. Should information become available regarding conditions at the site including previously unknown sources of contamination, AG reserves the right to review the report in the context of the additional information.

This report must be reviewed in its entirety and in conjunction with the objectives, scope and terms applicable to AG's engagement. The report must not be used for any purpose other than the purpose specified at the time AG was engaged to prepare the report.

Logs, figures, and drawings are generated for this report based on individual AG consultant interpretations of nominated data, as well as observations made at the time site walkover/s were completed.

Data and/or information presented in this report must not be redrawn for its inclusion in other reports, plans or documents, nor should that data and/or information be separated from this report in any way.

Should additional information that may impact on the findings of this report be encountered or site conditions change, AG reserves the right to review and amend this report.

12. REFERENCES

AG 2018, 'Supplementary Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 20 April 2018, ref: 7161-ER-1-3.

Friebel, E and Nadebaum, P, 2011, 'Health screening levels for petroleum hydrocarbons in soil and groundwater. Part 2: Application document', CRC CARE Technical Report no. 10, CRC for Contamination Assessment and Remediation of the Environment, Adelaide, Australia.

National Environment Protection Council (NEPC) 1999a, 'Schedule B(1) Guideline on Investigation Levels for Soil and Groundwater, National Environment Protection (Assessment of Site Contamination) Measure (NEPM) as amended in May 2013'.

National Environment Protection Council (NEPC) 1999b, 'Schedule B(2) Guideline on Site Characterisation, National Environment Protection (Assessment of Site Contamination) Measure (NEPM) as amended in May 2013'.

NSW EPA 2017, 'Contaminated Sites: Guidelines for the NSW Site Auditor Scheme (3rd edition)'.


NSW EPA 1995, 'Contaminated Sites: Sampling Design Guidelines'.

NSW OEH 2011, 'Contaminated Sites: Guidelines for Consultants Reporting on Contaminated Sites'.

URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.


WA DOH 2009, 'Guidelines for the Assessment, Remediation and Management of Asbestos-Contaminated Sites in Western Australia' dated May 2009.

FIGURES

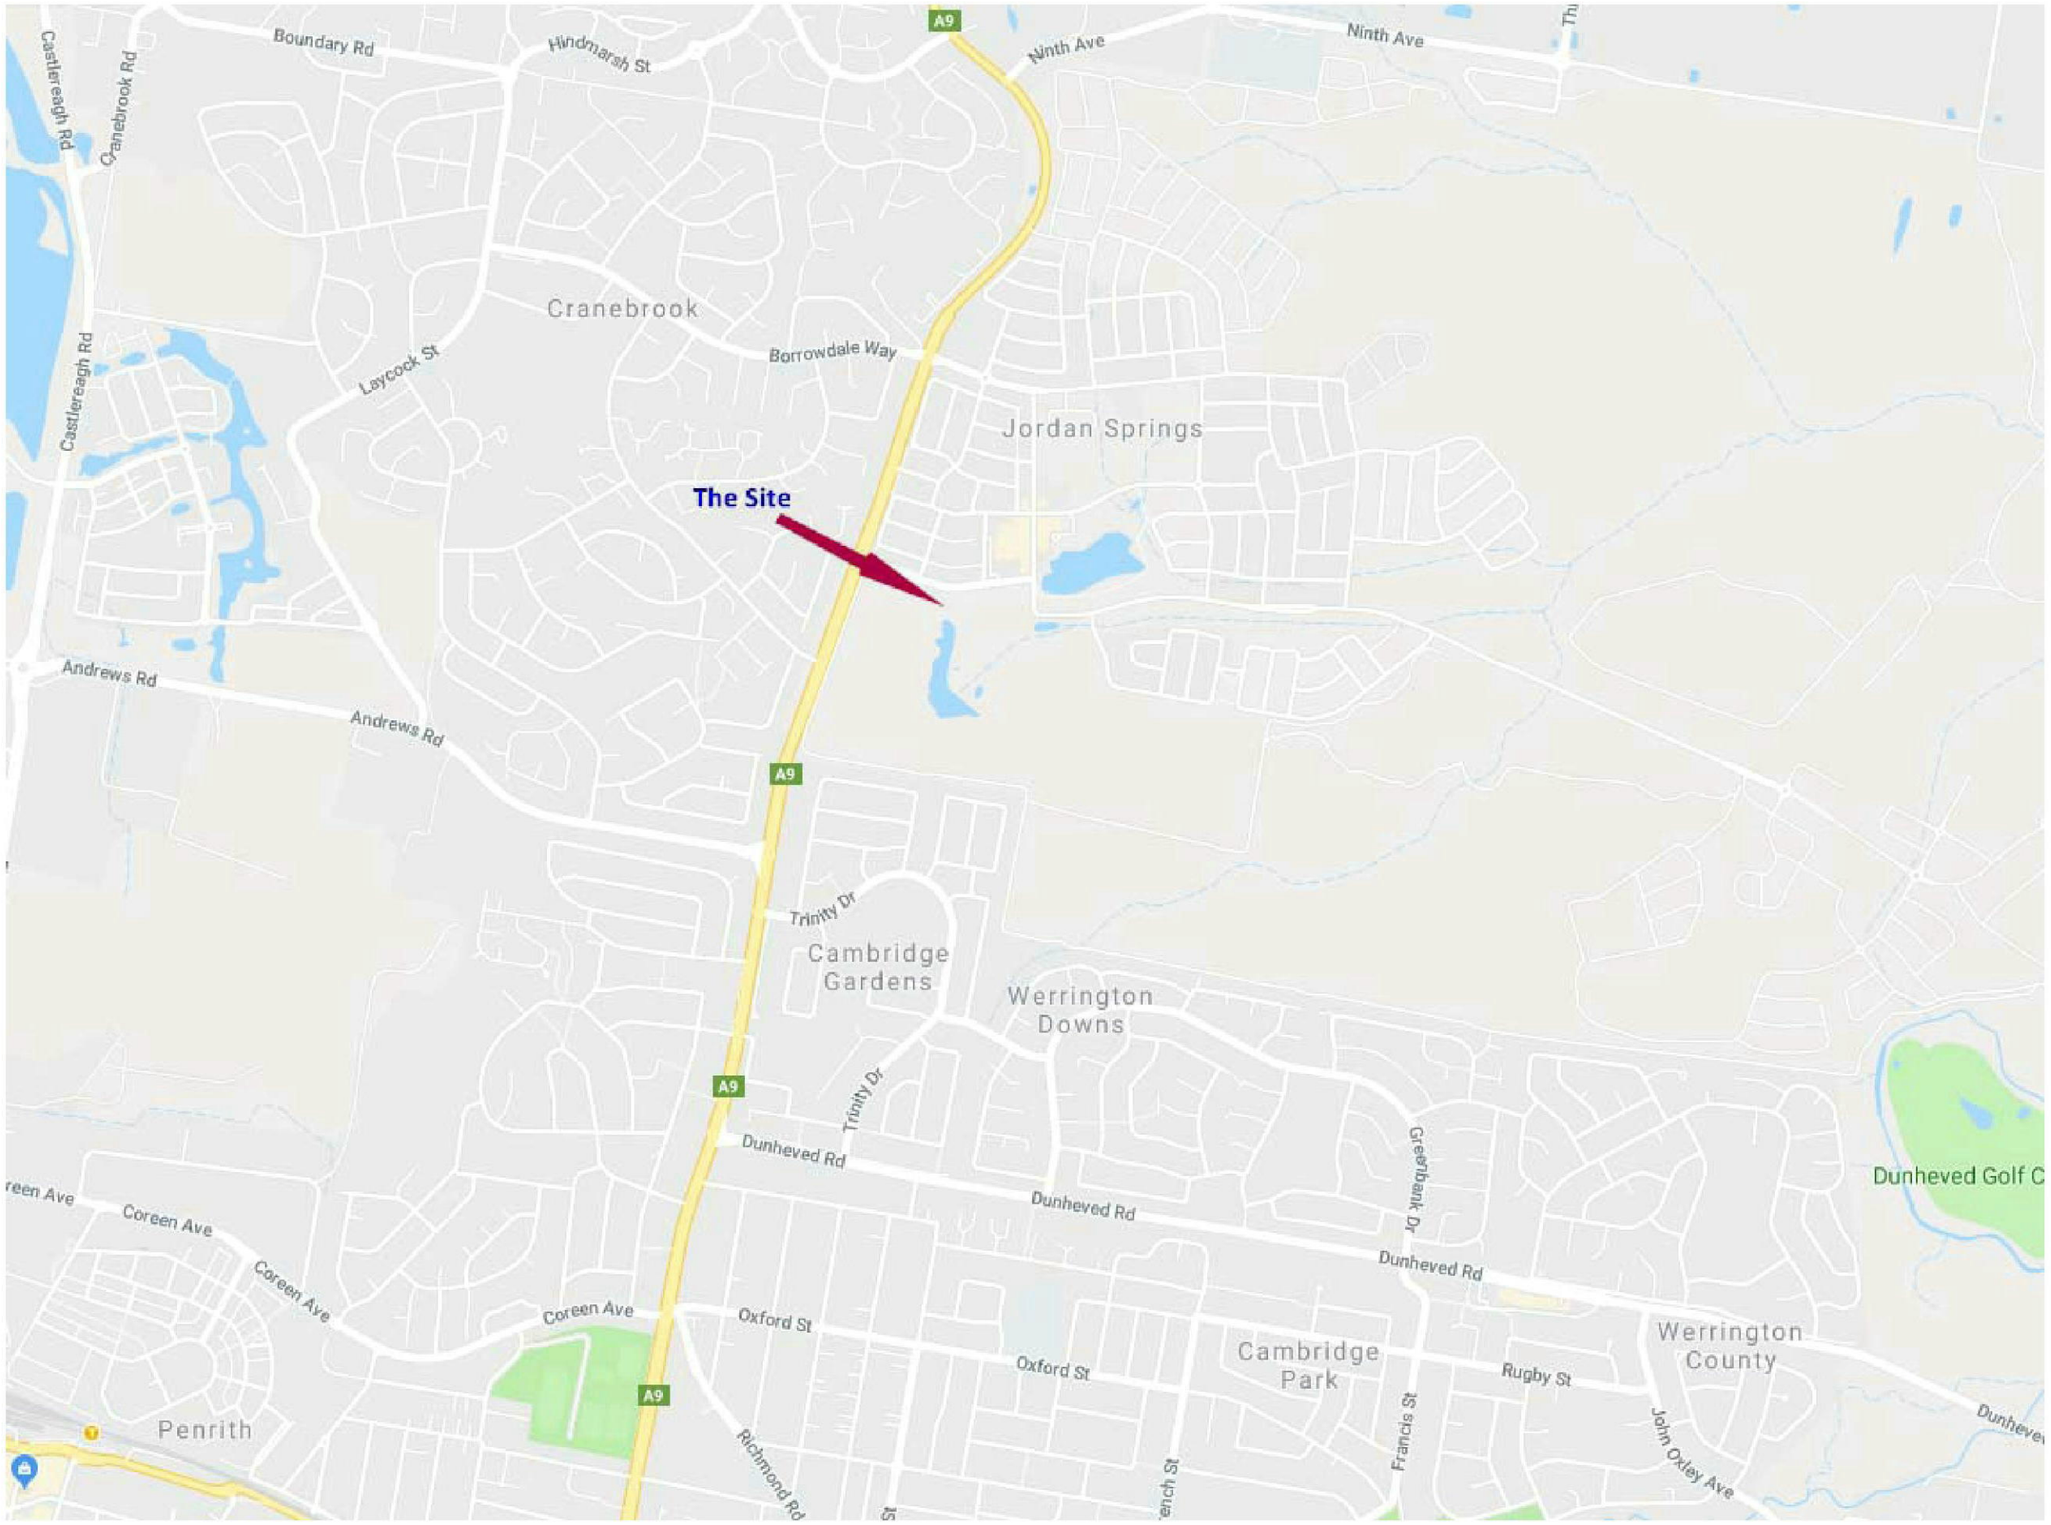


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpile Contamination Assessment	**Report No:** 7161-ER-1-4 **Figure Date:** 9 May 2018	N	**Figure No:** 1	**Figure Title:** Site Locality Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

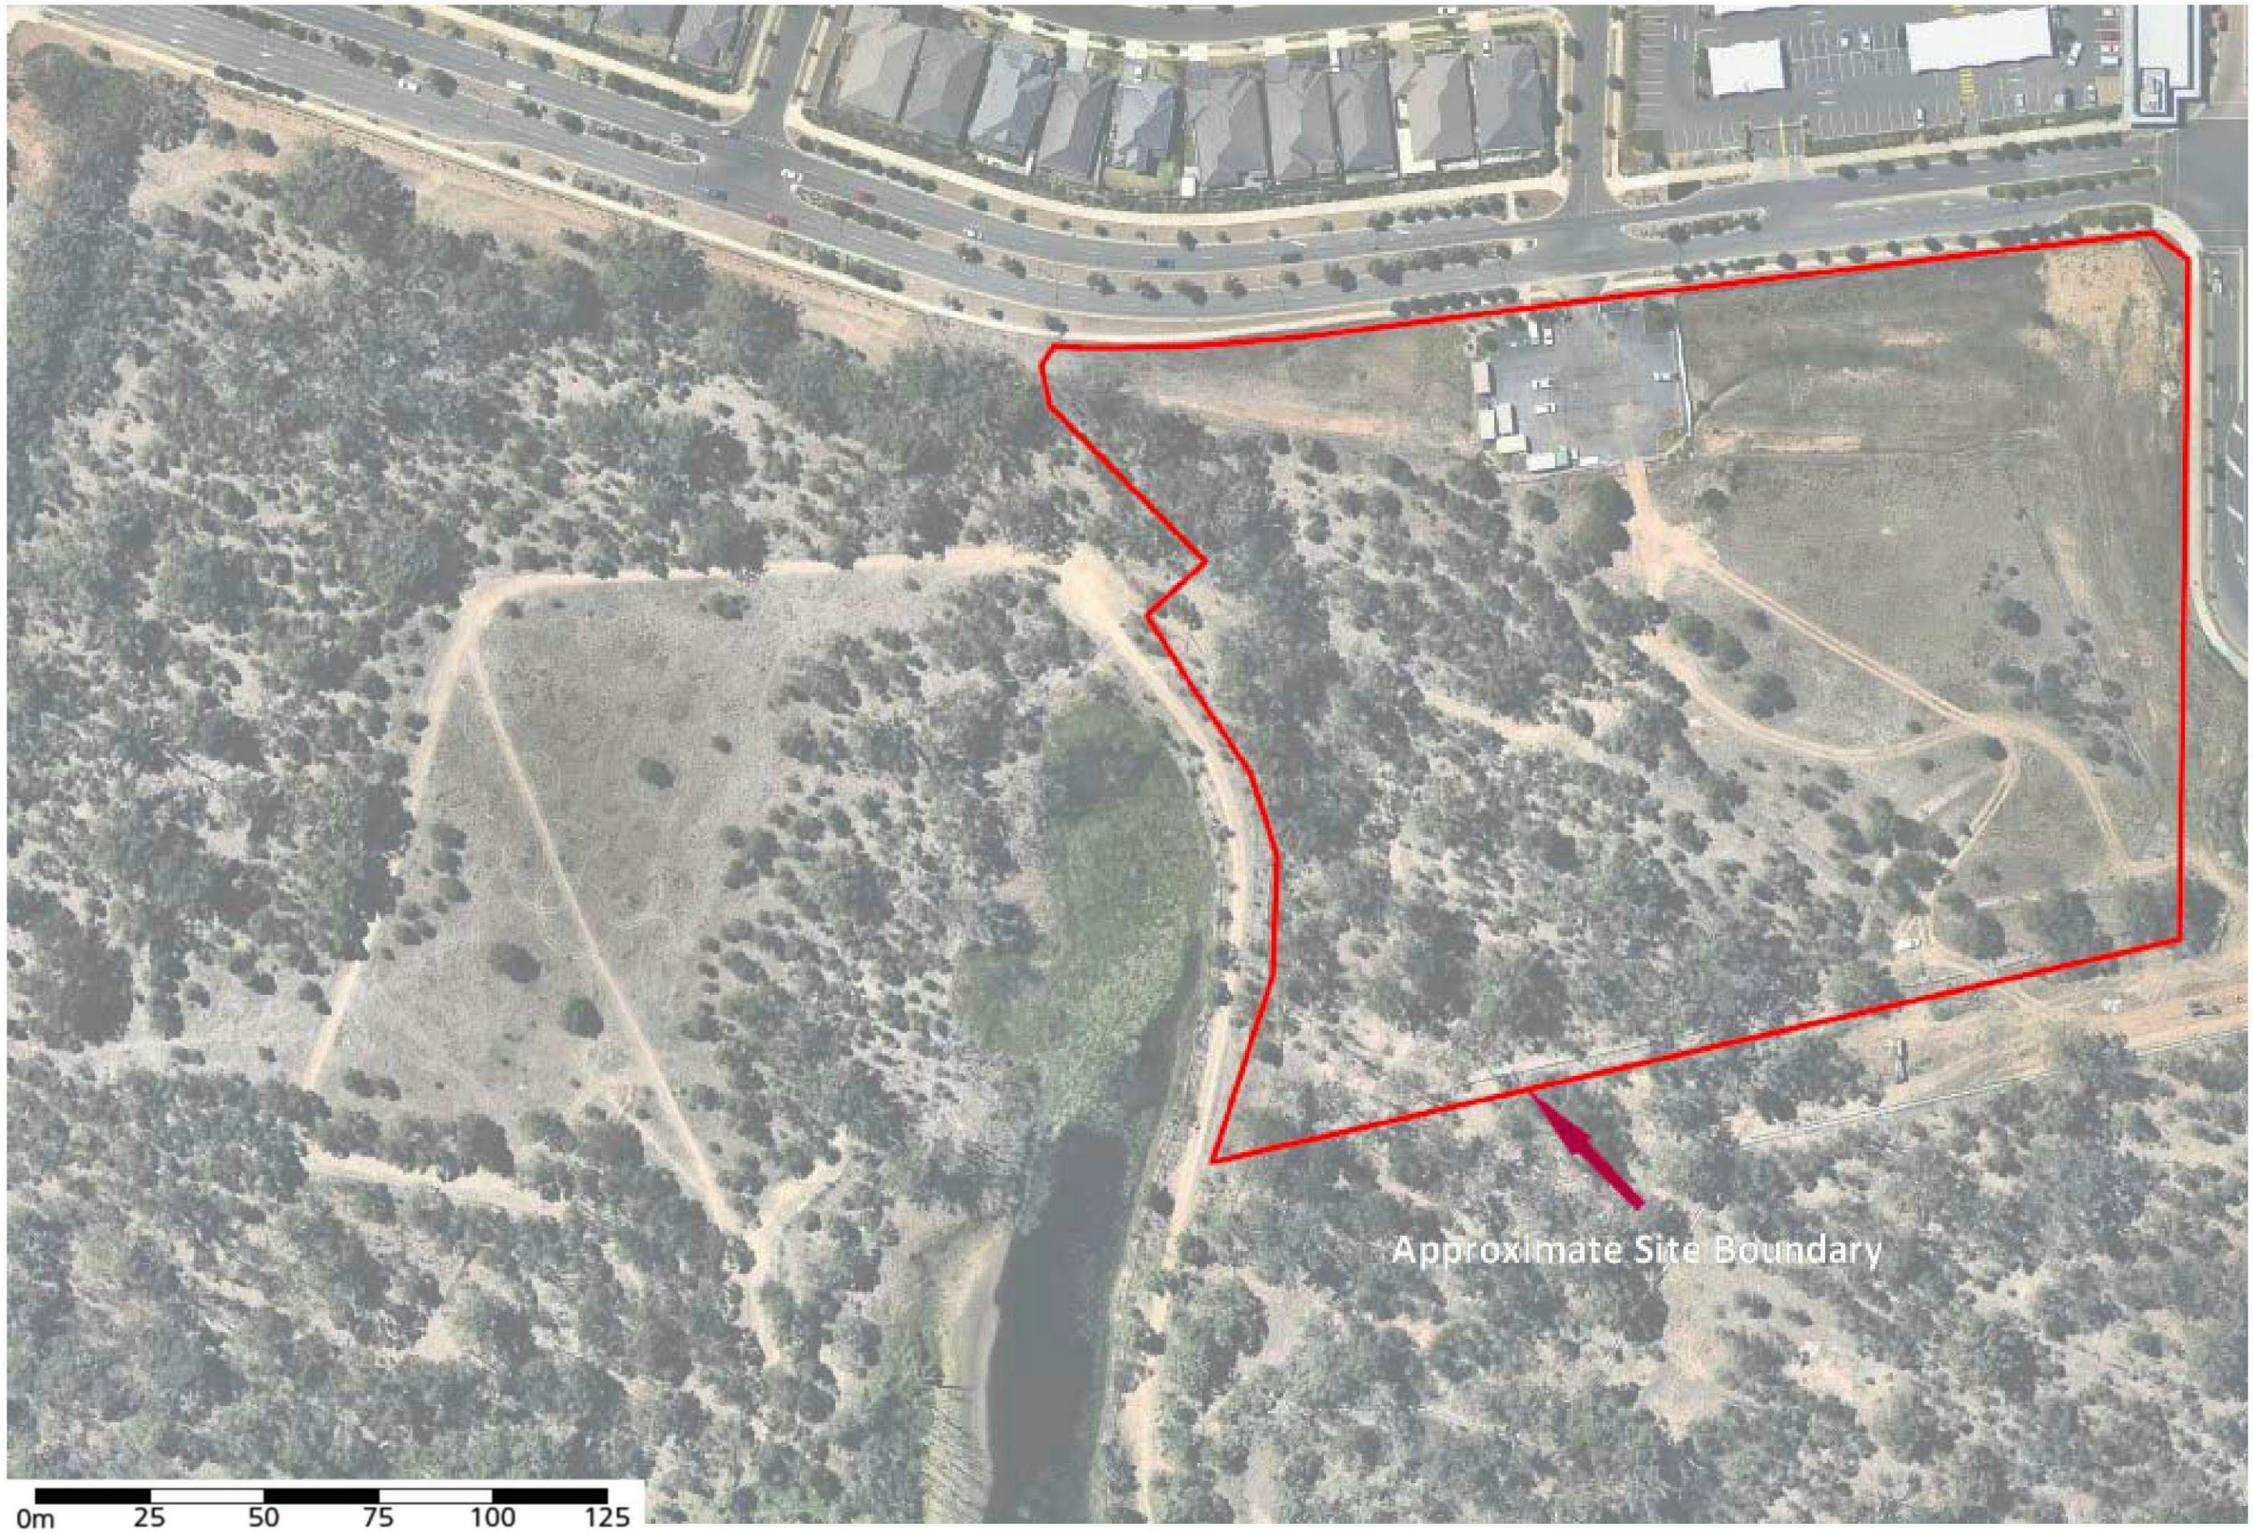

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpile Contamination Assessment	**Report No:** 7161-ER-1-4 **Figure Date:** 9 May 2018	N	**Figure No:** 2	**Figure Title:** Site Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

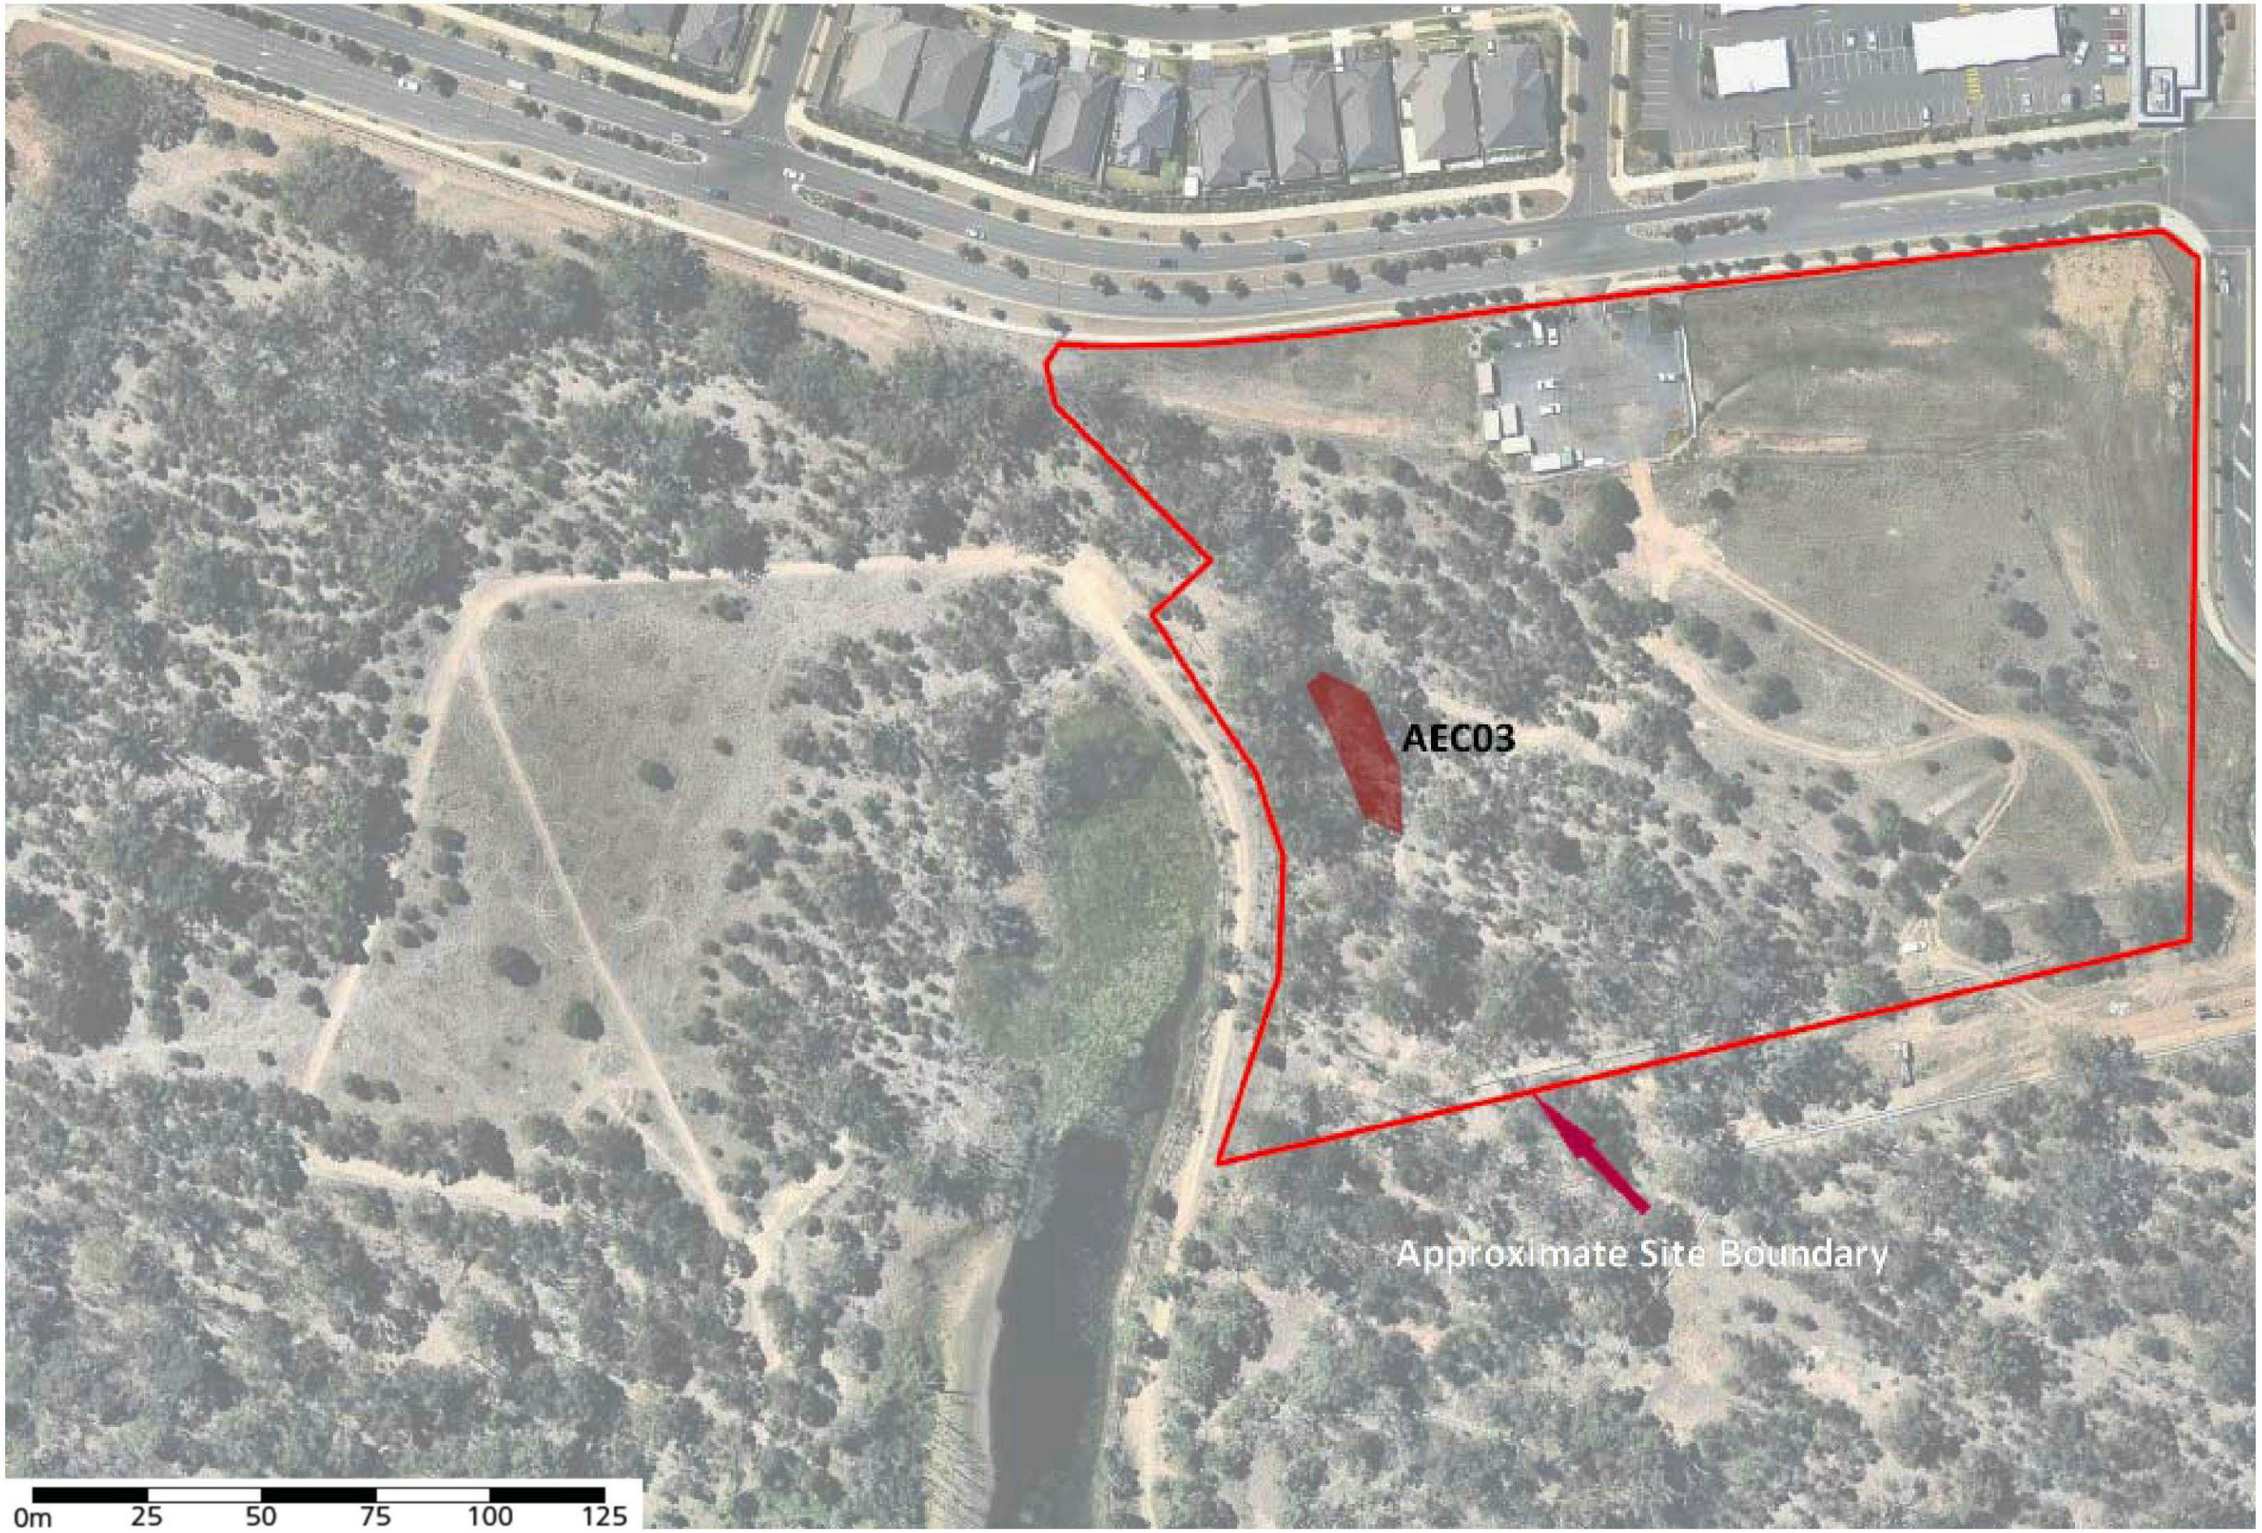

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpile Contamination Assessment	**Report No:** 7161-ER-1-4 **Figure Date:** 9 May 2018	N	**Figure No:** 3	**Figure Title:** Areas of Environmental Concern

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Stockpile Contamination Assessment	Report No: 7161-ER-1-4 Figure Date: 9 May 2018	N	Figure No: 4	Figure Title: Stockpile Layout in AEC03 Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TABLES

Alliance Geotechnical Pty Ltd **Report No. 7161-ER-1-4**
Table LAR1 Laboratory Analytical Results - Soils
Stockpile Contamination Assessment
Lot 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

Analyte Name	Units	Direct Contact HSL-A & HSL-A Residential (mg/kg)	Health Screening Levels Residential A	Inhalation / Vapour Intrusion HSL A 0m to <1m (mg/kg)	Management Limits - Residential (mg/kg)	Reporting Limit	SE178910.001 SP03-0.3 9/5/2018 Soil Result	SE178910.002 SP03-0.6 9/5/2018 Soil Result	SE178910.003 SP03-0.9 9/5/2018 Soil Result	SE178910.004 SP04-0.3 9/5/2018 Soil Result	SE178910.005 SP04-0.6 9/5/2018 Soil Result	SE178910.006 SP04-0.9 9/5/2018 Soil Result	SE178910.007 SP05-0.3 9/5/2018 Soil Result	SE178910.008 SP05-0.6 9/5/2018 Soil Result	SE178910.009 SP05-0.9 9/5/2018 Soil Result	SE178910.010 SP06-0.3 9/5/2018 Soil Result	SE178910.011 SP06-0.6 9/5/2018 Soil Result	SE178910.012 SP06-0.9 9/5/2018 Soil Result	SE178910.013 SP07-0.3 9/5/2018 Soil Result	SE178910.014 SP07-0.6 9/5/2018 Soil Result	SE178910.015 SP07-1.0 9/5/2018 Soil Result	SE178910.016 SP08-0.3 9/5/2018 Soil Result	SE178910.017 SP08-0.6 9/5/2018 Soil Result	SE178910.018 SP08-0.9 9/5/2018 Soil Result	SE178910.019 SP09-0.3 9/5/2018 Soil Result	SE178910.020 SP09-0.6 9/5/2018 Soil Result
BTEXN in Soil																											
Benzene	mg/kg	100		0.5		0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Toluene	mg/kg	14000		160		0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Ethylbenzene	mg/kg	4500		55		0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Total Xylenes	mg/kg	12000		40		0.3	<0.3	N.A.	N.A.	N.A.	<0.3	N.A.	N.A.	N.A.	<0.3	<0.3	N.A.	N.A.	N.A.	<0.3	N.A.	N.A.	N.A.	<0.3	<0.3	N.A.
Naphthalene	mg/kg	1400		3		0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
TRH in Soils																											
Benzene (F0)	mg/kg	100				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
TRH C6-C10	mg/kg	4400			700	25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.
TRH C6-C10 minus BTEX (F1)	mg/kg			45		25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.
TRH >C10-C16	mg/kg	3300			1000	25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.
TRH >C10-C16 - Naphthalene (F2)	mg/kg			110		25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.	N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25	<25	N.A.
TRH >C16-C34 (F3)	mg/kg	4500			3500	90	560	N.A.	N.A.	N.A.	160	N.A.	N.A.	N.A.	230	180	N.A.	N.A.	N.A.	220	N.A.	N.A.	N.A.	200	440	N.A.
TRH >C34-C40 (F4)	mg/kg	6300			10000	120	<120	N.A.	N.A.	N.A.	<120	N.A.	N.A.	N.A.	<120	<120	N.A.	N.A.	N.A.	<120	N.A.	N.A.	N.A.	<120	<120	N.A.
PAH in Soils																											
Naphthalene	mg/kg	1400		3		0.1	0.1	<0.1	N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.	N.A.	0.5	0.3	<0.1	<0.1	N.A.	N.A.	0.2	0.2	0.1	<0.1
2-methylnaphthalene	mg/kg					0.1	<0.1	<0.1	N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.	N.A.	0.4	<0.1	<0.1	<0.1	N.A.	N.A.	<0.1	0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg					0.1	0.1	<0.1	N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.	N.A.	0.4	0.1	<0.1	<0.1	N.A.	N.A.	<0.1	0.1	0.2	<0.1
Acenaphthylene	mg/kg					0.1	0.8	0.5	N.A.	N.A.	0.4	0.2	0.2	0.2	N.A.	N.A.	1.4	0.5	0.3	0.4	N.A.	N.A.	1.2	1.0	1.2	0.2
Acenaphthene	mg/kg					0.1	0.5	<0.1	N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.	N.A.	0.2	<0.1	0.2	0.2	N.A.	N.A.	0.1	<0.1	0.2	<0.1
Fluorene	mg/kg					0.1	0.3	0.1	N.A.	N.A.	0.2	<0.1	<0.1	<0.1	N.A.	N.A.	0.6	0.2	0.1	<0.1	N.A.	N.A.	0.2	0.2	0.5	<0.1
Phenanthrene	mg/kg					0.1	6.6	1.8	N.A.	N.A.	1.8	0.4	0.7	0.4	N.A.	N.A.	6.3	2.0	1.4	1.4	N.A.	N.A.	3.2	2.2	5.1	0.6
Anthracene	mg/kg					0.1	2.9	0.8	N.A.	N.A.	0.7	0.2	0.3	0.3	N.A.	N.A.	1.9	0.7	0.8	0.8	N.A.	N.A.	1.6	1.0	1.8	0.3
Fluoranthene	mg/kg					0.1	15	4.5	N.A.	N.A.	2.6	1.0	1.9	2.1	N.A.	N.A.	8.5	3.6	4.9	5.1	N.A.	N.A.	8.2	5.2	11	1.5
Pyrene	mg/kg					0.1	18	4.4	N.A.	N.A.	2.7	1.0	2.0	2.4	N.A.	N.A.	9.4	3.2	5.7	5.7	N.A.	N.A.	9.5	5.0	12	1.4
Benzo(a)anthracene	mg/kg					0.1	7.7	2.7	N.A.	N.A.	1.4	0.6	1.2	1.5	N.A.	N.A.	4.9	1.9	3.5	3.4	N.A.	N.A.	5.9	3.4	6.3	0.9
Chrysene	mg/kg					0.1	6.4	2.1	N.A.	N.A.	1.2	0.5	1.0	1.2	N.A.	N.A.	3.7	1.8	2.8	2.8	N.A.	N.A.	4.4	2.5	4.8	0.7
Benzo(b&j)fluoranthene	mg/kg					0.1	8.2	3.4	N.A.	N.A.	1.7	0.8	1.5	2.0	N.A.	N.A.	5.2	2.4	4.4	4.1	N.A.	N.A.	7.2	4.0	7.9	1.0
Benzo(k)fluoranthene	mg/kg					0.1	3.1	1.2	N.A.	N.A.	0.7	0.4	0.6	0.7	N.A.	N.A.	2.0	1.0	1.6	1.6	N.A.	N.A.	2.6	1.4	2.0	0.5
Benzo(a)pyrene	mg/kg					0.1	7.1	2.9	N.A.	N.A.	1.5	0.7	1.3	1.7	N.A.	N.A.	4.4	2.1	3.7	3.6	N.A.	N.A.	6.0	3.3	6.0	0.9
Indeno(1,2,3-cd)pyrene	mg/kg					0.1	4.2	1.9	N.A.	N.A.	0.9	0.5	0.8	1.0	N.A.	N.A.	2.6	1.4	2.3	2.2	N.A.	N.A.	3.8	2.2	3.7	0.6
Dibenzo(ah)anthracene	mg/kg					0.1	1.0	0.4	N.A.	N.A.	0.2	0.1	0.2	0.3	N.A.	N.A.	0.7	0.3	0.6	0.5	N.A.	N.A.	1.0	0.5	1.0	0.2
Benzo(ghi)perylene	mg/kg					0.1	4.3	2.0	N.A.	N.A.	1.0	0.5	0.9	1.1	N.A.	N.A.	2.5	1.4	2.3	2.2	N.A.	N.A.	3.7	2.1	3.8	0.8
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)					0.2	11	4.3	N.A.	N.A.	2.2	1.1	2.0	2.5	N.A.	N.A.	6.5	3.1	5.5	5.3	N.A.	N.A.	9.0	5.0	9.0	1.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	3				0.3	11	4.3	N.A.	N.A.	2.2	1.1	2.0	2.5	N.A.	N.A.	6.5	3.1	5.5	5.3	N.A.	N.A.	9.0	5.0	9.0	1.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)					0.2	11	4.3	N.A.	N.A.	2.2	1.1	2.0	2.5	N.A.	N.A.	6.5	3.1	5.5	5.3	N.A.	N.A.	9.0	5.0	9.0	1.3
Total PAH (18)	mg/kg					0.8	86	29	N.A.	N.A.	17	7.0	13	15	N.A.	N.A.	55	23	35	34	N.A.	N.A.	59	34	66	9.2
Total PAH (NEPM/WHO 16)	mg/kg	300				0.8	86	29	N.A.	N.A.	17	7.0	13	15	N.A.	N.A.	55	22	35	34	N.A.	N.A.	59	34	66	9.2
OCP in Soil																											
Hexachlorobenzene (HCB)	mg/kg	10				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Alpha BHC	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Lindane	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Heptachlor	mg/kg	6				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Aldrin	mg/kg	6				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Dieldrin	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Beta BHC	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Delta BHC	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Heptachlor epoxide	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
o,p'-DDT	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
p,p'-DDT	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
o,p'-DDE	mg/kg	240				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
p,p'-DDE	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
o,p'-DDD	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
p,p'-DDD	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Alpha Endosulfan	mg/kg	270				0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Beta Endosulfan	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Gamma Chlordane	mg/kg	50				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Alpha Chlordane	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
trans-Nonachlor	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Endrin	mg/kg	10				0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Endosulfan sulphate	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Endrin Aldehyde	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Methoxychlor	mg/kg	300				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Endrin Ketone	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Isodrin	mg/kg					0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
Mirex	mg/kg	10				0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.	N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1	<0.1	N.A.
PCB in Soil																											
Arochlor 1016	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1221	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1232	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1242	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1248	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1254	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1260	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1262	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Arochlor 1268	mg/kg					0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.	N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2	<0.2	N.A.
Total PCBs (Arochlors)	mg/kg	1				1	<1	N.A.	N.A.	N.A.	<1	N.A.	N.A.	N.A.	<1	<1	N.A.	N.A.	N.A.	<1	N.A.	N.A.	N.A.	<1	<1	N.A.
Metals in Soil																											
Arsenic, As	mg/kg	100				3	9	N.A.	5	12	8	N.A.	N.A.	19	11	10	N.A.	11	N.A.	7	11	37	N.A.	61	17	N.A.
Cadmium, Cd	mg/kg	20				0.3	0.3	N.A.	<0.3	0.4	<0.3	N.A.	N.A.	<0.3	0.3	0.4	N.A.	0.6	N.A.	<0.3	<0.3	0.9	N.A.	1.3	1.4	N.A.
Chromium, Cr	mg/kg	100				0.3	12	N.A.	11	11	9.8	N.A.	N.A.	8.0	10	12	N.A.	19	N.A.	8.2	16	15	N.A.	14	10	N.A.
Copper, Cu	mg/kg	6000				0.5	25	N.A.	29	43	34	N.A.	N.A.	26	30	41	N.A.	40	N.A.	34	25	26	N.A.	21	35	N.A.
Lead, Pb	mg/kg	300				1	140	N.A.	120	93	91	N.A.	N.A.	58	52	110	N.A.	170	N.A.	63	53	100	N.A.	83	69	N.A.
Nickel, Ni	mg/kg	400				0.5	6.4	N.A.	6.6	17	18	N.A.	N.A.	25	26	16	N.A.	17	N.A.	27	16	5.8	N.A.	4.0	10	N.A.
Zinc, Zn	mg/kg	7400				0.5	320	N.A.	280	160	150	N.A.	N.A.	100	80	200	N.A.	550	N.A.	46	72	180	N.A.	260	96	N.A.
Mercury	mg/kg	40				0.05	0.11	N.A.	0.12	0.14	0.09	N.A.	N.A.	0.07	0.10	0.10	N.A.	0.13	N.A.	<0.05	0.06	0.51	N.A.	0.40	0.10	N.A.
Asbestos in Soil																											
Total Sample Weight	g					1	N.A.	931	803	881	N.A.	800	924	1084	N.A.	N.A.	1009	895	970	N.A.	855	851	922	N.A.	N.A.	874
ACM in >7mm Sample	g					0.01	N.A.	<0.01	<0.01	<0.01	N.A.	<0.01	0.77	<0.01	N.A.	N.A.	<0.01	<0.01	<0.01	N.A.	<0.01	<0.01	<0.01	N.A.	N.A.	<0.01
AF/FA in >2mm to <7mm Sample	g					0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	N.A.	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	N.A.	<0.0001
AF/FA in <2mm Sample	g					0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	N.A.	<0.0001	<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.	N.A.	<0.0001
Asbestos in soil (>7mm ACM)	%w/w		0.01			0.01	N.A.	<0.01	<0.01	<0.01	N.A.	<0.01	0.01	<0.01	N.A.	N.A.	<0.01	<0.01	<0.01	N.A.	<0.01	<0.01	<0.01	N.A.	N.A.	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)	%w/w		0.001			0.001	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001
Asbestos in soil (<2mm AF/FA)	%w/w		0.001			0.001	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001
Asbestos in soil (<7mm AF/FA)	%w/w		0.001			0.001	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001	<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.	N.A.	<0.001
Fibre Type	No unit					0	N.A.	ORG,NAD	ORG,NAD	ORG,NAD	N.A.	ORG,NAD	CRY,ORG	ORG,NAD	N.A.	N.A.	ORG,NAD	ORG,NAD	ORG,NAD	N.A.	ORG,NAD	ORG,NAD	ORG,NAD	N.A.	N.A.	ORG,NAD

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical Pty Ltd Report No. 7161-ER-1-4
Table LAR1 Laboratory Analytical Results - Soils
Stockpile Contamination Assessment
Lot 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

Analyte Name	Units	Direct Contact HIL-A & HSL-A Residential (mg/kg)	Health Screening Levels Residential A	Inhalation / Vapour Intrusion HSL A 0m to <1m (mg/kg)	Management Limits - Residential (mg/kg)	Reporting Limit	Sample Name	SE178910.021	SE178910.022	SE178910.023	SE178910.024	SE178910.025	SE178910.026	SE178910.027
							Description	SP09-0.9	SP10-0.3	SP10-0.6	SP10-0.9	SP11-0.3	SP11-0.6	SP11-0.9
							Sample Date	9/5/2018	9/5/2018	9/5/2018	9/5/2018	9/5/2018	9/5/2018	9/5/2018
							Matrix	Soil	Soil	Soil	Soil	Soil	Soil	Soil
BTEXN in Soil														
Benzene	mg/kg	100		0.5		0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Toluene	mg/kg	14000		160		0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Ethylbenzene	mg/kg	4500		55		0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Total Xylenes	mg/kg	12000		40		0.3		N.A.	N.A.	<0.3	N.A.	N.A.	N.A.	<0.3
Naphthalene	mg/kg	1400		3		0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
TRH in Soils														
Benzene (F0)	mg/kg	100				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
TRH C6-C10	mg/kg	4400			700	25		N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25
TRH C6-C10 minus BTEX (F1)	mg/kg			45		25		N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25
TRH >C10-C16	mg/kg	3300			1000	25		N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg			110		25		N.A.	N.A.	<25	N.A.	N.A.	N.A.	<25
TRH >C16-C34 (F3)	mg/kg	4500			3500	90		N.A.	N.A.	470	N.A.	N.A.	N.A.	340
TRH >C34-C40 (F4)	mg/kg	6300			10000	120		N.A.	N.A.	<120	N.A.	N.A.	N.A.	<120
PAH in Soils														
Naphthalene	mg/kg	1400		3		0.1		N.A.	N.A.	0.2	0.1	<0.1	0.2	N.A.
2-methylnaphthalene	mg/kg					0.1		N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.
1-methylnaphthalene	mg/kg					0.1		N.A.	N.A.	<0.1	<0.1	<0.1	<0.1	N.A.
Acenaphthylene	mg/kg					0.1		N.A.	N.A.	0.8	0.6	0.7	1.4	N.A.
Acenaphthene	mg/kg					0.1		N.A.	N.A.	0.3	0.2	<0.1	0.1	N.A.
Fluorene	mg/kg					0.1		N.A.	N.A.	0.3	0.2	0.1	0.2	N.A.
Phenanthrene	mg/kg					0.1		N.A.	N.A.	3.4	2.6	2.6	2.5	N.A.
Anthracene	mg/kg					0.1		N.A.	N.A.	1.6	1.3	1.2	1.7	N.A.
Fluoranthene	mg/kg					0.1		N.A.	N.A.	10	7.3	7.2	8.8	N.A.
Pyrene	mg/kg					0.1		N.A.	N.A.	12	8.3	8.0	12	N.A.
Benzo(a)anthracene	mg/kg					0.1		N.A.	N.A.	7.0	4.7	4.7	6.9	N.A.
Chrysene	mg/kg					0.1		N.A.	N.A.	5.4	3.9	3.7	5.3	N.A.
Benzo(b&j)fluoranthene	mg/kg					0.1		N.A.	N.A.	8.2	6.0	5.7	9.3	N.A.
Benzo(k)fluoranthene	mg/kg					0.1		N.A.	N.A.	3.2	2.3	2.2	3.4	N.A.
Benzo(a)pyrene	mg/kg					0.1		N.A.	N.A.	7.0	5.1	4.9	8.3	N.A.
Indeno(1,2,3-cd)pyrene	mg/kg					0.1		N.A.	N.A.	4.5	3.4	3.2	5.8	N.A.
Dibenzo(ah)anthracene	mg/kg					0.1		N.A.	N.A.	1.1	0.8	0.8	1.4	N.A.
Benzo(ghi)perylene	mg/kg					0.1		N.A.	N.A.	4.4	3.4	3.2	6.0	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)					0.2		N.A.	N.A.	11	7.7	7.3	12	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	3				0.3		N.A.	N.A.	11	7.7	7.3	12	N.A.
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)					0.2		N.A.	N.A.	11	7.7	7.3	12	N.A.
Total PAH (18)	mg/kg					0.8		N.A.	N.A.	69	50	48	73	N.A.
Total PAH (NEPM/WHO 16)	mg/kg	300				0.8		N.A.	N.A.	69	50	48	73	N.A.
OCP in Soil														
Hexachlorobenzene (HCB)	mg/kg	10				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Alpha BHC	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Lindane	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Heptachlor	mg/kg	6				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Aldrin	mg/kg	6				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Dieldrin	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Beta BHC	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Delta BHC	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Heptachlor epoxide	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
o,p'-DDT	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
p,p'-DDT	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
o,p'-DDE	mg/kg	240				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
p,p'-DDE	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
o,p'-DDD	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
p,p'-DDD	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Alpha Endosulfan	mg/kg	270				0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Beta Endosulfan	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Gamma Chlordane	mg/kg	50				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Alpha Chlordane	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
trans-Nonachlor	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Endrin	mg/kg	10				0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Endosulfan sulphate	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Endrin Aldehyde	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Methoxychlor	mg/kg	300				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Endrin Ketone	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Isodrin	mg/kg					0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
Mirex	mg/kg	10				0.1		N.A.	N.A.	<0.1	N.A.	N.A.	N.A.	<0.1
PCB in Soil														
Arochlor 1016	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1221	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1232	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1242	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1248	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1254	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1260	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1262	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Arochlor 1268	mg/kg					0.2		N.A.	N.A.	<0.2	N.A.	N.A.	N.A.	<0.2
Total PCBs (Arochlors)	mg/kg	1				1		N.A.	N.A.	<1	N.A.	N.A.	N.A.	<1
Metals in Soil														
Arsenic, As	mg/kg	100				3		15	19	13	N.A.	13	N.A.	13
Cadmium, Cd	mg/kg	20				0.3		0.6	0.5	0.4	N.A.	0.4	N.A.	0.4
Chromium, Cr	mg/kg	100				0.3		17	13	15	N.A.	13	N.A.	10
Copper, Cu	mg/kg	6000				0.5		34	90	32	N.A.	27	N.A.	31
Lead, Pb	mg/kg	300				1		120	110	130	N.A.	120	N.A.	81
Nickel, Ni	mg/kg	400				0.5		16	4.5	4.4	N.A.	6.9	N.A.	13
Zinc, Zn	mg/kg	7400				0.5		570	210	150	N.A.	180	N.A.	110
Mercury	mg/kg	40				0.05		0.09	0.36	0.33	N.A.	0.25	N.A.	0.16
Asbestos in Soil														
Total Sample Weight	g					1		1089	979	N.A.	793	1114	944	N.A.
ACM in >7mm Sample	g					0.01		<0.01	<0.01	N.A.	<0.01	<0.01	<0.01	N.A.
AF/FA in >2mm to <7mm Sample	g					0.0001		<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.
AF/FA in <2mm Sample	g					0.0001		<0.0001	<0.0001	N.A.	<0.0001	<0.0001	<0.0001	N.A.
Asbestos in soil (>7mm ACM)	%w/w		0.01			0.01		<0.01	<0.01	N.A.	<0.01	<0.01	<0.01	N.A.
Asbestos in soil (>2mm to <7mm AF/FA)	%w/w		0.001			0.001		<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.
Asbestos in soil (<2mm AF/FA)	%w/w		0.001			0.001		<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.
Asbestos in soil (<7mm AF/FA)	%w/w		0.001			0.001		<0.001	<0.001	N.A.	<0.001	<0.001	<0.001	N.A.
Fibre Type	No unit					0		ORG,NAD	ORG,NAD	N.A.	ORG,NAD	ORG,NAD	ORG,NAD	N.A.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical Pty Ltd — **Report No. 7161-ER-1-4**

Table LAR2 Laboratory Analytical Results - RPD

Stockpile Contamination Assessment

Lot 3991 in DP1190132, Jordan Springs Boulevarde, Jordan Springs, NSW

Analyte Name	Units	Sample Name	SE178910.002	SE178910.028		S18-My13998			SE178910.008	SE178910.029		S18-My13999	
		Description	SP03-0.6	DUP1		DUP1A			SP05-0.6	DUP2		DUP2A	
		Sample Date	9/5/2018	9/5/2018	RPD %	9/4/2018	RPD %		9/5/2018	9/5/2018	RPD %	9/4/2018	RPD %
		Matrix	Soil	Soil		Soil			Soil	Soil		Soil	
		Reporting Limit	Result	Result		Result			Result	Result		Result	
Metals in Soil													
Arsenic, As	mg/kg	3	N.A.	7	#VALUE!	9.3	28		13	9	36	9.3	33
Cadmium, Cd	mg/kg	0.3	N.A.	0.3	#VALUE!	< 0.4	#VALUE!		<0.3	<0.3	#VALUE!	< 0.4	#VALUE!
Chromium, Cr	mg/kg	0.3	N.A.	19	#VALUE!	16	17		8.0	9.5	17	16	67
Copper, Cu	mg/kg	0.5	N.A.	33	#VALUE!	24	32		26	31	18	24	8
Lead, Pb	mg/kg	1	N.A.	190	#VALUE!	110	53		58	110	62	110	62
Nickel, Ni	mg/kg	0.5	N.A.	9.5	#VALUE!	13	31		25	19	27	13	63
Zinc, Zn	mg/kg	0.5	N.A.	430	#VALUE!	220	65		100	160	46	220	75
Mercury	mg/kg	0.05	N.A.	0.29	#VALUE!	0.2	37		0.07	0.09	25	0.2	96

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX A

SURVEY

MGA

ROWLAND PLACE

SEE SHEET 2

SANDSTOCK CRESCENT

PARADE

MATCHAM STREET

JORDAN

SPRINGS

BOULEVARD

McGARRITY'S

SEE SHEET 3

TYLER STREET

SEE SHEET 4

LAKESIDE

SEE SHEET 5

SEE SHEET 8

SEE SHEET 7

SEE SHEET 6

SEE SHEET 9

SEE SHEET 10

3391
DP 1190132
3.633 ha (Title)

3989
DP 1190132
5026 m² (Title)

3990
DP 1190132
2.345 ha (Title)

3992
DP 1190132
1.084 ha (Title)

3993
DP 1190132
1.183 ha (Title)

SEE SHEET 2 FOR LEGEND AND UNDERGROUND SERVICES

1:1000

GENERAL NOTES:-

1. THIS SURVEY IS NOT A 'LAND SURVEY' AS DEFINED BY THE SURVEYING AND SPATIAL INFORMATION ACT, 2002.
2. THE BOUNDARIES OF THE LAND HAVE NOT BEEN SURVEYED. THE RELATIONSHIP BETWEEN THE BOUNDARIES SHOWN AND FEATURES SURVEYED ARE APPROXIMATE AND SUITABLE FOR PLOTTING PURPOSES ONLY.
3. ONLY THOSE SERVICES VISIBLE AT THE TIME OF SURVEY HAVE BEEN LOCATED AND ARE QUALITY LEVEL A AS DEFINED BY AS 5488-2013.
4. UNDERGROUND SERVICES HAVE BEEN PLOTTED FROM 'DIAL-BEFORE'YOU-DIG' PLANS AND ARE QUALITY LEVEL D AS DEFINED BY AS 5488-2013. ALL RELEVANT AUTHORITIES MUST BE CONTRACTED TO DETERMINE THE FULL EXTENT OF SERVICES PRIOR TO ANY PLANNING OR WORKS NEAR THE SITE.
5. ONLY TREES GREATER THAN 3.5 METRES IN HEIGHT ARE SHOWN ON THIS PLAN AND THEIR POSITIONS AREA DIAGRAMMATIC ONLY AND MAY REQUIRE ADDITIONAL SURVEY WHERE CRITICAL TO DESIGN. NO TREES HAVE BEEN LOCATED ON LOTS 3990 & 3991 IN DP1190132.
6. CONTOURS ARE INDICATIVE AT GROUND FORM ONLY. SPOT LEVELS ONLY SHOULD BE USED FOR CALCULATIONS OF QUANTITIES WITH CAUTION.
7. CONTOUR INTERVAL 0.5 m.
8. ALL SETOUT LEVELS MUST BE REFERRED TO THE BENCH MARK.
9. THE ORIENTATION OF THIS PLAN IS MGA NORTH AS DETERMINED FROM DP 1190132. THE VARIATION FROM MGA NORTH TO TRUE NORTH IS APPROXIMATELY 1°06'.
10. SCHEDULE OF EASEMENTS NOTED ON TITLES DATED 11/01/2017:

LOT 3989 IN DP 1190132
APPURTENANT (NOT SHOWN ON PLAN):
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274)
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528)
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620)
* EASEMENT FOR TRANSMISSION LINE 4.85 WIDE (N324748)
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196)

LOT 3990 IN DP 1190132
APPURTENANT (NOT SHOWN ON PLAN):
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274)
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528)
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620)
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748)
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196)

BURDENED:
* EASEMENT FOR SERVICES VARIABLE WIDTH (DP 1190132) SHOWN 'S'
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3991 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP1190132) SHOWN 'R'
* EASEMENT FOR SERVICES VARIABLE WIDTH (DP 1190132) SHOWN 'S'
* COVENANT (DP 1190132)

BURDENED:
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3992 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP1190132) SHOWN 'R'

BURDENED:
* RIGHT OF CARRIAGE WAY 11.8 WIDE & VARIABLE WIDTH (DP 1190132) SHOWN 'R'

LOT 3993 IN DP 1190132
APPURTENANT:
* EASEMENT FOR DRAINAGE 10.06 WIDE (D431274) NOT SHOWN ON PLAN
* EASEMENT FOR POWER LINE 9.145 WIDE (K780528) NOT SHOWN ON PLAN
* EASEMENT FOR TRANSMISSION LINE 4.88 WIDE (L569620) NOT SHOWN ON PLAN
* EASEMENT FOR ELECTRICITY 4.85 WIDE (N324748) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 20.115 WIDE (DP 789196) NOT SHOWN ON PLAN
* RIGHT OF CARRIAGE WAY 11.8 WIDE (DP 1190132) SHOWN 'R'

11. COVENANTS AND RESTRICTIONS ARE NOTED ON ALL TITLES. THESE HAVE NOT BEEN INVESTIGATED.
12. MGA COORDINATES ARE BASED ON SSM 175299 (CLASS C ORDER 3)

DIAL BEFORE YOU DIG www.1100.com.au

©COPYRIGHT
SDG is the owner of the copyright subsisting in these drawings, plans, designs and specifications. They must not be used, reproduced or copied in whole or in part without prior written consent of SDG

ISSUE	DATE	AMENDMENT
A	20/12/16	ORIGINAL ISSUE
B	15/02/17	ADDITIONAL INFORMATION LOT 3993 DP1190132
C	15/01/18	ADDITIONAL INFORMATION LOTS 3390 & 3391 DP1190132

CLIENT: LENDLEASE

SCALE 1:1000
ORIGIN OF LEVELS: SSM 80426 RL 47.288
DATUM: A.H.D.
REF.: 7202
DATE: 15/01/2018
SURV/CHK: SW/CT
SHEET 1 OF 10 SHEETS
PLAN A1
ISSUE C

DETAIL AND LEVEL SURVEY OF PART OF JORDAN SPRINGS BOULEVARD, LAKESIDE PARADE & JUBILEE DRIVE JORDAN SPRINGS

SDG LAND DEVELOPMENT SOLUTIONS A.B.N. 85 213 023 621
Suite 1 3 Railway Street BAULKHAM HILLS 2153
P.O.Box 2572 NORTH PARRAMATTA 1750
t: (02) 9630 7955
e: office@sdg.net.au
w: www.sdg.net.au

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX B

LOGS

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP03
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, brown, soft, dry.	SP03-0.3 SP03-0.6 SP03-0.9	D	Some brick fragments, concrete cobbles/boulders and metal fragments, with trace glass and tile fragments, and potential ACM fragments observed.
			1.0			End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP04
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Started: 9/5/18
Project: Stockpile Waste Classification and Validation
Finished: 9/5/18
Location: Jordan Springs Boulevard, Jordan Springs NSW
Borehole Size:
Rig Type: 3.5T Excavator **Driller:** Ken Coles **Northing:** **Logged:** JW
RL Surface: **Contractor:** Ken Coles **Easting:** **Checked:** CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator						FILL: Silty CLAY, brown, soft, dry.		D	Some rootlets and weeds, concrete cobbles/boulders and metal fragments, with brick fragments, trace glass and tile fragments, and potential ACM fragments observed.
							SP04-0.3		
			0.5						
							SP04-0.6		
							SP04-0.9		
			1.0			End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP05
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, brown, soft, dry.	SP05-0.3 SP05-0.6 SP05-0.9	D	Some brick fragments, concrete cobbles/boulders and metal fragments, with trace glass and tile fragments and rubber sheeting observed.
			1.0			End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP06
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, brown/yellow, soft, dry with some sand.	SP06-0.3 SP06-0.6 SP06-0.9	D	Some brick fragments, concrete cobbles/boulders and metal fragments, with trace glass and tile fragments observed.
			1.0			End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP07
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, brown, soft, dry.	SP07-0.3	D	Some brick fragments, concrete cobbles/boulders and metal fragments, with trace glass and tile fragments, and potential ACM fragments observed.
			1.0				SP07-0.6		
							SP07-1.0		
						End of hole at 1.1m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP08
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, pale brown/grey, soft, dry with trace sand and gravels.	SP08-0.3	D	Some brick fragments, concrete boulders/cobbles and metal fragments, with trace glass and tile fragments, and potential ACM fragments observed.
							SP08-0.6		
			1.0				SP08-0.9		
						End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP09
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator			0.5			FILL: Silty CLAY, brown, soft, dry.	SP09-0.3	D	Large rusted metal pole, some brick fragments, concrete cobbles/boulders/small slabs, with trace glass and tile fragments, and potential ACM fragments observed.
							SP09-0.6		
			1.0				SP09-0.9		
						End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP10
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator						FILL: Sandy CLAY, pale brown/pale yellow, medium grained, soft, dry.		D	Some brick fragments, concrete cobbles and metal fragments, with trace glass and tile fragments, and potential ACM fragments observed.
							SP10-0.3		
			0.5						
							SP10-0.6		
							SP10-0.9		
			1.0						
						End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
Manage the earth, eliminate the risk

Alliance Geotechnical Pty Ltd
T: 02 9675 1777
F: 02 9675 1888
E: office@allgeo.com.au
W: www.allgeo.com.au

BH No: SP11
Sheet: 1 of 1
Job No: 7161

Borehole Log

Client: LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Project: Stockpile Waste Classification and Validation
Location: Jordan Springs Boulevard, Jordan Springs NSW

Started: 9/5/18
Finished: 9/5/18
Borehole Size:

Rig Type: 3.5T Excavator
Driller: Ken Coles
Northing:
Logged: JW

RL Surface:
Contractor: Ken Coles
Easting:
Checked: CC

Method	Water	RL (m)	Depth (m)	Graphic Log	Classification Symbol	Material Description	Samples Tests Remarks	Moisture Condition	Additional Observations
3.5T Excavator						FILL: Silty CLAY, pale brown/brown, soft, dry with some sand.		D	Some clay boulders, concrete cobbles/boulders and metal fragments, with trace glass and tile fragments, and potential ACM fragments observed.
							SP11-0.3		
			0.5						
							SP11-0.6		
							SP11-0.9		
			1.0						
						End of hole at 1.0m - target depth			

BOREHOLE / TEST PIT 7161-ER-1-4-LOGS.GPJ GINT STD AUSTRALIA.GDT 9/5/18

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX C

LABORATORY

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910 R0**
Date Received	9/5/2018
Date Reported	16/5/2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Sample # 7 : Asbestos found in cement sheet fragment in >7mm fraction.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam and Yusuf Kuthpudin .

SIGNATORIES

Akheeqar Beniameen
Chemist

Dong Liang
Metals/Inorganics Team Leader

Kamrul Ahsan
Senior Chemist

Ly Kim Ha
Organic Section Head

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

VOC's in Soil [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6	<0.6
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Volatile Petroleum Hydrocarbons in Soil [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
TRH C6-C9	mg/kg	20	<20	<20	<20	<20	<20
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10	mg/kg	25	<25	<25	<25	<25	<25
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25	<25

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
TRH C6-C9	mg/kg	20	<20	<20	<20	<20
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10	mg/kg	25	<25	<25	<25	<25
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25

TRH (Total Recoverable Hydrocarbons) in Soil [AN403] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
TRH C10-C14	mg/kg	20	<20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	390	97	160	120	150
TRH C29-C36	mg/kg	45	230	92	100	70	90
TRH C37-C40	mg/kg	100	<100	<100	<100	<100	<100
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	560	160	230	180	220
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120	<120
TRH C10-C36 Total	mg/kg	110	620	190	260	190	240
TRH C10-C40 Total (F bands)	mg/kg	210	560	<210	230	<210	220

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
TRH C10-C14	mg/kg	20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	150	300	320	220
TRH C29-C36	mg/kg	45	70	190	200	170
TRH C37-C40	mg/kg	100	<100	<100	<100	<100
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	200	440	470	340
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120
TRH C10-C36 Total	mg/kg	110	220	490	520	390
TRH C10-C40 Total (F bands)	mg/kg	210	<210	440	470	340

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

PAH (Polynuclear Aromatic Hydrocarbons) in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007
Naphthalene	mg/kg	0.1	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.8	0.5	0.4	0.2	0.2
Acenaphthene	mg/kg	0.1	0.5	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	0.3	0.1	0.2	<0.1	<0.1
Phenanthrene	mg/kg	0.1	6.6	1.8	1.8	0.4	0.7
Anthracene	mg/kg	0.1	2.9	0.8	0.7	0.2	0.3
Fluoranthene	mg/kg	0.1	15	4.5	2.6	1.0	1.9
Pyrene	mg/kg	0.1	18	4.4	2.7	1.0	2.0
Benzo(a)anthracene	mg/kg	0.1	7.7	2.7	1.4	0.6	1.2
Chrysene	mg/kg	0.1	6.4	2.1	1.2	0.5	1.0
Benzo(b&j)fluoranthene	mg/kg	0.1	8.2	3.4	1.7	0.8	1.5
Benzo(k)fluoranthene	mg/kg	0.1	3.1	1.2	0.7	0.4	0.6
Benzo(a)pyrene	mg/kg	0.1	7.1	2.9	1.5	0.7	1.3
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	4.2	1.9	0.9	0.5	0.8
Dibenzo(ah)anthracene	mg/kg	0.1	1.0	0.4	0.2	0.1	0.2
Benzo(ghi)perylene	mg/kg	0.1	4.3	2.0	1.0	0.5	0.9
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	11	4.3	2.2	1.1	2.0
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	11	4.3	2.2	1.1	2.0
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	11	4.3	2.2	1.1	2.0
Total PAH (18)	mg/kg	0.8	86	29	17	7.0	13
Total PAH (NEPM/WHO 16)	mg/kg	0.8	86	29	17	7.0	13

PARAMETER	UOM	LOR	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Naphthalene	mg/kg	0.1	<0.1	0.5	0.3	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	0.4	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	0.4	0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.2	1.4	0.5	0.3	0.4
Acenaphthene	mg/kg	0.1	<0.1	0.2	<0.1	0.2	0.2
Fluorene	mg/kg	0.1	<0.1	0.6	0.2	0.1	<0.1
Phenanthrene	mg/kg	0.1	0.4	6.3	2.0	1.4	1.4
Anthracene	mg/kg	0.1	0.3	1.9	0.7	0.8	0.8
Fluoranthene	mg/kg	0.1	2.1	8.5	3.6	4.9	5.1
Pyrene	mg/kg	0.1	2.4	9.4	3.2	5.7	5.7
Benzo(a)anthracene	mg/kg	0.1	1.5	4.9	1.9	3.5	3.4
Chrysene	mg/kg	0.1	1.2	3.7	1.6	2.8	2.8
Benzo(b&j)fluoranthene	mg/kg	0.1	2.0	5.2	2.4	4.4	4.1
Benzo(k)fluoranthene	mg/kg	0.1	0.7	2.0	1.0	1.6	1.6
Benzo(a)pyrene	mg/kg	0.1	1.7	4.4	2.1	3.7	3.6
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	1.0	2.6	1.4	2.3	2.2
Dibenzo(ah)anthracene	mg/kg	0.1	0.3	0.7	0.3	0.6	0.5
Benzo(ghi)perylene	mg/kg	0.1	1.1	2.5	1.4	2.3	2.2
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	2.5	6.5	3.1	5.5	5.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	2.5	6.5	3.1	5.5	5.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	2.5	6.5	3.1	5.5	5.3
Total PAH (18)	mg/kg	0.8	15	55	23	35	34
Total PAH (NEPM/WHO 16)	mg/kg	0.8	15	55	22	35	34

PAH (Polynuclear Aromatic Hydrocarbons) in Soil [AN420] Tested: 11/5/2018 (continued)

PARAMETER	UOM	LOR	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.6 SOIL - 9/5/2018 SE178910.020	SP10-0.6 SOIL - 9/5/2018 SE178910.023
Naphthalene	mg/kg	0.1	0.2	0.2	0.1	<0.1	0.2
2-methylnaphthalene	mg/kg	0.1	<0.1	0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	0.1	0.2	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	1.2	1.0	1.2	0.2	0.8
Acenaphthene	mg/kg	0.1	0.1	<0.1	0.2	<0.1	0.3
Fluorene	mg/kg	0.1	0.2	0.2	0.5	<0.1	0.3
Phenanthrene	mg/kg	0.1	3.2	2.2	5.1	0.6	3.4
Anthracene	mg/kg	0.1	1.6	1.0	1.8	0.3	1.6
Fluoranthene	mg/kg	0.1	8.2	5.2	11	1.5	10
Pyrene	mg/kg	0.1	9.5	5.0	12	1.4	12
Benzo(a)anthracene	mg/kg	0.1	5.9	3.4	6.3	0.9	7.0
Chrysene	mg/kg	0.1	4.4	2.5	4.8	0.7	5.4
Benzo(b&j)fluoranthene	mg/kg	0.1	7.2	4.0	7.9	1.0	8.2
Benzo(k)fluoranthene	mg/kg	0.1	2.6	1.4	2.0	0.5	3.2
Benzo(a)pyrene	mg/kg	0.1	6.0	3.3	6.0	0.9	7.0
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	3.8	2.2	3.7	0.6	4.5
Dibenzo(ah)anthracene	mg/kg	0.1	1.0	0.5	1.0	0.2	1.1
Benzo(ghi)perylene	mg/kg	0.1	3.7	2.1	3.6	0.6	4.4
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	9.0	5.0	9.0	1.3	11
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	9.0	5.0	9.0	1.3	11
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	9.0	5.0	9.0	1.3	11
Total PAH (18)	mg/kg	0.8	59	34	66	9.2	69
Total PAH (NEPM/WHO 16)	mg/kg	0.8	59	34	66	9.2	69

PARAMETER	UOM	LOR	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.6 SOIL - 9/5/2018 SE178910.026
Naphthalene	mg/kg	0.1	0.1	<0.1	0.2
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.6	0.7	1.4
Acenaphthene	mg/kg	0.1	0.2	<0.1	0.1
Fluorene	mg/kg	0.1	0.2	0.1	0.2
Phenanthrene	mg/kg	0.1	2.6	2.6	2.5
Anthracene	mg/kg	0.1	1.3	1.2	1.7
Fluoranthene	mg/kg	0.1	7.3	7.2	8.8
Pyrene	mg/kg	0.1	8.3	8.0	12
Benzo(a)anthracene	mg/kg	0.1	4.7	4.7	6.9
Chrysene	mg/kg	0.1	3.9	3.7	5.3
Benzo(b&j)fluoranthene	mg/kg	0.1	6.0	5.7	9.3
Benzo(k)fluoranthene	mg/kg	0.1	2.3	2.2	3.4
Benzo(a)pyrene	mg/kg	0.1	5.1	4.9	8.3
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	3.4	3.2	5.8
Dibenzo(ah)anthracene	mg/kg	0.1	0.8	0.8	1.4
Benzo(ghi)perylene	mg/kg	0.1	3.4	3.2	6.0
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	7.7	7.3	12
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	7.7	7.3	12
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	7.7	7.3	12
Total PAH (18)	mg/kg	0.8	50	48	73
Total PAH (NEPM/WHO 16)	mg/kg	0.8	50	48	73

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

OC Pesticides in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1	<1

OC Pesticides in Soil [AN420] Tested: 11/5/2018 (continued)

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1

PCBs in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1	<1

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES [AN040/AN320] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.6 SOIL - 9/5/2018 SE178910.008
Arsenic, As	mg/kg	3	9	5	12	8	13
Cadmium, Cd	mg/kg	0.3	0.3	<0.3	0.4	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	12	11	11	9.8	8.0
Copper, Cu	mg/kg	0.5	25	29	43	34	26
Lead, Pb	mg/kg	1	140	120	93	91	58
Nickel, Ni	mg/kg	0.5	6.4	6.6	17	18	25
Zinc, Zn	mg/kg	0.5	320	280	160	150	100

PARAMETER	UOM	LOR	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Arsenic, As	mg/kg	3	11	10	11	7	11
Cadmium, Cd	mg/kg	0.3	0.3	0.4	0.6	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	10	12	19	8.2	16
Copper, Cu	mg/kg	0.5	30	41	40	34	25
Lead, Pb	mg/kg	1	62	110	170	63	53
Nickel, Ni	mg/kg	0.5	26	16	17	27	16
Zinc, Zn	mg/kg	0.5	80	200	550	46	72

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Arsenic, As	mg/kg	3	37	61	17	15	19
Cadmium, Cd	mg/kg	0.3	0.9	1.3	1.4	0.6	0.5
Chromium, Cr	mg/kg	0.3	15	14	10	17	13
Copper, Cu	mg/kg	0.5	26	21	35	34	30
Lead, Pb	mg/kg	1	100	83	69	120	110
Nickel, Ni	mg/kg	0.5	5.8	4.0	10	16	4.5
Zinc, Zn	mg/kg	0.5	180	260	96	570	210

PARAMETER	UOM	LOR	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
Arsenic, As	mg/kg	3	13	13	13	7	9
Cadmium, Cd	mg/kg	0.3	0.4	0.4	0.4	0.3	<0.3
Chromium, Cr	mg/kg	0.3	15	13	10	19	9.5
Copper, Cu	mg/kg	0.5	32	27	31	33	31
Lead, Pb	mg/kg	1	130	120	81	190	110
Nickel, Ni	mg/kg	0.5	4.4	6.9	13	9.5	19
Zinc, Zn	mg/kg	0.5	150	180	110	430	160

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Mercury in Soil [AN312] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.6 SOIL - 9/5/2018 SE178910.008
Mercury	mg/kg	0.05	0.11	0.12	0.14	0.09	0.07

PARAMETER	UOM	LOR	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Mercury	mg/kg	0.05	0.10	0.10	0.13	<0.05	0.06

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Mercury	mg/kg	0.05	0.51	0.40	0.10	0.09	0.36

PARAMETER	UOM	LOR	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
Mercury	mg/kg	0.05	0.33	0.25	0.16	0.29	0.09

Moisture Content [AN002] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005
% Moisture	%w/w	0.5	9.7	8.9	7.8	11	7.2

PARAMETER	UOM	LOR	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010
% Moisture	%w/w	0.5	8.2	8.7	9.5	11	8.5

PARAMETER	UOM	LOR	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
% Moisture	%w/w	0.5	9.5	8.0	8.8	9.0	8.7

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.6 SOIL - 9/5/2018 SE178910.020
% Moisture	%w/w	0.5	9.5	7.8	8.1	10	8.0

PARAMETER	UOM	LOR	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025
% Moisture	%w/w	0.5	7.5	12	12	11	7.9

PARAMETER	UOM	LOR	SP11-0.6 SOIL - 9/5/2018 SE178910.026	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
% Moisture	%w/w	0.5	8.9	8.0	8.5	10

Gravimetric Determination of Asbestos in Soil [AN605] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007
Total Sample Weight*	g	1	931	803	881	800	924
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	0.77
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	CRY,ORG

PARAMETER	UOM	LOR	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Total Sample Weight*	g	1	1084	1009	895	970	855
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP09-0.6 SOIL - 9/5/2018 SE178910.020	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Total Sample Weight*	g	1	851	922	874	1089	979
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.6 SOIL - 9/5/2018 SE178910.026
Total Sample Weight*	g	1	793	1114	944
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

VOCs in Water [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	TRIP BLANK WATER - 9/5/2018 SE178910.030	TRIP SPIKE WATER - 9/5/2018 SE178910.031
Benzene	µg/L	0.5	<0.5	[93%]
Toluene	µg/L	0.5	<0.5	[96%]
Ethylbenzene	µg/L	0.5	<0.5	[89%]
m/p-xylene	µg/L	1	<1	[91%]
o-xylene	µg/L	0.5	<0.5	[92%]
Naphthalene	µg/L	0.5	<0.5	-
Total Xylenes	µg/L	1.5	<1.5	-
Total BTEX	µg/L	3	<3	-

METHOD	METHODOLOGY SUMMARY
AN002	The test is carried out by drying (at either 40°C or 105°C) a known mass of sample in a weighed evaporating basin. After fully dry the sample is re-weighed. Samples such as sludge and sediment having high percentages of moisture will take some time in a drying oven for complete removal of water.
AN040/AN320	A portion of sample is digested with nitric acid to decompose organic matter and hydrochloric acid to complete the digestion of metals. The digest is then analysed by ICP OES with metals results reported on the dried sample basis. Based on USEPA method 200.8 and 6010C.
AN040	A portion of sample is digested with Nitric acid to decompose organic matter and Hydrochloric acid to complete the digestion of metals and then filtered for analysis by ASS or ICP as per USEPA Method 200.8.
AN312	Mercury by Cold Vapour AAS in Soils: After digestion with nitric acid, hydrogen peroxide and hydrochloric acid, mercury ions are reduced by stannous chloride reagent in acidic solution to elemental mercury. This mercury vapour is purged by nitrogen into a cold cell in an atomic absorption spectrometer or mercury analyser. Quantification is made by comparing absorbances to those of the calibration standards. Reference APHA 3112/3500
AN403	Total Recoverable Hydrocarbons: Determination of Hydrocarbons by gas chromatography after a solvent extraction. Detection is by flame ionisation detector (FID) that produces an electronic signal in proportion to the combustible matter passing through it. Total Recoverable Hydrocarbons (TRH) are routinely reported as four alkane groupings based on the carbon chain length of the compounds: C6-C9, C10-C14, C15-C28 and C29-C36 and in recognition of the NEPM 1999 (2013), >C10-C16 (F2), >C16-C34 (F3) and >C34-C40 (F4). F2 is reported directly and also corrected by subtracting Naphthalene (from VOC method AN433) where available.
AN403	Additionally, the volatile C6-C9 fraction may be determined by a purge and trap technique and GC/MS because of the potential for volatiles loss. Total Petroleum Hydrocarbons (TPH) follows the same method of analysis after silica gel cleanup of the solvent extract. Aliphatic/Aromatic Speciation follows the same method of analysis after fractionation of the solvent extract over silica with differential polarity of the eluent solvents .
AN403	The GC/FID method is not well suited to the analysis of refined high boiling point materials (ie lubricating oils or greases) but is particularly suited for measuring diesel, kerosene and petrol if care to control volatility is taken. This method will detect naturally occurring hydrocarbons, lipids, animal fats, phenols and PAHs if they are present at sufficient levels, dependent on the use of specific cleanup/fractionation techniques. Reference USEPA 3510B, 8015B.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN420	SVOC Compounds: Semi-Volatile Organic Compounds (SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN433	VOCs and C6-C9 Hydrocarbons by GC-MS P&T: VOC`s are volatile organic compounds. The sample is presented to a gas chromatograph via a purge and trap (P&T) concentrator and autosampler and is detected with a Mass Spectrometer (MSD). Solid samples are initially extracted with methanol whilst liquid samples are processed directly. References: USEPA 5030B, 8020A, 8260.
AN605	This technique gravimetrically determines the mass of Asbestos Containing Material retained on a 7mm Sieve and assumes that 15% of this ACM is asbestos. This calculated asbestos weight is then calculated as a percentage of the total sample weight.
AN605	This technique also gravimetrically determines the mass of Fibrous Asbestos (FA) and Asbestos Fines (AF) Containing Material retained on and passing a 2mm sieve post 7mm sieving. Assumes that FA and AF are 100% asbestos containing. This calculated asbestos weight is then calculated as a percentage of the total sample weight. This does not include free fibres which are only observed by standard trace analysis as per AN 602.
AN605	AMO = Amosite Detected CRY = Chrysotile Detected CRO = Crocidolite Detected ORG = Organic Fibres Detected SMF = Synthetic Mineral Fibres Detected UMF = Unknown Mineral Fibres Detected NAD = No Asbestos Detected
AN605	Insofar as is technically feasible, this report is consistent with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment Remediation and Management of Asbestos - Contaminated Sites in Western Australia - May 2009.

FOOTNOTES

*	NATA accreditation does not cover the performance of this service.	-	Not analysed.	UOM	Unit of Measure.
		NVL	Not validated.	LOR	Limit of Reporting.
**	Indicative data, theoretical holding time exceeded.	IS	Insufficient sample for analysis.	↑↓	Raised/lowered Limit of Reporting.
		LNR	Sample listed, but not received.		

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calculated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

STATEMENT OF QA/QC PERFORMANCE

SE178910 R0

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910 R0**
Date Received	09 May 2018
Date Reported	16 May 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met with the exception of the following:

Duplicate	Total Recoverable Elements In Soil/Waste Solids/Materials by ICPOES	3 Items
Matrix Spike	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	1 Item
	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	1 Item
	TRH (Total Recoverable Hydrocarbons) In Soil	1 Item

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	29 Soil, 2 Water
Date documentation received	9/5/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Gravimetric Determination of Asbestos in Soil

Method: ME-(AU)-[ENV]AN605

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.6	SE178910.002	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP03-0.9	SE178910.003	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.3	SE178910.004	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.9	SE178910.006	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.3	SE178910.007	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.6	SE178910.008	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.6	SE178910.011	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.9	SE178910.012	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-0.3	SE178910.013	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-1.0	SE178910.015	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.3	SE178910.016	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.6	SE178910.017	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.6	SE178910.020	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.9	SE178910.021	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.3	SE178910.022	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.9	SE178910.024	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.3	SE178910.025	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.6	SE178910.026	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP03-0.9	SE178910.003	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP04-0.3	SE178910.004	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP07-1.0	SE178910.015	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.3	SE178910.016	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.3	SE178910.019	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP09-0.9	SE178910.021	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP10-0.3	SE178910.022	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
DUP1	SE178910.028	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
DUP2	SE178910.029	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018

Moisture Content

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP03-0.6	SE178910.002	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP03-0.9	SE178910.003	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.3	SE178910.004	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.6	SE178910.005	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.9	SE178910.006	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.3	SE178910.007	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.6	SE178910.008	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.9	SE178910.009	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.3	SE178910.010	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.6	SE178910.011	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.9	SE178910.012	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-0.3	SE178910.013	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-0.6	SE178910.014	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-1.0	SE178910.015	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP08-0.3	SE178910.016	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP08-0.6	SE178910.017	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Moisture Content (continued)

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP08-0.9	SE178910.018	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.3	SE178910.019	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.6	SE178910.020	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.9	SE178910.021	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.3	SE178910.022	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.6	SE178910.023	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.9	SE178910.024	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.3	SE178910.025	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.6	SE178910.026	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.9	SE178910.027	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
DUP1	SE178910.028	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
DUP2	SE178910.029	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP03-0.9	SE178910.003	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.3	SE178910.004	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.6	SE178910.005	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.6	SE178910.008	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.9	SE178910.009	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.3	SE178910.010	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.9	SE178910.012	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-0.6	SE178910.014	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-1.0	SE178910.015	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.3	SE178910.016	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.9	SE178910.018	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.3	SE178910.019	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.9	SE178910.021	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.3	SE178910.022	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.6	SE178910.023	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.3	SE178910.025	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.9	SE178910.027	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
DUP1	SE178910.028	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
DUP2	SE178910.029	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

TRH (Total Recoverable Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP04-0.6	SE178910.005	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP05-0.9	SE178910.009	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP06-0.3	SE178910.010	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP07-0.6	SE178910.014	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP08-0.9	SE178910.018	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP09-0.3	SE178910.019	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP10-0.6	SE178910.023	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018
SP11-0.9	SE178910.027	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
TRIP BLANK	SE178910.030	LB147735	09 May 2018	09 May 2018	16 May 2018	11 May 2018	20 Jun 2018	15 May 2018
TRIP SPIKE	SE178910.031	LB147735	09 May 2018	09 May 2018	16 May 2018	11 May 2018	20 Jun 2018	15 May 2018

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP04-0.6	SE178910.005	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP05-0.9	SE178910.009	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP06-0.3	SE178910.010	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP07-0.6	SE178910.014	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP08-0.9	SE178910.018	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP09-0.3	SE178910.019	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP10-0.6	SE178910.023	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018
SP11-0.9	SE178910.027	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

OC Pesticides in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	97
	SP04-0.6	SE178910.005	%	60 - 130%	105
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	97
	SP07-0.6	SE178910.014	%	60 - 130%	85
	SP08-0.9	SE178910.018	%	60 - 130%	89
	SP09-0.3	SE178910.019	%	60 - 130%	102
	SP10-0.6	SE178910.023	%	60 - 130%	93
	SP11-0.9	SE178910.027	%	60 - 130%	88

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	86
	SP03-0.6	SE178910.002	%	70 - 130%	92
	SP04-0.6	SE178910.005	%	70 - 130%	90
	SP04-0.9	SE178910.006	%	70 - 130%	92
	SP05-0.3	SE178910.007	%	70 - 130%	90
	SP05-0.6	SE178910.008	%	70 - 130%	88
	SP06-0.6	SE178910.011	%	70 - 130%	90
	SP06-0.9	SE178910.012	%	70 - 130%	88
	SP07-0.3	SE178910.013	%	70 - 130%	90
	SP07-0.6	SE178910.014	%	70 - 130%	94
	SP08-0.6	SE178910.017	%	70 - 130%	90
	SP08-0.9	SE178910.018	%	70 - 130%	94
	SP09-0.3	SE178910.019	%	70 - 130%	92
	SP09-0.6	SE178910.020	%	70 - 130%	90
	SP10-0.6	SE178910.023	%	70 - 130%	90
	SP10-0.9	SE178910.024	%	70 - 130%	102
	SP11-0.3	SE178910.025	%	70 - 130%	90
	SP11-0.6	SE178910.026	%	70 - 130%	96
d14-p-terphenyl (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	88
	SP03-0.6	SE178910.002	%	70 - 130%	94
	SP04-0.6	SE178910.005	%	70 - 130%	92
	SP04-0.9	SE178910.006	%	70 - 130%	98
	SP05-0.3	SE178910.007	%	70 - 130%	94
	SP05-0.6	SE178910.008	%	70 - 130%	94
	SP06-0.6	SE178910.011	%	70 - 130%	96
	SP06-0.9	SE178910.012	%	70 - 130%	92
	SP07-0.3	SE178910.013	%	70 - 130%	92
	SP07-0.6	SE178910.014	%	70 - 130%	96
	SP08-0.6	SE178910.017	%	70 - 130%	92
	SP08-0.9	SE178910.018	%	70 - 130%	96
	SP09-0.3	SE178910.019	%	70 - 130%	96
	SP09-0.6	SE178910.020	%	70 - 130%	94
	SP10-0.6	SE178910.023	%	70 - 130%	92
	SP10-0.9	SE178910.024	%	70 - 130%	102
	SP11-0.3	SE178910.025	%	70 - 130%	92
	SP11-0.6	SE178910.026	%	70 - 130%	96
d5-nitrobenzene (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	80
	SP03-0.6	SE178910.002	%	70 - 130%	86
	SP04-0.6	SE178910.005	%	70 - 130%	84
	SP04-0.9	SE178910.006	%	70 - 130%	84
	SP05-0.3	SE178910.007	%	70 - 130%	80
	SP05-0.6	SE178910.008	%	70 - 130%	78
	SP06-0.6	SE178910.011	%	70 - 130%	82
	SP06-0.9	SE178910.012	%	70 - 130%	82
	SP07-0.3	SE178910.013	%	70 - 130%	80
	SP07-0.6	SE178910.014	%	70 - 130%	88
	SP08-0.6	SE178910.017	%	70 - 130%	84
	SP08-0.9	SE178910.018	%	70 - 130%	88
	SP09-0.3	SE178910.019	%	70 - 130%	88

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued) — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
d5-nitrobenzene (Surrogate)	SP09-0.6	SE178910.020	%	70 - 130%	84
	SP10-0.6	SE178910.023	%	70 - 130%	86
	SP10-0.9	SE178910.024	%	70 - 130%	98
	SP11-0.3	SE178910.025	%	70 - 130%	90
	SP11-0.6	SE178910.026	%	70 - 130%	96

PCBs in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	97
	SP04-0.6	SE178910.005	%	60 - 130%	105
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	97
	SP07-0.6	SE178910.014	%	60 - 130%	85
	SP08-0.9	SE178910.018	%	60 - 130%	89
	SP09-0.3	SE178910.019	%	60 - 130%	102
	SP10-0.6	SE178910.023	%	60 - 130%	93
	SP11-0.9	SE178910.027	%	60 - 130%	88

VOC's in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	76
	SP04-0.6	SE178910.005	%	60 - 130%	97
	SP05-0.9	SE178910.009	%	60 - 130%	81
	SP06-0.3	SE178910.010	%	60 - 130%	77
	SP07-0.6	SE178910.014	%	60 - 130%	74
	SP08-0.9	SE178910.018	%	60 - 130%	76
	SP09-0.3	SE178910.019	%	60 - 130%	75
	SP10-0.6	SE178910.023	%	60 - 130%	79
	SP11-0.9	SE178910.027	%	60 - 130%	76
d4-1,2-dichloroethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	93
	SP05-0.9	SE178910.009	%	60 - 130%	103
	SP06-0.3	SE178910.010	%	60 - 130%	108
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	99
	SP09-0.3	SE178910.019	%	60 - 130%	100
	SP10-0.6	SE178910.023	%	60 - 130%	90
	SP11-0.9	SE178910.027	%	60 - 130%	99
d8-toluene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	84
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	91
	SP07-0.6	SE178910.014	%	60 - 130%	96
	SP08-0.9	SE178910.018	%	60 - 130%	102
	SP09-0.3	SE178910.019	%	60 - 130%	96
	SP10-0.6	SE178910.023	%	60 - 130%	94
	SP11-0.9	SE178910.027	%	60 - 130%	85
Dibromofluoromethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	100
	SP04-0.6	SE178910.005	%	60 - 130%	91
	SP05-0.9	SE178910.009	%	60 - 130%	109
	SP06-0.3	SE178910.010	%	60 - 130%	98
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	96
	SP09-0.3	SE178910.019	%	60 - 130%	101
	SP10-0.6	SE178910.023	%	60 - 130%	80
	SP11-0.9	SE178910.027	%	60 - 130%	121

VOCs in Water — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	98
	TRIP SPIKE	SE178910.031	%	40 - 130%	85
d4-1,2-dichloroethane (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	114

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOCs in Water (continued) — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
d4-1,2-dichloroethane (Surrogate)	TRIP SPIKE	SE178910.031	%	40 - 130%	97
d8-toluene (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	103
	TRIP SPIKE	SE178910.031	%	40 - 130%	97
Dibromofluoromethane (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	118
	TRIP SPIKE	SE178910.031	%	40 - 130%	97

Volatile Petroleum Hydrocarbons in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	76
	SP04-0.6	SE178910.005	%	60 - 130%	97
	SP05-0.9	SE178910.009	%	60 - 130%	81
	SP06-0.3	SE178910.010	%	60 - 130%	77
	SP07-0.6	SE178910.014	%	60 - 130%	74
	SP08-0.9	SE178910.018	%	60 - 130%	76
	SP09-0.3	SE178910.019	%	60 - 130%	75
	SP10-0.6	SE178910.023	%	60 - 130%	79
	SP11-0.9	SE178910.027	%	60 - 130%	76
d4-1,2-dichloroethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	93
	SP05-0.9	SE178910.009	%	60 - 130%	103
	SP06-0.3	SE178910.010	%	60 - 130%	108
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	99
	SP09-0.3	SE178910.019	%	60 - 130%	100
	SP10-0.6	SE178910.023	%	60 - 130%	90
	SP11-0.9	SE178910.027	%	60 - 130%	99
d8-toluene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	84
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	91
	SP07-0.6	SE178910.014	%	60 - 130%	96
	SP08-0.9	SE178910.018	%	60 - 130%	102
	SP09-0.3	SE178910.019	%	60 - 130%	96
	SP10-0.6	SE178910.023	%	60 - 130%	94
	SP11-0.9	SE178910.027	%	60 - 130%	85
Dibromofluoromethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	100
	SP04-0.6	SE178910.005	%	60 - 130%	91
	SP05-0.9	SE178910.009	%	60 - 130%	109
	SP06-0.3	SE178910.010	%	60 - 130%	98
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	96
	SP09-0.3	SE178910.019	%	60 - 130%	101
	SP10-0.6	SE178910.023	%	60 - 130%	80
	SP11-0.9	SE178910.027	%	60 - 130%	121

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury In Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result
LB147722.001	Mercury	mg/kg	0.05	<0.05
LB147723.001	Mercury	mg/kg	0.05	<0.05

OC Pesticides In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1
		Alpha BHC	mg/kg	0.1	<0.1
		Lindane	mg/kg	0.1	<0.1
		Heptachlor	mg/kg	0.1	<0.1
		Aldrin	mg/kg	0.1	<0.1
		Beta BHC	mg/kg	0.1	<0.1
		Delta BHC	mg/kg	0.1	<0.1
		Heptachlor epoxide	mg/kg	0.1	<0.1
		Alpha Endosulfan	mg/kg	0.2	<0.2
		Gamma Chlordane	mg/kg	0.1	<0.1
		Alpha Chlordane	mg/kg	0.1	<0.1
		p,p'-DDE	mg/kg	0.1	<0.1
		Dieldrin	mg/kg	0.2	<0.2
		Endrin	mg/kg	0.2	<0.2
		Beta Endosulfan	mg/kg	0.2	<0.2
		p,p'-DDD	mg/kg	0.1	<0.1
		p,p'-DDT	mg/kg	0.1	<0.1
		Endosulfan sulphate	mg/kg	0.1	<0.1
		Endrin Aldehyde	mg/kg	0.1	<0.1
		Methoxychlor	mg/kg	0.1	<0.1
		Endrin Ketone	mg/kg	0.1	<0.1
		Isodrin	mg/kg	0.1	<0.1
		Mirex	mg/kg	0.1	<0.1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	91

PAH (Polynuclear Aromatic Hydrocarbons) In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Naphthalene	mg/kg	0.1	<0.1
		2-methylnaphthalene	mg/kg	0.1	<0.1
		1-methylnaphthalene	mg/kg	0.1	<0.1
		Acenaphthylene	mg/kg	0.1	<0.1
		Acenaphthene	mg/kg	0.1	<0.1
		Fluorene	mg/kg	0.1	<0.1
		Phenanthrene	mg/kg	0.1	<0.1
		Anthracene	mg/kg	0.1	<0.1
		Fluoranthene	mg/kg	0.1	<0.1
		Pyrene	mg/kg	0.1	<0.1
		Benzo(a)anthracene	mg/kg	0.1	<0.1
		Chrysene	mg/kg	0.1	<0.1
		Benzo(a)pyrene	mg/kg	0.1	<0.1
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1
		Benzo(ghi)perylene	mg/kg	0.1	<0.1
		Total PAH (18)	mg/kg	0.8	<0.8
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	104
		2-fluorobiphenyl (Surrogate)	%	-	112
		d14-p-terphenyl (Surrogate)	%	-	116

PCBs In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result
LB147632.001	Arochlor 1016	mg/kg	0.2	<0.2
	Arochlor 1221	mg/kg	0.2	<0.2
	Arochlor 1232	mg/kg	0.2	<0.2
	Arochlor 1242	mg/kg	0.2	<0.2
	Arochlor 1248	mg/kg	0.2	<0.2
	Arochlor 1254	mg/kg	0.2	<0.2

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PCBs in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Arochlor 1260	mg/kg	0.2	<0.2
		Arochlor 1262	mg/kg	0.2	<0.2
		Arochlor 1268	mg/kg	0.2	<0.2
		Total PCBs (Arochlors)	mg/kg	1	<1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	91

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number		Parameter	Units	LOR	Result
LB147742.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5
LB147743.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result
LB147632.001		TRH C10-C14	mg/kg	20	<20
		TRH C15-C28	mg/kg	45	<45
		TRH C29-C36	mg/kg	45	<45
		TRH C37-C40	mg/kg	100	<100
		TRH C10-C36 Total	mg/kg	110	<110

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147606.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	95
		d4-1,2-dichloroethane (Surrogate)	%	-	93
		d8-toluene (Surrogate)	%	-	96
		Bromofluorobenzene (Surrogate)	%	-	87
	Totals	Total BTEX	mg/kg	0.6	<0.6
LB147614.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	118
		d4-1,2-dichloroethane (Surrogate)	%	-	108
		d8-toluene (Surrogate)	%	-	97
		Bromofluorobenzene (Surrogate)	%	-	85
	Totals	Total BTEX	mg/kg	0.6	<0.6

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147735.001	Monocyclic Aromatic	Benzene	µg/L	0.5	<0.5
	Hydrocarbons	Toluene	µg/L	0.5	<0.5
		Ethylbenzene	µg/L	0.5	<0.5
		m/p-xylene	µg/L	1	<1
		o-xylene	µg/L	0.5	<0.5

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

VOCs in Water (continued)

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147735.001	Polycyclic VOCs	Naphthalene	µg/L	0.5	<0.5
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	116
		d4-1,2-dichloroethane (Surrogate)	%	-	114
		d8-toluene (Surrogate)	%	-	101
		Bromofluorobenzene (Surrogate)	%	-	98

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147606.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	95
		d4-1,2-dichloroethane (Surrogate)	%	-	93
		d8-toluene (Surrogate)	%	-	96
LB147614.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	118
		d4-1,2-dichloroethane (Surrogate)	%	-	108
		d8-toluene (Surrogate)	%	-	97

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.012	LB147722.014	Mercury	mg/kg	0.05	0.13	0.11	71	15
SE178910.025	LB147722.024	Mercury	mg/kg	0.05	0.25	0.22	51	14
SE178919.016	LB147723.014	Mercury	mg/kg	0.05	0.0160929514	0.0123818708	200	0
SE178919.023	LB147723.022	Mercury	mg/kg	0.05	0.0827755092	0.1002152058	82	8

Moisture Content

Method: ME-(AU)-[ENV]AN002

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.010	LB147689.011	% Moisture	%w/w	0.5	8.5	8.0	42	6
SE178910.020	LB147689.022	% Moisture	%w/w	0.5	8.0	8.2	42	1
SE178910.029	LB147689.032	% Moisture	%w/w	0.5	10	11	39	6

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030	Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Lindane	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor	mg/kg	0.1	<0.1	<0.1	200	0
		Aldrin	mg/kg	0.1	<0.1	<0.1	200	0
		Beta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Delta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Dieldrin	mg/kg	0.2	<0.2	<0.2	200	0
		Endrin	mg/kg	0.2	<0.2	<0.2	200	0
		o,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		p,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	200	0
		Methoxychlor	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Ketone	mg/kg	0.1	<0.1	<0.1	200	0
		Isodrin	mg/kg	0.1	<0.1	<0.1	200	0
		Mirex	mg/kg	0.1	<0.1	<0.1	200	0
		Total CLP OC Pesticides	mg/kg	1	<1	<1	200	0
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.13	0.14	30	9

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.020	LB147632.031	Naphthalene	mg/kg	0.1	<0.1	0.04	200	0
		2-methylnaphthalene	mg/kg	0.1	<0.1	0.02	200	0
		1-methylnaphthalene	mg/kg	0.1	<0.1	0.02	200	0
		Acenaphthylene	mg/kg	0.1	0.2	0.16	67	17
		Acenaphthene	mg/kg	0.1	<0.1	0.01	200	0
		Fluorene	mg/kg	0.1	<0.1	0.04	200	0
		Phenanthrene	mg/kg	0.1	0.8	0.5	48	20
		Anthracene	mg/kg	0.1	0.3	0.21	73	21
		Fluoranthene	mg/kg	0.1	1.5	1.29	37	13
		Pyrene	mg/kg	0.1	1.4	1.24	38	14
		Benzo(a)anthracene	mg/kg	0.1	0.9	0.69	43	23
		Chrysene	mg/kg	0.1	0.7	0.59	46	17
		Benzo(b&j)fluoranthene	mg/kg	0.1	1.0	0.82	41	24
		Benzo(k)fluoranthene	mg/kg	0.1	0.5	0.41	53	11
		Benzo(a)pyrene	mg/kg	0.1	0.9	0.77	42	12
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	0.6	0.44	50	27
		Dibenzo(ah)anthracene	mg/kg	0.1	0.2	0.09	113	40

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in Green when within suggested criteria or Red with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.020	LB147632.031		Benzo(ghi)perylene	mg/kg	0.1	0.6	0.51	48	13
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	1.3	1.013	27	27
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	1.3	1.113	35	18
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	1.3	1.063	27	22
			Total PAH (18)	mg/kg	0.8	9.2	7.59	40	19
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.38	30	10
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	0.41	30	9
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.5	0.41	30	14

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030		Arochlor 1016	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1221	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1232	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1242	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1248	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1254	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1260	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1262	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1268	mg/kg	0.2	<0.2	<0.2	200	0
			Total PCBs (Arochlors)	mg/kg	1	<1	<1	200	0
		Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0	0	30	9

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.005	LB147742.024	Arsenic, As	mg/kg	3	8	11	41	26
		Cadmium, Cd	mg/kg	0.3	<0.3	0.3	134	0
		Chromium, Cr	mg/kg	0.3	9.8	9.6	35	2
		Copper, Cu	mg/kg	0.5	34	31	32	10
		Nickel, Ni	mg/kg	0.5	18	13	33	30
		Lead, Pb	mg/kg	1	91	95	31	5
		Zinc, Zn	mg/kg	0.5	150	140	31	6
SE178910.021	LB147743.014	Arsenic, As	mg/kg	3	15	36	34	80 ⊘
		Cadmium, Cd	mg/kg	0.3	0.6	1.6	58	94 ⊘
		Chromium, Cr	mg/kg	0.3	17	17	33	2
		Copper, Cu	mg/kg	0.5	34	36	31	6
		Nickel, Ni	mg/kg	0.5	16	13	33	23
		Lead, Pb	mg/kg	1	120	140	31	19
		Zinc, Zn	mg/kg	0.5	570	220	31	88 ⊘
SE178919.002	LB147743.024	Lead, Pb	mg/kg	1	13.74511718789.653320312		36	35
SE178959.041	LB147742.014	Arsenic, As	mg/kg	3	7.31000632927.2080361339		44	1
		Cadmium, Cd	mg/kg	0.3	0.04462764540.0963641194		200	0
		Chromium, Cr	mg/kg	0.3	24.79065706224.775215107		32	0
		Copper, Cu	mg/kg	0.5	14.80299000495.3411678145		33	4
		Nickel, Ni	mg/kg	0.5	4.60557301324.9145700913		41	6
		Lead, Pb	mg/kg	1	23.76422121623.5032087310		34	1
		Zinc, Zn	mg/kg	0.5	26.86584257727.3674099204		37	2

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.010	LB147632.032		TRH C10-C14	mg/kg	20	<20	0	200	0
			TRH C15-C28	mg/kg	45	120	116	68	3
			TRH C29-C36	mg/kg	45	70	111	80	45
			TRH C37-C40	mg/kg	100	<100	0	200	0
			TRH C10-C36 Total	mg/kg	110	190	229	82	18
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	194	143	0
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	0	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	0	200	0
			TRH >C16-C34 (F3)	mg/kg	90	180	194	79	9
			TRH >C34-C40 (F4)	mg/kg	120	<120	0	200	0
SE178910.027	LB147632.030		TRH C10-C14	mg/kg	20	<20	<20	200	0
			TRH C15-C28	mg/kg	45	220	170	53	29

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

TRH (Total Recoverable Hydrocarbons) In Soil (continued)

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030		TRH C29-C36	mg/kg	45	170	140	60	20
			TRH C37-C40	mg/kg	100	<100	<100	200	0
			TRH C10-C36 Total	mg/kg	110	390	300	62	25
			TRH C10-C40 Total (F bands)	mg/kg	210	340	270	99	25
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	<25	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	200	0
			TRH >C16-C34 (F3)	mg/kg	90	340	270	60	25
			TRH >C34-C40 (F4)	mg/kg	120	<120	<120	200	0

VOC's In Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178849.008	LB147606.014	Monocyclic	Benzene	mg/kg	0.1	0.02	0.02	200	0
		Aromatic	Toluene	mg/kg	0.1	0	0	200	0
			Ethylbenzene	mg/kg	0.1	0	0	200	0
			m/p-xylene	mg/kg	0.2	0	0	200	0
			o-xylene	mg/kg	0.1	0	0	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	0	0	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.99	5.37	50	7
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.4	6.08	50	12
			d8-toluene (Surrogate)	mg/kg	-	4.72	5.01	50	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.81	3.84	50	1
		Totals	Total Xylenes	mg/kg	0.3	0	0	200	0
			Total BTEX	mg/kg	0.6	0.02	0.02	200	0
SE178910.019	LB147606.025	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.0	5.0	50	1
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	5.2	50	4
			d8-toluene (Surrogate)	mg/kg	-	4.8	5.1	50	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	50	2
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE178910.027	LB147614.020	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.1	4.8	50	23
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.2	50	17
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.7	50	11
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.7	50	3
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE178991.010	LB147614.014	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	3.6	4.4	50	20
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.7	50	7
			d8-toluene (Surrogate)	mg/kg	-	4.4	4.4	50	0
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.9	3.8	50	2
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0

VOCs In Water

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOCs in Water (continued)

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178796.001	LB147735.022	Monocyclic	Benzene	µg/L	0.5	<0.5	0.05	200	0
		Aromatic	Toluene	µg/L	0.5	<0.5	0.06	200	0
			Ethylbenzene	µg/L	0.5	<0.5	0.02	200	0
			m/p-xylene	µg/L	1	<1	0.03	200	0
			o-xylene	µg/L	0.5	<0.5	0.02	200	0
		Polycyclic	Naphthalene	µg/L	0.5	<0.5	0.07	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	5.4	5.42	30	0
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	5.4	5.44	30	1
			d8-toluene (Surrogate)	µg/L	-	4.7	4.71	30	0
			Bromofluorobenzene (Surrogate)	µg/L	-	4.8	4.85	30	1
SE178837.001	LB147735.023	Monocyclic	Benzene	µg/L	0.5	<0.5	<0.5	200	0
		Aromatic	Toluene	µg/L	0.5	<0.5	<0.5	200	0
			Ethylbenzene	µg/L	0.5	<0.5	<0.5	200	0
			m/p-xylene	µg/L	1	<1	<1	200	0
			o-xylene	µg/L	0.5	<0.5	<0.5	200	0
		Polycyclic	Naphthalene	µg/L	0.5	<0.5	<0.5	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.9	4.9	30	1
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	5.2	5.2	30	1
			d8-toluene (Surrogate)	µg/L	-	4.9	4.9	30	0
			Bromofluorobenzene (Surrogate)	µg/L	-	4.8	4.8	30	0

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178649.008	LB147606.014		TRH C6-C10	mg/kg	25	0	0	200	0
			TRH C6-C9	mg/kg	20	0	0.15	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.99	5.37	30	7
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.4	6.08	30	12
			d8-toluene (Surrogate)	mg/kg	-	4.72	5.01	30	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.81	3.84	30	1
		VPH F Bands	Benzene (F0)	mg/kg	0.1	0.02	0.02	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	-0.02	-0.02	200	0
SE178910.019	LB147606.025		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.0	5.0	30	1
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	5.2	30	4
			d8-toluene (Surrogate)	mg/kg	-	4.8	5.1	30	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	30	2
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE178910.027	LB147614.020		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.1	4.8	30	23
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.2	30	17
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.7	30	11
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.7	30	3
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE178991.010	LB147614.014		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	3.6	4.4	30	20
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.7	30	7
			d8-toluene (Surrogate)	mg/kg	-	4.4	4.4	30	0
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.9	3.8	30	2
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147722.002	Mercury	mg/kg	0.05	0.23	0.2	70 - 130	113
LB147723.002	Mercury	mg/kg	0.05	0.22	0.2	70 - 130	111

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		Heptachlor	mg/kg	0.1	0.2	0.2	60 - 140	89
		Aldrin	mg/kg	0.1	0.2	0.2	60 - 140	102
		Delta BHC	mg/kg	0.1	0.2	0.2	60 - 140	98
		Dieldrin	mg/kg	0.2	<0.2	0.2	60 - 140	98
		Endrin	mg/kg	0.2	<0.2	0.2	60 - 140	83
		p,p'-DDT	mg/kg	0.1	0.2	0.2	60 - 140	76
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.15	0.15	40 - 130	99

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		Naphthalene	mg/kg	0.1	3.5	4	60 - 140	87
		Acenaphthylene	mg/kg	0.1	3.5	4	60 - 140	87
		Acenaphthene	mg/kg	0.1	3.3	4	60 - 140	82
		Phenanthrene	mg/kg	0.1	3.3	4	60 - 140	83
		Anthracene	mg/kg	0.1	3.4	4	60 - 140	85
		Fluoranthene	mg/kg	0.1	3.3	4	60 - 140	82
		Pyrene	mg/kg	0.1	3.1	4	60 - 140	78
		Benzo(a)pyrene	mg/kg	0.1	3.5	4	60 - 140	87
	Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	78
		2-fluorobiphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	82
		d14-p-terphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	82

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002	Arochlor 1260	mg/kg	0.2	0.4	0.4	60 - 140	103

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147742.002	Arsenic, As	mg/kg	3	310	336.32	79 - 120	93
	Cadmium, Cd	mg/kg	0.3	420	416.6	69 - 131	101
	Chromium, Cr	mg/kg	0.3	29	35.2	80 - 120	83
	Copper, Cu	mg/kg	0.5	310	370.46	80 - 120	84
	Nickel, Ni	mg/kg	0.5	170	210.88	79 - 120	82
	Lead, Pb	mg/kg	1	88	107.87	79 - 120	82
	Zinc, Zn	mg/kg	0.5	270	301.27	80 - 121	91
LB147743.002	Arsenic, As	mg/kg	3	340	336.32	79 - 120	101
	Cadmium, Cd	mg/kg	0.3	440	416.6	69 - 131	105
	Chromium, Cr	mg/kg	0.3	38	35.2	80 - 120	108
	Copper, Cu	mg/kg	0.5	380	370.46	80 - 120	102
	Nickel, Ni	mg/kg	0.5	200	210.88	79 - 120	98
	Lead, Pb	mg/kg	1	100	107.87	79 - 120	95
	Zinc, Zn	mg/kg	0.5	310	301.27	80 - 121	101

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		TRH C10-C14	mg/kg	20	34	40	60 - 140	85
		TRH C15-C28	mg/kg	45	<45	40	60 - 140	110
		TRH C29-C36	mg/kg	45	<45	40	60 - 140	90
	TRH F Bands	TRH >C10-C16	mg/kg	25	39	40	60 - 140	98
		TRH >C16-C34 (F3)	mg/kg	90	<90	40	60 - 140	100
		TRH >C34-C40 (F4)	mg/kg	120	<120	20	60 - 140	90

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number	Parameter	Units	LOR

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

VOC's in Soil (continued)

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147606.002	Monocyclic	Benzene	mg/kg	0.1	2.2	2.9	60 - 140	74
	Aromatic	Toluene	mg/kg	0.1	2.4	2.9	60 - 140	84
		Ethylbenzene	mg/kg	0.1	2.4	2.9	60 - 140	81
		m/p-xylene	mg/kg	0.2	4.8	5.8	60 - 140	82
		o-xylene	mg/kg	0.1	2.4	2.9	60 - 140	83
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	83
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	84
		d8-toluene (Surrogate)	mg/kg	-	5.2	5	60 - 140	103
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.7	5	60 - 140	94
LB147614.002	Monocyclic	Benzene	mg/kg	0.1	2.3	2.9	60 - 140	80
	Aromatic	Toluene	mg/kg	0.1	2.7	2.9	60 - 140	92
		Ethylbenzene	mg/kg	0.1	2.3	2.9	60 - 140	81
		m/p-xylene	mg/kg	0.2	4.5	5.8	60 - 140	78
		o-xylene	mg/kg	0.1	2.3	2.9	60 - 140	80
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.0	5	60 - 140	120
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.1	5	60 - 140	103
		d8-toluene (Surrogate)	mg/kg	-	5.1	5	60 - 140	102
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.1	5	60 - 140	101

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147735.002	Monocyclic	Benzene	µg/L	0.5	51	45.45	60 - 140	112
	Aromatic	Toluene	µg/L	0.5	51	45.45	60 - 140	112
		Ethylbenzene	µg/L	0.5	51	45.45	60 - 140	113
		m/p-xylene	µg/L	1	100	90.9	60 - 140	112
		o-xylene	µg/L	0.5	51	45.45	60 - 140	112
	Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.3	5	60 - 140	86
		d4-1,2-dichloroethane (Surrogate)	µg/L	-	4.4	5	60 - 140	87
		d8-toluene (Surrogate)	µg/L	-	4.5	5	60 - 140	91
		Bromofluorobenzene (Surrogate)	µg/L	-	4.6	5	60 - 140	93

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147606.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	78
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	69
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	83
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	84
		d8-toluene (Surrogate)	mg/kg	-	5.2	5	60 - 140	103
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.7	5	60 - 140	94
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	71
LB147614.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	89
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	80
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.0	5	60 - 140	120
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.1	5	60 - 140	103
		d8-toluene (Surrogate)	mg/kg	-	5.1	5	60 - 140	102
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.1	5	60 - 140	101
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	105

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178910.027	LB147723.004	Mercury	mg/kg	0.05	0.40	0.16	0.2	123
SE178959.045	LB147722.004	Mercury	mg/kg	0.05	0.24	0.03292042322	0.2	103

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

QC Sample	Sample Number		Parameter	Units	LOR	Original	Spike	Recovery%
SE178910.005	LB147632.032		Naphthalene	mg/kg	0.1	<0.1	4	91
			2-methylnaphthalene	mg/kg	0.1	<0.1	-	-
			1-methylnaphthalene	mg/kg	0.1	<0.1	-	-
			Acenaphthylene	mg/kg	0.1	0.4	4	89
			Acenaphthene	mg/kg	0.1	<0.1	4	86
			Fluorene	mg/kg	0.1	0.2	-	-
			Phenanthrene	mg/kg	0.1	1.8	4	87
			Anthracene	mg/kg	0.1	0.7	4	80
			Fluoranthene	mg/kg	0.1	2.6	4	89
			Pyrene	mg/kg	0.1	2.7	4	71
			Benzo(a)anthracene	mg/kg	0.1	1.4	-	-
			Chrysene	mg/kg	0.1	1.2	-	-
			Benzo(b&j)fluoranthene	mg/kg	0.1	1.7	-	-
			Benzo(k)fluoranthene	mg/kg	0.1	0.7	-	-
			Benzo(a)pyrene	mg/kg	0.1	1.5	4	95
			Indeno(1,2,3-cd)pyrene	mg/kg	0.1	0.9	-	-
			Dibenzo(ah)anthracene	mg/kg	0.1	0.2	-	-
			Benzo(ghi)perylene	mg/kg	0.1	1.0	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	2.2	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	2.2	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	2.2	-	-
			Total PAH (18)	mg/kg	0.8	17	-	-
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	-	88
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	-	88
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.5	-	90

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178897.003	LB147742.004	Arsenic, As	mg/kg	3	51	3.60216873678	50	95
		Cadmium, Cd	mg/kg	0.3	49	0.12115962115	50	99
		Chromium, Cr	mg/kg	0.3	55	7.96391509853	50	94
		Copper, Cu	mg/kg	0.5	160	05.2224709917	50	104
		Nickel, Ni	mg/kg	0.5	59	5.96511008049	50	87
		Lead, Pb	mg/kg	1	64	35.5743287666	50	58 ④
		Zinc, Zn	mg/kg	0.5	91	34.7548287932	50	72
SE178910.006	LB147743.004	Arsenic, As	mg/kg	3	51	13	50	77
		Cadmium, Cd	mg/kg	0.3	48	<0.3	50	95
		Chromium, Cr	mg/kg	0.3	57	8.0	50	97
		Copper, Cu	mg/kg	0.5	77	26	50	101
		Nickel, Ni	mg/kg	0.5	61	25	50	73
		Lead, Pb	mg/kg	1	140	58	50	169 ④
		Zinc, Zn	mg/kg	0.5	150	100	50	107

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

QC Sample	Sample Number		Parameter	Units	LOR	Original	Spike	Recovery%
SE178910.005	LB147632.031		TRH C10-C14	mg/kg	20	<20	40	90
			TRH C15-C28	mg/kg	45	97	40	138
			TRH C29-C36	mg/kg	45	92	40	100
			TRH C37-C40	mg/kg	100	<100	-	-
			TRH C10-C36 Total	mg/kg	110	190	-	-
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	-	-
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	40	108
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	-	-
			TRH >C16-C34 (F3)	mg/kg	90	160	40	150 ⑧
			TRH >C34-C40 (F4)	mg/kg	120	<120	-	-

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178849.003	LB147606.026	Monocyclic	Benzene	mg/kg	0.1		0.01	2.9	67
		Aromatic	Toluene	mg/kg	0.1		0	2.9	64
			Ethylbenzene	mg/kg	0.1		0	2.9	65
			m/p-xylene	mg/kg	0.2		0	5.8	83
			o-xylene	mg/kg	0.1		0	2.9	77
		Polycyclic	Naphthalene	mg/kg	0.1		0.01	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-		4.95	-	81
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-		4.76	-	81
			d8-toluene (Surrogate)	mg/kg	-		4.82	-	88
			Bromofluorobenzene (Surrogate)	mg/kg	-		3.58	-	118
		Totals	Total Xylenes	mg/kg	0.3		0	-	-
			Total BTEX	mg/kg	0.6		0.01	-	-
SE178991.001	LB147614.004	Monocyclic	Benzene	mg/kg	0.1	2.3	<0.1	2.9	79
		Aromatic	Toluene	mg/kg	0.1	2.4	<0.1	2.9	82
			Ethylbenzene	mg/kg	0.1	2.3	<0.1	2.9	79
			m/p-xylene	mg/kg	0.2	4.6	<0.2	5.8	79
			o-xylene	mg/kg	0.1	2.3	<0.1	2.9	80
		Polycyclic	Naphthalene	mg/kg	0.1	0.7	0.2	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.7	3.8	-	114
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.6	4.9	-	92
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.3	-	84
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.5	3.9	-	90
		Totals	Total Xylenes	mg/kg	0.3	6.9	<0.3	-	-
			Total BTEX	mg/kg	0.6	14	<0.6	-	-

VOCs in Water

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178919.024	LB147735.024	Monocyclic	Benzene	µg/L	0.5	48	0.14	45.45	105
		Aromatic	Toluene	µg/L	0.5	54	0.1	45.45	119
			Ethylbenzene	µg/L	0.5	47	0.06	45.45	104
			m/p-xylene	µg/L	1	100	0.09	90.9	112
			o-xylene	µg/L	0.5	52	0.03	45.45	115
		Polycyclic	Naphthalene	µg/L	0.5	56	0.12	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.2	5.9	-	85
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	4.2	5.63	-	84
			d8-toluene (Surrogate)	µg/L	-	4.5	5	-	89
			Bromofluorobenzene (Surrogate)	µg/L	-	5.4	4.89	-	108

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178849.003	LB147606.026		TRH C6-C10	mg/kg	25		0	24.65	85
			TRH C6-C9	mg/kg	20		0	23.2	79
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-		4.95	-	81
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-		4.76	-	81
			d8-toluene (Surrogate)	mg/kg	-		4.82	-	88
			Bromofluorobenzene (Surrogate)	mg/kg	-		3.58	-	118
		VPH F	Benzene (F0)	mg/kg	0.1		0.01	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25		-0.01	7.25	113
SE178991.001	LB147614.004		TRH C6-C10	mg/kg	25	<25	<25	24.65	89
			TRH C6-C9	mg/kg	20	22	<20	23.2	94
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.7	3.8	-	114
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.6	4.9	-	92
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.3	-	84
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.5	3.9	-	90
		VPH F	Benzene (F0)	mg/kg	0.1	2.3	<0.1	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	7.25	110

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Wed 9/5/2018
Report Due	Wed 16/5/2018
SGS Reference	**SE178910**

SUBMISSION DETAILS

This is to confirm that 31 samples were received on Wednesday 9/5/2018. Results are expected to be ready by COB Wednesday 16/5/2018.
Please quote SGS reference SE178910 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	29 Soil, 2 Water
Date documentation received	9/5/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

DUP1A and DUP2A have been forwarded to Eurofins.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx.
Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
001	SP03-0.3	29	26	11	7	10	12	8
002	SP03-0.6	-	26	-	-	-	-	-
003	SP03-0.9	-	-	-	7	-	-	-
004	SP04-0.3	-	-	-	7	-	-	-
005	SP04-0.6	29	26	11	7	10	12	8
006	SP04-0.9	-	26	-	-	-	-	-
007	SP05-0.3	-	26	-	-	-	-	-
008	SP05-0.6	-	26	-	7	-	-	-
009	SP05-0.9	29	-	11	7	10	12	8
010	SP06-0.3	29	-	11	7	10	12	8
011	SP06-0.6	-	26	-	-	-	-	-
012	SP06-0.9	-	26	-	7	-	-	-
013	SP07-0.3	-	26	-	-	-	-	-
014	SP07-0.6	29	26	11	7	10	12	8
015	SP07-1.0	-	-	-	7	-	-	-
016	SP08-0.3	-	-	-	7	-	-	-
017	SP08-0.6	-	26	-	-	-	-	-
018	SP08-0.9	29	26	11	7	10	12	8
019	SP09-0.3	29	26	11	7	10	12	8
020	SP09-0.6	-	26	-	-	-	-	-
021	SP09-0.9	-	-	-	7	-	-	-
022	SP10-0.3	-	-	-	7	-	-	-
023	SP10-0.6	29	26	11	7	10	12	8
024	SP10-0.9	-	26	-	-	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
025	SP11-0.3	-	26	-	7	-	-	-
026	SP11-0.6	-	26	-	-	-	-	-
027	SP11-0.9	29	-	11	7	10	12	8
028	DUP1	-	-	-	7	-	-	-
029	DUP2	-	-	-	7	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Gravimetric Determination of Asbestos in Soil	Mercury in Soil	Moisture Content
001	SP03-0.3	-	1	1
002	SP03-0.6	9	-	1
003	SP03-0.9	9	1	1
004	SP04-0.3	9	1	1
005	SP04-0.6	-	1	1
006	SP04-0.9	9	-	1
007	SP05-0.3	9	-	1
008	SP05-0.6	9	1	1
009	SP05-0.9	-	1	1
010	SP06-0.3	-	1	1
011	SP06-0.6	9	-	1
012	SP06-0.9	9	1	1
013	SP07-0.3	9	-	1
014	SP07-0.6	-	1	1
015	SP07-1.0	9	1	1
016	SP08-0.3	9	1	1
017	SP08-0.6	9	-	1
018	SP08-0.9	-	1	1
019	SP09-0.3	-	1	1
020	SP09-0.6	9	-	1
021	SP09-0.9	9	1	1
022	SP10-0.3	9	1	1
023	SP10-0.6	-	1	1
024	SP10-0.9	9	-	1

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Gravimetric Determination of Asbestos in Soil	Mercury in Soil	Moisture Content	VOCs in Water
025	SP11-0.3	9	1	1	-
026	SP11-0.6	9	-	1	-
027	SP11-0.9	-	1	1	-
028	DUP1	-	1	1	-
029	DUP2	-	1	1	-
030	TRIP BLANK	-	-	-	12
031	TRIP SPIKE	-	-	-	12

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: [Untitled].pdf page: 1 SGS Ref: SE178910_COC

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	SGS – P1185 Eurofins – P1186
	Seven Hills NSW	Results Required By:	5 day turnaround
Contact Name:	Craig Cowper	Telephone:	0407 989 885
		Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP03-0.3	9/5/2018	1		X	Ice	2	X	X	X	X	X			
SP03-0.6	9/5/2018	2		X	Ice	2		X				X		
SP03-0.9	9/5/2018	3		X	Ice	2					X	X		
SP04-0.3	9/5/2018	4		X	Ice	2					X	X		
SP04-0.6	9/5/2018	5		X	Ice	2	X	X	X	X	X			
SP04-0.9	9/5/2018	6		X	Ice	2		X				X		
SP05-0.3	9/5/2018	7		X	Ice	2		X				X		
SP05-0.6	9/5/2018	8		X	Ice	2		X			X	X		
SP05-0.9	9/5/2018	9		X	Ice	2	X		X	X	X			
SP06-0.3	9/5/2018	10		X	Ice	2	X		X	X	X			

SGS EHS Alexandria Laboratory

SE178910 COC

Received: 09 – May – 2018

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
Contact Name:	Craig Cowper	Telephone:	0407 989 885
		Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP06-0.6	9/5/2018	11		X	Ice	2		X				X		
SP06-0.9	9/5/2018	12		X	Ice	2		X			X	X		
SP07-0.3	9/5/2018	13		X	Ice	2		X				X		
SP07-0.6	9/5/2018	14		X	Ice	2	X	X	X	X	X			
SP07-1.0	9/5/2018	15		X	Ice	2					X	X		
SP08-0.3	9/5/2018	16		X	Ice	2					X	X		
SP08-0.6	9/5/2018	17		X	Ice	2		X				X		
SP08-0.9	9/5/2018	18		X	Ice	2	X	X	X	X	X			
SP09-0.3	9/5/2018	19		X	Ice	2	X	X	X	X	X			
SP09-0.6	9/5/2018	20		X	Ice	2		X				X		

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes / No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes / No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP09-0.9	9/5/2018	21		X	Ice	2					X	X		
SP10-0.3	9/5/2018	22		X	Ice	2					X	X		
SP10-0.6	9/5/2018	23		X	Ice	2	X	X	X	X	X			
SP10-0.9	9/5/2018	24		X	Ice	2		X				X		
SP11-0.3	9/5/2018	25		X	Ice	2		X			X	X		
SP11-0.6	9/5/2018	26		X	Ice	2		X				X		
SP11-0.9	9/5/2018	27		X	Ice	2	X		X	X	X			
DUP1	9/5/2018	28		X	Ice	1					X			
DUP1A	9/5/2018			X	Ice	1					X			
DUP2	9/5/2018	29		X	Ice	1					X			

Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: (Yes) No	Temperature: Ambient / (Chilled)	Sample Cooler Sealed: (Yes) No	Laboratory Quotation No:
	Comments:		

CHAIN OF CUSTODY & ANALYSIS REQUEST

Page __4__ of __4__

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	WATER	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX								
DUP2A	9/5/2018			X	Ice	1					X											Send To Eurofins
TRIP-BLANK	9/5/2018	30	X		Ice	1								X								
TRIP-SPIKE	9/5/2018	31	X		Ice	1								X								

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: (Yes) No	Temperature: Ambient / (Chilled)	Sample Cooler Sealed: (Yes) No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

30 years Testing For Life 1987–2017
Celebrating 30 years Testing and Protecting Human Health

Certificate of Analysis

NATA Accredited
Accreditation Number 1261
Site Number 18217

Accredited for compliance with ISO/IEC 17025 – Testing
The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.

Alliance Geotechnical
10 Welder Road
Seven Hills
NSW 2147

Attention: **Craig Cowper**

Report **597827-S**
Project name JORDAN SPRINGS
Project ID 7161
Received Date May 10, 2018

Client Sample ID			DUP1A	DUP2A
Sample Matrix			Soil	Soil
Eurofins | mgt Sample No.			S18-My13998	S18-My13999
Date Sampled			May 09, 2018	May 09, 2018
Test/Reference	LOR	Unit		
Heavy Metals				
Arsenic	2	mg/kg	9.3	15
Cadmium	0.4	mg/kg	< 0.4	< 0.4
Chromium	5	mg/kg	16	20
Copper	5	mg/kg	24	39
Lead	5	mg/kg	110	150
Mercury	0.1	mg/kg	0.2	0.1
Nickel	5	mg/kg	13	26
Zinc	5	mg/kg	220	230
% Moisture	1	%	9.1	11

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Sample History

Where samples are submitted/analysed over several days, the last date of extraction and analysis is reported.
A recent review of our LIMS has resulted in the correction or clarification of some method identifications. Due to this, some of the method reference information on reports has changed. However, no substantive change has been made to our laboratory methods, and as such there is no change in the validity of current or previous results (regarding both quality and NATA accreditation).

If the date and time of sampling are not provided, the Laboratory will not be responsible for compromised results should testing be performed outside the recommended holding time.

Description	Testing Site	Extracted	Holding Time
Metals M8	Sydney	May 15, 2018	28 Day
- Method: LTM-MET-3040 Metals in Waters, Soils & Sediments by ICP-MS			
% Moisture	Sydney	May 10, 2018	14 Day
- Method: LTM-GEN-7080 Moisture			

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

ABN– 50 005 085 521
e.mail : EnviroSales@eurofins.com
web : www.eurofins.com.au

Melbourne
2-5 Kingston Town Close
Oakleigh VIC 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261
Site # 23736

Company Name: Alliance Geotechnical
Address: 10 Welder Road
Seven Hills
NSW 2147

Project Name: JORDAN SPRINGS
Project ID: 7161

Order No.:
Report #: 597827
Phone: 1800 288 188
Fax: 02 9675 1888

Received: May 10, 2018 3:26 PM
Due: May 17, 2018
Priority: 5 Day
Contact Name: Craig Cowper

Eurofins | mgt Analytical Services Manager : Nibha Valdya

Sample Detail						Metals M8	Moisture Set
Melbourne Laboratory - NATA Site # 1254 & 14271							
Sydney Laboratory - NATA Site # 18217						X	X
Brisbane Laboratory - NATA Site # 20794							
Perth Laboratory - NATA Site # 23736							
External Laboratory							
No	**Sample ID**	**Sample Date**	**Sampling Time**	**Matrix**	**LAB ID**		
1	DUP1A	May 09, 2018		Soil	S18-My13998	X	X
2	DUP2A	May 09, 2018		Soil	S18-My13999	X	X
Test Counts						2	2

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Internal Quality Control Review and Glossary

General

1. Laboratory QC results for Method Blanks, Duplicates, Matrix Spikes, and Laboratory Control Samples are included in this QC report where applicable. Additional QC data may be available on request.
2. All soil results are reported on a dry basis, unless otherwise stated.
3. All biota/food results are reported on a wet weight basis on the edible portion, unless otherwise stated.
4. Actual LORs are matrix dependant. Quoted LORs may be raised where sample extracts are diluted due to interferences.
5. Results are uncorrected for matrix spikes or surrogate recoveries except for PFAS compounds.
6. SVOC analysis on waters are performed on homogenised, unfiltered samples, unless noted otherwise.
7. Samples were analysed on an 'as received' basis.
8. This report replaces any interim results previously issued.

Holding Times

Please refer to 'Sample Preservation and Container Guide' for holding times (QS3001).

For samples received on the last day of holding time, notification of testing requirements should have been received at least 6 hours prior to sample receipt deadlines as stated on the SRA.

If the Laboratory did not receive the information in the required timeframe, and regardless of any other integrity issues, suitably qualified results may still be reported.

Holding times apply from the date of sampling, therefore compliance to these may be outside the laboratory's control.

For VOCs containing vinyl chloride, styrene and 2-chloroethyl vinyl ether the holding time is 7 days however for all other VOCs such as BTEX or C6-10 TRH then the holding time is 14 days.

****NOTE:** pH duplicates are reported as a range NOT as RPD

Units

mg/kg: milligrams per kilogram
mg/L: milligrams per litre
ug/L: micrograms per litre
ppm: Parts per million
ppb: Parts per billion
%: Percentage
org/100mL: Organisms per 100 millilitres
NTU: Nephelometric Turbidity Units
MPN/100mL: Most Probable Number of organisms per 100 millilitres

Terms

Dry	Where a moisture has been determined on a solid sample the result is expressed on a dry basis.
LOR	Limit of Reporting.
SPIKE	Addition of the analyte to the sample and reported as percentage recovery.
RPD	Relative Percent Difference between two Duplicate pieces of analysis.
LCS	Laboratory Control Sample - reported as percent recovery.
CRM	Certified Reference Material - reported as percent recovery.
Method Blank	In the case of solid samples these are performed on laboratory certified clean sands and in the case of water samples these are performed on de-ionised water.
Surr - Surrogate	The addition of a like compound to the analyte target and reported as percentage recovery.
Duplicate	A second piece of analysis from the same sample and reported in the same units as the result to show comparison.
USEPA	United States Environmental Protection Agency
APHA	American Public Health Association
TCLP	Toxicity Characteristic Leaching Procedure
COC	Chain of Custody
SRA	Sample Receipt Advice
QSM	Quality Systems Manual ver 5.1 US Department of Defense
CP	Client Parent - QC was performed on samples pertaining to this report
NCP	Non-Client Parent - QC performed on samples not pertaining to this report, QC is representative of the sequence or batch that client samples were analysed within.
TEQ	Toxic Equivalency Quotient

QC - Acceptance Criteria

RPD Duplicates: Global RPD Duplicates Acceptance Criteria is 30% however the following acceptance guidelines are equally applicable:

Results <10 times the LOR : No Limit

Results between 10-20 times the LOR : RPD must lie between 0-50%

Results >20 times the LOR : RPD must lie between 0-30%

Surrogate Recoveries: Recoveries must lie between 50-150%-Phenols & PFASs

PFAS field samples that contain surrogate recoveries in excess of the QC limit designated in QSM 5.1 where no positive PFAS results have been reported have been reviewed and no data was affected.

QC Data General Comments

1. Where a result is reported as a less than (<), higher than the nominated LOR, this is due to either matrix interference, extract dilution required due to interferences or contaminant levels within the sample, high moisture content or insufficient sample provided.
2. Duplicate data shown within this report that states the word "BATCH" is a Batch Duplicate from outside of your sample batch, but within the laboratory sample batch at a 1:10 ratio. The Parent and Duplicate data shown is not data from your samples.
3. Organochlorine Pesticide analysis - where reporting LCS data, Toxaphene & Chlordane are not added to the LCS.
4. Organochlorine Pesticide analysis - where reporting Spike data, Toxaphene is not added to the Spike.
5. Total Recoverable Hydrocarbons - where reporting Spike & LCS data, a single spike of commercial Hydrocarbon products in the range of C12-C30 is added and it's Total Recovery is reported in the C10-C14 cell of the Report.
6. pH and Free Chlorine analysed in the laboratory - Analysis on this test must begin within 30 minutes of sampling.Therefore laboratory analysis is unlikely to be completed within holding time. Analysis will begin as soon as possible after sample receipt.
7. Recovery Data (Spikes & Surrogates) - where chromatographic interference does not allow the determination of Recovery the term "INT" appears against that analyte.
8. Polychlorinated Biphenyls are spiked only using Aroclor 1260 in Matrix Spikes and LCS.
9. For Matrix Spikes and LCS results a dash " -" in the report means that the specific analyte was not added to the QC sample.
10. Duplicate RPDs are calculated from raw analytical data thus it is possible to have two sets of data.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

Quality Control Results

Test	Units	Result 1			Acceptance Limits	Pass Limits	Qualifying Code
Method Blank							
Heavy Metals							
Arsenic	mg/kg	< 2			2	Pass	
Cadmium	mg/kg	< 0.4			0.4	Pass	
Chromium	mg/kg	< 5			5	Pass	
Copper	mg/kg	< 5			5	Pass	
Lead	mg/kg	< 5			5	Pass	
Mercury	mg/kg	< 0.1			0.1	Pass	
Nickel	mg/kg	< 5			5	Pass	
Zinc	mg/kg	< 5			5	Pass	
LCS - % Recovery							
Heavy Metals							
Arsenic	%	115			70-130	Pass	
Cadmium	%	103			70-130	Pass	
Chromium	%	116			70-130	Pass	
Copper	%	119			70-130	Pass	
Lead	%	125			70-130	Pass	
Mercury	%	119			70-130	Pass	
Nickel	%	122			70-130	Pass	
Zinc	%	119			70-130	Pass	

Test	Lab Sample ID	QA Source	Units	Result 1			Acceptance Limits	Pass Limits	Qualifying Code
Spike - % Recovery									
Heavy Metals				Result 1					
Arsenic	S18-My17381	NCP	%	110			70-130	Pass	
Cadmium	S18-My17381	NCP	%	111			70-130	Pass	
Chromium	S18-My17381	NCP	%	106			70-130	Pass	
Copper	S18-My17381	NCP	%	105			70-130	Pass	
Lead	S18-My17381	NCP	%	96			70-130	Pass	
Mercury	S18-My17381	NCP	%	109			70-130	Pass	
Nickel	S18-My17381	NCP	%	104			70-130	Pass	
Zinc	S18-My17381	NCP	%	84			70-130	Pass	

Test	Lab Sample ID	QA Source	Units	Result 1	Result 2	RPD	Acceptance Limits	Pass Limits	Qualifying Code
Duplicate									
Heavy Metals				Result 1	Result 2	RPD			
Arsenic	S18-My17380	NCP	mg/kg	3.8	3.5	7.0	30%	Pass	
Cadmium	S18-My17380	NCP	mg/kg	< 0.4	< 0.4	<1	30%	Pass	
Chromium	S18-My17380	NCP	mg/kg	13	12	11	30%	Pass	
Copper	S18-My17380	NCP	mg/kg	18	16	16	30%	Pass	
Lead	S18-My17380	NCP	mg/kg	64	58	10	30%	Pass	
Mercury	S18-My18035	NCP	mg/kg	< 0.1	< 0.1	<1	30%	Pass	
Nickel	S18-My17380	NCP	mg/kg	9.0	9.6	6.0	30%	Pass	
Zinc	S18-My18035	NCP	mg/kg	6.6	6.9	5.0	30%	Pass	
Duplicate									
				Result 1	Result 2	RPD			
% Moisture	S18-My13998	CP	%	9.1	9.6	5.0	30%	Pass	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Comments

Sample Integrity

Custody Seals Intact (If used)	N/A
Attempt to Chill was evident	Yes
Sample correctly preserved	Yes
Appropriate sample containers have been used	Yes
Sample containers for volatile analysis received with minimal headspace	Yes
Samples received within HoldingTime	Yes
Some samples have been subcontracted	No

Authorised By

Nibha Vaidya Analytical Services Manager



Glenn Jackson
National Operations Manager

Final report - this Report replaces any previously issued Report

- Indicates Not Requested

* Indicates NATA accreditation does not cover the performance of this service

Measurement uncertainty of test data is available on request or please click here.

Eurofins | mgt shall not be liable for loss, cost, damages or expenses incurred by the client, or any other person or company, resulting from the use of any information or interpretation given in this report. In no case shall Eurofins | mgt be liable for consequential damages including, but not limited to, lost profits, damages for failure to meet deadlines and lost production arising from this report. This document shall not be reproduced except in full and relates only to the items tested. Unless indicated otherwise, the tests were performed on the samples as received.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

ABN– 50 005 085 521
e.mail : EnviroSales@eurofins.com
web : www.eurofins.com.au

Melbourne
2-5 Kingston Town Close
Oakleigh VIC 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261
Site # 23736

Company Name:	Alliance Geotechnical	**Order No.:**		**Received:**	May 10, 2018 3:26 PM
Address:	10 Welder Road Seven Hills NSW 2147	**Report #:** **Phone:** **Fax:**	597827 1800 288 188 02 9675 1888	**Due:** **Priority:** **Contact Name:**	May 17, 2018 5 Day Craig Cowper
Project Name:	JORDAN SPRINGS				
Project ID:	7161				

Eurofins | mgt Analytical Services Manager : Nibha Valdya

Sample Detail						Metals M8	Moisture Set
Melbourne Laboratory - NATA Site # 1254 & 14271							
Sydney Laboratory - NATA Site # 18217						X	X
Brisbane Laboratory - NATA Site # 20794							
Perth Laboratory - NATA Site # 23736							
External Laboratory							
No	**Sample ID**	**Sample Date**	**Sampling Time**	**Matrix**	**LAB ID**		
1	DUP1A	May 09, 2018		Soil	S18-My13998	X	X
2	DUP2A	May 09, 2018		Soil	S18-My13999	X	X
Test Counts						2	2

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

eurofins | mgt

Melbourne
3-5 Kingston Town Close
Oakleigh Vic 3166
Phone : +61 3 8564 5000
NATA # 1261
Site # 1254 & 14271

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Perth
2/91 Leach Highway
Kewdale WA 6105
Phone : +61 8 9251 9600
NATA # 1261 Site # 23736

ABN – 50 005 085 521 e.mail : EnviroSales@eurofins.com web : www.eurofins.com.au

Sample Receipt Advice

Company name:	**Alliance Geotechnical**
Contact name:	Craig Cowper
Project name:	JORDAN SPRINGS
Project ID:	7161
COC number:	Not provided
Turn around time:	5 Day
Date/Time received:	May 10, 2018 3:26 PM
Eurofins | mgt reference:	**597827**

Sample information

☑ A detailed list of analytes logged into our LIMS, is included in the attached summary table.

☑ All samples have been received as described on the above COC.

☑ COC has been completed correctly.

☑ Attempt to chill was evident.

☑ Appropriately preserved sample containers have been used.

☑ All samples were received in good condition.

☑ Samples have been provided with adequate time to commence analysis in accordance with the relevant holding times.

☑ Appropriate sample containers have been used.

☒ Split sample sent to requested external lab.

☒ Some samples have been subcontracted.

N/A Custody Seals intact (if used).

Contact notes

If you have any questions with respect to these samples please contact:

Nibha Vaidya on Phone : +61 (2) 9900 8400 or by e.mail: NibhaVaidya@eurofins.com

Results will be delivered electronically via e.mail to Craig Cowper - c.cowper@allgeo.com.au.

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX								
SP09-0.9	9/5/2018			X	Ice	2					X	X										
SP10-0.3	9/5/2018			X	Ice	2					X	X										
SP10-0.6	9/5/2018			X	Ice	2	X	X	X	X	X											
SP10-0.9	9/5/2018			X	Ice	2		X				X										
SP11-0.3	9/5/2018			X	Ice	2		X			X	X										
SP11-0.6	9/5/2018			X	Ice	2		X				X										
SP11-0.9	9/5/2018			X	Ice	2	X		X	X	X											
DUP1	9/5/2018			X	Ice	1					X											
DUP1A	9/5/2018			X	Ice	1					X											Send to Eurofins
DUP2	9/5/2018			X	Ice	1					X											

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Bolisnic	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By: Jadan	Date/Time 10/05/18 @ 3:26pm.
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No: #97827.
	Comments		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 – Jordan Springs
Purchase Order No:
Results Required By:
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com au

Client Sample ID	Date Sampled	Lab Sample ID	WATER	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX								
DUP2A	9/5/2018			X	Ice	1					X											Send To Eurofins
TRIP-BLANK	9/5/2018		X		Ice	1								X								
TRIP-SPIKE	9/5/2018		X		Ice	1								X								

Relinquished By: Craig Cowper — Date/Time: 09/05/2018 @ 1200hrs — Received By: A Edise — Date/Time 9/5/18 @ 2:57pm
Relinquished By: — Date/Time: — Received By: Jack W — Date/Time 9/5/18 @ 3:26pm
Samples Intact: Yes/ No — Temperature: Ambient / Chilled — Sample Cooler Sealed: Yes/ No — Laboratory Quotation No.
Comments

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
ENGINEERING | ENVIRONMENTAL | TESTING
Your On-Site Geotechnical & Environmental Specialists

T: 1800 288 188
E: office@allgeo.com.au
W: www.allgeo.com.au
P: PO Box 275
Seven Hills NSW, 1730

LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust
Level 14, Tower Three, International Towers Sydney
Exchange Place, 300 Barangaroo Avenue
Barangaroo NSW 2000

Report Type: Waste Classification
Project Name: Stockpiles SP02 to SP11
Project Address: Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW
Report Number: 7161-ER-1-5
Report Date: 22 May 2018

1. Introduction

Alliance Geotechnical Pty Ltd (AG) was engaged by Company Name (the client) to assess the waste classification of ten soil stockpiles located in Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW (the site), to facilitate their offsite disposal. The locality of the site is presented in attached Figure 1 and the layout of the site is presented in attached Figure 2.

This classification has been undertaken with reference to NSW EPA 2014, 'Waste Classification Guidelines'.

2. History of Waste and Production of Waste

Based on information contained in:

- AG 2018a, 'Supplementary Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 20 April 2018, ref: 7161-ER-1-3.
- AG 2018b, 'Stockpile Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 17 May 2018, ref: 7161-ER-1-3.

and verbal advice from the client, the history of SP02 to SP11 is not clear, and may be associated with fly tipping on the site.

It is also understood that the waste will be produced during excavation and removal offsite of the stockpiles.

3. Potential Contaminating Activities at Waste Generation Site

Based on information contained in AG (2018a) and AG (2018b), there does not appear to be land contaminating activities being undertaken at the waste generation site.

4. Acid Sulfate Soils

The Australian Soil Resource Information System website (http://www.asris.csiro.au/mapping/viewer.htm) indicates that the site is in an area mapped as 'Extremely Low Probability / Low Confidence', with respect to acid sulfate soils. Observations made of the stockpiles during fieldwork, did not include indicators of potential or actual acid sulfate soil

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

material (e.g. sulfurous odours, presence of shell, blue green or dark greenish grey muds, estuarine silty sands or sands).

5. Fieldwork

Soil sampling was undertaken by AG on 9 April 2018 and 9 May 2018.

Sampling points were excavated into each stockpiles SP02 to SP11. The locations of the stockpiles are presented in Figure 3.

Collected samples were placed in labelled laboratory supplied acid-rinsed glass jars (with Teflon lined lids) and zip lock bags.

Table 5 Material Description

ID	Material Observation	Discolouration, Staining or Odour
SP02	Clayey SILT, brown, trace sandstone and shale gravels, trace fibrous cement sheeting fragment	Nil reported
SP03	Silty CLAY, brown, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP04	Silty CLAY, brown, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP05	Silty CLAY, brown, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP06	Silty CLAY, brown/yellow, some SAND, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP07	Silty CLAY, brown, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP08	Silty CLAY, pale brown, trace sand and gravels, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP09	Silty CLAY, brown, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP10	Silty CLAY, pale brown/pale yellow, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported
SP11	Silty CLAY, pale brown/brown, some SAND, with building and demolition waste and fragments of fibrous cement sheeting	Nil reported

6. Quantity of Waste

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Based on observations made in the field, AG estimated that SP02 was approximately 20m^3 in volume, while stockpiles SP03 to SP11 were approximately 10m^3 in volume each.

7. Laboratory Analysis

A selection of the samples collected were scheduled for NATA accredited laboratory analysis. The results of the analysis are attached to this report.

8. Waste Classification Procedure

The 6-step classification procedure in NSW EPA (2014) was followed, with the results presented in Table 8.1.

Table 8.1 Waste Classification Procedure

Step		Material Observation
1	Is the waste special waste?	Yes – the waste contains asbestos
2	Is the waste liquid waste?	No
3	Is the waste pre-classified?	No
4	Does the waste possess hazardous characteristics?	No
5	Waste classification using chemical assessment	The detected concentrations of contaminants in the samples analysed by the laboratory, did not exceed relevant CTl, SCC1 and TCLP1 threshold values presented in Table 1 and Table 2 of NSW EPA (2014).
6	Is the waste putrescible or non-putrescible?	Non-putrescible

9. Material Classification

Based on AG's assessment of fieldwork observations and laboratory analytical data, and as of the date of this report, the material assessed would classify as GENERAL SOLID WASTE non-putrescible, managed as SPECIAL WASTE (asbestos).

This classification must be read in conjunction with the remainder of this report and the statement of limitations presented in **Section 10.**

10. Limitations

The findings presented in this report are based on chemical analysis, physical observations made during a site inspection, and anecdotal information that were made available during the course of this investigation. To the best of our knowledge, these observations represent a reasonable interpretation

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

of the general condition of the site at the time of report completion. Should new information become available regarding conditions at the site, AG reserves the right to review the report in the context of the additional information.

This report has been prepared solely for the use of the client to whom it is addressed and no other party is entitled to rely on its findings.

No warranties are made as to the information provided in this report. All conclusions and recommendations made in this report are of the professional opinions of personnel involved with the project and while normal checking of the accuracy of data has been conducted, any circumstances outside the scope of this report or which are not made known to personnel and which may impact on those opinions is not the responsibility of Alliance Geotechnical Pty Ltd.

11. Closing

Should you need any further information or to discuss this report, please contact the undersigned.

For and on behalf of Alliance Geotechnical Pty Ltd




Craig Cowper
Principal Environmental Scientist

Attachments

Figure 1 Site Locality Plan
Figure 2 Site Layout Plan
Figure 3 Stockpile Locations Plan
Laboratory Documentation


Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Attachments

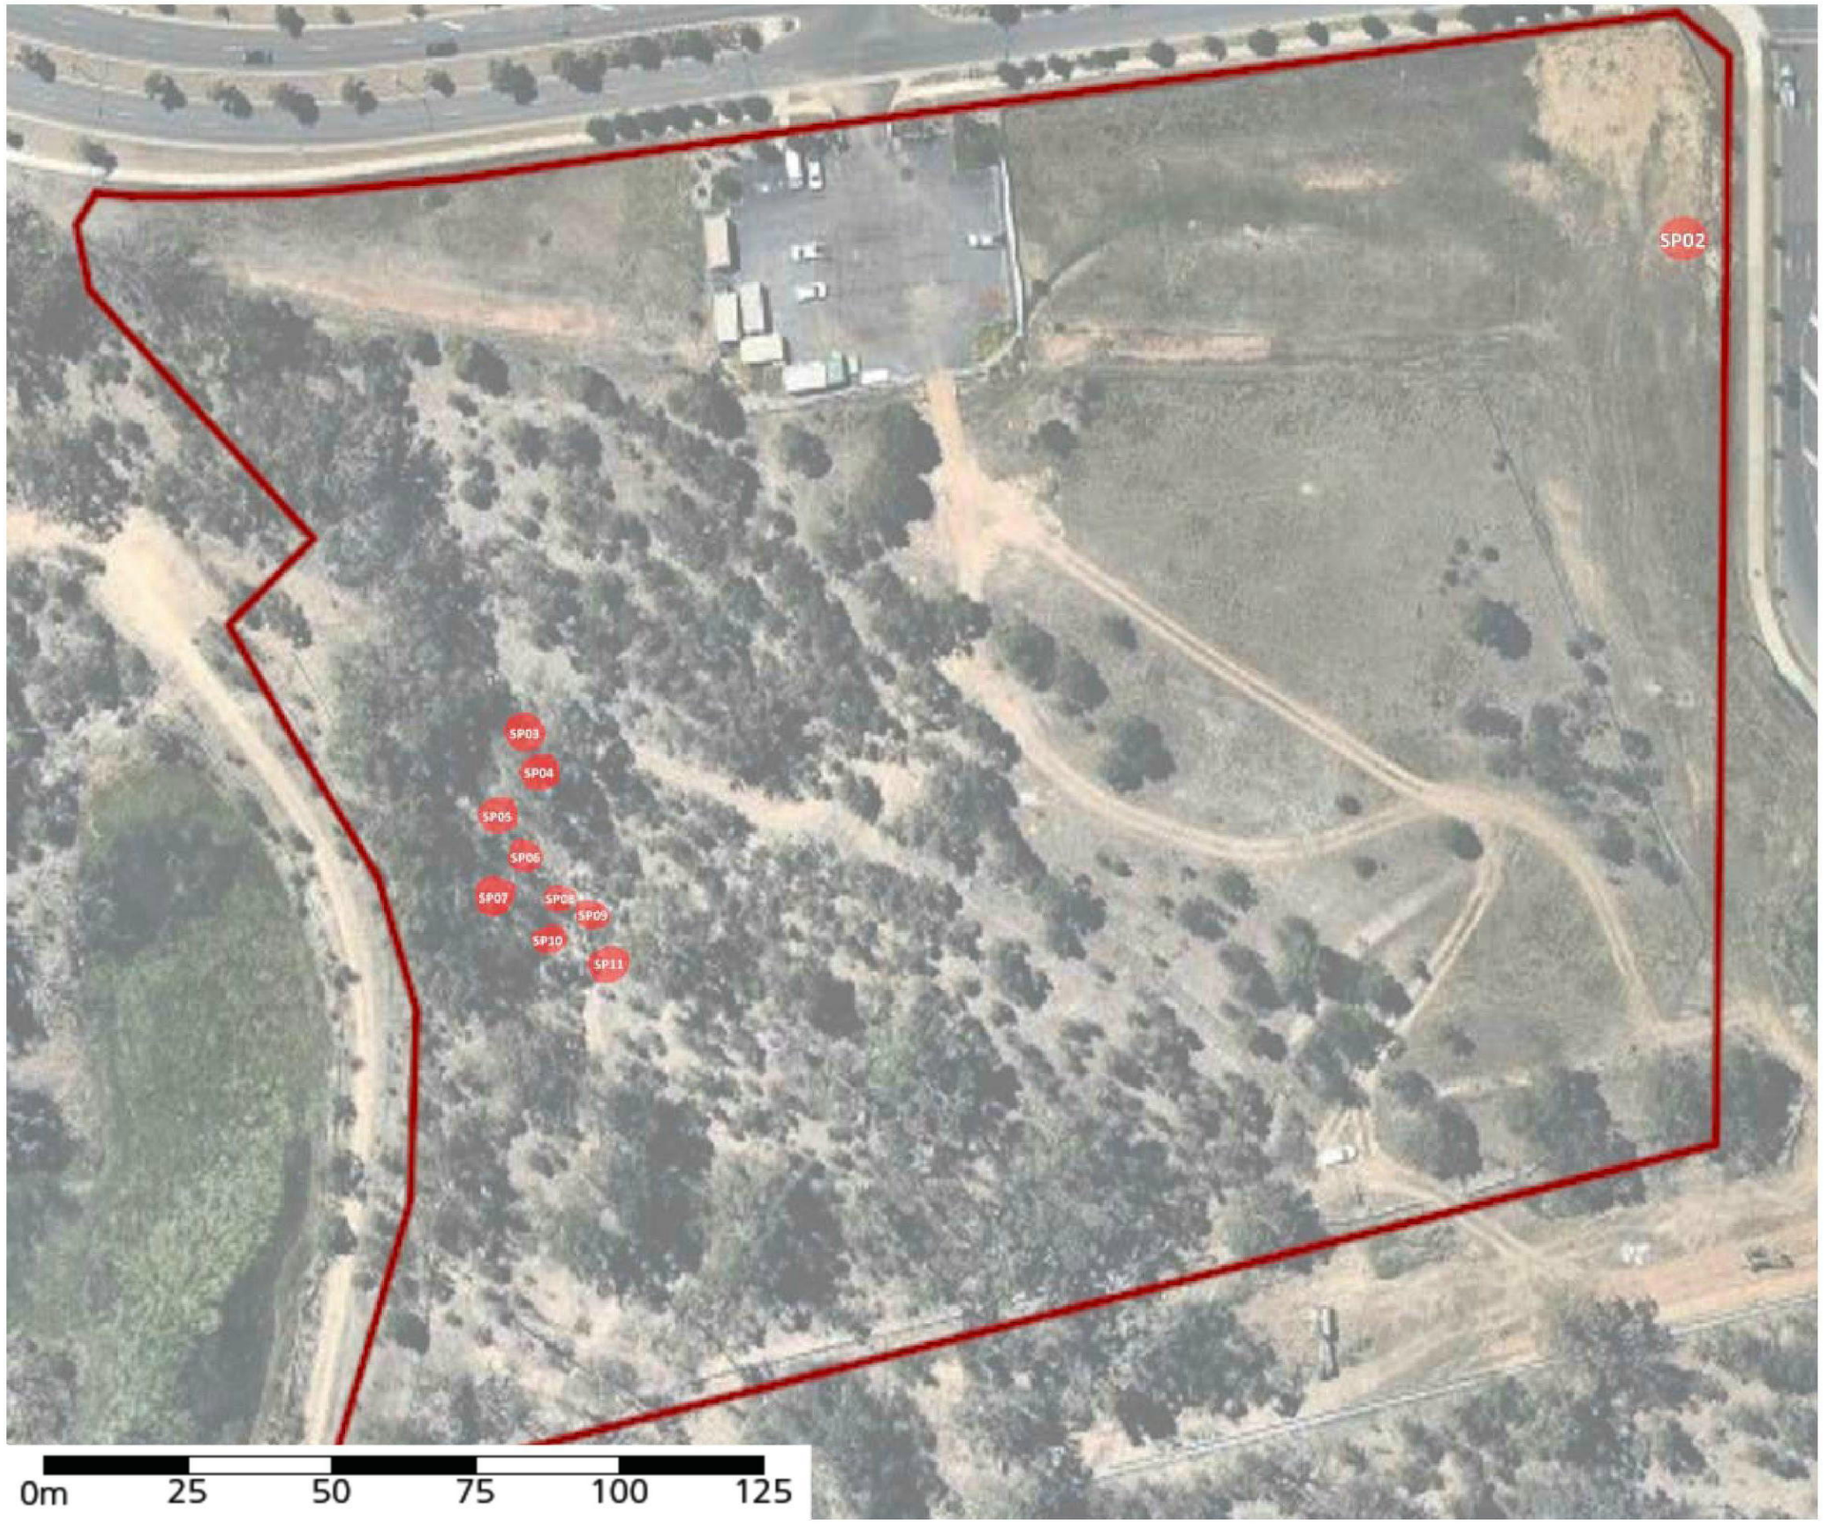


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpiles SP02 to SP11	**Report No:** 7161-ER-1-5 **Figure Date:** 21 May 2018	N	**Figure No:** 3	**Figure Title:** Stockpile Locations Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

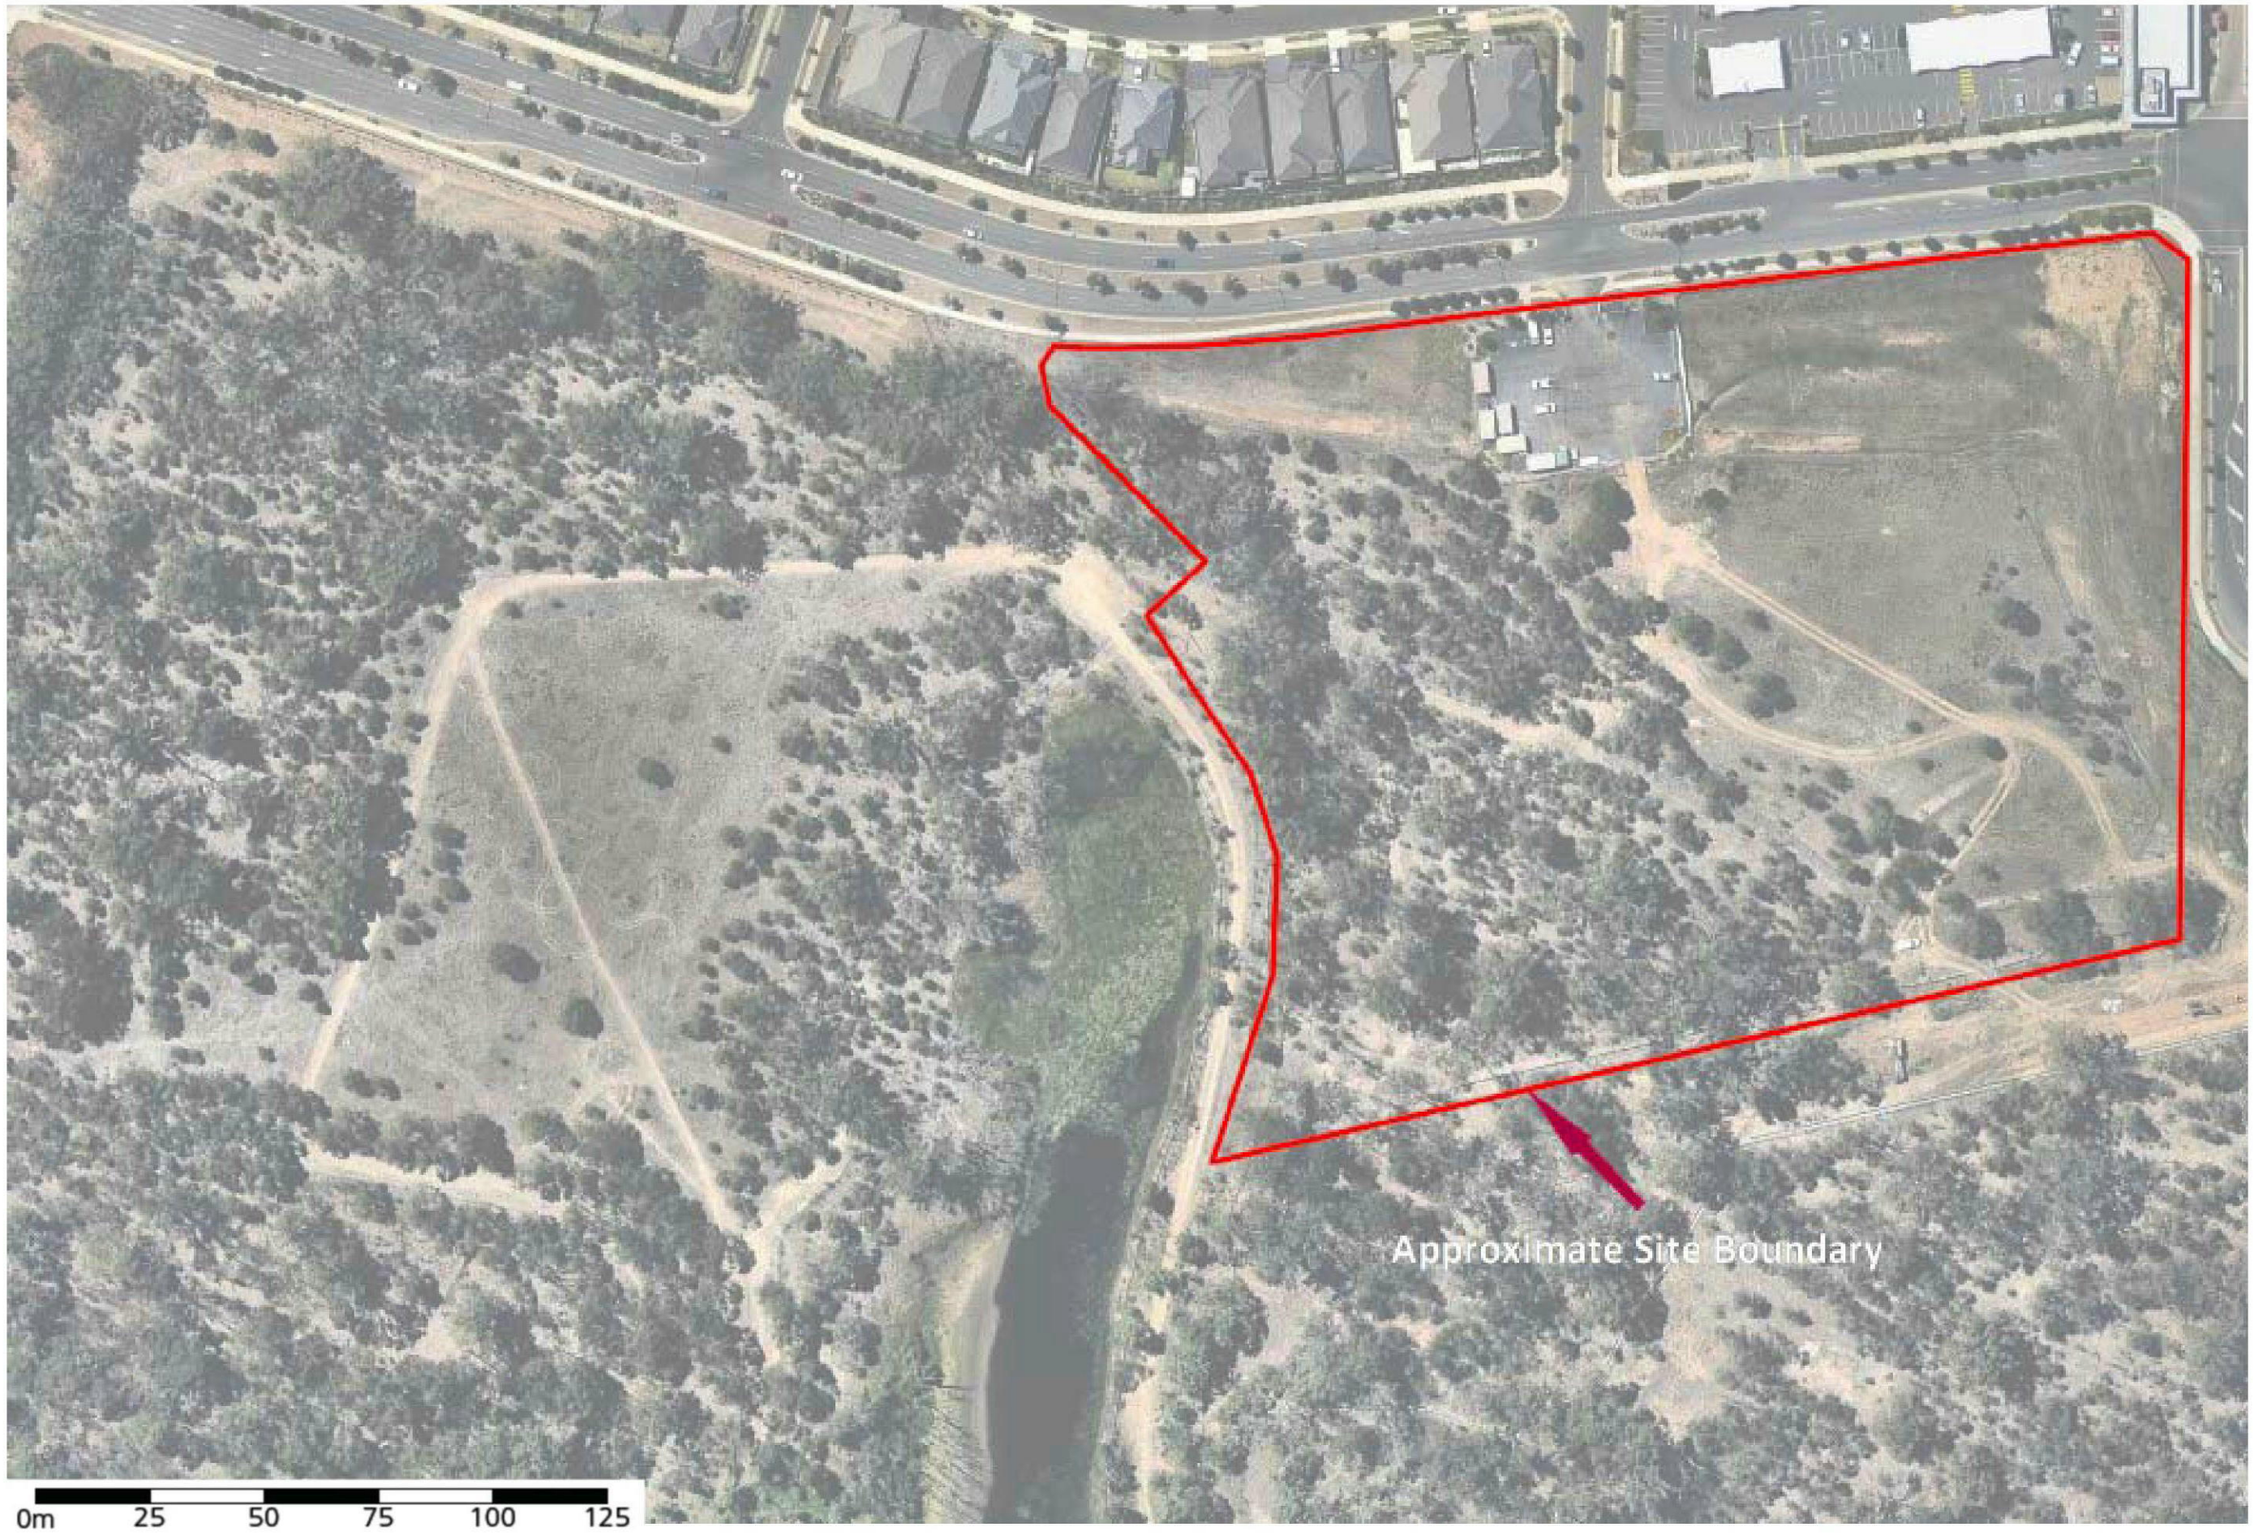

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpiles SP02 to SP11	**Report No:** 7161-ER-1-5 **Figure Date:** 21 May 2018	N	**Figure No:** 2	**Figure Title:** Site Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

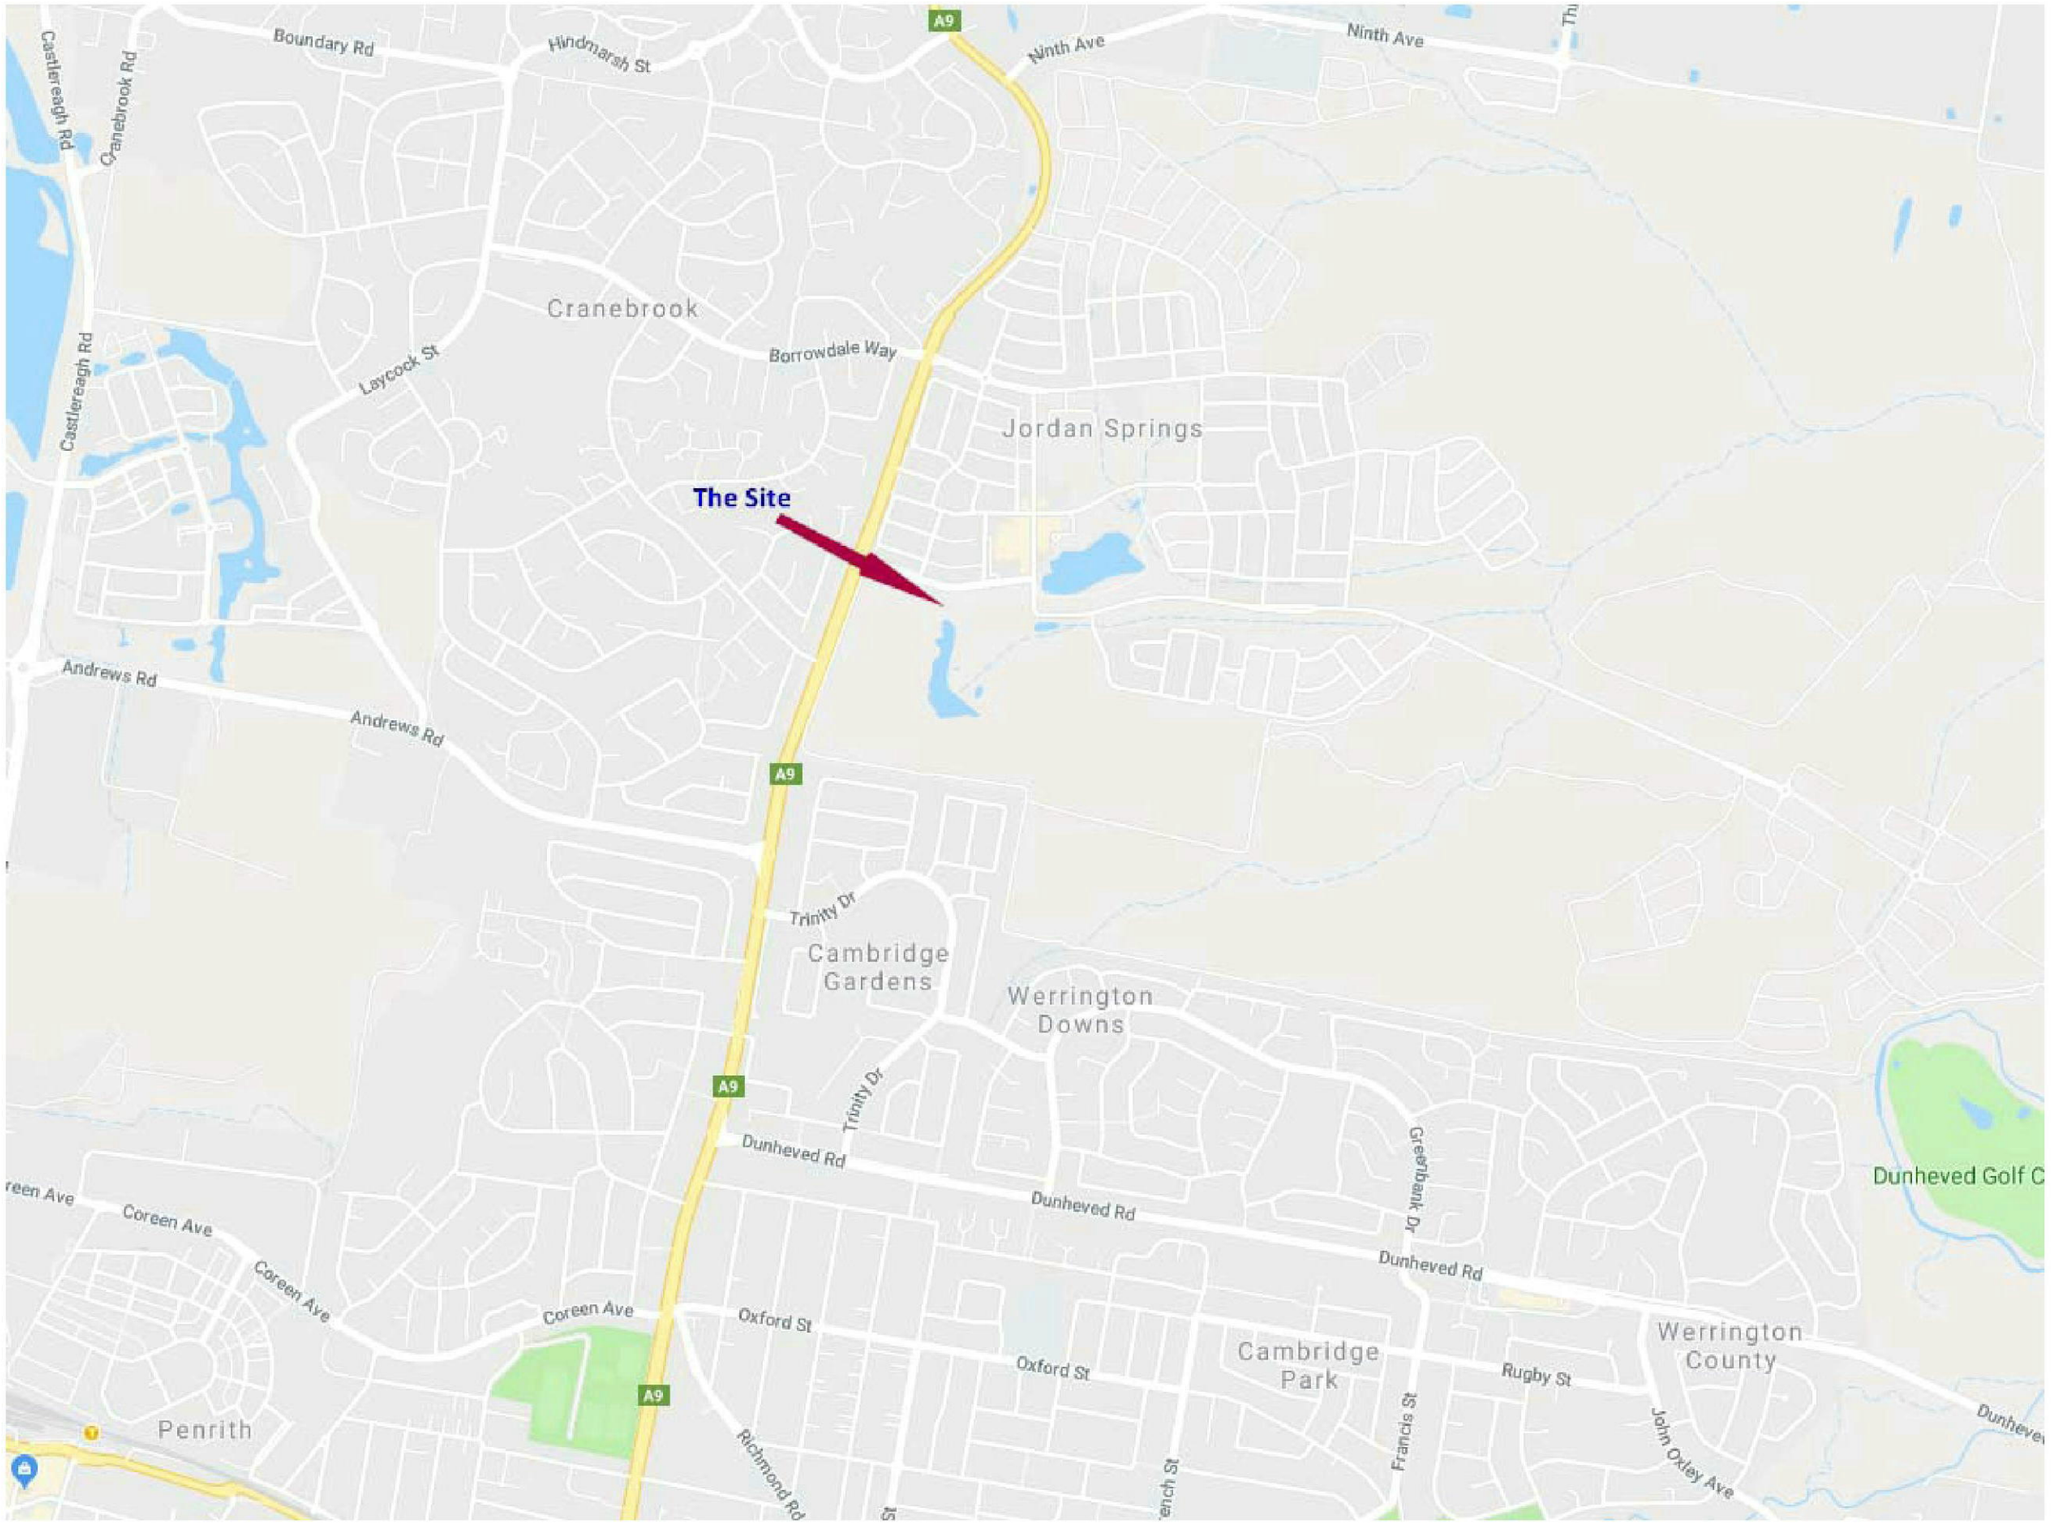

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Stockpiles SP02 to SP11	**Report No:** 7161-ER-1-5 **Figure Date:** 21 May 2018	N	**Figure No:** 1	**Figure Title:** Site Locality Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS		LABORATORY DETAILS	
Contact	Craig Cowper	Manager	Huong Crawford
Client	ALLIANCE GEOTECHNICAL PTY LTD	Laboratory	SGS Alexandria Environmental
Address	10 Welder Road Seven Hills NSW 2147	Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	0407 989 885	Telephone	+61 2 8594 0400
Facsimile	02 9675 1888	Facsimile	+61 2 8594 0499
Email	c.cowper@allgeo.com.au	Email	au.environmental.sydney@sgs.com
Project	**7161 Jordan Springs**	SGS Reference	**SE177801 R1**
Order Number	**P1054**	Date Received	10 Apr 2018
Samples	17	Date Reported	17 Apr 2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

This report cancels and supersedes the report No.SE177801 R0 dated 13th April 2018 issued by SGS Environment, Health and Safety due to addition of PAH results #5.

SIGNATORIES

Akheeqar Beniameen
Chemist

Bennet Lo
Senior Organic Chemist/Metals Chemis

Kamrul Ahsan
Senior Chemist

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
VOC's In Soil Method: AN433 Tested: 12/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	0.4	<0.1	<0.1	0.4
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	89	81	73	86
d4-1,2-dichloroethane (Surrogate)	%	-	110	108	118	115
d8-toluene (Surrogate)	%	-	126	118	114	109
Bromofluorobenzene (Surrogate)	%	-	76	82	82	72
Totals						
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6
Volatile Petroleum Hydrocarbons In Soil Method: AN433 Tested: 12/4/2018						
TRH C6-C10	mg/kg	25	<25	<25	<25	<25
TRH C6-C9	mg/kg	20	<20	<20	<20	<20
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	89	81	73	86
d4-1,2-dichloroethane (Surrogate)	%	-	110	108	118	115
d8-toluene (Surrogate)	%	-	126	118	114	109
Bromofluorobenzene (Surrogate)	%	-	76	82	82	72
VPH F Bands						
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
TRH (Total Recoverable Hydrocarbons) In Soil Method: AN403 Tested: 12/4/2018						
TRH C10-C14	mg/kg	20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	<45	<45	<45	<45
TRH C29-C36	mg/kg	45	<45	<45	<45	<45
TRH C37-C40	mg/kg	100	<100	<100	<100	<100
TRH C10-C36 Total	mg/kg	110	<110	<110	<110	<110
TRH C10-C40 Total (F bands)	mg/kg	210	<210	<210	<210	<210
TRH F Bands						
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	<90	<90	<90	<90
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 12/4/2018						
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Phenanthrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Chrysene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Total PAH (18)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	78	74	74	72
2-fluorobiphenyl (Surrogate)	%	-	96	104	102	104
d14-p-terphenyl (Surrogate)	%	-	108	114	114	114
OC Pesticides In Soil Method: AN420 Tested: 12/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
OC Pesticides in Soil Method: AN420 Tested: 12/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	105	105	89	98
PCBs in Soil Method: AN420 Tested: 12/4/2018						
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	105	105	89	98
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018						
Arsenic, As	mg/kg	3	6	7	5	7
Cadmium, Cd	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	11	21	13	15
Copper, Cu	mg/kg	0.5	14	20	24	43
Nickel, Ni	mg/kg	0.5	2.4	6.9	7.6	13
Lead, Pb	mg/kg	1	14	19	14	45
Zinc, Zn	mg/kg	0.5	14	42	31	140
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	<0.05	<0.05	<0.05	<0.05

Parameter	Units	LOR	Sample Number: SE177801.001 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP01/01	SE177801.002 Soil 09 Apr 2018 SP01/02	SE177801.003 Soil 09 Apr 2018 SP01/03	SE177801.004 Soil 09 Apr 2018 SP02/01
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	10	5.9	9.2	10

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
VOC's In Soil Method: AN433 Tested: 12/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	<0.1	-	<0.1	-
Toluene	mg/kg	0.1	<0.1	-	<0.1	-
Ethylbenzene	mg/kg	0.1	<0.1	-	<0.1	-
m/p-xylene	mg/kg	0.2	<0.2	-	<0.2	-
o-xylene	mg/kg	0.1	<0.1	-	<0.1	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	0.3	-	<0.1	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	83	-	72	-
d4-1,2-dichloroethane (Surrogate)	%	-	103	-	103	-
d8-toluene (Surrogate)	%	-	115	-	116	-
Bromofluorobenzene (Surrogate)	%	-	73	-	79	-
Totals						
Total Xylenes	mg/kg	0.3	<0.3	-	<0.3	-
Total BTEX	mg/kg	0.6	<0.6	-	<0.6	-
Volatile Petroleum Hydrocarbons In Soil Method: AN433 Tested: 12/4/2018						
TRH C6-C10	mg/kg	25	<25	-	<25	-
TRH C6-C9	mg/kg	20	<20	-	<20	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	83	-	72	-
d4-1,2-dichloroethane (Surrogate)	%	-	103	-	103	-
d8-toluene (Surrogate)	%	-	115	-	116	-
Bromofluorobenzene (Surrogate)	%	-	73	-	79	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	<0.1	-	<0.1	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	-	<25	-

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
TRH (Total Recoverable Hydrocarbons) In Soil Method: AN403 Tested: 12/4/2018						
TRH C10-C14	mg/kg	20	<20	-	<20	-
TRH C15-C28	mg/kg	45	<45	-	<45	-
TRH C29-C36	mg/kg	45	<45	-	<45	-
TRH C37-C40	mg/kg	100	<100	-	<100	-
TRH C10-C36 Total	mg/kg	110	<110	-	<110	-
TRH C10-C40 Total (F bands)	mg/kg	210	<210	-	<210	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	<25	-	<25	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	-	<25	-
TRH >C16-C34 (F3)	mg/kg	90	<90	-	<90	-
TRH >C34-C40 (F4)	mg/kg	120	<120	-	<120	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 12/4/2018						
Naphthalene	mg/kg	0.1	<0.1	-	<0.1	-
2-methylnaphthalene	mg/kg	0.1	<0.1	-	<0.1	-
1-methylnaphthalene	mg/kg	0.1	<0.1	-	<0.1	-
Acenaphthylene	mg/kg	0.1	<0.1	-	<0.1	-
Acenaphthene	mg/kg	0.1	<0.1	-	<0.1	-
Fluorene	mg/kg	0.1	<0.1	-	<0.1	-
Phenanthrene	mg/kg	0.1	0.3	-	<0.1	-
Anthracene	mg/kg	0.1	<0.1	-	<0.1	-
Fluoranthene	mg/kg	0.1	0.3	-	<0.1	-
Pyrene	mg/kg	0.1	0.5	-	<0.1	-
Benzo(a)anthracene	mg/kg	0.1	0.2	-	<0.1	-
Chrysene	mg/kg	0.1	0.2	-	<0.1	-
Benzo(b&j)fluoranthene	mg/kg	0.1	0.1	-	<0.1	-
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	-	<0.1	-
Benzo(a)pyrene	mg/kg	0.1	0.1	-	<0.1	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	-	<0.1	-
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	-	<0.1	-
Benzo(ghi)perylene	mg/kg	0.1	0.1	-	<0.1	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	-	<0.2	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	-	<0.3	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	0.2	-	<0.2	-
Total PAH (18)	mg/kg	0.8	1.9	-	<0.8	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	1.9	-	<0.8	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	78	-	76	-
2-fluorobiphenyl (Surrogate)	%	-	106	-	86	-
d14-p-terphenyl (Surrogate)	%	-	114	-	98	-
OC Pesticides in Soil Method: AN420 Tested: 12/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	-	<0.1	-
Alpha BHC	mg/kg	0.1	<0.1	-	<0.1	-
Lindane	mg/kg	0.1	<0.1	-	<0.1	-
Heptachlor	mg/kg	0.1	<0.1	-	<0.1	-
Aldrin	mg/kg	0.1	<0.1	-	<0.1	-
Beta BHC	mg/kg	0.1	<0.1	-	<0.1	-
Delta BHC	mg/kg	0.1	<0.1	-	<0.1	-
Heptachlor epoxide	mg/kg	0.1	<0.1	-	<0.1	-
o,p'-DDE	mg/kg	0.1	<0.1	-	<0.1	-
Alpha Endosulfan	mg/kg	0.2	<0.2	-	<0.2	-
Gamma Chlordane	mg/kg	0.1	<0.1	-	<0.1	-
Alpha Chlordane	mg/kg	0.1	<0.1	-	<0.1	-
trans-Nonachlor	mg/kg	0.1	<0.1	-	<0.1	-
p,p'-DDE	mg/kg	0.1	<0.1	-	<0.1	-
Dieldrin	mg/kg	0.2	<0.2	-	<0.2	-
Endrin	mg/kg	0.2	<0.2	-	<0.2	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	<0.1	-	<0.1	-
o,p'-DDT	mg/kg	0.1	<0.1	-	<0.1	-
Beta Endosulfan	mg/kg	0.2	<0.2	-	<0.2	-
p,p'-DDD	mg/kg	0.1	<0.1	-	<0.1	-
p,p'-DDT	mg/kg	0.1	<0.1	-	<0.1	-
Endosulfan sulphate	mg/kg	0.1	<0.1	-	<0.1	-
Endrin Aldehyde	mg/kg	0.1	<0.1	-	<0.1	-
Methoxychlor	mg/kg	0.1	<0.1	-	<0.1	-
Endrin Ketone	mg/kg	0.1	<0.1	-	<0.1	-
Isodrin	mg/kg	0.1	<0.1	-	<0.1	-
Mirex	mg/kg	0.1	<0.1	-	<0.1	-
Total CLP OC Pesticides	mg/kg	1	<1	-	<1	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	104	-	70	-
PCBs in Soil Method: AN420 Tested: 12/4/2018						
Arochlor 1016	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1221	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1232	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1242	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1248	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1254	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1260	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1262	mg/kg	0.2	<0.2	-	<0.2	-
Arochlor 1268	mg/kg	0.2	<0.2	-	<0.2	-
Total PCBs (Arochlors)	mg/kg	1	<1	-	<1	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	104	-	70	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018						
Arsenic, As	mg/kg	3	7	-	5	-
Cadmium, Cd	mg/kg	0.3	<0.3	-	<0.3	-
Chromium, Cr	mg/kg	0.3	15	-	13	-
Copper, Cu	mg/kg	0.5	55	-	34	-
Nickel, Ni	mg/kg	0.5	12	-	11	-
Lead, Pb	mg/kg	1	68	-	40	-
Zinc, Zn	mg/kg	0.5	180	-	190	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	0.05	-	<0.05	-

Parameter	Units	LOR	Sample Number: SE177801.005 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: SP02/02	SE177801.006 Material 09 Apr 2018 SP02/02-FRAG	SE177801.007 Soil 09 Apr 2018 SP02/03	SE177801.008 Material 09 Apr 2018 SP03/FCS
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	9.6	-	8.3	-

Parameter	Units	LOR	Sample Number: SE177801.009 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
VOC's In Soil Method: AN433 Tested: 13/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	-	-	-	-
Toluene	mg/kg	0.1	-	-	-	-
Ethylbenzene	mg/kg	0.1	-	-	-	-
m/p-xylene	mg/kg	0.2	-	-	-	-
o-xylene	mg/kg	0.1	-	-	-	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
Totals						
Total Xylenes	mg/kg	0.3	-	-	-	-
Total BTEX	mg/kg	0.6	-	-	-	-
Volatile Petroleum Hydrocarbons In Soil Method: AN433 Tested: 13/4/2018						
TRH C6-C10	mg/kg	25	-	-	-	-
TRH C6-C9	mg/kg	20	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	-	-	-	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-	-	-	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
TRH (Total Recoverable Hydrocarbons) In Soil Method: AN403 Tested: 13/4/2018						
TRH C10-C14	mg/kg	20	-	-	-	-
TRH C15-C28	mg/kg	45	-	-	-	-
TRH C29-C36	mg/kg	45	-	-	-	-
TRH C37-C40	mg/kg	100	-	-	-	-
TRH C10-C36 Total	mg/kg	110	-	-	-	-
TRH C10-C40 Total (F bands)	mg/kg	210	-	-	-	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	-	-	-	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-	-	-	-
TRH >C16-C34 (F3)	mg/kg	90	-	-	-	-
TRH >C34-C40 (F4)	mg/kg	120	-	-	-	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018						
Naphthalene	mg/kg	0.1	-	-	-	-
2-methylnaphthalene	mg/kg	0.1	-	-	-	-
1-methylnaphthalene	mg/kg	0.1	-	-	-	-
Acenaphthylene	mg/kg	0.1	-	-	-	-
Acenaphthene	mg/kg	0.1	-	-	-	-
Fluorene	mg/kg	0.1	-	-	-	-
Phenanthrene	mg/kg	0.1	-	-	-	-
Anthracene	mg/kg	0.1	-	-	-	-
Fluoranthene	mg/kg	0.1	-	-	-	-
Pyrene	mg/kg	0.1	-	-	-	-
Benzo(a)anthracene	mg/kg	0.1	-	-	-	-
Chrysene	mg/kg	0.1	-	-	-	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(k)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(a)pyrene	mg/kg	0.1	-	-	-	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-	-	-	-
Dibenzo(ah)anthracene	mg/kg	0.1	-	-	-	-
Benzo(ghi)perylene	mg/kg	0.1	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-	-	-	-
Total PAH (18)	mg/kg	0.8	-	-	-	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-	-	-	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	-	-	-	-
2-fluorobiphenyl (Surrogate)	%	-	-	-	-	-
d14-p-terphenyl (Surrogate)	%	-	-	-	-	-
OC Pesticides In Soil Method: AN420 Tested: 13/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	-	-	-	-
Alpha BHC	mg/kg	0.1	-	-	-	-
Lindane	mg/kg	0.1	-	-	-	-
Heptachlor	mg/kg	0.1	-	-	-	-
Aldrin	mg/kg	0.1	-	-	-	-
Beta BHC	mg/kg	0.1	-	-	-	-
Delta BHC	mg/kg	0.1	-	-	-	-
Heptachlor epoxide	mg/kg	0.1	-	-	-	-
o,p'-DDE	mg/kg	0.1	-	-	-	-
Alpha Endosulfan	mg/kg	0.2	-	-	-	-
Gamma Chlordane	mg/kg	0.1	-	-	-	-
Alpha Chlordane	mg/kg	0.1	-	-	-	-
trans-Nonachlor	mg/kg	0.1	-	-	-	-
p,p'-DDE	mg/kg	0.1	-	-	-	-
Dieldrin	mg/kg	0.2	-	-	-	-
Endrin	mg/kg	0.2	-	-	-	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.009 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	-	-	-	-
o,p'-DDT	mg/kg	0.1	-	-	-	-
Beta Endosulfan	mg/kg	0.2	-	-	-	-
p,p'-DDD	mg/kg	0.1	-	-	-	-
p,p'-DDT	mg/kg	0.1	-	-	-	-
Endosulfan sulphate	mg/kg	0.1	-	-	-	-
Endrin Aldehyde	mg/kg	0.1	-	-	-	-
Methoxychlor	mg/kg	0.1	-	-	-	-
Endrin Ketone	mg/kg	0.1	-	-	-	-
Isodrin	mg/kg	0.1	-	-	-	-
Mirex	mg/kg	0.1	-	-	-	-
Total CLP OC Pesticides	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
PCBs in Soil Method: AN420 Tested: 13/4/2018						
Arochlor 1016	mg/kg	0.2	-	-	-	-
Arochlor 1221	mg/kg	0.2	-	-	-	-
Arochlor 1232	mg/kg	0.2	-	-	-	-
Arochlor 1242	mg/kg	0.2	-	-	-	-
Arochlor 1248	mg/kg	0.2	-	-	-	-
Arochlor 1254	mg/kg	0.2	-	-	-	-
Arochlor 1260	mg/kg	0.2	-	-	-	-
Arochlor 1262	mg/kg	0.2	-	-	-	-
Arochlor 1268	mg/kg	0.2	-	-	-	-
Total PCBs (Arochlors)	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 13/4/2018						
Arsenic, As	mg/kg	3	-	-	-	-
Cadmium, Cd	mg/kg	0.3	-	-	-	-
Chromium, Cr	mg/kg	0.3	-	-	-	-
Copper, Cu	mg/kg	0.5	-	-	-	-
Nickel, Ni	mg/kg	0.5	-	-	-	-
Lead, Pb	mg/kg	1	-	-	-	-
Zinc, Zn	mg/kg	0.5	-	-	-	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	-	-	-	-

Parameter	Units	LOR	Sample Number Sample Matrix Sample Date Sample Name SE177801.009 Material 09 Apr 2018 SP04/FCS	SE177801.010 Material 09 Apr 2018 SP05/FCS	SE177801.011 Material 09 Apr 2018 SP06/FCS	SE177801.012 Material 09 Apr 2018 SP07/FCS
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
VOC's In Soil Method: AN433 Tested: 13/4/2018						
Monocyclic Aromatic Hydrocarbons						
Benzene	mg/kg	0.1	-	-	-	-
Toluene	mg/kg	0.1	-	-	-	-
Ethylbenzene	mg/kg	0.1	-	-	-	-
m/p-xylene	mg/kg	0.2	-	-	-	-
o-xylene	mg/kg	0.1	-	-	-	-
Polycyclic VOCs						
Naphthalene	mg/kg	0.1	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
Totals						
Total Xylenes	mg/kg	0.3	-	-	-	-
Total BTEX	mg/kg	0.6	-	-	-	-
Volatile Petroleum Hydrocarbons In Soil Method: AN433 Tested: 13/4/2018						
TRH C6-C10	mg/kg	25	-	-	-	-
TRH C6-C9	mg/kg	20	-	-	-	-
Surrogates						
Dibromofluoromethane (Surrogate)	%	-	-	-	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-	-	-	-
d8-toluene (Surrogate)	%	-	-	-	-	-
Bromofluorobenzene (Surrogate)	%	-	-	-	-	-
VPH F Bands						
Benzene (F0)	mg/kg	0.1	-	-	-	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-	-	-	-

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
TRH (Total Recoverable Hydrocarbons) In Soil Method: AN403 Tested: 13/4/2018						
TRH C10-C14	mg/kg	20	-	-	-	-
TRH C15-C28	mg/kg	45	-	-	-	-
TRH C29-C36	mg/kg	45	-	-	-	-
TRH C37-C40	mg/kg	100	-	-	-	-
TRH C10-C36 Total	mg/kg	110	-	-	-	-
TRH C10-C40 Total (F bands)	mg/kg	210	-	-	-	-
TRH F Bands						
TRH >C10-C16	mg/kg	25	-	-	-	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-	-	-	-
TRH >C16-C34 (F3)	mg/kg	90	-	-	-	-
TRH >C34-C40 (F4)	mg/kg	120	-	-	-	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018						
Naphthalene	mg/kg	0.1	-	-	-	-
2-methylnaphthalene	mg/kg	0.1	-	-	-	-
1-methylnaphthalene	mg/kg	0.1	-	-	-	-
Acenaphthylene	mg/kg	0.1	-	-	-	-
Acenaphthene	mg/kg	0.1	-	-	-	-
Fluorene	mg/kg	0.1	-	-	-	-
Phenanthrene	mg/kg	0.1	-	-	-	-
Anthracene	mg/kg	0.1	-	-	-	-
Fluoranthene	mg/kg	0.1	-	-	-	-
Pyrene	mg/kg	0.1	-	-	-	-
Benzo(a)anthracene	mg/kg	0.1	-	-	-	-
Chrysene	mg/kg	0.1	-	-	-	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(k)fluoranthene	mg/kg	0.1	-	-	-	-
Benzo(a)pyrene	mg/kg	0.1	-	-	-	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-	-	-	-
Dibenzo(ah)anthracene	mg/kg	0.1	-	-	-	-
Benzo(ghi)perylene	mg/kg	0.1	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-	-	-	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-	-	-	-
Total PAH (18)	mg/kg	0.8	-	-	-	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-	-	-	-
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	-	-	-	-
2-fluorobiphenyl (Surrogate)	%	-	-	-	-	-
d14-p-terphenyl (Surrogate)	%	-	-	-	-	-
OC Pesticides In Soil Method: AN420 Tested: 13/4/2018						
Hexachlorobenzene (HCB)	mg/kg	0.1	-	-	-	-
Alpha BHC	mg/kg	0.1	-	-	-	-
Lindane	mg/kg	0.1	-	-	-	-
Heptachlor	mg/kg	0.1	-	-	-	-
Aldrin	mg/kg	0.1	-	-	-	-
Beta BHC	mg/kg	0.1	-	-	-	-
Delta BHC	mg/kg	0.1	-	-	-	-
Heptachlor epoxide	mg/kg	0.1	-	-	-	-
o,p'-DDE	mg/kg	0.1	-	-	-	-
Alpha Endosulfan	mg/kg	0.2	-	-	-	-
Gamma Chlordane	mg/kg	0.1	-	-	-	-
Alpha Chlordane	mg/kg	0.1	-	-	-	-
trans-Nonachlor	mg/kg	0.1	-	-	-	-
p,p'-DDE	mg/kg	0.1	-	-	-	-
Dieldrin	mg/kg	0.2	-	-	-	-
Endrin	mg/kg	0.2	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018 (continued)						
o,p'-DDD	mg/kg	0.1	-	-	-	-
o,p'-DDT	mg/kg	0.1	-	-	-	-
Beta Endosulfan	mg/kg	0.2	-	-	-	-
p,p'-DDD	mg/kg	0.1	-	-	-	-
p,p'-DDT	mg/kg	0.1	-	-	-	-
Endosulfan sulphate	mg/kg	0.1	-	-	-	-
Endrin Aldehyde	mg/kg	0.1	-	-	-	-
Methoxychlor	mg/kg	0.1	-	-	-	-
Endrin Ketone	mg/kg	0.1	-	-	-	-
Isodrin	mg/kg	0.1	-	-	-	-
Mirex	mg/kg	0.1	-	-	-	-
Total CLP OC Pesticides	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
PCBs in Soil Method: AN420 Tested: 13/4/2018						
Arochlor 1016	mg/kg	0.2	-	-	-	-
Arochlor 1221	mg/kg	0.2	-	-	-	-
Arochlor 1232	mg/kg	0.2	-	-	-	-
Arochlor 1242	mg/kg	0.2	-	-	-	-
Arochlor 1248	mg/kg	0.2	-	-	-	-
Arochlor 1254	mg/kg	0.2	-	-	-	-
Arochlor 1260	mg/kg	0.2	-	-	-	-
Arochlor 1262	mg/kg	0.2	-	-	-	-
Arochlor 1268	mg/kg	0.2	-	-	-	-
Total PCBs (Arochlors)	mg/kg	1	-	-	-	-
Surrogates						
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-	-	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 13/4/2018						
Arsenic, As	mg/kg	3	-	-	-	-
Cadmium, Cd	mg/kg	0.3	-	-	-	-
Chromium, Cr	mg/kg	0.3	-	-	-	-
Copper, Cu	mg/kg	0.5	-	-	-	-
Nickel, Ni	mg/kg	0.5	-	-	-	-
Lead, Pb	mg/kg	1	-	-	-	-
Zinc, Zn	mg/kg	0.5	-	-	-	-
Mercury in Soil Method: AN312 Tested: 12/4/2018						
Mercury	mg/kg	0.05	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.013 Sample Matrix: Material Sample Date: 09 Apr 2018 Sample Name: SP08/FCS	SE177801.014 Material 09 Apr 2018 SP09/FCS	SE177801.015 Material 09 Apr 2018 SP10/FCS	SE177801.016 Material 09 Apr 2018 SP11/FCS
Moisture Content Method: AN002 Tested: 12/4/2018						
% Moisture	%w/w	0.5	-	-	-	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
VOC's In Soil Method: AN433 Tested: 13/4/2018			
Monocyclic Aromatic Hydrocarbons			
Benzene	mg/kg	0.1	-
Toluene	mg/kg	0.1	-
Ethylbenzene	mg/kg	0.1	-
m/p-xylene	mg/kg	0.2	-
o-xylene	mg/kg	0.1	-
Polycyclic VOCs			
Naphthalene	mg/kg	0.1	-
Surrogates			
Dibromofluoromethane (Surrogate)	%	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-
d8-toluene (Surrogate)	%	-	-
Bromofluorobenzene (Surrogate)	%	-	-
Totals			
Total Xylenes	mg/kg	0.3	-
Total BTEX	mg/kg	0.6	-
Volatile Petroleum Hydrocarbons in Soil Method: AN433 Tested: 13/4/2018			
TRH C6-C10	mg/kg	25	-
TRH C6-C9	mg/kg	20	-
Surrogates			
Dibromofluoromethane (Surrogate)	%	-	-
d4-1,2-dichloroethane (Surrogate)	%	-	-
d8-toluene (Surrogate)	%	-	-
Bromofluorobenzene (Surrogate)	%	-	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
Volatile Petroleum Hydrocarbons In Soil Method: AN433 Tested: 13/4/2018 (continued)			
VPH F Bands			
Benzene (F0)	mg/kg	0.1	-
TRH C6-C10 minus BTEX (F1)	mg/kg	25	-
TRH (Total Recoverable Hydrocarbons) In Soil Method: AN403 Tested: 13/4/2018			
TRH C10-C14	mg/kg	20	-
TRH C15-C28	mg/kg	45	-
TRH C29-C36	mg/kg	45	-
TRH C37-C40	mg/kg	100	-
TRH C10-C36 Total	mg/kg	110	-
TRH C10-C40 Total (F bands)	mg/kg	210	-
TRH F Bands			
TRH >C10-C16	mg/kg	25	-
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	-
TRH >C16-C34 (F3)	mg/kg	90	-
TRH >C34-C40 (F4)	mg/kg	120	-
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018			
Naphthalene	mg/kg	0.1	-
2-methylnaphthalene	mg/kg	0.1	-
1-methylnaphthalene	mg/kg	0.1	-
Acenaphthylene	mg/kg	0.1	-
Acenaphthene	mg/kg	0.1	-
Fluorene	mg/kg	0.1	-
Phenanthrene	mg/kg	0.1	-
Anthracene	mg/kg	0.1	-
Fluoranthene	mg/kg	0.1	-
Pyrene	mg/kg	0.1	-
Benzo(a)anthracene	mg/kg	0.1	-
Chrysene	mg/kg	0.1	-
Benzo(b&j)fluoranthene	mg/kg	0.1	-
Benzo(k)fluoranthene	mg/kg	0.1	-
Benzo(a)pyrene	mg/kg	0.1	-
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	-
Dibenzo(ah)anthracene	mg/kg	0.1	-
Benzo(ghi)perylene	mg/kg	0.1	-
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	-
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	-
Total PAH (18)	mg/kg	0.8	-
Total PAH (NEPM/WHO 16)	mg/kg	0.8	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 13/4/2018 (continued)			
Surrogates			
d5-nitrobenzene (Surrogate)	%	-	-
2-fluorobiphenyl (Surrogate)	%	-	-
d14-p-terphenyl (Surrogate)	%	-	-
OC Pesticides in Soil Method: AN420 Tested: 13/4/2018			
Hexachlorobenzene (HCB)	mg/kg	0.1	-
Alpha BHC	mg/kg	0.1	-
Lindane	mg/kg	0.1	-
Heptachlor	mg/kg	0.1	-
Aldrin	mg/kg	0.1	-
Beta BHC	mg/kg	0.1	-
Delta BHC	mg/kg	0.1	-
Heptachlor epoxide	mg/kg	0.1	-
o,p'-DDE	mg/kg	0.1	-
Alpha Endosulfan	mg/kg	0.2	-
Gamma Chlordane	mg/kg	0.1	-
Alpha Chlordane	mg/kg	0.1	-
trans-Nonachlor	mg/kg	0.1	-
p,p'-DDE	mg/kg	0.1	-
Dieldrin	mg/kg	0.2	-
Endrin	mg/kg	0.2	-
o,p'-DDD	mg/kg	0.1	-
o,p'-DDT	mg/kg	0.1	-
Beta Endosulfan	mg/kg	0.2	-
p,p'-DDD	mg/kg	0.1	-
p,p'-DDT	mg/kg	0.1	-
Endosulfan sulphate	mg/kg	0.1	-
Endrin Aldehyde	mg/kg	0.1	-
Methoxychlor	mg/kg	0.1	-
Endrin Ketone	mg/kg	0.1	-
Isodrin	mg/kg	0.1	-
Mirex	mg/kg	0.1	-
Total CLP OC Pesticides	mg/kg	1	-
Surrogates			
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
PCBs in Soil Method: AN420 Tested: 13/4/2018			
Arochlor 1016	mg/kg	0.2	-
Arochlor 1221	mg/kg	0.2	-
Arochlor 1232	mg/kg	0.2	-
Arochlor 1242	mg/kg	0.2	-
Arochlor 1248	mg/kg	0.2	-
Arochlor 1254	mg/kg	0.2	-
Arochlor 1260	mg/kg	0.2	-
Arochlor 1262	mg/kg	0.2	-
Arochlor 1268	mg/kg	0.2	-
Total PCBs (Arochlors)	mg/kg	1	-
Surrogates			
Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	-
Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES Method: AN040/AN320 Tested: 12/4/2018			
Arsenic, As	mg/kg	3	4
Cadmium, Cd	mg/kg	0.3	<0.3
Chromium, Cr	mg/kg	0.3	13
Copper, Cu	mg/kg	0.5	22
Nickel, Ni	mg/kg	0.5	4.2
Lead, Pb	mg/kg	1	15
Zinc, Zn	mg/kg	0.5	28
Mercury in Soil Method: AN312 Tested: 12/4/2018			
Mercury	mg/kg	0.05	<0.05

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE177801.017 Sample Matrix: Soil Sample Date: 09 Apr 2018 Sample Name: DUP01
Moisture Content Method: AN002 Tested: 12/4/2018			
% Moisture	%w/w	0.5	8.8

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

Mercury in Soil Method: ME-(AU)-[ENV]AN312

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Mercury	LB145441	mg/kg	0.05	<0.05	0%	106%	95%

Moisture Content Method: ME-(AU)-[ENV]AN002

Parameter	QC Reference	Units	LOR	DUP %RPD
% Moisture	LB145459	%w/w	0.5	0%

OC Pesticides in Soil Method: ME-(AU)-[ENV]AN420

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Hexachlorobenzene (HCB)	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha BHC	LB145485	mg/kg	0.1	<0.1	0%	NA
Lindane	LB145485	mg/kg	0.1	<0.1	0%	NA
Heptachlor	LB145485	mg/kg	0.1	<0.1	0%	97%
Aldrin	LB145485	mg/kg	0.1	<0.1	0%	94%
Beta BHC	LB145485	mg/kg	0.1	<0.1	0%	NA
Delta BHC	LB145485	mg/kg	0.1	<0.1	0%	90%
Heptachlor epoxide	LB145485	mg/kg	0.1	<0.1	0%	NA
o,p'-DDE	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha Endosulfan	LB145485	mg/kg	0.2	<0.2	0%	NA
Gamma Chlordane	LB145485	mg/kg	0.1	<0.1	0%	NA
Alpha Chlordane	LB145485	mg/kg	0.1	<0.1	0%	NA
trans-Nonachlor	LB145485	mg/kg	0.1	<0.1	0%	NA
p,p'-DDE	LB145485	mg/kg	0.1	<0.1	0%	NA
Dieldrin	LB145485	mg/kg	0.2	<0.2	0%	93%
Endrin	LB145485	mg/kg	0.2	<0.2	0%	95%
o,p'-DDD	LB145485	mg/kg	0.1	<0.1	0%	NA
o,p'-DDT	LB145485	mg/kg	0.1	<0.1	0%	NA
Beta Endosulfan	LB145485	mg/kg	0.2	<0.2	0%	NA
p,p'-DDD	LB145485	mg/kg	0.1	<0.1	0%	NA
p,p'-DDT	LB145485	mg/kg	0.1	<0.1	0%	89%
Endosulfan sulphate	LB145485	mg/kg	0.1	<0.1	0%	NA
Endrin Aldehyde	LB145485	mg/kg	0.1	<0.1	0%	NA
Methoxychlor	LB145485	mg/kg	0.1	<0.1	0%	NA
Endrin Ketone	LB145485	mg/kg	0.1	<0.1	0%	NA
Isodrin	LB145485	mg/kg	0.1	<0.1	0%	NA
Mirex	LB145485	mg/kg	0.1	<0.1	0%	NA
Total CLP OC Pesticides	LB145485	mg/kg	1	<1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Tetrachloro-m-xylene (TCMX) (Surrogate)	LB145485	%	-	107%	14%	95%

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil **Method: ME-(AU)-[ENV]AN420**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Naphthalene	LB145485	mg/kg	0.1	<0.1	0%	103%
2-methylnaphthalene	LB145485	mg/kg	0.1	<0.1	0%	NA
1-methylnaphthalene	LB145485	mg/kg	0.1	<0.1	0%	NA
Acenaphthylene	LB145485	mg/kg	0.1	<0.1	0%	96%
Acenaphthene	LB145485	mg/kg	0.1	<0.1	0%	107%
Fluorene	LB145485	mg/kg	0.1	<0.1	0%	NA
Phenanthrene	LB145485	mg/kg	0.1	<0.1	0%	104%
Anthracene	LB145485	mg/kg	0.1	<0.1	0%	101%
Fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	104%
Pyrene	LB145485	mg/kg	0.1	<0.1	0%	101%
Benzo(a)anthracene	LB145485	mg/kg	0.1	<0.1	0%	NA
Chrysene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(b&j)fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(k)fluoranthene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(a)pyrene	LB145485	mg/kg	0.1	<0.1	0%	112%
Indeno(1,2,3-cd)pyrene	LB145485	mg/kg	0.1	<0.1	0%	NA
Dibenzo(ah)anthracene	LB145485	mg/kg	0.1	<0.1	0%	NA
Benzo(ghi)perylene	LB145485	mg/kg	0.1	<0.1	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=0	LB145485	TEQ (mg/kg)	0.2	<0.2	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR	LB145485	TEQ (mg/kg)	0.3	<0.3	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	LB145485	TEQ (mg/kg)	0.2	<0.2	0%	NA
Total PAH (18)	LB145485	mg/kg	0.8	<0.8	0%	NA
Total PAH (NEPM/WHO 16)	LB145485	mg/kg	0.8	<0.8		

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
d5-nitrobenzene (Surrogate)	LB145485	%	-	86%	0%	96%
2-fluorobiphenyl (Surrogate)	LB145485	%	-	92%	4%	88%
d14-p-terphenyl (Surrogate)	LB145485	%	-	100%	0%	86%

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

PCBs in Soil **Method: ME-(AU)-[ENV]AN420**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Arochlor 1016	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1221	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1232	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1242	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1248	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1254	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1260	LB145485	mg/kg	0.2	<0.2	0%	105%
Arochlor 1262	LB145485	mg/kg	0.2	<0.2	0%	NA
Arochlor 1268	LB145485	mg/kg	0.2	<0.2	0%	NA
Total PCBs (Arochlors)	LB145485	mg/kg	1	<1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Tetrachloro-m-xylene (TCMX) (Surrogate)	LB145485	%	-	97%	14%	92%

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES **Method: ME-(AU)-[ENV]AN040/AN320**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Arsenic, As	LB145473	mg/kg	3	<3	28 - 61%	111%	100%
Cadmium, Cd	LB145473	mg/kg	0.3	<0.3	0 - 18%	112%	111%
Chromium, Cr	LB145473	mg/kg	0.3	<0.3	1 - 14%	100%	101%
Copper, Cu	LB145473	mg/kg	0.5	<0.5	3 - 51%	111%	109%
Nickel, Ni	LB145473	mg/kg	0.5	<0.5	10 - 12%	106%	107%
Lead, Pb	LB145473	mg/kg	1	<1	5 - 13%	103%	5%
Zinc, Zn	LB145473	mg/kg	0.5	<0.5	8 - 23%	108%	34%

TRH (Total Recoverable Hydrocarbons) in Soil **Method: ME-(AU)-[ENV]AN403**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH C10-C14	LB145485	mg/kg	20	<20	0%	88%	120%
TRH C15-C28	LB145485	mg/kg	45	<45	0%	100%	113%
TRH C29-C36	LB145485	mg/kg	45	<45	0%	75%	113%
TRH C37-C40	LB145485	mg/kg	100	<100	0%	NA	NA
TRH C10-C36 Total	LB145485	mg/kg	110	<110	0%	NA	NA
TRH C10-C40 Total (F bands)	LB145485	mg/kg	210	<210	0%	NA	NA

TRH F Bands

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH >C10-C16	LB145485	mg/kg	25	<25	0%	75%	120%
TRH >C10-C16 - Naphthalene (F2)	LB145485	mg/kg	25	<25	0%	NA	NA
TRH >C16-C34 (F3)	LB145485	mg/kg	90	<90	0%	78%	98%
TRH >C34-C40 (F4)	LB145485	mg/kg	120	<120	0%	90%	NA

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

VOC's in Soil Method: ME-(AU)-[ENV]AN433

Monocyclic Aromatic Hydrocarbons

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Benzene	LB145431	mg/kg	0.1	<0.1	0%	96%
Toluene	LB145431	mg/kg	0.1	<0.1	0%	113%
Ethylbenzene	LB145431	mg/kg	0.1	<0.1	0%	113%
m/p-xylene	LB145431	mg/kg	0.2	<0.2	0%	122%
o-xylene	LB145431	mg/kg	0.1	<0.1	0%	112%

Polycyclic VOCs

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Naphthalene	LB145431	mg/kg	0.1	<0.1	0%	NA

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Dibromofluoromethane (Surrogate)	LB145431	%	-	104%	5 - 15%	85%
d4-1,2-dichloroethane (Surrogate)	LB145431	%	-	111%	14 - 15%	85%
d8-toluene (Surrogate)	LB145431	%	-	110%	1 - 7%	93%
Bromofluorobenzene (Surrogate)	LB145431	%	-	104%	3 - 6%	105%

Totals

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Total Xylenes	LB145431	mg/kg	0.3	<0.3	0%	NA
Total BTEX	LB145431	mg/kg	0.6	<0.6	0%	NA

Volatile Petroleum Hydrocarbons in Soil Method: ME-(AU)-[ENV]AN433

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
TRH C6-C10	LB145431	mg/kg	25	<25	0%	82%	87%
TRH C6-C9	LB145431	mg/kg	20	<20	0%	76%	80%

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Dibromofluoromethane (Surrogate)	LB145431	%	-	101%	5 - 15%	80%	85%
d4-1,2-dichloroethane (Surrogate)	LB145431	%	-	110%	14 - 15%	79%	85%
d8-toluene (Surrogate)	LB145431	%	-	109%	1 - 7%	80%	108%
Bromofluorobenzene (Surrogate)	LB145431	%	-	88%	3 - 6%	96%	80%

VPH F Bands

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery	MS %Recovery
Benzene (F0)	LB145431	mg/kg	0.1	<0.1	0%	NA	NA
TRH C6-C10 minus BTEX (F1)	LB145431	mg/kg	25	<25	0%	92%	120%

METHOD SUMMARY

METHOD	METHODOLOGY SUMMARY
AN002	The test is carried out by drying (at either 40°C or 105°C) a known mass of sample in a weighed evaporating basin. After fully dry the sample is re-weighed. Samples such as sludge and sediment having high percentages of moisture will take some time in a drying oven for complete removal of water.
AN040	A portion of sample is digested with Nitric acid to decompose organic matter and Hydrochloric acid to complete the digestion of metals and then filtered for analysis by ASS or ICP as per USEPA Method 200.8.
AN040/AN320	A portion of sample is digested with nitric acid to decompose organic matter and hydrochloric acid to complete the digestion of metals. The digest is then analysed by ICP OES with metals results reported on the dried sample basis. Based on USEPA method 200.8 and 6010C.
AN312	Mercury by Cold Vapour AAS in Soils: After digestion with nitric acid, hydrogen peroxide and hydrochloric acid, mercury ions are reduced by stannous chloride reagent in acidic solution to elemental mercury. This mercury vapour is purged by nitrogen into a cold cell in an atomic absorption spectrometer or mercury analyser. Quantification is made by comparing absorbances to those of the calibration standards. Reference APHA 3112/3500
AN403	Total Recoverable Hydrocarbons: Determination of Hydrocarbons by gas chromatography after a solvent extraction. Detection is by flame ionisation detector (FID) that produces an electronic signal in proportion to the combustible matter passing through it. Total Recoverable Hydrocarbons (TRH) are routinely reported as four alkane groupings based on the carbon chain length of the compounds: C6-C9, C10-C14, C15-C28 and C29-C36 and in recognition of the NEPM 1999 (2013), >C10-C16 (F2), >C16-C34 (F3) and >C34-C40 (F4). F2 is reported directly and also corrected by subtracting Naphthalene (from VOC method AN433) where available.
AN403	Additionally, the volatile C6-C9 fraction may be determined by a purge and trap technique and GC/MS because of the potential for volatiles loss. Total Petroleum Hydrocarbons (TPH) follows the same method of analysis after silica gel cleanup of the solvent extract. Aliphatic/Aromatic Speciation follows the same method of analysis after fractionation of the solvent extract over silica with differential polarity of the eluent solvents .
AN403	The GC/FID method is not well suited to the analysis of refined high boiling point materials (ie lubricating oils or greases) but is particularly suited for measuring diesel, kerosene and petrol if care to control volatility is taken. This method will detect naturally occurring hydrocarbons, lipids, animal fats, phenols and PAHs if they are present at sufficient levels, dependent on the use of specific cleanup/fractionation techniques. Reference USEPA 3510B, 8015B.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN420	SVOC Compounds: Semi-Volatile Organic Compounds (SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN433	VOCs and C6-C9 Hydrocarbons by GC-MS P&T: VOC`s are volatile organic compounds. The sample is presented to a gas chromatograph via a purge and trap (P&T) concentrator and autosampler and is detected with a Mass Spectrometer (MSD). Solid samples are initially extracted with methanol whilst liquid samples are processed directly. References: USEPA 5030B, 8020A, 8260.

FOOTNOTES

IS	Insufficient sample for analysis.	LOR	Limit of Reporting
LNR	Sample listed, but not received.	↑↓	Raised or Lowered Limit of Reporting
*	NATA accreditation does not cover the performance of this service.	QFH	QC result is above the upper tolerance
		QFL	QC result is below the lower tolerance
**	Indicative data, theoretical holding time exceeded.	-	The sample was not analysed for this analyte
		NVL	Not Validated

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calcuated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

STATEMENT OF QA/QC PERFORMANCE

SE177801 R1

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801 R1**
Date Received	10 Apr 2018
Date Reported	17 Apr 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met with the exception of the following:

Duplicate	Total Recoverable Elements In Soil/Waste Solids/Materials by ICPOES	2 items
Matrix Spike	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	2 items

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	8 Soil, 9 Material
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Three Days		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE177801 R1

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018
DUP01	SE177801.017	LB145441	09 Apr 2018	10 Apr 2018	07 May 2018	12 Apr 2018	07 May 2018	13 Apr 2018

Moisture Content

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP01/02	SE177801.002	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP01/03	SE177801.003	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/01	SE177801.004	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/02	SE177801.005	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
SP02/03	SE177801.007	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018
DUP01	SE177801.017	LB145459	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	17 Apr 2018	13 Apr 2018

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	17 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP01/02	SE177801.002	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP01/03	SE177801.003	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/01	SE177801.004	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/02	SE177801.005	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
SP02/03	SE177801.007	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018
DUP01	SE177801.017	LB145473	09 Apr 2018	10 Apr 2018	06 Oct 2018	12 Apr 2018	06 Oct 2018	13 Apr 2018

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145485	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE177801 R1

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP01/01	SE177801.001	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/02	SE177801.002	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP01/03	SE177801.003	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/01	SE177801.004	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/02	SE177801.005	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018
SP02/03	SE177801.007	LB145431	09 Apr 2018	10 Apr 2018	23 Apr 2018	12 Apr 2018	22 May 2018	13 Apr 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	105
	SP01/02	SE177801.002	%	60 - 130%	105
	SP01/03	SE177801.003	%	60 - 130%	89
	SP02/01	SE177801.004	%	60 - 130%	98
	SP02/02	SE177801.005	%	60 - 130%	104
	SP02/03	SE177801.007	%	60 - 130%	70

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	96
	SP01/02	SE177801.002	%	70 - 130%	104
	SP01/03	SE177801.003	%	70 - 130%	102
	SP02/01	SE177801.004	%	70 - 130%	104
	SP02/02	SE177801.005	%	70 - 130%	106
	SP02/03	SE177801.007	%	70 - 130%	86
d14-p-terphenyl (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	108
	SP01/02	SE177801.002	%	70 - 130%	114
	SP01/03	SE177801.003	%	70 - 130%	114
	SP02/01	SE177801.004	%	70 - 130%	114
	SP02/02	SE177801.005	%	70 - 130%	114
	SP02/03	SE177801.007	%	70 - 130%	98
d5-nitrobenzene (Surrogate)	SP01/01	SE177801.001	%	70 - 130%	78
	SP01/02	SE177801.002	%	70 - 130%	74
	SP01/03	SE177801.003	%	70 - 130%	74
	SP02/01	SE177801.004	%	70 - 130%	72
	SP02/02	SE177801.005	%	70 - 130%	78
	SP02/03	SE177801.007	%	70 - 130%	76

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	105
	SP01/02	SE177801.002	%	60 - 130%	105
	SP01/03	SE177801.003	%	60 - 130%	89
	SP02/01	SE177801.004	%	60 - 130%	98
	SP02/02	SE177801.005	%	60 - 130%	104
	SP02/03	SE177801.007	%	60 - 130%	70

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	76
	SP01/02	SE177801.002	%	60 - 130%	82
	SP01/03	SE177801.003	%	60 - 130%	82
	SP02/01	SE177801.004	%	60 - 130%	72
	SP02/02	SE177801.005	%	60 - 130%	73
	SP02/03	SE177801.007	%	60 - 130%	79
d4-1,2-dichloroethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	110
	SP01/02	SE177801.002	%	60 - 130%	108
	SP01/03	SE177801.003	%	60 - 130%	118
	SP02/01	SE177801.004	%	60 - 130%	115
	SP02/02	SE177801.005	%	60 - 130%	103
	SP02/03	SE177801.007	%	60 - 130%	103
d8-toluene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	126
	SP01/02	SE177801.002	%	60 - 130%	118
	SP01/03	SE177801.003	%	60 - 130%	114
	SP02/01	SE177801.004	%	60 - 130%	109
	SP02/02	SE177801.005	%	60 - 130%	115
	SP02/03	SE177801.007	%	60 - 130%	116
Dibromofluoromethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	89
	SP01/02	SE177801.002	%	60 - 130%	81
	SP01/03	SE177801.003	%	60 - 130%	73
	SP02/01	SE177801.004	%	60 - 130%	86
	SP02/02	SE177801.005	%	60 - 130%	83

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil (continued) — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Dibromofluoromethane (Surrogate)	SP02/03	SE177801.007	%	60 - 130%	72

Volatile Petroleum Hydrocarbons in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	76
	SP01/02	SE177801.002	%	60 - 130%	82
	SP01/03	SE177801.003	%	60 - 130%	82
	SP02/01	SE177801.004	%	60 - 130%	72
	SP02/02	SE177801.005	%	60 - 130%	73
	SP02/03	SE177801.007	%	60 - 130%	79
d4-1,2-dichloroethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	110
	SP01/02	SE177801.002	%	60 - 130%	108
	SP01/03	SE177801.003	%	60 - 130%	118
	SP02/01	SE177801.004	%	60 - 130%	115
	SP02/02	SE177801.005	%	60 - 130%	103
	SP02/03	SE177801.007	%	60 - 130%	103
d8-toluene (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	126
	SP01/02	SE177801.002	%	60 - 130%	118
	SP01/03	SE177801.003	%	60 - 130%	114
	SP02/01	SE177801.004	%	60 - 130%	109
	SP02/02	SE177801.005	%	60 - 130%	115
	SP02/03	SE177801.007	%	60 - 130%	116
Dibromofluoromethane (Surrogate)	SP01/01	SE177801.001	%	60 - 130%	89
	SP01/02	SE177801.002	%	60 - 130%	81
	SP01/03	SE177801.003	%	60 - 130%	73
	SP02/01	SE177801.004	%	60 - 130%	86
	SP02/02	SE177801.005	%	60 - 130%	83
	SP02/03	SE177801.007	%	60 - 130%	72

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury In Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result
LB145441.001	Mercury	mg/kg	0.05	<0.05

OC Pesticides In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1
		Alpha BHC	mg/kg	0.1	<0.1
		Lindane	mg/kg	0.1	<0.1
		Heptachlor	mg/kg	0.1	<0.1
		Aldrin	mg/kg	0.1	<0.1
		Beta BHC	mg/kg	0.1	<0.1
		Delta BHC	mg/kg	0.1	<0.1
		Heptachlor epoxide	mg/kg	0.1	<0.1
		Alpha Endosulfan	mg/kg	0.2	<0.2
		Gamma Chlordane	mg/kg	0.1	<0.1
		Alpha Chlordane	mg/kg	0.1	<0.1
		p,p'-DDE	mg/kg	0.1	<0.1
		Dieldrin	mg/kg	0.2	<0.2
		Endrin	mg/kg	0.2	<0.2
		Beta Endosulfan	mg/kg	0.2	<0.2
		p,p'-DDD	mg/kg	0.1	<0.1
		p,p'-DDT	mg/kg	0.1	<0.1
		Endosulfan sulphate	mg/kg	0.1	<0.1
		Endrin Aldehyde	mg/kg	0.1	<0.1
		Methoxychlor	mg/kg	0.1	<0.1
		Endrin Ketone	mg/kg	0.1	<0.1
		Isodrin	mg/kg	0.1	<0.1
		Mirex	mg/kg	0.1	<0.1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	107

PAH (Polynuclear Aromatic Hydrocarbons) In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Naphthalene	mg/kg	0.1	<0.1
		2-methylnaphthalene	mg/kg	0.1	<0.1
		1-methylnaphthalene	mg/kg	0.1	<0.1
		Acenaphthylene	mg/kg	0.1	<0.1
		Acenaphthene	mg/kg	0.1	<0.1
		Fluorene	mg/kg	0.1	<0.1
		Phenanthrene	mg/kg	0.1	<0.1
		Anthracene	mg/kg	0.1	<0.1
		Fluoranthene	mg/kg	0.1	<0.1
		Pyrene	mg/kg	0.1	<0.1
		Benzo(a)anthracene	mg/kg	0.1	<0.1
		Chrysene	mg/kg	0.1	<0.1
		Benzo(a)pyrene	mg/kg	0.1	<0.1
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1
		Benzo(ghi)perylene	mg/kg	0.1	<0.1
		Total PAH (18)	mg/kg	0.8	<0.8
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	86
		2-fluorobiphenyl (Surrogate)	%	-	92
		d14-p-terphenyl (Surrogate)	%	-	100

PCBs In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result
LB145485.001	Arochlor 1016	mg/kg	0.2	<0.2
	Arochlor 1221	mg/kg	0.2	<0.2
	Arochlor 1232	mg/kg	0.2	<0.2
	Arochlor 1242	mg/kg	0.2	<0.2
	Arochlor 1248	mg/kg	0.2	<0.2
	Arochlor 1254	mg/kg	0.2	<0.2

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PCBs in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB145485.001		Arochlor 1260	mg/kg	0.2	<0.2
		Arochlor 1262	mg/kg	0.2	<0.2
		Arochlor 1268	mg/kg	0.2	<0.2
		Total PCBs (Arochlors)	mg/kg	1	<1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	97

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number		Parameter	Units	LOR	Result
LB145473.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result
LB145485.001		TRH C10-C14	mg/kg	20	<20
		TRH C15-C28	mg/kg	45	<45
		TRH C29-C36	mg/kg	45	<45
		TRH C37-C40	mg/kg	100	<100
		TRH C10-C36 Total	mg/kg	110	<110

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB145431.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	104
		d4-1,2-dichloroethane (Surrogate)	%	-	111
		d8-toluene (Surrogate)	%	-	110
		Bromofluorobenzene (Surrogate)	%	-	104
	Totals	Total BTEX	mg/kg	0.6	<0.6

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB145431.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	101
		d4-1,2-dichloroethane (Surrogate)	%	-	110
		d8-toluene (Surrogate)	%	-	109

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177640.004	LB145441.024	Mercury	mg/kg	0.05	<0.05	<0.05	200	0
SE177801.002	LB145441.014	Mercury	mg/kg	0.05	<0.05	<0.05	200	0

Moisture Content

Method: ME-(AU)-[ENV]AN002

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177693.004	LB145459.022	% Moisture	%w/w	0.5	2.2	2.2	75	0
SE177801.001	LB145459.033	% Moisture	%w/w	0.5	10	10	40	0
SE177801.017	LB145459.040	% Moisture	%w/w	0.5	8.8	8.8	41	0

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014	Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Lindane	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor	mg/kg	0.1	<0.1	<0.1	200	0
		Aldrin	mg/kg	0.1	<0.1	<0.1	200	0
		Beta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Delta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Dieldrin	mg/kg	0.2	<0.2	<0.2	200	0
		Endrin	mg/kg	0.2	<0.2	<0.2	200	0
		o,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		p,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	200	0
		Methoxychlor	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Ketone	mg/kg	0.1	<0.1	<0.1	200	0
		Isodrin	mg/kg	0.1	<0.1	<0.1	200	0
		Mirex	mg/kg	0.1	<0.1	<0.1	200	0
		Total CLP OC Pesticides	mg/kg	1	<1	<1	200	0
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.15	0.17	30	14

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Acenaphthylene	mg/kg	0.1	<0.1	<0.1	200	0
		Acenaphthene	mg/kg	0.1	<0.1	<0.1	200	0
		Fluorene	mg/kg	0.1	<0.1	<0.1	200	0
		Phenanthrene	mg/kg	0.1	<0.1	<0.1	200	0
		Anthracene	mg/kg	0.1	<0.1	<0.1	200	0
		Fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	197	0
		Chrysene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
		Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	200	0

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	134	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	175	0
			Total PAH (18)	mg/kg	0.8	<0.8	<0.8	200	0
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.4	30	0
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	0.5	30	4
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.6	0.6	30	0

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		Arochlor 1016	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1221	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1232	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1242	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1248	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1254	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1260	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1262	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1268	mg/kg	0.2	<0.2	<0.2	200	0
			Total PCBs (Arochlors)	mg/kg	1	<1	<1	200	0
		Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0	0	30	14

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177662.015	LB145473.014		Arsenic, As	mg/kg	3	13	7	40	61 ②
			Cadmium, Cd	mg/kg	0.3	0.4	<0.3	134	18
			Chromium, Cr	mg/kg	0.3	13	12	34	14
			Copper, Cu	mg/kg	0.5	67	40	31	51 ②
			Nickel, Ni	mg/kg	0.5	4.7	5.3	40	12
			Lead, Pb	mg/kg	1	16	14	36	13
			Zinc, Zn	mg/kg	0.5	26	21	38	23
SE177801.017	LB145473.024		Arsenic, As	mg/kg	3	4	5	51	26
			Cadmium, Cd	mg/kg	0.3	<0.3	<0.3	200	0
			Chromium, Cr	mg/kg	0.3	13	12	34	1
			Copper, Cu	mg/kg	0.5	22	22	32	3
			Nickel, Ni	mg/kg	0.5	4.2	4.7	41	10
			Lead, Pb	mg/kg	1	15	15	37	5
			Zinc, Zn	mg/kg	0.5	28	26	37	8

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177801.004	LB145485.014		TRH C10-C14	mg/kg	20	<20	<20	200	0
			TRH C15-C28	mg/kg	45	<45	<45	200	0
			TRH C29-C36	mg/kg	45	<45	<45	200	0
			TRH C37-C40	mg/kg	100	<100	<100	200	0
			TRH C10-C36 Total	mg/kg	110	<110	<110	200	0
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	<210	200	0
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	<25	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	200	0
			TRH >C16-C34 (F3)	mg/kg	90	<90	<90	200	0
			TRH >C34-C40 (F4)	mg/kg	120	<120	<120	200	0

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.3	50	5
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.9	50	15

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil (continued)

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014	Surrogates	d8-toluene (Surrogate)	mg/kg	-	5.4	5.3	50	1
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	50	6
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE177797.001	LB145431.023	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.8	50	15
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.6	4.9	50	14
			d8-toluene (Surrogate)	mg/kg	-	6.1	5.7	50	7
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	4.1	50	3
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE177783.009	LB145431.014		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.3	30	5
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.9	30	15
			d8-toluene (Surrogate)	mg/kg	-	5.4	5.3	30	1
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	30	6
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE177797.001	LB145431.023		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.1	4.8	30	15
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.6	4.9	30	14
			d8-toluene (Surrogate)	mg/kg	-	6.1	5.7	30	7
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	4.1	30	3
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145441.002	Mercury	mg/kg	0.05	0.21	0.2	70 - 130	106

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		Heptachlor	mg/kg	0.1	0.2	0.2	60 - 140	97
		Aldrin	mg/kg	0.1	0.2	0.2	60 - 140	94
		Delta BHC	mg/kg	0.1	0.2	0.2	60 - 140	90
		Dieldrin	mg/kg	0.2	<0.2	0.2	60 - 140	93
		Endrin	mg/kg	0.2	<0.2	0.2	60 - 140	95
		p,p'-DDT	mg/kg	0.1	0.2	0.2	60 - 140	89
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.14	0.15	40 - 130	95

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		Naphthalene	mg/kg	0.1	4.1	4	60 - 140	103
		Acenaphthylene	mg/kg	0.1	3.8	4	60 - 140	96
		Acenaphthene	mg/kg	0.1	4.3	4	60 - 140	107
		Phenanthrene	mg/kg	0.1	4.2	4	60 - 140	104
		Anthracene	mg/kg	0.1	4.0	4	60 - 140	101
		Fluoranthene	mg/kg	0.1	4.2	4	60 - 140	104
		Pyrene	mg/kg	0.1	4.1	4	60 - 140	101
		Benzo(a)pyrene	mg/kg	0.1	4.5	4	60 - 140	112
	Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.5	0.5	40 - 130	96
		2-fluorobiphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	88
		d14-p-terphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	86

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002	Arochlor 1260	mg/kg	0.2	0.4	0.4	60 - 140	105

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145473.002	Arsenic, As	mg/kg	3	370	336.32	79 - 120	111
	Cadmium, Cd	mg/kg	0.3	470	416.6	69 - 131	112
	Chromium, Cr	mg/kg	0.3	35	35.2	80 - 120	100
	Copper, Cu	mg/kg	0.5	410	370.46	80 - 120	111
	Nickel, Ni	mg/kg	0.5	220	210.88	79 - 120	106
	Lead, Pb	mg/kg	1	110	107.87	79 - 120	103
	Zinc, Zn	mg/kg	0.5	320	301.27	80 - 121	108

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145485.002		TRH C10-C14	mg/kg	20	35	40	60 - 140	88
		TRH C15-C28	mg/kg	45	<45	40	60 - 140	100
		TRH C29-C36	mg/kg	45	<45	40	60 - 140	75
	TRH F Bands	TRH >C10-C16	mg/kg	25	30	40	60 - 140	75
		TRH >C16-C34 (F3)	mg/kg	90	<90	40	60 - 140	78
		TRH >C34-C40 (F4)	mg/kg	120	<120	20	60 - 140	90

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145431.002	Monocyclic Aromatic	Benzene	mg/kg	0.1	2.8	2.9	60 - 140	96
		Toluene	mg/kg	0.1	3.3	2.9	60 - 140	113
		Ethylbenzene	mg/kg	0.1	3.3	2.9	60 - 140	113
		m/p-xylene	mg/kg	0.2	7.1	5.8	60 - 140	122
		o-xylene	mg/kg	0.1	3.3	2.9	60 - 140	112
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.3	5	60 - 140	85
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.3	5	60 - 140	85
		d8-toluene (Surrogate)	mg/kg	-	4.7	5	60 - 140	93
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.2	5	60 - 140	105

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB145431.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	82
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	78
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.0	5	60 - 140	80
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.0	5	60 - 140	79
		d8-toluene (Surrogate)	mg/kg	-	4.0	5	60 - 140	80
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.8	5	60 - 140	96
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	92

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177783.008	LB145441.004	Mercury	mg/kg	0.05	0.27	0.08	0.2	95

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177783.004	LB145473.004	Arsenic, As	mg/kg	3	57	7	50	100
		Cadmium, Cd	mg/kg	0.3	56	0.6	50	111
		Chromium, Cr	mg/kg	0.3	69	19	50	101
		Copper, Cu	mg/kg	0.5	110	58	50	109
		Nickel, Ni	mg/kg	0.5	64	11	50	107
		Lead, Pb	mg/kg	1	490	490	50	5 ⊗
		Zinc, Zn	mg/kg	0.5	240	220	50	34 ⊗

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177720.001	LB145485.018		TRH C10-C14	mg/kg	20	48	0	40	120
			TRH C15-C28	mg/kg	45	53	8	40	113
			TRH C29-C36	mg/kg	45	45	0	40	113
			TRH C37-C40	mg/kg	100	<100	0	-	-
			TRH C10-C36 Total	mg/kg	110	150	0	-	-
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	0	-	-
		TRH F Bands	TRH >C10-C16	mg/kg	25	48	0	40	120
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	48	0	-	-
			TRH >C16-C34 (F3)	mg/kg	90	<90	14	40	98
			TRH >C34-C40 (F4)	mg/kg	120	<120	0	-	-

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE177720.001	LB145431.004		TRH C6-C10	mg/kg	25	<25	0	24.65	87
			TRH C6-C9	mg/kg	20	<20	0	23.2	80
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	4.05	-	85
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	4.56	-	85
			d8-toluene (Surrogate)	mg/kg	-	5.4	4.7	-	108
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.0	3.55	-	80
		VPH F	Benzene (F0)	mg/kg	0.1	2.0	0.02	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	-0.04	7.25	120

MATRIX SPIKE DUPLICATES

SE177801 R1

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Tue 10/4/2018
Report Due	Fri 13/4/2018
SGS Reference	**SE177801**

SUBMISSION DETAILS

This is to confirm that 17 samples were received on Tuesday 10/4/2018. Results are expected to be ready by COB Friday 13/4/2018. Please quote SGS reference SE177801 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	8 Soil, 9 Material
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Three Days		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

Results for asbestos analysis will be reported in SE177801A, on a standard TAT.
DUP01A has been forwarded to Eurofins.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
001	SP01/01	29	26	11	7	10	12	8
002	SP01/02	29	26	11	7	10	12	8
003	SP01/03	29	26	11	7	10	12	8
004	SP02/01	29	26	11	7	10	12	8
005	SP02/02	29	26	11	7	10	12	8
007	SP02/03	29	26	11	7	10	12	8
017	DUP01	-	-	-	7	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Mercury in Soil	Moisture Content
001	SP01/01	1	1
002	SP01/02	1	1
003	SP01/03	1	1
004	SP02/01	1	1
005	SP02/02	1	1
007	SP02/03	1	1
017	DUP01	1	1

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Tue 10/4/2018
Report Due	Fri 13/4/2018
SGS Reference	**SE177801**

SUBMISSION DETAILS

This is to confirm that 17 samples were received on Tuesday 10/4/2018. Results are expected to be ready by COB Friday 13/4/2018. Please quote SGS reference SE177801 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	8 Soil, 9 Material
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Three Days		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

Results for asbestos analysis will be reported in SE177801A, on a standard TAT.
DUP01A has been forwarded to Eurofins.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
001	SP01/01	29	26	11	7	10	12	8
002	SP01/02	29	26	11	7	10	12	8
003	SP01/03	29	26	11	7	10	12	8
004	SP02/01	29	26	11	7	10	12	8
005	SP02/02	29	26	11	7	10	12	8
007	SP02/03	29	26	11	7	10	12	8
017	DUP01	-	-	-	7	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Mercury in Soil	Moisture Content
001	SP01/01	1	1
002	SP01/02	1	1
003	SP01/03	1	1
004	SP02/01	1	1
005	SP02/02	1	1
007	SP02/03	1	1
017	DUP01	1	1

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801A R0**
Date Received	10/4/2018
Date Reported	17/4/2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam.

SIGNATORIES

S. Ravendra.

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Gravimetric Determination of Asbestos in Soil [AN605] Tested: 13/4/2018

PARAMETER	UOM	LOR	SP01/01 SOIL - 9/4/2018 SE177801A.001	SP01/02 SOIL - 9/4/2018 SE177801A.002	SP01/03 SOIL - 9/4/2018 SE177801A.003	SP02/01 SOIL - 9/4/2018 SE177801A.004	SP02/02 SOIL - 9/4/2018 SE177801A.005
Total Sample Weight*	g	1	576	532	501	537	503
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP02/03 SOIL - 9/4/2018 SE177801A.007
Total Sample Weight*	g	1	426
ACM in >7mm Sample*	g	0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Fibre ID in bulk materials [AN602] Tested: 17/4/2018

PARAMETER	UOM	LOR	SP02/02-FRAG MATERIAL - 9/4/2018 SE177801A.008	SP03/FCS MATERIAL - 9/4/2018 SE177801A.008	SP04/FCS MATERIAL - 9/4/2018 SE177801A.009	SP05/FCS MATERIAL - 9/4/2018 SE177801A.010	SP06/FCS MATERIAL - 9/4/2018 SE177801A.011
Asbestos Detected	No unit	-	Yes	Yes	Yes	Yes	Yes

PARAMETER	UOM	LOR	SP07/FCS MATERIAL - 9/4/2018 SE177801A.012	SP08/FCS MATERIAL - 9/4/2018 SE177801A.013	SP09/FCS MATERIAL - 9/4/2018 SE177801A.014	SP10/FCS MATERIAL - 9/4/2018 SE177801A.015	SP11/FCS MATERIAL - 9/4/2018 SE177801A.016
Asbestos Detected	No unit	-	Yes	Yes	Yes	Yes	Yes

METHOD	METHODOLOGY SUMMARY
AN602	Qualitative identification of chrysotile, amosite and crocidolite in bulk samples by polarised light microscopy (PLM) in conjunction with dispersion staining (DS). AS4964 provides the basis for this document. Unequivocal identification of the asbestos minerals present is made by obtaining sufficient diagnostic `clues`, which provide a reasonable degree of certainty, dispersion staining is a mandatory `clue` for positive identification. If sufficient `clues` are absent, then positive identification of asbestos is not possible. This procedure requires removal of suspect fibres/bundles from the sample which cannot be returned.
AN602	Fibres/material that cannot be unequivocably identified as one of the three asbestos forms, will be reported as unknown mineral fibres (umf). The fibres detected may or may not be asbestos fibres.
AN605	This technique gravimetrically determines the mass of Asbestos Containing Material retained on a 7mm Sieve and assumes that 15% of this ACM is asbestos. This calculated asbestos weight is then calculated as a percentage of the total sample weight.
AN605	This technique also gravimetrically determines the mass of Fibrous Asbestos (FA) and Asbestos Fines (AF) Containing Material retained on and passing a 2mm sieve post 7mm sieving. Assumes that FA and AF are 100% asbestos containing. This calculated asbestos weight is then calculated as a percentage of the total sample weight. This does not include free fibres which are only observed by standard trace analysis as per AN 602.
AN605	AMO = Amosite Detected CRY = Chrysotile Detected CRO = Crocidolite Detected ORG = Organic Fibres Detected SMF = Synthetic Mineral Fibres Detected UMF = Unknown Mineral Fibres Detected NAD = No Asbestos Detected
AN605	Insofar as is technically feasible, this report is consistent with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment Remediation and Management of Asbestos - Contaminated Sites in Western Australia - May 2009.

FOOTNOTES

*	NATA accreditation does not cover the performance of this service.	-	Not analysed.	UOM	Unit of Measure.
		NVL	Not validated.	LOR	Limit of Reporting.
**	Indicative data, theoretical holding time exceeded.	IS	Insufficient sample for analysis.	↑↓	Raised/lowered Limit of Reporting.
		LNR	Sample listed, but not received.		

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calculated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	10

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE177801A R0**
Date Received	10 Apr 2018
Date Reported	17 Apr 2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam.

SIGNATORIES

S. Ravee Sivasubramaniam

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

RESULTS

Fibre ID in bulk materials — Method AN602

Laboratory Reference	Client Reference	Matrix	Sample Description	Date Sampled	Fibre Identification	Est.%w/w*
SE177801A.006	SP02/02-FRAG	Other	35x30x4mm Cement Sheet Fragment	09 Apr 2018	Chrysotile Asbestos Detected	
SE177801A.008	SP03/FCS	Other	80x65x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.009	SP04/FCS	Other	60x50x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.010	SP05/FCS	Other	35x20x5mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.011	SP06/FCS	Other	40x30x8mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.012	SP07/FCS	Other	50x40x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.013	SP08/FCS	Other	20x20x7mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.014	SP09/FCS	Other	90x50x8mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	
SE177801A.015	SP10/FCS	Other	40x30x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile Asbestos Detected	
SE177801A.016	SP11/FCS	Other	65x30x10mm Cement Sheet Fragment	09 Apr 2018	Chrysotile & Crocidolite Asbestos Detected	

METHOD SUMMARY

METHOD	METHODOLOGY SUMMARY
AN602	Qualitative identification of chrysotile, amosite and crocidolite in bulk samples by polarised light microscopy (PLM) in conjunction with dispersion staining (DS). AS4964 provides the basis for this document. Unequivocal identification of the asbestos minerals present is made by obtaining sufficient diagnostic `clues`, which provide a reasonable degree of certainty, dispersion staining is a mandatory `clue` for positive identification. If sufficient `clues` are absent, then positive identification of asbestos is not possible. This procedure requires removal of suspect fibres/bundles from the sample which cannot be returned.
AN602	Fibres/material that cannot be unequivocably identified as one of the three asbestos forms, will be reported as unknown mineral fibres (umf). The fibres detected may or may not be asbestos fibres.

FOOTNOTES

Amosite	-	Brown Asbestos	NA	-	Not Analysed
Chrysotile	-	White Asbestos	LNR	-	Listed, Not Required
Crocidolite	-	Blue Asbestos	*	-	NATA accreditation does not cover the performance of this service.
Amphiboles	-	Amosite and/or Crocidolite	**	-	Indicative data, theoretical holding time exceeded.

(In reference to soil samples only) This report does not comply with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment and Remediation and Management of Asbestos Contaminated sites in Western Australia - May 2009.

Sampled by the client.

Where reported: 'Asbestos Detected': Asbestos detected by polarised light microscopy, including dispersion staining.
Where reported: 'No Asbestos Found': No Asbestos Found by polarised light microscopy, including dispersion staining.
Where reported: 'UMF Detected': Mineral fibres of unknown type detected by polarised light microscopy, including dispersion staining. Confirmation by another independent analytical technique may be necessary.

Even after disintegration it can be very difficult, or impossible, to detect the presence of asbestos in some asbestos-containing bulk materials using polarised light microscopy. This is due to the low grade or small length or diameter of asbestos fibres present in the material, or to the fact that very fine fibres have been distributed intimately throughout the materials.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801A

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs - Asbestos**
Order Number	**P1054**
Samples	17

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Tue 10/4/2018
Report Due	Mon 16/4/2018
SGS Reference	**SE177801A**

SUBMISSION DETAILS

This is to confirm that 17 samples were received on Tuesday 10/4/2018. Results are expected to be ready by COB Monday 16/4/2018. Please quote SGS reference SE177801A when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	16 Soil
Date documentation received	10/4/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	5.4°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE177801A

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs - Asbestos

SUMMARY OF ANALYSIS

No.	Sample ID	Fibre ID in bulk materials	Gravimetric Determination of Asbestos In Soil
001	SP01/01	-	9
002	SP01/02	-	9
003	SP01/03	-	9
004	SP02/01	-	9
005	SP02/02	-	9
006	SP02/02-FRAG	1	-
007	SP02/03	-	9
008	SP03/FCS	1	-
009	SP04/FCS	1	-
010	SP05/FCS	1	-
011	SP06/FCS	1	-
012	SP07/FCS	1	-
013	SP08/FCS	1	-
014	SP09/FCS	1	-
015	SP10/FCS	1	-
016	SP11/FCS	1	-

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: ALX_EHS_OFFICE_X585_20180411183516.pdf page: 5 SGS Ref: SE177801A_COC

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road, Seven Hills NSW
Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)
SP01/01	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP01/02	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP01/03	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/01	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/02	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP02/02-FRAG	09/04/18		X		Ice	1							X
SP02/03	09/04/18			X	Ice	2	X	X	X	X	X	X	
SP03/FCS	09/04/18		X		Ice	1							X
SP04/FCS	09/04/18		X		Ice	1							X
SP05/FCS	09/04/18		X		Ice	1							X

SGS EHS Alexandria Laboratory

SE177801A COC
Received: 10 – Apr – 2018

Relinquished By: Craig Cowper — Date/Time: 06/03/18 @ 1300hrs — Received By: A. Odisho — Date/Time 10/4/18 @ 2:05pm
Relinquished By: — Date/Time: — Received By: — Date/Time
Samples Intact: Yes/ No — Temperature: Ambient / Chilled — Sample Cooler Sealed: Yes/ No — Laboratory Quotation No:
Comments:

Uncontrolled template when printed

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name: Alliance Geotechnical Pty Ltd
Address: 10 Welder Road,
Seven Hills NSW

Contact Name: Craig Cowper

Project Name/No: 7161 Jordan Springs
Purchase Order No: SGS – P1054 Eurofins – P1055
Results Required By: 3 day turnaround
Telephone: 0407 989 885
Facsimile:
Email Results: c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)
SP06/FCS	09/04/18		X		Ice	1						X
SP07/FCS	09/04/18		X		Ice	1						X
SP08/FCS	09/04/18		X		Ice	1						X
SP09/FCS	09/04/18		X		Ice	1						X
SP10/FCS	09/04/18		X		Ice	2						X
SP11/FCS	09/04/18		X		Ice	1						X
DUP01	09/04/18			X	Ice	1				X		
DUP01A	09/04/18			X	Ice	1				X		

Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 10/04/18 @ 12:00pm	Received By: A. Odisho	Date/Time 6/4/18 @ 2:05pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910 R0**
Date Received	9/5/2018
Date Reported	16/5/2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

No respirable fibres detected in soil samples using trace analysis technique as per AS 4964-2004.

Sample # 7 : Asbestos found in cement sheet fragment in >7mm fraction.

Asbestos analysed by approved identifiers Ravee Sivasubramaniam and Yusuf Kuthpudin .

SIGNATORIES

Akheeqar Beniameen
Chemist

Dong Liang
Metals/Inorganics Team Leader

Kamrul Ahsan
Senior Chemist

Ly Kim Ha
Organic Section Head

Ravee Sivasubramaniam
Hygiene Team Leader

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

VOC's in Soil [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6	<0.6
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Benzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Toluene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Ethylbenzene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
m/p-xylene	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o-xylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total Xylenes	mg/kg	0.3	<0.3	<0.3	<0.3	<0.3
Total BTEX	mg/kg	0.6	<0.6	<0.6	<0.6	<0.6
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Volatile Petroleum Hydrocarbons in Soil [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
TRH C6-C9	mg/kg	20	<20	<20	<20	<20	<20
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10	mg/kg	25	<25	<25	<25	<25	<25
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25	<25

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
TRH C6-C9	mg/kg	20	<20	<20	<20	<20
Benzene (F0)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
TRH C6-C10	mg/kg	25	<25	<25	<25	<25
TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	<25	<25

TRH (Total Recoverable Hydrocarbons) in Soil [AN403] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
TRH C10-C14	mg/kg	20	<20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	390	97	160	120	150
TRH C29-C36	mg/kg	45	230	92	100	70	90
TRH C37-C40	mg/kg	100	<100	<100	<100	<100	<100
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	560	160	230	180	220
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120	<120
TRH C10-C36 Total	mg/kg	110	620	190	260	190	240
TRH C10-C40 Total (F bands)	mg/kg	210	560	<210	230	<210	220

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
TRH C10-C14	mg/kg	20	<20	<20	<20	<20
TRH C15-C28	mg/kg	45	150	300	320	220
TRH C29-C36	mg/kg	45	70	190	200	170
TRH C37-C40	mg/kg	100	<100	<100	<100	<100
TRH >C10-C16	mg/kg	25	<25	<25	<25	<25
TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	<25	<25
TRH >C16-C34 (F3)	mg/kg	90	200	440	470	340
TRH >C34-C40 (F4)	mg/kg	120	<120	<120	<120	<120
TRH C10-C36 Total	mg/kg	110	220	490	520	390
TRH C10-C40 Total (F bands)	mg/kg	210	<210	440	470	340

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

PAH (Polynuclear Aromatic Hydrocarbons) in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007
Naphthalene	mg/kg	0.1	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.8	0.5	0.4	0.2	0.2
Acenaphthene	mg/kg	0.1	0.5	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	0.3	0.1	0.2	<0.1	<0.1
Phenanthrene	mg/kg	0.1	6.6	1.8	1.8	0.4	0.7
Anthracene	mg/kg	0.1	2.9	0.8	0.7	0.2	0.3
Fluoranthene	mg/kg	0.1	15	4.5	2.6	1.0	1.9
Pyrene	mg/kg	0.1	18	4.4	2.7	1.0	2.0
Benzo(a)anthracene	mg/kg	0.1	7.7	2.7	1.4	0.6	1.2
Chrysene	mg/kg	0.1	6.4	2.1	1.2	0.5	1.0
Benzo(b&j)fluoranthene	mg/kg	0.1	8.2	3.4	1.7	0.8	1.5
Benzo(k)fluoranthene	mg/kg	0.1	3.1	1.2	0.7	0.4	0.6
Benzo(a)pyrene	mg/kg	0.1	7.1	2.9	1.5	0.7	1.3
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	4.2	1.9	0.9	0.5	0.8
Dibenzo(ah)anthracene	mg/kg	0.1	1.0	0.4	0.2	0.1	0.2
Benzo(ghi)perylene	mg/kg	0.1	4.3	2.0	1.0	0.5	0.9
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	11	4.3	2.2	1.1	2.0
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	11	4.3	2.2	1.1	2.0
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	11	4.3	2.2	1.1	2.0
Total PAH (18)	mg/kg	0.8	86	29	17	7.0	13
Total PAH (NEPM/WHO 16)	mg/kg	0.8	86	29	17	7.0	13

PARAMETER	UOM	LOR	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Naphthalene	mg/kg	0.1	<0.1	0.5	0.3	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	0.4	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	0.4	0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.2	1.4	0.5	0.3	0.4
Acenaphthene	mg/kg	0.1	<0.1	0.2	<0.1	0.2	0.2
Fluorene	mg/kg	0.1	<0.1	0.6	0.2	0.1	<0.1
Phenanthrene	mg/kg	0.1	0.4	6.3	2.0	1.4	1.4
Anthracene	mg/kg	0.1	0.3	1.9	0.7	0.8	0.8
Fluoranthene	mg/kg	0.1	2.1	8.5	3.6	4.9	5.1
Pyrene	mg/kg	0.1	2.4	9.4	3.2	5.7	5.7
Benzo(a)anthracene	mg/kg	0.1	1.5	4.9	1.9	3.5	3.4
Chrysene	mg/kg	0.1	1.2	3.7	1.6	2.8	2.8
Benzo(b&j)fluoranthene	mg/kg	0.1	2.0	5.2	2.4	4.4	4.1
Benzo(k)fluoranthene	mg/kg	0.1	0.7	2.0	1.0	1.6	1.6
Benzo(a)pyrene	mg/kg	0.1	1.7	4.4	2.1	3.7	3.6
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	1.0	2.6	1.4	2.3	2.2
Dibenzo(ah)anthracene	mg/kg	0.1	0.3	0.7	0.3	0.6	0.5
Benzo(ghi)perylene	mg/kg	0.1	1.1	2.5	1.4	2.3	2.2
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	2.5	6.5	3.1	5.5	5.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	2.5	6.5	3.1	5.5	5.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	2.5	6.5	3.1	5.5	5.3
Total PAH (18)	mg/kg	0.8	15	55	23	35	34
Total PAH (NEPM/WHO 16)	mg/kg	0.8	15	55	22	35	34

PAH (Polynuclear Aromatic Hydrocarbons) in Soil [AN420] Tested: 11/5/2018 (continued)

PARAMETER	UOM	LOR	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.6 SOIL - 9/5/2018 SE178910.020	SP10-0.6 SOIL - 9/5/2018 SE178910.023
Naphthalene	mg/kg	0.1	0.2	0.2	0.1	<0.1	0.2
2-methylnaphthalene	mg/kg	0.1	<0.1	0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	0.1	0.2	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	1.2	1.0	1.2	0.2	0.8
Acenaphthene	mg/kg	0.1	0.1	<0.1	0.2	<0.1	0.3
Fluorene	mg/kg	0.1	0.2	0.2	0.5	<0.1	0.3
Phenanthrene	mg/kg	0.1	3.2	2.2	5.1	0.6	3.4
Anthracene	mg/kg	0.1	1.6	1.0	1.8	0.3	1.6
Fluoranthene	mg/kg	0.1	8.2	5.2	11	1.5	10
Pyrene	mg/kg	0.1	9.5	5.0	12	1.4	12
Benzo(a)anthracene	mg/kg	0.1	5.9	3.4	6.3	0.9	7.0
Chrysene	mg/kg	0.1	4.4	2.5	4.8	0.7	5.4
Benzo(b&j)fluoranthene	mg/kg	0.1	7.2	4.0	7.9	1.0	8.2
Benzo(k)fluoranthene	mg/kg	0.1	2.6	1.4	2.0	0.5	3.2
Benzo(a)pyrene	mg/kg	0.1	6.0	3.3	6.0	0.9	7.0
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	3.8	2.2	3.7	0.6	4.5
Dibenzo(ah)anthracene	mg/kg	0.1	1.0	0.5	1.0	0.2	1.1
Benzo(ghi)perylene	mg/kg	0.1	3.7	2.1	3.6	0.6	4.4
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	9.0	5.0	9.0	1.3	11
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	9.0	5.0	9.0	1.3	11
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	9.0	5.0	9.0	1.3	11
Total PAH (18)	mg/kg	0.8	59	34	66	9.2	69
Total PAH (NEPM/WHO 16)	mg/kg	0.8	59	34	66	9.2	69

PARAMETER	UOM	LOR	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.6 SOIL - 9/5/2018 SE178910.026
Naphthalene	mg/kg	0.1	0.1	<0.1	0.2
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	0.6	0.7	1.4
Acenaphthene	mg/kg	0.1	0.2	<0.1	0.1
Fluorene	mg/kg	0.1	0.2	0.1	0.2
Phenanthrene	mg/kg	0.1	2.6	2.6	2.5
Anthracene	mg/kg	0.1	1.3	1.2	1.7
Fluoranthene	mg/kg	0.1	7.3	7.2	8.8
Pyrene	mg/kg	0.1	8.3	8.0	12
Benzo(a)anthracene	mg/kg	0.1	4.7	4.7	6.9
Chrysene	mg/kg	0.1	3.9	3.7	5.3
Benzo(b&j)fluoranthene	mg/kg	0.1	6.0	5.7	9.3
Benzo(k)fluoranthene	mg/kg	0.1	2.3	2.2	3.4
Benzo(a)pyrene	mg/kg	0.1	5.1	4.9	8.3
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	3.4	3.2	5.8
Dibenzo(ah)anthracene	mg/kg	0.1	0.8	0.8	1.4
Benzo(ghi)perylene	mg/kg	0.1	3.4	3.2	6.0
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	7.7	7.3	12
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	7.7	7.3	12
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	7.7	7.3	12
Total PAH (18)	mg/kg	0.8	50	48	73
Total PAH (NEPM/WHO 16)	mg/kg	0.8	50	48	73

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

OC Pesticides in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1	<1

OC Pesticides in Soil [AN420] Tested: 11/5/2018 (continued)

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Lindane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Aldrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Delta BHC	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDE	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dieldrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Endrin	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
o,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
o,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
p,p'-DDD	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
p,p'-DDT	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Methoxychlor	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Endrin Ketone	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Isodrin	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Mirex	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Total CLP OC Pesticides	mg/kg	1	<1	<1	<1	<1

PCBs in Soil [AN420] Tested: 11/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP07-0.6 SOIL - 9/5/2018 SE178910.014
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1	<1

PARAMETER	UOM	LOR	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.9 SOIL - 9/5/2018 SE178910.027
Arochlor 1016	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1221	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1232	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1242	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1248	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1254	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1260	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1262	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Arochlor 1268	mg/kg	0.2	<0.2	<0.2	<0.2	<0.2
Total PCBs (Arochlors)	mg/kg	1	<1	<1	<1	<1

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES [AN040/AN320] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.6 SOIL - 9/5/2018 SE178910.008
Arsenic, As	mg/kg	3	9	5	12	8	13
Cadmium, Cd	mg/kg	0.3	0.3	<0.3	0.4	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	12	11	11	9.8	8.0
Copper, Cu	mg/kg	0.5	25	29	43	34	26
Lead, Pb	mg/kg	1	140	120	93	91	58
Nickel, Ni	mg/kg	0.5	6.4	6.6	17	18	25
Zinc, Zn	mg/kg	0.5	320	280	160	150	100

PARAMETER	UOM	LOR	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Arsenic, As	mg/kg	3	11	10	11	7	11
Cadmium, Cd	mg/kg	0.3	0.3	0.4	0.6	<0.3	<0.3
Chromium, Cr	mg/kg	0.3	10	12	19	8.2	16
Copper, Cu	mg/kg	0.5	30	41	40	34	25
Lead, Pb	mg/kg	1	62	110	170	63	53
Nickel, Ni	mg/kg	0.5	26	16	17	27	16
Zinc, Zn	mg/kg	0.5	80	200	550	46	72

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Arsenic, As	mg/kg	3	37	61	17	15	19
Cadmium, Cd	mg/kg	0.3	0.9	1.3	1.4	0.6	0.5
Chromium, Cr	mg/kg	0.3	15	14	10	17	13
Copper, Cu	mg/kg	0.5	26	21	35	34	30
Lead, Pb	mg/kg	1	100	83	69	120	110
Nickel, Ni	mg/kg	0.5	5.8	4.0	10	16	4.5
Zinc, Zn	mg/kg	0.5	180	260	96	570	210

PARAMETER	UOM	LOR	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
Arsenic, As	mg/kg	3	13	13	13	7	9
Cadmium, Cd	mg/kg	0.3	0.4	0.4	0.4	0.3	<0.3
Chromium, Cr	mg/kg	0.3	15	13	10	19	9.5
Copper, Cu	mg/kg	0.5	32	27	31	33	31
Lead, Pb	mg/kg	1	130	120	81	190	110
Nickel, Ni	mg/kg	0.5	4.4	6.9	13	9.5	19
Zinc, Zn	mg/kg	0.5	150	180	110	430	160

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Mercury in Soil [AN312] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005	SP05-0.6 SOIL - 9/5/2018 SE178910.008
Mercury	mg/kg	0.05	0.11	0.12	0.14	0.09	0.07

PARAMETER	UOM	LOR	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Mercury	mg/kg	0.05	0.10	0.10	0.13	<0.05	0.06

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Mercury	mg/kg	0.05	0.51	0.40	0.10	0.09	0.36

PARAMETER	UOM	LOR	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
Mercury	mg/kg	0.05	0.33	0.25	0.16	0.29	0.09

Moisture Content [AN002] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.3 SOIL - 9/5/2018 SE178910.001	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.6 SOIL - 9/5/2018 SE178910.005
% Moisture	%w/w	0.5	9.7	8.9	7.8	11	7.2

PARAMETER	UOM	LOR	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP05-0.9 SOIL - 9/5/2018 SE178910.009	SP06-0.3 SOIL - 9/5/2018 SE178910.010
% Moisture	%w/w	0.5	8.2	8.7	9.5	11	8.5

PARAMETER	UOM	LOR	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-0.6 SOIL - 9/5/2018 SE178910.014	SP07-1.0 SOIL - 9/5/2018 SE178910.015
% Moisture	%w/w	0.5	9.5	8.0	8.8	9.0	8.7

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP08-0.9 SOIL - 9/5/2018 SE178910.018	SP09-0.3 SOIL - 9/5/2018 SE178910.019	SP09-0.6 SOIL - 9/5/2018 SE178910.020
% Moisture	%w/w	0.5	9.5	7.8	8.1	10	8.0

PARAMETER	UOM	LOR	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022	SP10-0.6 SOIL - 9/5/2018 SE178910.023	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025
% Moisture	%w/w	0.5	7.5	12	12	11	7.9

PARAMETER	UOM	LOR	SP11-0.6 SOIL - 9/5/2018 SE178910.026	SP11-0.9 SOIL - 9/5/2018 SE178910.027	DUP1 SOIL - 9/5/2018 SE178910.028	DUP2 SOIL - 9/5/2018 SE178910.029
% Moisture	%w/w	0.5	8.9	8.0	8.5	10

Gravimetric Determination of Asbestos in Soil [AN605] Tested: 14/5/2018

PARAMETER	UOM	LOR	SP03-0.6 SOIL - 9/5/2018 SE178910.002	SP03-0.9 SOIL - 9/5/2018 SE178910.003	SP04-0.3 SOIL - 9/5/2018 SE178910.004	SP04-0.9 SOIL - 9/5/2018 SE178910.006	SP05-0.3 SOIL - 9/5/2018 SE178910.007
Total Sample Weight*	g	1	931	803	881	800	924
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	0.77
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	CRY,ORG

PARAMETER	UOM	LOR	SP05-0.6 SOIL - 9/5/2018 SE178910.008	SP06-0.6 SOIL - 9/5/2018 SE178910.011	SP06-0.9 SOIL - 9/5/2018 SE178910.012	SP07-0.3 SOIL - 9/5/2018 SE178910.013	SP07-1.0 SOIL - 9/5/2018 SE178910.015
Total Sample Weight*	g	1	1084	1009	895	970	855
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP08-0.3 SOIL - 9/5/2018 SE178910.016	SP08-0.6 SOIL - 9/5/2018 SE178910.017	SP09-0.6 SOIL - 9/5/2018 SE178910.020	SP09-0.9 SOIL - 9/5/2018 SE178910.021	SP10-0.3 SOIL - 9/5/2018 SE178910.022
Total Sample Weight*	g	1	851	922	874	1089	979
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD	ORG,NAD

PARAMETER	UOM	LOR	SP10-0.9 SOIL - 9/5/2018 SE178910.024	SP11-0.3 SOIL - 9/5/2018 SE178910.025	SP11-0.6 SOIL - 9/5/2018 SE178910.026
Total Sample Weight*	g	1	793	1114	944
ACM in >7mm Sample*	g	0.01	<0.01	<0.01	<0.01
AF/FA in >2mm to <7mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001
AF/FA in <2mm Sample*	g	0.0001	<0.0001	<0.0001	<0.0001
Asbestos in soil (>7mm ACM)*	%w/w	0.01	<0.01	<0.01	<0.01
Asbestos in soil (>2mm to <7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Asbestos in soil (<2mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Asbestos in soil (<7mm AF/FA)*	%w/w	0.001	<0.001	<0.001	<0.001
Fibre Type*	No unit	-	ORG,NAD	ORG,NAD	ORG,NAD

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

VOCs in Water [AN433] Tested: 11/5/2018

PARAMETER	UOM	LOR	TRIP BLANK WATER - 9/5/2018 SE178910.030	TRIP SPIKE WATER - 9/5/2018 SE178910.031
Benzene	µg/L	0.5	<0.5	[93%]
Toluene	µg/L	0.5	<0.5	[96%]
Ethylbenzene	µg/L	0.5	<0.5	[89%]
m/p-xylene	µg/L	1	<1	[91%]
o-xylene	µg/L	0.5	<0.5	[92%]
Naphthalene	µg/L	0.5	<0.5	-
Total Xylenes	µg/L	1.5	<1.5	-
Total BTEX	µg/L	3	<3	-

METHOD	METHODOLOGY SUMMARY
AN002	The test is carried out by drying (at either 40°C or 105°C) a known mass of sample in a weighed evaporating basin. After fully dry the sample is re-weighed. Samples such as sludge and sediment having high percentages of moisture will take some time in a drying oven for complete removal of water.
AN040/AN320	A portion of sample is digested with nitric acid to decompose organic matter and hydrochloric acid to complete the digestion of metals. The digest is then analysed by ICP OES with metals results reported on the dried sample basis. Based on USEPA method 200.8 and 6010C.
AN040	A portion of sample is digested with Nitric acid to decompose organic matter and Hydrochloric acid to complete the digestion of metals and then filtered for analysis by ASS or ICP as per USEPA Method 200.8.
AN312	Mercury by Cold Vapour AAS in Soils: After digestion with nitric acid, hydrogen peroxide and hydrochloric acid, mercury ions are reduced by stannous chloride reagent in acidic solution to elemental mercury. This mercury vapour is purged by nitrogen into a cold cell in an atomic absorption spectrometer or mercury analyser. Quantification is made by comparing absorbances to those of the calibration standards. Reference APHA 3112/3500
AN403	Total Recoverable Hydrocarbons: Determination of Hydrocarbons by gas chromatography after a solvent extraction. Detection is by flame ionisation detector (FID) that produces an electronic signal in proportion to the combustible matter passing through it. Total Recoverable Hydrocarbons (TRH) are routinely reported as four alkane groupings based on the carbon chain length of the compounds: C6-C9, C10-C14, C15-C28 and C29-C36 and in recognition of the NEPM 1999 (2013), >C10-C16 (F2), >C16-C34 (F3) and >C34-C40 (F4). F2 is reported directly and also corrected by subtracting Naphthalene (from VOC method AN433) where available.
AN403	Additionally, the volatile C6-C9 fraction may be determined by a purge and trap technique and GC/MS because of the potential for volatiles loss. Total Petroleum Hydrocarbons (TPH) follows the same method of analysis after silica gel cleanup of the solvent extract. Aliphatic/Aromatic Speciation follows the same method of analysis after fractionation of the solvent extract over silica with differential polarity of the eluent solvents .
AN403	The GC/FID method is not well suited to the analysis of refined high boiling point materials (ie lubricating oils or greases) but is particularly suited for measuring diesel, kerosene and petrol if care to control volatility is taken. This method will detect naturally occurring hydrocarbons, lipids, animal fats, phenols and PAHs if they are present at sufficient levels, dependent on the use of specific cleanup/fractionation techniques. Reference USEPA 3510B, 8015B.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN420	SVOC Compounds: Semi-Volatile Organic Compounds (SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN433	VOCs and C6-C9 Hydrocarbons by GC-MS P&T: VOC`s are volatile organic compounds. The sample is presented to a gas chromatograph via a purge and trap (P&T) concentrator and autosampler and is detected with a Mass Spectrometer (MSD). Solid samples are initially extracted with methanol whilst liquid samples are processed directly. References: USEPA 5030B, 8020A, 8260.
AN605	This technique gravimetrically determines the mass of Asbestos Containing Material retained on a 7mm Sieve and assumes that 15% of this ACM is asbestos. This calculated asbestos weight is then calculated as a percentage of the total sample weight.
AN605	This technique also gravimetrically determines the mass of Fibrous Asbestos (FA) and Asbestos Fines (AF) Containing Material retained on and passing a 2mm sieve post 7mm sieving. Assumes that FA and AF are 100% asbestos containing. This calculated asbestos weight is then calculated as a percentage of the total sample weight. This does not include free fibres which are only observed by standard trace analysis as per AN 602.
AN605	AMO = Amosite Detected CRY = Chrysotile Detected CRO = Crocidolite Detected ORG = Organic Fibres Detected SMF = Synthetic Mineral Fibres Detected UMF = Unknown Mineral Fibres Detected NAD = No Asbestos Detected
AN605	Insofar as is technically feasible, this report is consistent with the analytical reporting recommendations in the Western Australian Department of Health Guidelines for the Assessment Remediation and Management of Asbestos - Contaminated Sites in Western Australia - May 2009.

FOOTNOTES

*	NATA accreditation does not cover the performance of this service.	-	Not analysed.	UOM	Unit of Measure.
		NVL	Not validated.	LOR	Limit of Reporting.
**	Indicative data, theoretical holding time exceeded.	IS	Insufficient sample for analysis.	↑↓	Raised/lowered Limit of Reporting.
		LNR	Sample listed, but not received.		

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calculated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

STATEMENT OF QA/QC PERFORMANCE

SE178910 R0

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910 R0**
Date Received	09 May 2018
Date Reported	16 May 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met with the exception of the following:

Duplicate	Total Recoverable Elements In Soil/Waste Solids/Materials by ICPOES	3 Items
Matrix Spike	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	1 Item
	Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES	1 Item
	TRH (Total Recoverable Hydrocarbons) In Soil	1 Item

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	29 Soil, 2 Water
Date documentation received	9/5/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Gravimetric Determination of Asbestos in Soil

Method: ME-(AU)-[ENV]AN605

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.6	SE178910.002	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP03-0.9	SE178910.003	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.3	SE178910.004	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.9	SE178910.006	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.3	SE178910.007	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.6	SE178910.008	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.6	SE178910.011	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.9	SE178910.012	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-0.3	SE178910.013	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-1.0	SE178910.015	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.3	SE178910.016	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.6	SE178910.017	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.6	SE178910.020	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.9	SE178910.021	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.3	SE178910.022	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.9	SE178910.024	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.3	SE178910.025	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.6	SE178910.026	LB147732	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP03-0.9	SE178910.003	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP04-0.3	SE178910.004	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP07-1.0	SE178910.015	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.3	SE178910.016	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP08-0.3	SE178910.019	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP09-0.9	SE178910.021	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP10-0.3	SE178910.022	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147722	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
DUP1	SE178910.028	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018
DUP2	SE178910.029	LB147723	09 May 2018	09 May 2018	06 Jun 2018	14 May 2018	06 Jun 2018	16 May 2018

Moisture Content

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP03-0.6	SE178910.002	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP03-0.9	SE178910.003	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.3	SE178910.004	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.6	SE178910.005	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP04-0.9	SE178910.006	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.3	SE178910.007	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.6	SE178910.008	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP05-0.9	SE178910.009	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.3	SE178910.010	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.6	SE178910.011	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP06-0.9	SE178910.012	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-0.3	SE178910.013	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-0.6	SE178910.014	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP07-1.0	SE178910.015	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP08-0.3	SE178910.016	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP08-0.6	SE178910.017	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Moisture Content (continued)

Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP08-0.9	SE178910.018	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.3	SE178910.019	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.6	SE178910.020	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP09-0.9	SE178910.021	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.3	SE178910.022	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.6	SE178910.023	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP10-0.9	SE178910.024	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.3	SE178910.025	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.6	SE178910.026	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
SP11-0.9	SE178910.027	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
DUP1	SE178910.028	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018
DUP2	SE178910.029	LB147689	09 May 2018	09 May 2018	23 May 2018	14 May 2018	19 May 2018	16 May 2018

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP03-0.9	SE178910.003	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.3	SE178910.004	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP04-0.6	SE178910.005	LB147742	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.6	SE178910.008	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP05-0.9	SE178910.009	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.3	SE178910.010	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP06-0.9	SE178910.012	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-0.6	SE178910.014	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP07-1.0	SE178910.015	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.3	SE178910.016	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP08-0.9	SE178910.018	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.3	SE178910.019	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP09-0.9	SE178910.021	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.3	SE178910.022	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP10-0.6	SE178910.023	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.3	SE178910.025	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
SP11-0.9	SE178910.027	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
DUP1	SE178910.028	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018
DUP2	SE178910.029	LB147743	09 May 2018	09 May 2018	05 Nov 2018	14 May 2018	05 Nov 2018	16 May 2018

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP03-0.6	SE178910.002	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.6	SE178910.005	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP04-0.9	SE178910.006	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.3	SE178910.007	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.6	SE178910.008	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP05-0.9	SE178910.009	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.3	SE178910.010	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.6	SE178910.011	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP06-0.9	SE178910.012	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.3	SE178910.013	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP07-0.6	SE178910.014	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.6	SE178910.017	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP08-0.9	SE178910.018	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

TRH (Total Recoverable Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN403

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP09-0.3	SE178910.019	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP09-0.6	SE178910.020	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.6	SE178910.023	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP10-0.9	SE178910.024	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.3	SE178910.025	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.6	SE178910.026	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018
SP11-0.9	SE178910.027	LB147632	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	16 May 2018

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP04-0.6	SE178910.005	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP05-0.9	SE178910.009	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP06-0.3	SE178910.010	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP07-0.6	SE178910.014	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP08-0.9	SE178910.018	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP09-0.3	SE178910.019	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP10-0.6	SE178910.023	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018
SP11-0.9	SE178910.027	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
TRIP BLANK	SE178910.030	LB147735	09 May 2018	09 May 2018	16 May 2018	11 May 2018	20 Jun 2018	15 May 2018
TRIP SPIKE	SE178910.031	LB147735	09 May 2018	09 May 2018	16 May 2018	11 May 2018	20 Jun 2018	15 May 2018

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-0.3	SE178910.001	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP04-0.6	SE178910.005	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP05-0.9	SE178910.009	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP06-0.3	SE178910.010	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP07-0.6	SE178910.014	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP08-0.9	SE178910.018	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP09-0.3	SE178910.019	LB147606	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	15 May 2018
SP10-0.6	SE178910.023	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018
SP11-0.9	SE178910.027	LB147614	09 May 2018	09 May 2018	23 May 2018	11 May 2018	20 Jun 2018	14 May 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

OC Pesticides in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	97
	SP04-0.6	SE178910.005	%	60 - 130%	105
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	97
	SP07-0.6	SE178910.014	%	60 - 130%	85
	SP08-0.9	SE178910.018	%	60 - 130%	89
	SP09-0.3	SE178910.019	%	60 - 130%	102
	SP10-0.6	SE178910.023	%	60 - 130%	93
	SP11-0.9	SE178910.027	%	60 - 130%	88

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	86
	SP03-0.6	SE178910.002	%	70 - 130%	92
	SP04-0.6	SE178910.005	%	70 - 130%	90
	SP04-0.9	SE178910.006	%	70 - 130%	92
	SP05-0.3	SE178910.007	%	70 - 130%	90
	SP05-0.6	SE178910.008	%	70 - 130%	88
	SP06-0.6	SE178910.011	%	70 - 130%	90
	SP06-0.9	SE178910.012	%	70 - 130%	88
	SP07-0.3	SE178910.013	%	70 - 130%	90
	SP07-0.6	SE178910.014	%	70 - 130%	94
	SP08-0.6	SE178910.017	%	70 - 130%	90
	SP08-0.9	SE178910.018	%	70 - 130%	94
	SP09-0.3	SE178910.019	%	70 - 130%	92
	SP09-0.6	SE178910.020	%	70 - 130%	90
	SP10-0.6	SE178910.023	%	70 - 130%	90
	SP10-0.9	SE178910.024	%	70 - 130%	102
	SP11-0.3	SE178910.025	%	70 - 130%	90
	SP11-0.6	SE178910.026	%	70 - 130%	96
d14-p-terphenyl (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	88
	SP03-0.6	SE178910.002	%	70 - 130%	94
	SP04-0.6	SE178910.005	%	70 - 130%	92
	SP04-0.9	SE178910.006	%	70 - 130%	98
	SP05-0.3	SE178910.007	%	70 - 130%	94
	SP05-0.6	SE178910.008	%	70 - 130%	94
	SP06-0.6	SE178910.011	%	70 - 130%	96
	SP06-0.9	SE178910.012	%	70 - 130%	92
	SP07-0.3	SE178910.013	%	70 - 130%	92
	SP07-0.6	SE178910.014	%	70 - 130%	96
	SP08-0.6	SE178910.017	%	70 - 130%	92
	SP08-0.9	SE178910.018	%	70 - 130%	96
	SP09-0.3	SE178910.019	%	70 - 130%	96
	SP09-0.6	SE178910.020	%	70 - 130%	94
	SP10-0.6	SE178910.023	%	70 - 130%	92
	SP10-0.9	SE178910.024	%	70 - 130%	102
	SP11-0.3	SE178910.025	%	70 - 130%	92
	SP11-0.6	SE178910.026	%	70 - 130%	96
d5-nitrobenzene (Surrogate)	SP03-0.3	SE178910.001	%	70 - 130%	80
	SP03-0.6	SE178910.002	%	70 - 130%	86
	SP04-0.6	SE178910.005	%	70 - 130%	84
	SP04-0.9	SE178910.006	%	70 - 130%	84
	SP05-0.3	SE178910.007	%	70 - 130%	80
	SP05-0.6	SE178910.008	%	70 - 130%	78
	SP06-0.6	SE178910.011	%	70 - 130%	82
	SP06-0.9	SE178910.012	%	70 - 130%	82
	SP07-0.3	SE178910.013	%	70 - 130%	80
	SP07-0.6	SE178910.014	%	70 - 130%	88
	SP08-0.6	SE178910.017	%	70 - 130%	84
	SP08-0.9	SE178910.018	%	70 - 130%	88
	SP09-0.3	SE178910.019	%	70 - 130%	88

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued) — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
d5-nitrobenzene (Surrogate)	SP09-0.6	SE178910.020	%	70 - 130%	84
	SP10-0.6	SE178910.023	%	70 - 130%	86
	SP10-0.9	SE178910.024	%	70 - 130%	98
	SP11-0.3	SE178910.025	%	70 - 130%	90
	SP11-0.6	SE178910.026	%	70 - 130%	96

PCBs in Soil — Method: ME-(AU)-[ENV]AN420

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Tetrachloro-m-xylene (TCMX) (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	97
	SP04-0.6	SE178910.005	%	60 - 130%	105
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	97
	SP07-0.6	SE178910.014	%	60 - 130%	85
	SP08-0.9	SE178910.018	%	60 - 130%	89
	SP09-0.3	SE178910.019	%	60 - 130%	102
	SP10-0.6	SE178910.023	%	60 - 130%	93
	SP11-0.9	SE178910.027	%	60 - 130%	88

VOC's in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	76
	SP04-0.6	SE178910.005	%	60 - 130%	97
	SP05-0.9	SE178910.009	%	60 - 130%	81
	SP06-0.3	SE178910.010	%	60 - 130%	77
	SP07-0.6	SE178910.014	%	60 - 130%	74
	SP08-0.9	SE178910.018	%	60 - 130%	76
	SP09-0.3	SE178910.019	%	60 - 130%	75
	SP10-0.6	SE178910.023	%	60 - 130%	79
	SP11-0.9	SE178910.027	%	60 - 130%	76
d4-1,2-dichloroethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	93
	SP05-0.9	SE178910.009	%	60 - 130%	103
	SP06-0.3	SE178910.010	%	60 - 130%	108
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	99
	SP09-0.3	SE178910.019	%	60 - 130%	100
	SP10-0.6	SE178910.023	%	60 - 130%	90
	SP11-0.9	SE178910.027	%	60 - 130%	99
d8-toluene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	84
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	91
	SP07-0.6	SE178910.014	%	60 - 130%	96
	SP08-0.9	SE178910.018	%	60 - 130%	102
	SP09-0.3	SE178910.019	%	60 - 130%	96
	SP10-0.6	SE178910.023	%	60 - 130%	94
	SP11-0.9	SE178910.027	%	60 - 130%	85
Dibromofluoromethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	100
	SP04-0.6	SE178910.005	%	60 - 130%	91
	SP05-0.9	SE178910.009	%	60 - 130%	109
	SP06-0.3	SE178910.010	%	60 - 130%	98
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	96
	SP09-0.3	SE178910.019	%	60 - 130%	101
	SP10-0.6	SE178910.023	%	60 - 130%	80
	SP11-0.9	SE178910.027	%	60 - 130%	121

VOCs in Water — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	98
	TRIP SPIKE	SE178910.031	%	40 - 130%	85
d4-1,2-dichloroethane (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	114

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOCs in Water (continued) — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
d4-1,2-dichloroethane (Surrogate)	TRIP SPIKE	SE178910.031	%	40 - 130%	97
d8-toluene (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	103
	TRIP SPIKE	SE178910.031	%	40 - 130%	97
Dibromofluoromethane (Surrogate)	TRIP BLANK	SE178910.030	%	40 - 130%	118
	TRIP SPIKE	SE178910.031	%	40 - 130%	97

Volatile Petroleum Hydrocarbons in Soil — Method: ME-(AU)-[ENV]AN433

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
Bromofluorobenzene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	76
	SP04-0.6	SE178910.005	%	60 - 130%	97
	SP05-0.9	SE178910.009	%	60 - 130%	81
	SP06-0.3	SE178910.010	%	60 - 130%	77
	SP07-0.6	SE178910.014	%	60 - 130%	74
	SP08-0.9	SE178910.018	%	60 - 130%	76
	SP09-0.3	SE178910.019	%	60 - 130%	75
	SP10-0.6	SE178910.023	%	60 - 130%	79
	SP11-0.9	SE178910.027	%	60 - 130%	76
d4-1,2-dichloroethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	93
	SP05-0.9	SE178910.009	%	60 - 130%	103
	SP06-0.3	SE178910.010	%	60 - 130%	108
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	99
	SP09-0.3	SE178910.019	%	60 - 130%	100
	SP10-0.6	SE178910.023	%	60 - 130%	90
	SP11-0.9	SE178910.027	%	60 - 130%	99
d8-toluene (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	103
	SP04-0.6	SE178910.005	%	60 - 130%	84
	SP05-0.9	SE178910.009	%	60 - 130%	101
	SP06-0.3	SE178910.010	%	60 - 130%	91
	SP07-0.6	SE178910.014	%	60 - 130%	96
	SP08-0.9	SE178910.018	%	60 - 130%	102
	SP09-0.3	SE178910.019	%	60 - 130%	96
	SP10-0.6	SE178910.023	%	60 - 130%	94
	SP11-0.9	SE178910.027	%	60 - 130%	85
Dibromofluoromethane (Surrogate)	SP03-0.3	SE178910.001	%	60 - 130%	100
	SP04-0.6	SE178910.005	%	60 - 130%	91
	SP05-0.9	SE178910.009	%	60 - 130%	109
	SP06-0.3	SE178910.010	%	60 - 130%	98
	SP07-0.6	SE178910.014	%	60 - 130%	95
	SP08-0.9	SE178910.018	%	60 - 130%	96
	SP09-0.3	SE178910.019	%	60 - 130%	101
	SP10-0.6	SE178910.023	%	60 - 130%	80
	SP11-0.9	SE178910.027	%	60 - 130%	121

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury In Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result
LB147722.001	Mercury	mg/kg	0.05	<0.05
LB147723.001	Mercury	mg/kg	0.05	<0.05

OC Pesticides In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1
		Alpha BHC	mg/kg	0.1	<0.1
		Lindane	mg/kg	0.1	<0.1
		Heptachlor	mg/kg	0.1	<0.1
		Aldrin	mg/kg	0.1	<0.1
		Beta BHC	mg/kg	0.1	<0.1
		Delta BHC	mg/kg	0.1	<0.1
		Heptachlor epoxide	mg/kg	0.1	<0.1
		Alpha Endosulfan	mg/kg	0.2	<0.2
		Gamma Chlordane	mg/kg	0.1	<0.1
		Alpha Chlordane	mg/kg	0.1	<0.1
		p,p'-DDE	mg/kg	0.1	<0.1
		Dieldrin	mg/kg	0.2	<0.2
		Endrin	mg/kg	0.2	<0.2
		Beta Endosulfan	mg/kg	0.2	<0.2
		p,p'-DDD	mg/kg	0.1	<0.1
		p,p'-DDT	mg/kg	0.1	<0.1
		Endosulfan sulphate	mg/kg	0.1	<0.1
		Endrin Aldehyde	mg/kg	0.1	<0.1
		Methoxychlor	mg/kg	0.1	<0.1
		Endrin Ketone	mg/kg	0.1	<0.1
		Isodrin	mg/kg	0.1	<0.1
		Mirex	mg/kg	0.1	<0.1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	91

PAH (Polynuclear Aromatic Hydrocarbons) In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Naphthalene	mg/kg	0.1	<0.1
		2-methylnaphthalene	mg/kg	0.1	<0.1
		1-methylnaphthalene	mg/kg	0.1	<0.1
		Acenaphthylene	mg/kg	0.1	<0.1
		Acenaphthene	mg/kg	0.1	<0.1
		Fluorene	mg/kg	0.1	<0.1
		Phenanthrene	mg/kg	0.1	<0.1
		Anthracene	mg/kg	0.1	<0.1
		Fluoranthene	mg/kg	0.1	<0.1
		Pyrene	mg/kg	0.1	<0.1
		Benzo(a)anthracene	mg/kg	0.1	<0.1
		Chrysene	mg/kg	0.1	<0.1
		Benzo(a)pyrene	mg/kg	0.1	<0.1
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1
		Benzo(ghi)perylene	mg/kg	0.1	<0.1
		Total PAH (18)	mg/kg	0.8	<0.8
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	104
		2-fluorobiphenyl (Surrogate)	%	-	112
		d14-p-terphenyl (Surrogate)	%	-	116

PCBs In Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result
LB147632.001	Arochlor 1016	mg/kg	0.2	<0.2
	Arochlor 1221	mg/kg	0.2	<0.2
	Arochlor 1232	mg/kg	0.2	<0.2
	Arochlor 1242	mg/kg	0.2	<0.2
	Arochlor 1248	mg/kg	0.2	<0.2
	Arochlor 1254	mg/kg	0.2	<0.2

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PCBs in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB147632.001		Arochlor 1260	mg/kg	0.2	<0.2
		Arochlor 1262	mg/kg	0.2	<0.2
		Arochlor 1268	mg/kg	0.2	<0.2
		Total PCBs (Arochlors)	mg/kg	1	<1
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	%	-	91

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number		Parameter	Units	LOR	Result
LB147742.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5
LB147743.001		Arsenic, As	mg/kg	3	<3
		Cadmium, Cd	mg/kg	0.3	<0.3
		Chromium, Cr	mg/kg	0.3	<0.3
		Copper, Cu	mg/kg	0.5	<0.5
		Nickel, Ni	mg/kg	0.5	<0.5
		Lead, Pb	mg/kg	1	<1
		Zinc, Zn	mg/kg	0.5	<0.5

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result
LB147632.001		TRH C10-C14	mg/kg	20	<20
		TRH C15-C28	mg/kg	45	<45
		TRH C29-C36	mg/kg	45	<45
		TRH C37-C40	mg/kg	100	<100
		TRH C10-C36 Total	mg/kg	110	<110

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147606.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	95
		d4-1,2-dichloroethane (Surrogate)	%	-	93
		d8-toluene (Surrogate)	%	-	96
		Bromofluorobenzene (Surrogate)	%	-	87
	Totals	Total BTEX	mg/kg	0.6	<0.6
LB147614.001	Monocyclic Aromatic	Benzene	mg/kg	0.1	<0.1
	Hydrocarbons	Toluene	mg/kg	0.1	<0.1
		Ethylbenzene	mg/kg	0.1	<0.1
		m/p-xylene	mg/kg	0.2	<0.2
		o-xylene	mg/kg	0.1	<0.1
	Polycyclic VOCs	Naphthalene	mg/kg	0.1	<0.1
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	118
		d4-1,2-dichloroethane (Surrogate)	%	-	108
		d8-toluene (Surrogate)	%	-	97
		Bromofluorobenzene (Surrogate)	%	-	85
	Totals	Total BTEX	mg/kg	0.6	<0.6

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147735.001	Monocyclic Aromatic	Benzene	µg/L	0.5	<0.5
	Hydrocarbons	Toluene	µg/L	0.5	<0.5
		Ethylbenzene	µg/L	0.5	<0.5
		m/p-xylene	µg/L	1	<1
		o-xylene	µg/L	0.5	<0.5

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

VOCs in Water (continued)

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147735.001	Polycyclic VOCs	Naphthalene	µg/L	0.5	<0.5
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	116
		d4-1,2-dichloroethane (Surrogate)	%	-	114
		d8-toluene (Surrogate)	%	-	101
		Bromofluorobenzene (Surrogate)	%	-	98

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result
LB147606.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	95
		d4-1,2-dichloroethane (Surrogate)	%	-	93
		d8-toluene (Surrogate)	%	-	96
LB147614.001		TRH C6-C9	mg/kg	20	<20
	Surrogates	Dibromofluoromethane (Surrogate)	%	-	118
		d4-1,2-dichloroethane (Surrogate)	%	-	108
		d8-toluene (Surrogate)	%	-	97

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.012	LB147722.014	Mercury	mg/kg	0.05	0.13	0.11	71	15
SE178910.025	LB147722.024	Mercury	mg/kg	0.05	0.25	0.22	51	14
SE178919.016	LB147723.014	Mercury	mg/kg	0.05	0.0160929514	0.0123818708	200	0
SE178919.023	LB147723.022	Mercury	mg/kg	0.05	0.0827755092	0.1002152058	82	8

Moisture Content

Method: ME-(AU)-[ENV]AN002

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.010	LB147689.011	% Moisture	%w/w	0.5	8.5	8.0	42	6
SE178910.020	LB147689.022	% Moisture	%w/w	0.5	8.0	8.2	42	1
SE178910.029	LB147689.032	% Moisture	%w/w	0.5	10	11	39	6

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030	Hexachlorobenzene (HCB)	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Lindane	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor	mg/kg	0.1	<0.1	<0.1	200	0
		Aldrin	mg/kg	0.1	<0.1	<0.1	200	0
		Beta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Delta BHC	mg/kg	0.1	<0.1	<0.1	200	0
		Heptachlor epoxide	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		Gamma Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		Alpha Chlordane	mg/kg	0.1	<0.1	<0.1	200	0
		trans-Nonachlor	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDE	mg/kg	0.1	<0.1	<0.1	200	0
		Dieldrin	mg/kg	0.2	<0.2	<0.2	200	0
		Endrin	mg/kg	0.2	<0.2	<0.2	200	0
		o,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		o,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Beta Endosulfan	mg/kg	0.2	<0.2	<0.2	200	0
		p,p'-DDD	mg/kg	0.1	<0.1	<0.1	200	0
		p,p'-DDT	mg/kg	0.1	<0.1	<0.1	200	0
		Endosulfan sulphate	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Aldehyde	mg/kg	0.1	<0.1	<0.1	200	0
		Methoxychlor	mg/kg	0.1	<0.1	<0.1	200	0
		Endrin Ketone	mg/kg	0.1	<0.1	<0.1	200	0
		Isodrin	mg/kg	0.1	<0.1	<0.1	200	0
		Mirex	mg/kg	0.1	<0.1	<0.1	200	0
		Total CLP OC Pesticides	mg/kg	1	<1	<1	200	0
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.13	0.14	30	9

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.020	LB147632.031	Naphthalene	mg/kg	0.1	<0.1	0.04	200	0
		2-methylnaphthalene	mg/kg	0.1	<0.1	0.02	200	0
		1-methylnaphthalene	mg/kg	0.1	<0.1	0.02	200	0
		Acenaphthylene	mg/kg	0.1	0.2	0.16	67	17
		Acenaphthene	mg/kg	0.1	<0.1	0.01	200	0
		Fluorene	mg/kg	0.1	<0.1	0.04	200	0
		Phenanthrene	mg/kg	0.1	0.8	0.5	48	20
		Anthracene	mg/kg	0.1	0.3	0.21	73	21
		Fluoranthene	mg/kg	0.1	1.5	1.29	37	13
		Pyrene	mg/kg	0.1	1.4	1.24	38	14
		Benzo(a)anthracene	mg/kg	0.1	0.9	0.69	43	23
		Chrysene	mg/kg	0.1	0.7	0.59	46	17
		Benzo(b&j)fluoranthene	mg/kg	0.1	1.0	0.82	41	24
		Benzo(k)fluoranthene	mg/kg	0.1	0.5	0.41	53	11
		Benzo(a)pyrene	mg/kg	0.1	0.9	0.77	42	12
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	0.6	0.44	50	27
		Dibenzo(ah)anthracene	mg/kg	0.1	0.2	0.09	113	40

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in Green when within suggested criteria or Red with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil (continued)

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.020	LB147632.031		Benzo(ghi)perylene	mg/kg	0.1	0.6	0.51	48	13
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	1.3	1.013	27	27
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	1.3	1.113	35	18
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	1.3	1.063	27	22
			Total PAH (18)	mg/kg	0.8	9.2	7.59	40	19
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.38	30	10
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	0.41	30	9
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.5	0.41	30	14

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030		Arochlor 1016	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1221	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1232	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1242	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1248	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1254	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1260	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1262	mg/kg	0.2	<0.2	<0.2	200	0
			Arochlor 1268	mg/kg	0.2	<0.2	<0.2	200	0
			Total PCBs (Arochlors)	mg/kg	1	<1	<1	200	0
		Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0	0	30	9

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.005	LB147742.024	Arsenic, As	mg/kg	3	8	11	41	26
		Cadmium, Cd	mg/kg	0.3	<0.3	0.3	134	0
		Chromium, Cr	mg/kg	0.3	9.8	9.6	35	2
		Copper, Cu	mg/kg	0.5	34	31	32	10
		Nickel, Ni	mg/kg	0.5	18	13	33	30
		Lead, Pb	mg/kg	1	91	95	31	5
		Zinc, Zn	mg/kg	0.5	150	140	31	6
SE178910.021	LB147743.014	Arsenic, As	mg/kg	3	15	36	34	80 ⊘
		Cadmium, Cd	mg/kg	0.3	0.6	1.6	58	94 ⊘
		Chromium, Cr	mg/kg	0.3	17	17	33	2
		Copper, Cu	mg/kg	0.5	34	36	31	6
		Nickel, Ni	mg/kg	0.5	16	13	33	23
		Lead, Pb	mg/kg	1	120	140	31	19
		Zinc, Zn	mg/kg	0.5	570	220	31	88 ⊘
SE178919.002	LB147743.024	Lead, Pb	mg/kg	1	13.74511718789.653320312		36	35
SE178959.041	LB147742.014	Arsenic, As	mg/kg	3	7.31000632927.2080361339		44	1
		Cadmium, Cd	mg/kg	0.3	0.04462764540.0963641194		200	0
		Chromium, Cr	mg/kg	0.3	24.79065706224.775215107		32	0
		Copper, Cu	mg/kg	0.5	14.80299000495.3411678145		33	4
		Nickel, Ni	mg/kg	0.5	4.60557301324.9145700913		41	6
		Lead, Pb	mg/kg	1	23.76422121623.5032087310		34	1
		Zinc, Zn	mg/kg	0.5	26.86584257727.3674099204		37	2

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.010	LB147632.032		TRH C10-C14	mg/kg	20	<20	0	200	0
			TRH C15-C28	mg/kg	45	120	116	68	3
			TRH C29-C36	mg/kg	45	70	111	80	45
			TRH C37-C40	mg/kg	100	<100	0	200	0
			TRH C10-C36 Total	mg/kg	110	190	229	82	18
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	194	143	0
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	0	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	0	200	0
			TRH >C16-C34 (F3)	mg/kg	90	180	194	79	9
			TRH >C34-C40 (F4)	mg/kg	120	<120	0	200	0
SE178910.027	LB147632.030		TRH C10-C14	mg/kg	20	<20	<20	200	0
			TRH C15-C28	mg/kg	45	220	170	53	29

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

TRH (Total Recoverable Hydrocarbons) In Soil (continued)

Method: ME-(AU)-[ENV]AN403

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178910.027	LB147632.030		TRH C29-C36	mg/kg	45	170	140	60	20
			TRH C37-C40	mg/kg	100	<100	<100	200	0
			TRH C10-C36 Total	mg/kg	110	390	300	62	25
			TRH C10-C40 Total (F bands)	mg/kg	210	340	270	99	25
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	<25	200	0
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	<25	200	0
			TRH >C16-C34 (F3)	mg/kg	90	340	270	60	25
			TRH >C34-C40 (F4)	mg/kg	120	<120	<120	200	0

VOC's In Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178849.008	LB147606.014	Monocyclic	Benzene	mg/kg	0.1	0.02	0.02	200	0
		Aromatic	Toluene	mg/kg	0.1	0	0	200	0
			Ethylbenzene	mg/kg	0.1	0	0	200	0
			m/p-xylene	mg/kg	0.2	0	0	200	0
			o-xylene	mg/kg	0.1	0	0	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	0	0	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.99	5.37	50	7
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.4	6.08	50	12
			d8-toluene (Surrogate)	mg/kg	-	4.72	5.01	50	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.81	3.84	50	1
		Totals	Total Xylenes	mg/kg	0.3	0	0	200	0
			Total BTEX	mg/kg	0.6	0.02	0.02	200	0
SE178910.019	LB147606.025	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.0	5.0	50	1
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	5.2	50	4
			d8-toluene (Surrogate)	mg/kg	-	4.8	5.1	50	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	50	2
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE178910.027	LB147614.020	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.1	4.8	50	23
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.2	50	17
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.7	50	11
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.7	50	3
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0
SE178991.010	LB147614.014	Monocyclic	Benzene	mg/kg	0.1	<0.1	<0.1	200	0
		Aromatic	Toluene	mg/kg	0.1	<0.1	<0.1	200	0
			Ethylbenzene	mg/kg	0.1	<0.1	<0.1	200	0
			m/p-xylene	mg/kg	0.2	<0.2	<0.2	200	0
			o-xylene	mg/kg	0.1	<0.1	<0.1	200	0
		Polycyclic	Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	3.6	4.4	50	20
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.7	50	7
			d8-toluene (Surrogate)	mg/kg	-	4.4	4.4	50	0
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.9	3.8	50	2
		Totals	Total Xylenes	mg/kg	0.3	<0.3	<0.3	200	0
			Total BTEX	mg/kg	0.6	<0.6	<0.6	200	0

VOCs In Water

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOCs in Water (continued)

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178796.001	LB147735.022	Monocyclic	Benzene	µg/L	0.5	<0.5	0.05	200	0
		Aromatic	Toluene	µg/L	0.5	<0.5	0.06	200	0
			Ethylbenzene	µg/L	0.5	<0.5	0.02	200	0
			m/p-xylene	µg/L	1	<1	0.03	200	0
			o-xylene	µg/L	0.5	<0.5	0.02	200	0
		Polycyclic	Naphthalene	µg/L	0.5	<0.5	0.07	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	5.4	5.42	30	0
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	5.4	5.44	30	1
			d8-toluene (Surrogate)	µg/L	-	4.7	4.71	30	0
			Bromofluorobenzene (Surrogate)	µg/L	-	4.8	4.85	30	1
SE178837.001	LB147735.023	Monocyclic	Benzene	µg/L	0.5	<0.5	<0.5	200	0
		Aromatic	Toluene	µg/L	0.5	<0.5	<0.5	200	0
			Ethylbenzene	µg/L	0.5	<0.5	<0.5	200	0
			m/p-xylene	µg/L	1	<1	<1	200	0
			o-xylene	µg/L	0.5	<0.5	<0.5	200	0
		Polycyclic	Naphthalene	µg/L	0.5	<0.5	<0.5	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.9	4.9	30	1
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	5.2	5.2	30	1
			d8-toluene (Surrogate)	µg/L	-	4.9	4.9	30	0
			Bromofluorobenzene (Surrogate)	µg/L	-	4.8	4.8	30	0

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE178649.008	LB147606.014		TRH C6-C10	mg/kg	25	0	0	200	0
			TRH C6-C9	mg/kg	20	0	0.15	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.99	5.37	30	7
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.4	6.08	30	12
			d8-toluene (Surrogate)	mg/kg	-	4.72	5.01	30	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.81	3.84	30	1
		VPH F Bands	Benzene (F0)	mg/kg	0.1	0.02	0.02	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	-0.02	-0.02	200	0
SE178910.019	LB147606.025		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.0	5.0	30	1
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	5.2	30	4
			d8-toluene (Surrogate)	mg/kg	-	4.8	5.1	30	6
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.8	30	2
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE178910.027	LB147614.020		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.1	4.8	30	23
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.2	30	17
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.7	30	11
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.8	3.7	30	3
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0
SE178991.010	LB147614.014		TRH C6-C10	mg/kg	25	<25	<25	200	0
			TRH C6-C9	mg/kg	20	<20	<20	200	0
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	3.6	4.4	30	20
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.0	4.7	30	7
			d8-toluene (Surrogate)	mg/kg	-	4.4	4.4	30	0
			Bromofluorobenzene (Surrogate)	mg/kg	-	3.9	3.8	30	2
		VPH F Bands	Benzene (F0)	mg/kg	0.1	<0.1	<0.1	200	0
			TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	200	0

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147722.002	Mercury	mg/kg	0.05	0.23	0.2	70 - 130	113
LB147723.002	Mercury	mg/kg	0.05	0.22	0.2	70 - 130	111

OC Pesticides in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		Heptachlor	mg/kg	0.1	0.2	0.2	60 - 140	89
		Aldrin	mg/kg	0.1	0.2	0.2	60 - 140	102
		Delta BHC	mg/kg	0.1	0.2	0.2	60 - 140	98
		Dieldrin	mg/kg	0.2	<0.2	0.2	60 - 140	98
		Endrin	mg/kg	0.2	<0.2	0.2	60 - 140	83
		p,p'-DDT	mg/kg	0.1	0.2	0.2	60 - 140	76
	Surrogates	Tetrachloro-m-xylene (TCMX) (Surrogate)	mg/kg	-	0.15	0.15	40 - 130	99

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		Naphthalene	mg/kg	0.1	3.5	4	60 - 140	87
		Acenaphthylene	mg/kg	0.1	3.5	4	60 - 140	87
		Acenaphthene	mg/kg	0.1	3.3	4	60 - 140	82
		Phenanthrene	mg/kg	0.1	3.3	4	60 - 140	83
		Anthracene	mg/kg	0.1	3.4	4	60 - 140	85
		Fluoranthene	mg/kg	0.1	3.3	4	60 - 140	82
		Pyrene	mg/kg	0.1	3.1	4	60 - 140	78
		Benzo(a)pyrene	mg/kg	0.1	3.5	4	60 - 140	87
	Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	78
		2-fluorobiphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	82
		d14-p-terphenyl (Surrogate)	mg/kg	-	0.4	0.5	40 - 130	82

PCBs in Soil

Method: ME-(AU)-[ENV]AN420

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002	Arochlor 1260	mg/kg	0.2	0.4	0.4	60 - 140	103

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147742.002	Arsenic, As	mg/kg	3	310	336.32	79 - 120	93
	Cadmium, Cd	mg/kg	0.3	420	416.6	69 - 131	101
	Chromium, Cr	mg/kg	0.3	29	35.2	80 - 120	83
	Copper, Cu	mg/kg	0.5	310	370.46	80 - 120	84
	Nickel, Ni	mg/kg	0.5	170	210.88	79 - 120	82
	Lead, Pb	mg/kg	1	88	107.87	79 - 120	82
	Zinc, Zn	mg/kg	0.5	270	301.27	80 - 121	91
LB147743.002	Arsenic, As	mg/kg	3	340	336.32	79 - 120	101
	Cadmium, Cd	mg/kg	0.3	440	416.6	69 - 131	105
	Chromium, Cr	mg/kg	0.3	38	35.2	80 - 120	108
	Copper, Cu	mg/kg	0.5	380	370.46	80 - 120	102
	Nickel, Ni	mg/kg	0.5	200	210.88	79 - 120	98
	Lead, Pb	mg/kg	1	100	107.87	79 - 120	95
	Zinc, Zn	mg/kg	0.5	310	301.27	80 - 121	101

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147632.002		TRH C10-C14	mg/kg	20	34	40	60 - 140	85
		TRH C15-C28	mg/kg	45	<45	40	60 - 140	110
		TRH C29-C36	mg/kg	45	<45	40	60 - 140	90
	TRH F Bands	TRH >C10-C16	mg/kg	25	39	40	60 - 140	98
		TRH >C16-C34 (F3)	mg/kg	90	<90	40	60 - 140	100
		TRH >C34-C40 (F4)	mg/kg	120	<120	20	60 - 140	90

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number	Parameter	Units	LOR

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

VOC's in Soil (continued)

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147606.002	Monocyclic	Benzene	mg/kg	0.1	2.2	2.9	60 - 140	74
	Aromatic	Toluene	mg/kg	0.1	2.4	2.9	60 - 140	84
		Ethylbenzene	mg/kg	0.1	2.4	2.9	60 - 140	81
		m/p-xylene	mg/kg	0.2	4.8	5.8	60 - 140	82
		o-xylene	mg/kg	0.1	2.4	2.9	60 - 140	83
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	83
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	84
		d8-toluene (Surrogate)	mg/kg	-	5.2	5	60 - 140	103
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.7	5	60 - 140	94
LB147614.002	Monocyclic	Benzene	mg/kg	0.1	2.3	2.9	60 - 140	80
	Aromatic	Toluene	mg/kg	0.1	2.7	2.9	60 - 140	92
		Ethylbenzene	mg/kg	0.1	2.3	2.9	60 - 140	81
		m/p-xylene	mg/kg	0.2	4.5	5.8	60 - 140	78
		o-xylene	mg/kg	0.1	2.3	2.9	60 - 140	80
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.0	5	60 - 140	120
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.1	5	60 - 140	103
		d8-toluene (Surrogate)	mg/kg	-	5.1	5	60 - 140	102
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.1	5	60 - 140	101

VOCs in Water

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147735.002	Monocyclic	Benzene	µg/L	0.5	51	45.45	60 - 140	112
	Aromatic	Toluene	µg/L	0.5	51	45.45	60 - 140	112
		Ethylbenzene	µg/L	0.5	51	45.45	60 - 140	113
		m/p-xylene	µg/L	1	100	90.9	60 - 140	112
		o-xylene	µg/L	0.5	51	45.45	60 - 140	112
	Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.3	5	60 - 140	86
		d4-1,2-dichloroethane (Surrogate)	µg/L	-	4.4	5	60 - 140	87
		d8-toluene (Surrogate)	µg/L	-	4.5	5	60 - 140	91
		Bromofluorobenzene (Surrogate)	µg/L	-	4.6	5	60 - 140	93

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB147606.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	78
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	69
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	83
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.2	5	60 - 140	84
		d8-toluene (Surrogate)	mg/kg	-	5.2	5	60 - 140	103
		Bromofluorobenzene (Surrogate)	mg/kg	-	4.7	5	60 - 140	94
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	71
LB147614.002		TRH C6-C10	mg/kg	25	<25	24.65	60 - 140	89
		TRH C6-C9	mg/kg	20	<20	23.2	60 - 140	80
	Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	6.0	5	60 - 140	120
		d4-1,2-dichloroethane (Surrogate)	mg/kg	-	5.1	5	60 - 140	103
		d8-toluene (Surrogate)	mg/kg	-	5.1	5	60 - 140	102
		Bromofluorobenzene (Surrogate)	mg/kg	-	5.1	5	60 - 140	101
	VPH F Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	7.25	60 - 140	105

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Mercury in Soil

Method: ME-(AU)-[ENV]AN312

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178910.027	LB147723.004	Mercury	mg/kg	0.05	0.40	0.16	0.2	123
SE178959.045	LB147722.004	Mercury	mg/kg	0.05	0.24	0.03292042322	0.2	103

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

QC Sample	Sample Number		Parameter	Units	LOR	Original	Spike	Recovery%
SE178910.005	LB147632.032		Naphthalene	mg/kg	0.1	<0.1	4	91
			2-methylnaphthalene	mg/kg	0.1	<0.1	-	-
			1-methylnaphthalene	mg/kg	0.1	<0.1	-	-
			Acenaphthylene	mg/kg	0.1	0.4	4	89
			Acenaphthene	mg/kg	0.1	<0.1	4	86
			Fluorene	mg/kg	0.1	0.2	-	-
			Phenanthrene	mg/kg	0.1	1.8	4	87
			Anthracene	mg/kg	0.1	0.7	4	80
			Fluoranthene	mg/kg	0.1	2.6	4	89
			Pyrene	mg/kg	0.1	2.7	4	71
			Benzo(a)anthracene	mg/kg	0.1	1.4	-	-
			Chrysene	mg/kg	0.1	1.2	-	-
			Benzo(b&j)fluoranthene	mg/kg	0.1	1.7	-	-
			Benzo(k)fluoranthene	mg/kg	0.1	0.7	-	-
			Benzo(a)pyrene	mg/kg	0.1	1.5	4	95
			Indeno(1,2,3-cd)pyrene	mg/kg	0.1	0.9	-	-
			Dibenzo(ah)anthracene	mg/kg	0.1	0.2	-	-
			Benzo(ghi)perylene	mg/kg	0.1	1.0	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	2.2	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	2.2	-	-
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	2.2	-	-
			Total PAH (18)	mg/kg	0.8	17	-	-
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.4	-	88
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	-	88
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.5	-	90

Total Recoverable Elements in Soil/Waste Solids/Materials by ICPOES

Method: ME-(AU)-[ENV]AN040/AN320

QC Sample	Sample Number	Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178897.003	LB147742.004	Arsenic, As	mg/kg	3	51	3.60216873678	50	95
		Cadmium, Cd	mg/kg	0.3	49	0.12115962115	50	99
		Chromium, Cr	mg/kg	0.3	55	7.96391509853	50	94
		Copper, Cu	mg/kg	0.5	160	05.2224709917	50	104
		Nickel, Ni	mg/kg	0.5	59	5.96511008049	50	87
		Lead, Pb	mg/kg	1	64	35.5743287666	50	58 ④
		Zinc, Zn	mg/kg	0.5	91	34.7548287932	50	72
SE178910.006	LB147743.004	Arsenic, As	mg/kg	3	51	13	50	77
		Cadmium, Cd	mg/kg	0.3	48	<0.3	50	95
		Chromium, Cr	mg/kg	0.3	57	8.0	50	97
		Copper, Cu	mg/kg	0.5	77	26	50	101
		Nickel, Ni	mg/kg	0.5	61	25	50	73
		Lead, Pb	mg/kg	1	140	58	50	169 ④
		Zinc, Zn	mg/kg	0.5	150	100	50	107

TRH (Total Recoverable Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN403

QC Sample	Sample Number		Parameter	Units	LOR	Original	Spike	Recovery%
SE178910.005	LB147632.031		TRH C10-C14	mg/kg	20	<20	40	90
			TRH C15-C28	mg/kg	45	97	40	138
			TRH C29-C36	mg/kg	45	92	40	100
			TRH C37-C40	mg/kg	100	<100	-	-
			TRH C10-C36 Total	mg/kg	110	190	-	-
			TRH C10-C40 Total (F bands)	mg/kg	210	<210	-	-
		TRH F Bands	TRH >C10-C16	mg/kg	25	<25	40	108
			TRH >C10-C16 - Naphthalene (F2)	mg/kg	25	<25	-	-
			TRH >C16-C34 (F3)	mg/kg	90	160	40	150 ⑧
			TRH >C34-C40 (F4)	mg/kg	120	<120	-	-

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

VOC's in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178849.003	LB147606.026	Monocyclic	Benzene	mg/kg	0.1		0.01	2.9	67
		Aromatic	Toluene	mg/kg	0.1		0	2.9	64
			Ethylbenzene	mg/kg	0.1		0	2.9	65
			m/p-xylene	mg/kg	0.2		0	5.8	83
			o-xylene	mg/kg	0.1		0	2.9	77
		Polycyclic	Naphthalene	mg/kg	0.1		0.01	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-		4.95	-	81
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-		4.76	-	81
			d8-toluene (Surrogate)	mg/kg	-		4.82	-	88
			Bromofluorobenzene (Surrogate)	mg/kg	-		3.58	-	118
		Totals	Total Xylenes	mg/kg	0.3		0	-	-
			Total BTEX	mg/kg	0.6		0.01	-	-
SE178991.001	LB147614.004	Monocyclic	Benzene	mg/kg	0.1	2.3	<0.1	2.9	79
		Aromatic	Toluene	mg/kg	0.1	2.4	<0.1	2.9	82
			Ethylbenzene	mg/kg	0.1	2.3	<0.1	2.9	79
			m/p-xylene	mg/kg	0.2	4.6	<0.2	5.8	79
			o-xylene	mg/kg	0.1	2.3	<0.1	2.9	80
		Polycyclic	Naphthalene	mg/kg	0.1	0.7	0.2	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.7	3.8	-	114
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.6	4.9	-	92
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.3	-	84
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.5	3.9	-	90
		Totals	Total Xylenes	mg/kg	0.3	6.9	<0.3	-	-
			Total BTEX	mg/kg	0.6	14	<0.6	-	-

VOCs in Water

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178919.024	LB147735.024	Monocyclic	Benzene	µg/L	0.5	48	0.14	45.45	105
		Aromatic	Toluene	µg/L	0.5	54	0.1	45.45	119
			Ethylbenzene	µg/L	0.5	47	0.06	45.45	104
			m/p-xylene	µg/L	1	100	0.09	90.9	112
			o-xylene	µg/L	0.5	52	0.03	45.45	115
		Polycyclic	Naphthalene	µg/L	0.5	56	0.12	-	-
		Surrogates	Dibromofluoromethane (Surrogate)	µg/L	-	4.2	5.9	-	85
			d4-1,2-dichloroethane (Surrogate)	µg/L	-	4.2	5.63	-	84
			d8-toluene (Surrogate)	µg/L	-	4.5	5	-	89
			Bromofluorobenzene (Surrogate)	µg/L	-	5.4	4.89	-	108

Volatile Petroleum Hydrocarbons in Soil

Method: ME-(AU)-[ENV]AN433

QC Sample	Sample Number		Parameter	Units	LOR	Result	Original	Spike	Recovery%
SE178849.003	LB147606.026		TRH C6-C10	mg/kg	25		0	24.65	85
			TRH C6-C9	mg/kg	20		0	23.2	79
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-		4.95	-	81
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-		4.76	-	81
			d8-toluene (Surrogate)	mg/kg	-		4.82	-	88
			Bromofluorobenzene (Surrogate)	mg/kg	-		3.58	-	118
		VPH F	Benzene (F0)	mg/kg	0.1		0.01	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25		-0.01	7.25	113
SE178991.001	LB147614.004		TRH C6-C10	mg/kg	25	<25	<25	24.65	89
			TRH C6-C9	mg/kg	20	22	<20	23.2	94
		Surrogates	Dibromofluoromethane (Surrogate)	mg/kg	-	5.7	3.8	-	114
			d4-1,2-dichloroethane (Surrogate)	mg/kg	-	4.6	4.9	-	92
			d8-toluene (Surrogate)	mg/kg	-	4.2	4.3	-	84
			Bromofluorobenzene (Surrogate)	mg/kg	-	4.5	3.9	-	90
		VPH F	Benzene (F0)	mg/kg	0.1	2.3	<0.1	-	-
		Bands	TRH C6-C10 minus BTEX (F1)	mg/kg	25	<25	<25	7.25	110

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Wed 9/5/2018
Report Due	Wed 16/5/2018
SGS Reference	**SE178910**

SUBMISSION DETAILS

This is to confirm that 31 samples were received on Wednesday 9/5/2018. Results are expected to be ready by COB Wednesday 16/5/2018.
Please quote SGS reference SE178910 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	29 Soil, 2 Water
Date documentation received	9/5/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Standard		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

DUP1A and DUP2A have been forwarded to Eurofins.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx.
Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
001	SP03-0.3	29	26	11	7	10	12	8
002	SP03-0.6	-	26	-	-	-	-	-
003	SP03-0.9	-	-	-	7	-	-	-
004	SP04-0.3	-	-	-	7	-	-	-
005	SP04-0.6	29	26	11	7	10	12	8
006	SP04-0.9	-	26	-	-	-	-	-
007	SP05-0.3	-	26	-	-	-	-	-
008	SP05-0.6	-	26	-	7	-	-	-
009	SP05-0.9	29	-	11	7	10	12	8
010	SP06-0.3	29	-	11	7	10	12	8
011	SP06-0.6	-	26	-	-	-	-	-
012	SP06-0.9	-	26	-	7	-	-	-
013	SP07-0.3	-	26	-	-	-	-	-
014	SP07-0.6	29	26	11	7	10	12	8
015	SP07-1.0	-	-	-	7	-	-	-
016	SP08-0.3	-	-	-	7	-	-	-
017	SP08-0.6	-	26	-	-	-	-	-
018	SP08-0.9	29	26	11	7	10	12	8
019	SP09-0.3	29	26	11	7	10	12	8
020	SP09-0.6	-	26	-	-	-	-	-
021	SP09-0.9	-	-	-	7	-	-	-
022	SP10-0.3	-	-	-	7	-	-	-
023	SP10-0.6	29	26	11	7	10	12	8
024	SP10-0.9	-	26	-	-	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	OC Pesticides in Soil	PAH (Polynuclear Aromatic Hydrocarbons) In Soil	PCBs in Soil	Total Recoverable Elements in Soil/Waste	TRH (Total Recoverable Hydrocarbons) in Soil	VOC's in Soil	Volatile Petroleum Hydrocarbons in Soil
025	SP11-0.3	-	26	-	7	-	-	-
026	SP11-0.6	-	26	-	-	-	-	-
027	SP11-0.9	29	-	11	7	10	12	8
028	DUP1	-	-	-	7	-	-	-
029	DUP2	-	-	-	7	-	-	-

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Gravimetric Determination of Asbestos in Soil	Mercury in Soil	Moisture Content
001	SP03-0.3	-	1	1
002	SP03-0.6	9	-	1
003	SP03-0.9	9	1	1
004	SP04-0.3	9	1	1
005	SP04-0.6	-	1	1
006	SP04-0.9	9	-	1
007	SP05-0.3	9	-	1
008	SP05-0.6	9	1	1
009	SP05-0.9	-	1	1
010	SP06-0.3	-	1	1
011	SP06-0.6	9	-	1
012	SP06-0.9	9	1	1
013	SP07-0.3	9	-	1
014	SP07-0.6	-	1	1
015	SP07-1.0	9	1	1
016	SP08-0.3	9	1	1
017	SP08-0.6	9	-	1
018	SP08-0.9	-	1	1
019	SP09-0.3	-	1	1
020	SP09-0.6	9	-	1
021	SP09-0.9	9	1	1
022	SP10-0.3	9	1	1
023	SP10-0.6	-	1	1
024	SP10-0.9	9	-	1

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Gravimetric Determination of Asbestos in Soil	Mercury in Soil	Moisture Content	VOCs in Water
025	SP11-0.3	9	1	1	-
026	SP11-0.6	9	-	1	-
027	SP11-0.9	-	1	1	-
028	DUP1	-	1	1	-
029	DUP2	-	1	1	-
030	TRIP BLANK	-	-	-	12
031	TRIP SPIKE	-	-	-	12

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: [Untitled].pdf page: 1 SGS Ref: SE178910_COC

SGS

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	SGS – P1185 Eurofins – P1186
	Seven Hills NSW	Results Required By:	5 day turnaround
Contact Name:	Craig Cowper	Telephone:	0407 989 885
		Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP03-0.3	9/5/2018	1		X	Ice	2	X	X	X	X	X			
SP03-0.6	9/5/2018	2		X	Ice	2		X				X		
SP03-0.9	9/5/2018	3		X	Ice	2					X	X		
SP04-0.3	9/5/2018	4		X	Ice	2					X	X		
SP04-0.6	9/5/2018	5		X	Ice	2	X	X	X	X	X			
SP04-0.9	9/5/2018	6		X	Ice	2		X				X		
SP05-0.3	9/5/2018	7		X	Ice	2		X				X		
SP05-0.6	9/5/2018	8		X	Ice	2		X			X	X		
SP05-0.9	9/5/2018	9		X	Ice	2	X		X	X	X			
SP06-0.3	9/5/2018	10		X	Ice	2	X		X	X	X			

SGS EHS Alexandria Laboratory

SE178910 COC

Received: 09 – May – 2018

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
Contact Name:	Craig Cowper	Telephone:	0407 989 885
		Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP06-0.6	9/5/2018	11		X	Ice	2		X				X		
SP06-0.9	9/5/2018	12		X	Ice	2		X			X	X		
SP07-0.3	9/5/2018	13		X	Ice	2		X				X		
SP07-0.6	9/5/2018	14		X	Ice	2	X	X	X	X	X			
SP07-1.0	9/5/2018	15		X	Ice	2					X	X		
SP08-0.3	9/5/2018	16		X	Ice	2					X	X		
SP08-0.6	9/5/2018	17		X	Ice	2		X				X		
SP08-0.9	9/5/2018	18		X	Ice	2	X	X	X	X	X			
SP09-0.3	9/5/2018	19		X	Ice	2	X	X	X	X	X			
SP09-0.6	9/5/2018	20		X	Ice	2		X				X		

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes / No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes / No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	BUILDING MATERIAL	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX
SP09-0.9	9/5/2018	21		X	Ice	2					X	X		
SP10-0.3	9/5/2018	22		X	Ice	2					X	X		
SP10-0.6	9/5/2018	23		X	Ice	2	X	X	X	X	X			
SP10-0.9	9/5/2018	24		X	Ice	2		X				X		
SP11-0.3	9/5/2018	25		X	Ice	2		X			X	X		
SP11-0.6	9/5/2018	26		X	Ice	2		X				X		
SP11-0.9	9/5/2018	27		X	Ice	2	X		X	X	X			
DUP1	9/5/2018	28		X	Ice	1					X			
DUP1A	9/5/2018			X	Ice	1					X			
DUP2	9/5/2018	29		X	Ice	1					X			

Send to Eurofins

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: (Yes) No	Temperature: Ambient / (Chilled)	Sample Cooler Sealed: (Yes) No	Laboratory Quotation No:
	Comments:		

CHAIN OF CUSTODY & ANALYSIS REQUEST

Page __4__ of __4__

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 – Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	
	Seven Hills NSW	Results Required By:	
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	c.cowper@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	WATER	SOIL	PRESERVATIVE	NO OF CONTAINERS	TRH / BTEX	PAH	OCP	PCB	Metals (8)	Asbestos (0.001%)	Asbestos ID (Build Mat)	BTEX								
DUP2A	9/5/2018			X	Ice	1					X											Send To Eurofins
TRIP-BLANK	9/5/2018	30	X		Ice	1								X								
TRIP-SPIKE	9/5/2018	31	X		Ice	1								X								

Relinquished By: Craig Cowper	Date/Time: 09/05/2018 @ 1200hrs	Received By: A. Odisho	Date/Time 9/5/18 @ 2:50pm
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: (Yes) No	Temperature: Ambient / (Chilled)	Sample Cooler Sealed: (Yes) No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs - Additional**
Order Number	**P1205**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910A R0**
Date Received	17/5/2018
Date Reported	21/5/2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

SIGNATORIES

Akheeqar Beniameen
Chemist

Bennet Lo
Senior Organic Chemist/Metals Chemist

Teresa Nguyen
Organic Chemist

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TCLP (Toxicity Characteristic Leaching Procedure) for Organics/SVOC [AN006] Tested: 18/5/2018

PARAMETER	UOM	LOR	SP11-0.6 SOIL - 9/5/2018 SE178910A.026
pH 1:20	pH Units	-	7.7
pH 1:20 plus HCL	pH Units	-	1.8
Extraction Solution Used	No unit	-	1
Mass of Sample Used*	g	-	25
Volume of ExtractionSolution Used*	mL	-	500
pH TCLP after 18 hours	pH Units	-	5.0

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract [AN420] Tested: 18/5/2018

PARAMETER	UOM	LOR	SP11-0.6 SOIL - 9/5/2018 SE178910A.026
Benzo(a)pyrene	µg/L	0.1	<0.1

TCLP (Toxicity Characteristic Leaching Procedure) for Metals [AN006] Tested: 18/5/2018

PARAMETER	UOM	LOR	SP06-0.9 SOIL - 9/5/2018 SE178910A.012
pH 1:20	pH Units	-	8.1
pH 1:20 plus HCL	pH Units	-	1.7
Extraction Solution Used	No unit	-	1
Mass of Sample Used*	g	-	13
Volume of ExtractionSolution Used*	mL	-	250
pH TCLP after 18 hours	pH Units	-	5.1

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Metals in TCLP Extract by ICPOES [AN320] Tested: 21/5/2018

PARAMETER	UOM	LOR	SP06-0.9 SOIL - 9/5/2018 SE178910A.012
Lead, Pb	mg/L	0.02	0.02

METHOD	METHODOLOGY SUMMARY
AN006	Contaminants of interest in a waste material are leached out of the waste with a selected leaching solution under controlled conditions. The ratio of sample to extraction fluid is 100g to 2L (1 to 20 by mass). The concentration of each contaminant of interest is determined in the leachate by appropriate methods after separation from the sample by filtering. Base on USEPA 1311.
AN006	Extraction Fluid #1: This fluid is made by combining 128.6mL of dilute sodium hydroxide solution and 11.5mL glacial acetic acid with water and diluting to a volume of 2 litres. The pH of this fluid should be 4.93 ± 0.05.
AN006	Extraction Fluid #2: This fluid is made by diluting 5.7mL glacial acetic acid with water to a volume of 1 litre. The pH of this fluid should be 2.88 ± 0.05.
AN020	Unpreserved water sample is filtered through a 0.45µm membrane filter and acidified with nitric acid similar to APHA3030B.
AN320	Metals by ICP-OES: Samples are preserved with 10% nitric acid for a wide range of metals and some non-metals. This solution is measured by Inductively Coupled Plasma. Solutions are aspirated into an argon plasma at 8000-10000K and emit characteristic energy or light as a result of electron transitions through unique energy levels. The emitted light is focused onto a diffraction grating where it is separated into components .
AN320	Photomultipliers or CCDs are used to measure the light intensity at specific wavelengths. This intensity is directly proportional to concentration. Corrections are required to compensate for spectral overlap between elements . Reference APHA 3120 B.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).

FOOTNOTES

*	NATA accreditation does not cover the performance of this service.	-	Not analysed.	UOM	Unit of Measure.
		NVL	Not validated.	LOR	Limit of Reporting.
**	Indicative data, theoretical holding time exceeded.	IS	Insufficient sample for analysis.	↑↓	Raised/lowered Limit of Reporting.
		LNR	Sample listed, but not received.		

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calculated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

STATEMENT OF QA/QC PERFORMANCE

SE178910A R0

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs - Additional**
Order Number	**P1205**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE178910A R0**
Date Received	17 May 2018
Date Reported	21 May 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met (within the SGS Alexandria Environmental laboratory).

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	2 Soil
Date documentation received	17/5/2018@10.40	Type of documentation received	Email
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Two Days		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE178910A R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Metals in TCLP Extract by ICPOES

Method: ME-(AU)-[ENV]AN320

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP06-0.9	SE178910A.012	LB148191	09 May 2018	17 May 2018	05 Nov 2018	21 May 2018	05 Nov 2018	21 May 2018

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract

Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP11-0.6	SE178910A.026	LB148107	09 May 2018	17 May 2018	30 May 2018	18 May 2018	27 Jun 2018	21 May 2018

TCLP (Toxicity Characteristic Leaching Procedure) for Metals

Method: ME-(AU)-[ENV]AN006

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP06-0.9	SE178910A.012	LB148149	09 May 2018	17 May 2018	05 Nov 2018	18 May 2018	05 Nov 2018	21 May 2018

TCLP (Toxicity Characteristic Leaching Procedure) for Organics/SVOC

Method: ME-(AU)-[ENV]AN006

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP11-0.6	SE178910A.026	LB148150	09 May 2018	17 May 2018	23 May 2018	18 May 2018	23 May 2018	21 May 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract — **Method: ME-(AU)-[ENV]AN420**

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP11-0.6	SE178910A.026	%	40 - 130%	62
d14-p-terphenyl (Surrogate)	SP11-0.6	SE178910A.026	%	40 - 130%	76
d5-nitrobenzene (Surrogate)	SP11-0.6	SE178910A.026	%	40 - 130%	50

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Metals in TCLP Extract by ICPOES — Method: ME-(AU)-[ENV]AN320

Sample Number	Parameter	Units	LOR	Result
LB148191.001	Lead, Pb	mg/L	0.02	<0.02

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract — Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB148107.001		Benzo(a)pyrene	µg/L	0.1	<0.1
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	68
		2-fluorobiphenyl (Surrogate)	%	-	72
		d14-p-terphenyl (Surrogate)	%	-	84

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract — Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE179257.003	LB148107.020		Benzo(a)pyrene	µg/L	0.1	<0.1	0.01	200	0
		Surrogates	d5-nitrobenzene (Surrogate)	µg/L	-	0.2	0.26	30	15
			2-fluorobiphenyl (Surrogate)	µg/L	-	0.3	0.32	30	13
			d14-p-terphenyl (Surrogate)	µg/L	-	0.4	0.38	30	3

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

Metals in TCLP Extract by ICPOES — Method: ME-(AU)-[ENV]AN320

Sample Number	Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB148191.002	Lead, Pb	mg/L	0.02	2.1	2	80 - 120	105

PAH (Polynuclear Aromatic Hydrocarbons) in TCLP Extract — Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB148107.002		Benzo(a)pyrene	µg/L	0.1	38	40	60 - 140	94
	Surrogates	d5-nitrobenzene (Surrogate)	µg/L	-	0.3	0.5	40 - 130	64
		2-fluorobiphenyl (Surrogate)	µg/L	-	0.3	0.5	40 - 130	64
		d14-p-terphenyl (Surrogate)	µg/L	-	0.3	0.5	40 - 130	68

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spikes were required for this job.

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE178910A

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 - Jorden Springs - Additional**
Order Number	**P1185**
Samples	31

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Thu 17/5/2018
Report Due	Mon 21/5/2018
SGS Reference	**SE178910A**

SUBMISSION DETAILS

This is to confirm that 31 samples were received on Thursday 17/5/2018. Results are expected to be ready by COB Monday 21/5/2018. Please quote SGS reference SE178910A when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	2 Soil
Date documentation received	17/5/2018@10.40	Type of documentation received	Email
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	6.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Two Days		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910A

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs - Additional

SUMMARY OF ANALYSIS

No.	Sample ID	Metals in TCLP Extract by ICPOES	TCLP (Toxicity Characteristic Leaching
012	SP06-0.9	1	6

CONTINUED OVERLEAF

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE178910A

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 - Jorden Springs - Additional

SUMMARY OF ANALYSIS

No.	Sample ID	PAH (Polynuclear Aromatic Hydrocarbons) in TCLP	TCLP (Toxicity Characteristic Leaching
026	SP11-0.6	4	6

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: [Untitled].pdf page: 1 SGS Ref: SE178910A_COC

RE: Report Job SE178910, your reference 7161 - Jordan Springs, ADDITIONAL ANALYSIS

Craig Cowper <c.cowper@allgeo.com.au>

Thu 17/05/2018 10:40 AM

To: AU.SampleReceipt.Sydney (Sydney) <AU.SampleReceipt.Sydney@sgs.com>; AU.Environmental.Sydney (Sydney) <AU.Environmental.Sydney@sgs.com>;

Morning

Can you please arrange the following additional analysis, on 2 day turnaround.

12 SP06-0.9 Pb TCLP
20 SP11-0.6 Benzo(a)pyrene TCLP

SGS EHS Alexandria Laboratory
SE178910A COC
Received: 17 – May – 2018

Order number P1205

Cheers
Craig Cowper
Principal Environmental Scientist
Board Chair/Director – Australasian Land & Groundwater Association
Mobile: 0407 989 885 | Email: c.cowper@allgeo.com.au

Alliance Geotechnical Pty Ltd
Engineering | Environmental | Testing
Your On-Site Geotechnical & Environmental Specialists

-----Original Message-----
From: AU.Environmental.Sydney@SGS.com <AU.Environmental.Sydney@SGS.com>
Sent: Wednesday, 16 May 2018 4:04 PM
To: Craig Cowper <c.cowper@allgeo.com.au>; enviro <enviro@allgeo.com.au>
Subject: Report Job SE178910, your reference 7161 - Jorden Springs, order number P1185

Hi Craig

Please find attached the report for SGS job SE178910, your reference 7161 - Jorden Springs, order number P1185.

-IMPORTANT INFORMATION ABOUT YOUR REPORT- To align with NEPM 1999 (2013), SGS Environmental has changed the way Silica Gel Clean-up of TRH extracts is reported. TPH Silica Gel has now become TRH – Silica.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Manage the earth, eliminate the risk

Alliance Geotechnical

Engineering | Environmental | Testing

Report Type:
Site Validation Report

Project Address:
Jordan Springs Boulevard, Jordan Springs, NSW
Lot 3991 in DP1190132

Client Name:
LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust

11 July 2018 2018
Report No: 7161-ER-1-6

We give you the right information to make the right decisions

Alliance Geotechnical Pty Ltd | ABN: 62 106 885 214

PO Box 275, Seven Hills NSW 1730 - 10 Welder Road, Seven Hills, NSW

Phone: 1800 288 188 - Office Email: office@allgeo.com.au - Web: allgeo.com.au

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

DOCUMENT CONTROL

Revision	Date	Author	Reviewer
Rev 0	11 July 2018	Jacob Walker / Craig Cowper	Craig Cowper

EXECUTIVE SUMMARY

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust to prepare a site validation report (SVR) for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- the site is defined as Lot 3991 in DP1190132;
- the site is proposed for a medium density residential land use development;
- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting, subject to implementation of a contamination management plan (CMP);
- contamination assessments undertake by AG in 2018 identified 10 stockpiles on site, that presented a potentially unacceptable human health exposure risk, in the context of a residential land use setting;
- the stockpiles are to be removed (by others) from site;
- a validation report is required to assess the contamination status of the site following removal of the stockpiles, for inclusion with the development application to Council.

The objectives of this project are to:

- assess the potential for contamination to be present following removal of the stockpiles;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting; and
- provide recommendations for further investigation, management and/or remediation (if warranted).

Alliance Geotechnical undertook the following scope of works to address the project objective:

- desktop review;
- fieldwork;
- laboratory analysis; and
- data assessment and reporting.

Stockpile removal works were undertaken on 5, 6 and 9 July 2018. Stockpiles SP02 and SP03 to SP11 were excavated using a hydraulic excavator and removed for offsite disposal. The stockpiles were removed down their respective bases.

A visual inspection and soil validation samples were collected from relevant stockpile removal locations. Soil samples were subjected to laboratory analysis for the relevant contaminants of potential concern.

The concentrations of naphthalene, benzo(a)pyrene TEQ and total PAH in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

There was no visual evidence observed of potential asbestos containing materials on the surface of the footprints of former stockpiles SP02 (AEC02) and SP03 to SP11 (AEC03).

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Records provided by the client indicate that 152.88 tonnes of soil were reported as being removed for offsite.

Based on a review of the historical contamination assessment reports provided, observations made on site by AG, and an assessment of validation laboratory analytical data in the context of the proposed low density residential land use setting, AG makes the following conclusions:

- the contamination status of the broader site is considered unlikely to have materially changed since the issue of a site audit statement in 1999;
- stockpiles SP02 and SP03 to SP11 have been adequately removed from site;
- the site is suitable for the proposed land use setting (in the context of land contamination), subject to ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the site.

This report must be read in conjunction with the limitations set out in **Section 12.**

TABLE OF CONTENTS

DOCUMENT CONTROL i
EXECUTIVE SUMMARY ii

1. INTRODUCTION 1
1.1. Background 1
1.2. Objectives 1
1.3. Scope of Work 1
2. SITE IDENTIFICATION 2
3. GEOLOGY, ACID SULPHATE SOILS, TOPOGRAPHY AND HYDROGEOLOGY 3
3.1. Geology 3
3.2. Acid Sulphate Soils 3
3.3. Topography 3
3.4. Hydrogeology 3
4. PREVIOUS CONTAMINATION ASSESSMENTS 4
4.1. URS (2008) 4
4.2. Douglas Partners (2017) 5
4.3. AG (2018a) 6
4.4. AG (2018b) 6
4.5. AG (2018c) 8
5. CONCEPTUAL SITE MODEL 9
5.1. Areas of Environmental Concern and Contaminants of Potential Concern 9
5.2. Land Use Setting 9
5.3. Direct Contact – Human Health 9
5.4. Inhalation / Vapour Intrusion – Human Health 9
5.5. Management Limits for Petroleum Hydrocarbon Compounds 9
5.6. Aesthetics – Human Health 10
5.7. Terrestrial Ecosystems 10
6. DATA QUALITY OBJECTIVES 11
6.1. Step 1: State the problem 11
6.2. Step 2: Identify the decision/goal of the study 11
6.3. Step 3: Identify the information inputs 11
6.4. Step 4: Define the boundaries of the study 12
6.5. Step 5: Develop the analytical approach (or decision rule) 12
6.6. Step 6: Specify the performance or acceptance criteria 13

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

6.7. Step 7: Develop the plan for obtaining data 16
6.7.1. Sampling Point Density and Locations 16
6.7.2. Sampling Methodology 16
6.7.3. Identification, Storage and Handling of Samples 17
6.7.4. Decontamination 17
6.7.5. Laboratory Selection 17
6.7.6. Laboratory Analytical Schedule 17
6.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting 18
7. STOCKPILE REMOVAL WORKS SUMMARY 19
7.1. Notifications 19
7.2. AEC02 – Removal of Stockpile SP02 19
7.3. AEC03 – Removal of Stockpiles SP03 to SP11 20
7.4. Waste Disposal 21
8. LABORATORY 23
9. DATA QUALITY INDICATOR ASSESSMENT 24
9.1. Completeness 24
9.2. Comparability 24
9.3. Representativeness 25
9.4. Precision 26
9.5. Accuracy 26
10. DISCUSSION 28
10.1. Human Health - Direct Contact 28
10.1.1. PAH 28
10.1.2. Asbestos 28
11. CONCLUSIONS 29
12. STATEMENT OF LIMITATIONS 30
13. REFERENCES 31

FIGURES
Figure 1 Site Location
Figure 2 Site Layout
Figure 3 Stockpile Layout Plan
Figure 4 Sampling Point Layout Plan

TABLES
Table LAR1 Laboratory Analytical Results - Soils

APPENDICES
A Waste

B Laboratory
C Previous Reports
D WorkCover NSW

LIST OF ABBREVIATIONS

A list of the common abbreviations used throughout this report is provided below:

ACM	Asbestos Containing Material
AEC	Area of Environmental Concern
AG	Alliance Geotechnical Pty Ltd
AHD	Australian Height Datum
BTEX	Benzene, toluene, ethyl benzene, xylenes
COPC	Contaminant of Potential Concern
CSM	Conceptual Site Model
DP	Deposited Plan
DSI	Detailed Site Investigation
EPA	Environment Protection Authority
LOR	Limit of reporting
m	metres
m^2	square metres
m bgs	metres below ground surface
mg/kg	milligrams per kilogram
NSW	New South Wales
OCP	Organochlorine pesticides
PAH	Polycyclic aromatic hydrocarbons
PCB	Polychlorinated biphenyls
PSI	Preliminary Site Investigation
RAP	Remedial Action Plan
RPD	Relative percentage difference
SVR	Site Validation Report
TRH	Total recoverable hydrocarbons
UCL	Upper Confidence Limit

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

1. INTRODUCTION

1.1. Background

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as trustee of LLRL Management Services Trust to prepare a site validation report (SVR) for a parcel of land located at Jordan Springs Boulevard, Jordan Springs, NSW (refer **Figure 1** with the 'site' boundaries outlined in **Figure 2**).

AG has the following project appreciation:

- the site is defined as Lot 3991 in DP1190132;
- the site is proposed for a medium density residential land use development;
- the site was the subject of a site audit statement in 1999, which confirmed the site was suitable for a residential land use setting, subject to implementation of a contamination management plan (CMP);
- contamination assessments undertake by AG in 2018 identified 10 stockpiles on site, that presented a potentially unacceptable human health exposure risk, in the context of a residential land use setting;
- the stockpiles are to be removed (by others) from site;
- a validation report is required to assess the contamination status of the site following removal of the stockpiles, for inclusion with the development application to Council.

1.2. Objectives

The objectives of this project are to:

- assess the potential for contamination to be present following removal of the stockpiles;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting; and
- provide recommendations for further investigation, management and/or remediation (if warranted).

1.3. Scope of Work

Alliance Geotechnical undertook the following scope of works to address the project objective:

- desktop review;
- fieldwork;
- laboratory analysis; and
- data assessment and reporting.

2. SITE IDENTIFICATION

The site is identified as Lot 3991 in DP1190132.

The approximate geographic coordinates of the middle of the site, inferred from Google Earth were 33°43'45" S and 150°43'23" E.

The locality of the site is set out in **Figure 1**.

The general layout and boundary of the site is set out in **Figure 2**.

The site covers an area of approximately 3.633 hectares.

A copy of a detail and level survey is presented in **Appendix A**.

3. GEOLOGY, ACID SULPHATE SOILS, TOPOGRAPHY AND HYDROGEOLOGY

3.1. Geology

A review of the Sydney 1:100,000 Geological Series Sheet 9130 (Edition 1) 1983, Indicated that the site is likely to be underlain by Middle Triassic, Wianamatta Group, Bringelly Shale, defined as shale, carbonaceous claystone, claystone, laminite, fine to medium grained lithic sandstone, rare coal and tuff.

3.2. Acid Sulphate Soils

The Australian Soil Resource Information System website (http://www.asris.csiro.au/mapping/viewer.htm) indicates that the site is in an area mapped as **'Extremely Low Probability / Low Confidence', with respect to acid sulfate soils.**

Further assessment of acid sulphate soils in the context of this project is considered by AG as not warranted.

3.3. Topography

The site topography was generally flat, with some minor localised undulations, and some south east facing slopes.

A detail and level survey indicated that the site surface was located at an elevation of approximately 42m Australian Height Datum (AHD) in the north west, to approximately 35m AHD in the south east.

3.4. Hydrogeology

Surface water courses proximal to the site include an unnamed dam/lake located adjacent to central western boundary of the site, and a small dam located adjacent to the eastern boundary of the site. The Penrith Lakes precinct is located approximately 2.5km to the west of the site, and the Nepean River is located approximately 4km to the west of the site. South Creek is located approximately 3.6km to the east of the site, with minor tributaries to South Creek located between the site and South Creek.

4. PREVIOUS CONTAMINATION ASSESSMENTS

The following reports were considered during the undertaking of this project:

- URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.
- Douglas Partners 2017, 'Site Walkover Contamination Report, Proposed Lots 3989, 3990 and 3991, DP1190132, Jordan Springs, NSW', dated 21 September 2017, ref: 92245.00.
- AG 2018a, 'Supplementary Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 20 April 2018, ref: 7161-ER-1-3.
- AG 2018b, 'Stockpile Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 17 May 2018, ref: 7161-ER-1-4.
- AG 2018c, 'Waste Classification, Stockpiles SP02 to SP11, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 22 May 2018, ref: 7161-ER-1-5.

A summary of these reports is presented in **Section 4.1 to 4.5**. A copy of URS (2008) and Douglas Partners (2017) is presented in **Appendix C.**

4.1. URS (2008)

The objective of URS (2008) was to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the nature environment.

URS (2008) was prepared for a parcel of land referred to as the Western Precinct. AG understands the Western Precinct fell within the former Australia Defence Industries (ADI) facility in St Marys.

An assessment by AG of Figure 2 in URS (2008) indicated that the subject site falls within the south western corner of the Western Precinct.

Section 1.2 of URS (2008) noted that the majority of the Western Precinct was assessed by a NSW EPA Accredited Site Auditor (Site Auditor), to pose a negligible risk to the public or the environment with regard to chemical contamination and/or explosive ordnance. A number of site audit statements (SASs) for parcels of land across the Western Precinct were included in Appendix A of URS (2008).

URS (2008) noted that:

- unexpected finds may occur in areas which, although searched extensively, contain remnant materials which were obscured by the local topography, the type of surface cover (e.g. building) or at a depth preventing detection; and
- the Site Auditor considered that, while explosive ordnance may be uncovered during earthworks, it is unlikely that these will present an unacceptable risk provided appropriate procedures for the safe handling and disposal of such material are adopted.

A copy of a Site Audit Statement (SAS), prepared by the Site Auditor (Mr Christopher Kidd of HLA-Envirosciences), dated 7 June 1999, reference CHK001/1 was presented in Appendix A of URS (2008). An assessment of the SAS by AG indicated that the subject site fell within the boundaries of the land that SAS CHK001/1 applied to. AG also found that the SAS certified that land as suitable for residential, including substantial vegetable garden and poultry, residential with minimal, opportunity for soil access including units, day care centre, preschool, primary schools, secondary school, park, recreational open space, playing field and commercial / industrial land use settings, subject to a number of conditions, including:

- the exclusion of specific parcels of land, as marked on the plan attached to the SAS; and
- an appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, being lodged prior to the commencement of development earthworks.

AG assessed the plan attached to the SAS and considered that:

- the subject site did not appear to fall within the shaded areas excluded from SAS CHK001/1; and
- land located immediately adjacent to the subject site, did not appear to fall within the shaded areas excluded from SAS CHK001/1.

4.2. Douglas Partners (2017)

The objective of Douglas Partners (2017) was to identify additional activities or sources that have occurred/appeared on site since the sale of the property in June 2013.

The scope of work undertaken to address the project objective included a document review and site walkover.

Douglas Partners (2017) reported the following conclusions, considered relevant to the subject Lot 3990 and Lot 3991:

- Limited review of historical aerial imagery and site walkover completed on 19 September 2017, identified the following potential sources appearing onsite in recent years that have the potential for contamination of the site:
    - Five small stockpiles or soil observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark on Lot 3991. Given the small volume (15-20m^3) of the stockpiles, likely origins from bulk earthworks associated with the nearby carpark and observed contents, the soil within the stockpiles poses a low contamination risk to the site.

Douglas Partners (2017) recommended that:

- further investigations be completed within the soil stockpiles on Lot 3991, to confirm the absence/presence of contaminants of potential concern associated with fill of an unknown origin; and

the recommended further assessment should build on the information presented in Douglas Partners (2017) with reference to NEPC (1999) and should include intrusive investigation, sampling and analysis.

4.3. AG (2018a)

The objectives of this project were to:

- assess the potential for contamination to be present on the site as a result of past and current land use activities;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- limited soil sampling and laboratory analysis; and
- data assessment and reporting.

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG makes the following conclusions:

- the contamination status of the broader site is considered unlikely to have materially changed since the issue of a site audit statement in 1999;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable direct contact human health exposure risk;
- the concentrations of identified contaminants of potential concern in stockpile SP01 and SP02 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;
- stockpile SP01 (in AEC01) would be suitable (in the context of human health and land contamination) for beneficial reuse on site;
- the estimated concentration of bonded asbestos in soil detected in AEC02 (stockpile SP02), may present an unacceptable human health exposure risk and unacceptable aesthetics risk;
- chemical contaminants of concern, asbestos fines and friable asbestos in AEC03 (stockpiles SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11) require further investigation, to assess whether they may present an unacceptable human health exposure risk;
- the site could be made suitable for the proposed land use setting (in the context of land contamination), subject to:
    - management and/or remediation of bonded asbestos in stockpile SP02;
    - further assessment, management and/or remediation of potential unacceptable human health exposure risks in SP03, SP04, SP05, SP06, SP07, SP08, SP09, SP10 and SP11;
    - ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the sites; and

Further assessment, management and/or remediation planning works should be undertaken by a suitably experienced environmental consultant.

4.4. AG (2018b)

The objectives of this project were to:

- assess the nature and extent of contamination to be present in nine stockpiles on the site;
- provide advice on whether the stockpiles be suitable (in the context human health exposure risks) for the proposed land use setting;
- provide recommendations for further investigation, management and/or remediation (if warranted).

The scope of works undertaken to address the project objectives, included:

- a limited desktop review;
- a site walkover;
- stockpile soil sampling and laboratory analysis; and
- data assessment and reporting.

Based on AG's assessment of the desktop review information, fieldwork data and laboratory analytical data, in the context of the assessment objectives and current commercial / industrial land use setting, AG made the following conclusions:

- the concentrations of identified contaminants of potential concern in stockpile SP03 to SP11 are considered unlikely to present an unacceptable direct contact human health exposure risk, with the exception of benzo(a)pyrene TEQ in stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11;

- the concentrations of identified contaminants of potential concern in stockpiles SP03 to SP11 are considered unlikely to present an unacceptable inhalation / vapour intrusion human health exposure risk;

- the concentrations of bonded asbestos in soil in stockpiles SP03 to SP11 may present an unacceptable human health exposure risk;

- the visible presence of asbestos containing materials in SP03 to SP11 may present an unacceptable aesthetics risk; and

- management and/or remediation of stockpiles SP03 to SP11 is required.

Based on these conclusions, AG made the following recommendations:

- stockpiles SP03, SP06, SP07, SP08, SP09, SP10 and SP11 should be excavated, transported and disposed of to a suitably licensed landfill facility. The excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;

- stockpiles SP04 and SP05 could be either remediated to remove the identified bonded asbestos human health and aesthetics risks, or excavated, transported and disposed of to a suitably licensed landfill facility. The remediation and/or excavation and transportation works should be undertaken by a suitably licensed and experienced contractor, under an asbestos removal control plan;

- a waste classification should be prepared for materials proposed for offsite disposal, with reference to relevant NSW EPA waste classification guidelines. The waste classification should be prepared by a suitably experienced environmental consultant; and

a validation report should be prepared following removal and/or remedial works, that assesses whether the identified human health and aesthetics risks have been appropriate managed and/or remediated. The validation report should be prepared by a suitably experienced environmental consultant.

4.5. AG (2018c)

The objective of AG (2018c) was to assess the waste classification of stockpiles SP02 to SP11.

Based on AG's assessment of fieldwork observations and laboratory analytical data, and as of the date of this report, the material assessed was classified as GENERAL SOLID WASTE non-putrescible, managed as SPECIAL WASTE (asbestos).

5. CONCEPTUAL SITE MODEL

5.1. Areas of Environmental Concern and Contaminants of Potential Concern

The site history data collected and site walkover observations made were assessed within the objectives of this investigation and in the context of the proposed development works. That assessment identified areas of environmental concern (AEC) and contaminants of potential concern (COPC) which have the potential to be present on site. The AEC identified are presented in attached **Figure 3** and associated COPC are presented in **Table 5.1.**

Table 5.1: AEC and COPC

ID	Areas of Environmental Concern	Land Use Activity	Contaminants of Potential Concern
AEC02	Stockpile located in north eastern portion (<20m^3)	Uncontrolled filling	Asbestos
AEC03	Nine stockpiles located adjacent to western boundary (~10m^3 each)	Uncontrolled filling	Benzo(a)pyrene TEQ and asbestos

5.2. Land Use Setting

AG understands that the proposed development works includes a low density residential development.

Based on the proposed development works and guidance provided in Section 2.2 of NEPC (1999a), AG considers it reasonable to adopt the 'HIL A – residential with accessible soils' land use setting, for the purpose of assessing land contamination exposure risks.

5.3. Direct Contact – Human Health

The proposed land use setting is likely to include accessible soils. In these areas, it is considered that a direct contact exposure pathway may be complete.

5.4. Inhalation / Vapour Intrusion – Human Health

In order for a potentially unacceptable inhalation / vapour intrusion human health exposure risk to exist, a primary vapour source (e.g. underground storage tank) or secondary vapour source (e.g. significantly contaminated soil or groundwater).

The historical evidence reviewed indicated the concentrations of identified volatile contaminants of potential concern in the stockpiles did not present an unacceptable inhalation / vapour intrusion human health exposure risk, based on the proposed land use setting.

Further assessment of this exposure pathway is considered not warranted.

5.5. Management Limits for Petroleum Hydrocarbon Compounds

NEPC (1999a) notes that there are a number of policy considerations which reflect the nature and properties of petroleum hydrocarbons:

- formation of observable light non-aqueous phase liquids (LNAPL);
- fire and explosive hazards; and
- effects on buried infrastructure (e.g. penetration of or damage to, in-ground services by hydrocarbons).

NEPC (1999a) includes 'management limits' to avoid or minimise these potential effects. Application of the management limits requires consideration of site-specific factors such as the depth of building basements and services and depth to groundwater, to determine the maximum depth to which the limits should apply. NEPC (1999a) also notes that management limits may have less relevance at operating industrial sites which have no or limited sensitive receptors in the area of potential impact, and when management limits are exceeded, further site-specific assessment and management may enable any identified risk to be addressed.

Given the nature of the identified contaminants of potential concern at the site, further assessment against these management limits is considered not warranted.

5.6. Aesthetics – Human Health

Section 3.6.3 of NEPC (1999a) advises that there are no specific numeric aesthetic guidelines, however site assessment requires a balanced consideration of the quantity, type and distribution of foreign material or odours in relation to the specific land use and its sensitivity.

Further assessment of aesthetics (in the context of visible fragments of asbestos containing materials) is considered warranted.

5.7. Terrestrial Ecosystems

NEPC (1999) requires a pragmatic risk-based approach should be taken in applying ecological investigation and screening levels in residential and commercial / industrial land use settings.

It is noted that:

- vegetation on site and on adjacent properties did not display evidence of significant or widespread phytotoxic impact (i.e. plant stress or dieback); and
- the stockpiles are being removed from site.

Further assessment of unacceptable risk to terrestrial ecosystems is considered not warranted.

6. DATA QUALITY OBJECTIVES

Appendix B of NEPC (1999b) provides guidance on the development of data quality objectives (DQO) using a seven-step process.

The DQO for this project are set out in **Sections 6.1** to **6.7** of this report.

6.1. Step 1: State the problem

The first step involves summarising the contamination problem that requires new environmental data and identifying resources available to solve the problem.

The objectives of this project are to:

- assess the potential for contamination to be present following removal of the stockpiles;
- provide advice on whether the site would be suitable (in the context of land contamination) for the proposed land use setting; and
- provide recommendations for further investigation, management and/or remediation (if warranted).

The assessment is being undertaken because:

- advice is required on the suitability of the site in the context of land contamination and human health exposure risks) for the proposed land use setting.

The project team identified for this project is comprised primarily of suitably experienced environmental consultants from Alliance Geotechnical Pty Ltd.

The regulatory authorities identified for this project include NSW EPA and the local Council.

6.2. Step 2: Identify the decision/goal of the study

The second step involves identifying decisions that need to be made about the contamination problem and the new environmental data required to make them.

The decisions that need to be made during this project include:

- Is the environmental data collected for the project, suitable for assessing relevant human health exposure risks?
- Do the concentrations of identified contaminants of potential concern (COPC) present an unacceptable exposure risk to identified receptors, for the proposed land use setting?
- Are the stockpiles suitable for the proposed land use setting, in the context of human health exposure risks?

6.3. Step 3: Identify the information inputs

The third step involves identifying the information needed to support decisions and whether new environmental data will be needed.

The inputs required to make the decisions set out in **Section 6.2** for this project, will include:

- the nature and extent of sampling at the site, including both density and distribution;
- samples of relevant site media;
- the measured physical and/or chemical parameters of the site media samples (including field screening and laboratory analysis, where relevant); and
- assessment criteria adopted for each of the media sampled.

Taking into consideration the objectives of this project, and the conceptual site model and land use setting presented in Section 5.2 of this project, the assessment criteria relevant to the proposed land use setting have been adopted for this project.

- Human health direct contact – HILs in Table 1A (1) in NEPC (1999a) and HSLs in Table B4 of Friebel, E & Nadebaum, P (2011);
- Aesthetics – no visible asbestos containing materials observed on the surface of the stockpile removal areas.

6.4. Step 4: Define the boundaries of the study

The fourth step involves specifying the spatial and temporal aspects of the environmental media that the data must represent to support decisions.

The spatial extent of the project will be limited to the stockpile footprints.

The lateral extent that contamination is expected to be distributed across, based on the conceptual site model, is defined by the inferred boundaries of the areas of environmental concern (AEC).

The vertical extent that contamination is expected to be distributed across, based on the conceptual site model and the project scope, is limited to the inferred base of the identified AEC.

The scale of the decisions required will be based on the stockpiles.

The temporal boundaries of the project include

- the project timeframe presented in the AG proposal for this project,
- unacceptable weather conditions at the time of undertaking fieldwork, including rainfall, cold and/or heat;
- access availability of the site (to be defined by the site owner/representative); and
- availability of AG field staff (typically normal daylight working hours, Monday to Friday).

Constraints which may affect the carrying out of this project may include access limitations, presence of above and below ground infrastructure, and hazards creating health and safety risks.

6.5. Step 5: Develop the analytical approach (or decision rule)

The fifth step involves defining the parameter of interest, specifying the action level, and integrating information from Steps 1 to 4 into a single statement that gives a logical basis for choosing between alternative actions.

6.5.1. Rinsate Blanks

One rinsate blank will be collected and scheduled for analysis, for each day of sampling undertaken, if non-disposable sampling equipment was used on that day. The rinsate blank will be analysed for at

least one of the analytes the sample/s collected that day are being scheduled for analysis for (with the exception of asbestos).

6.5.2. Trip Spikes and Trip Blank Samples

One trip spike and trip blank sample will be used and scheduled for analysis, for each day of sampling undertaken, if site samples being collected that day are being analysed for volatile contaminants of concern (typically BTEX and/or TRH C_6-C_{10}).

6.5.3. Field Duplicates

Field duplicates will be collected at a rate of one per twenty (5%) site samples collected. The duplicates collected will be analysed for at least one of the analytes that the parent sample of the duplicate/triplicate is being scheduled for analysis for (with the exception of asbestos).

The relevant percent difference (RPD) of concentrations of relevant analytes, between the parent sample and the duplicate will be calculated.

6.5.4. Laboratory Analysis Quality Assurance / Quality Control

The analytical laboratory QA/QC program will typically include laboratory method blank samples, matrix spike samples, surrogate spike samples, laboratory control samples, and laboratory duplicate samples.

6.5.5. If/Then Decision Rules

AG has adopted the following 'if/then' decision rules for this project:

- If the result of the assessment of field data and laboratory analytical data is considered acceptable, then that field data and laboratory analytical data is suitable for interpretation within the scope of this project; and
- If the field data and laboratory analytical data is within the constraints of the assessment criteria adopted for this project (refer **Section 6.3**), then the contamination exposure risks to identified receptors, are considered acceptable.

In the event the assessment of field data and/or laboratory analytical data results in the data being not suitable for interpretation, then AG will determine if additional data is required to allow interpretation to be undertaken.

In the event that field data and/or laboratory analytical data exceeds the assessment criteria adopted for this project (refer **Section 6.3**), AG will undertake an assessment of the exceedance in the context of the project objectives to determine if additional data is required and whether management and/or remediation is required.

6.6. Step 6: Specify the performance or acceptance criteria

The sixth step involves specifying the decision maker's acceptable limits on decision errors, which are used to establish performance goals for limiting uncertainties in the data. When assessing contaminated land, there are generally two types of errors in decision making:

- Contamination exposure risks for a specific land use setting are acceptable, when they are not; and

- Contamination exposure risks for a specific land use setting are not acceptable when they are.

AG will mitigate the risk of decision error by:

- Calculation of the 95% upper confidence limit (UCL) statistic to assess the mean concentration of relevant contaminants of potential concern;
- Assignment of fieldwork tasks to suitably experienced AG consulting staff, and suitably experienced contractors;
- Assignment of laboratory analytical tasks to reputable NATA accredited laboratories;
- Assignment of data interpretation tasks to suitably experienced AG consulting staff and outsourcing to technical experts where required.

AG will also adopt a range of data quality indicators (DQI) to facilitate assessment of the completeness, comparability, representativeness, precision and accuracy (bias).

Completeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Critical locations sampled	Refer **Section 6.7.1**	Critical samples analysed according to DQO	Refer **Section 6.7.6**
Critical samples collected	Refer **Section 6.7.1**	Analytes analysed according to DQO	Refer **Section 6.7.6**
SOPs appropriate and complied with	100%	Appropriate laboratory analytical methods and LORs	Refer **Section 6.7.6**
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	Sample documentation complete	All sample receipt advices, all certificates of analysis
		Sample extraction and holding times complied with	Refer **Section 6.7.7**
Comparability			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Same SOPs used on each occasion	100%	Same analytical methods used by primary laboratory	Refer **Section 6.7.7**
Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	Same LORs at primary laboratory	Refer **Section 6.7.7**

Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	Same laboratory for primary sample analysis	All primary samples to SGS Environmental
		Same analytical measurement units	Refer **Section 6.7.7**
Representativeness			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Appropriate media sampled according to DQO	Refer **Section 6.4**	Samples analysed according to DQO	Refer **Section 6.7.6**
Media identified in DQO sampled	Refer **Section 6.4**		
Precision			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Field duplicate RPD	Minimum 5% duplicates No limit for analytical results <10 times LOR 50% for analytical results 10-20 times LOR 30% for analytical results >20 times LOR	Laboratory duplicates	No exceedances of laboratory acceptance criteria
SOPs appropriate and complied with	100%		
Accuracy (bias)			
Field Considerations	**Assessment Criterion**	**Laboratory Considerations**	**Assessment Criterion**
Rinsate blanks	Less than laboratory limit of reporting	Laboratory method blank	No exceedances of laboratory acceptance criteria
Field trip spikes	Recoveries between 60% and 140%	Matrix spike recovery	No exceedances of laboratory acceptance criteria

Field trip blanks	Analyte concentration <LOR	Surrogate spike recovery	No exceedances of laboratory acceptance criteria
		Laboratory control sample recovery	No exceedances of laboratory acceptance criteria

6.7. Step 7: Develop the plan for obtaining data

The seventh step involves identifying the most resource effective sampling and analysis design for generating the data that is required to satisfy the DQOs.

6.7.1. Sampling Point Density and Locations

Section 6.2.1 of NEPC (1999b) states that the number and location or sampling points is based on knowledge of the site and professional judgement. Sampling should be localised to known or potentially contaminated areas identified from knowledge of the site either from site history or an earlier phase of site investigation. Judgemental sampling can be used to investigate sub-surface contamination issues in site assessment. Section 7.5.2 of NEPC (1999b) provides guidance on the quantity of samples to be collected form stockpiles.

Given AG's understanding of site history, and the nature and extent of the identified AEC, AG considers a judgemental sampling strategy is appropriate for this project.

6.7.2. Sampling Methodology

The sampling point methodology presented in **Table 6.7.2** will be used for this assessment. The methodology is based on a range of factors considered relevant to this project, including:

- the identified contaminants of potential concern;
- the suspected laydown mechanisms for those contaminants of concern;
- the suspected likely depth of contamination; and
- site specific constraints which affect the type of sampling techniques suited to the site.

Table 6.7.2 Proposed Sampling Methodology

AEC	Sampling Point ID	Method	Target Depth of Sampling Point (m bgs)
AEC02	Not applicable	Not applicable	Walkover of surface soils in footprint of former stockpile for visual evidence of potential asbestos containing materials. Collect photographic record.
AEC03	SP03-11/01 to SP03-11/09	Grab Sample	Collect up to nine surface soil samples across the footprint of the former stockpiles SP03 to SP11 Walkover of surface soils in footprint of former stockpile for visual evidence of potential asbestos containing materials. Collect photographic record.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

6.7.3. Identification, Storage and Handling of Samples

Sample identifiers will be used for each sample collected, based on the sampling point number and the depth the sample was collected from.

Project samples will be stored in laboratory prepared containers (and zip lock bags if collected for asbestos or acid sulfate soil assessment). Filled containers will be placed in insulated container/s with ice.

Samples will be transported to the relevant analytical laboratory, with chain of custody (COC) documentation that includes the following information:

AG project identification number

- Each sample identifier
- Date each sample was collected
- Sample type (e.g. soil or water)
- Container type/s for each sample collected
- Preservation method used for each sample (e.g. ice)
- Analytical requirements for each sample and turnaround times
- Date and time of dispatch and receipt of samples (including signatures)

6.7.4. Decontamination

In the event that non-disposable sampling equipment is used, that equipment will be decontaminated before and in between sampling events, to mitigate potential for cross contamination between samples collected. The decontamination methodology to be adopted for this project will include:

- Washing relevant sampling equipment using potable water with a phosphate free detergent (i.e. Decon 90 or similar) mixed into the water;
- Rinsing the washed non-disposable sampling equipment with distilled or de-ionised water; and
- Air drying as required.

6.7.5. Laboratory Selection

The analytical laboratories used for this project will be NATA accredited for the analysis undertaken.

6.7.6. Laboratory Analytical Schedule

Project samples will be scheduled for NATA accredited laboratory analysis, using a combination of:

- Observations made in the field of the media sampled;
- The contaminants of potential concern (COPC) identified for the area of environmental concern that the sample was collected from.

Based on site history, AG has adopted the laboratory analytical schedule (and associated upper limiting quantities) presented in **Table 6.7.6** for this project.

Table 6.7.6 Laboratory Analytical Schedule

AEC	Sampling Point ID	TRH/BTEX	PAH	OCP	PCB	Metals	Asbestos (0.001%)	Asbestos ID
AEC02	Not applicable	-	-	-	-	-	-	-
AEC03	SP03-11/01 to 09	-	9	-	-	-	-	-

6.7.7. Laboratory Holding Times, Analytical Methods and Limits of Reporting

The laboratory holding times, analytical methods and limits of reporting (LOR) being used for this project, are presented in **Table 6.7.7**.

Table 6.7.7 Laboratory Holding Times, Analytical Methods and Limits of Reporting

Analyte	Holding Time	Analytical Method	Limit of Reporting (mg/kg)
PAH	14 days	USEPA 8270	0.1-0.5

7. STOCKPILE REMOVAL WORKS SUMMARY

7.1. Notifications

AG was provided with a copy of a WorkCover NSW notification summary, addressing the asbestos removal associated with the stockpile removal works. AG notes that the works date in the summary does not align with the dates the work was actually undertaken. AG understands the works were delayed as a result of rainfall adversely affecting truck and plant access/egress at the site.

A copy of the summary is presented in **Appendix D**.

7.2. AEC02 – Removal of Stockpile SP02

Stockpile removal works in AEC02 were undertaken on 5 July 2018 by Multi Services Solutions Pty Ltd (and its sub-contractor, Summerfield Pty Ltd). The stockpiled material was excavated using a hydraulic excavator, loaded into a truck and removed for offsite disposal. Observations made on site by AG indicated that the stockpile had been removed to its base, covering a nominal area of 6.5m by 6m.

The residual surface of the stockpile SP02 foot print was visually assessed by AG on 6 July 2018, by undertaking walkover along north-south and east-west transects across the foot print. No observations were made of potential asbestos containing materials across the surface of the former stockpile SP02 footprint.

Image 7.1.1 View of stockpile SP02 removal footprint, facing south



Image 7.1.2 View of stockpile SP02 removal footprint, facing north



7.3. AEC03 – Removal of Stockpiles SP03 to SP11

Stockpile removal works in AEC02 were undertaken on 6 and 9 July 2018 by Multi Services Solutions Pty Ltd (and its sub-contractor, Summerfield Pty Ltd).

The stockpiled material was excavated using a hydraulic excavator, loaded into a truck and removed for offsite disposal. Observations made on site by AG indicated that the stockpiles had been removed to their bases.

The residual surface of the stockpiles SP03 to SP11 foot prints were visually assessed by AG on 9 July 2018, by undertaking walkover along north-south and east-west transects across the stockpile foot prints. No observations were made of potential asbestos containing materials across the surface of the former stockpile SP03 to SP11 footprints.

Nine soil validation samples (SP03-11/01 to SP03-11/09) were collected from across the remediation surface of the site. The locations of the sampling points are presented in **Figure 4**.

Image 7.1.2 View of stockpile SP03-SP11 removal footprint, facing south



Image 7.1.2 View of stockpile SP02 removal footprint, facing north



7.4. Waste Disposal

Records provided by Multi Services Solutions and its sub-contractor, Summerfield Pty Ltd) that 152.88 tonnes of soil were reported as being removed for offsite disposal during stockpile removal works, as 'contaminated asbestos soil'. Waste disposal records indicate that the waste was transported to the Elizabeth Drive Waste Management Centre at 1725 Elizabeth Drive, Kemps Creek, NSW.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

A copy of the waste tracking records is presented in **Appendix A.**

8. LABORATORY

The samples collected were transported to the analytical laboratory, using chain of custody (COC) protocols. A selection of these samples was scheduled for analysis, with reference to the relevant COPC identified for the AEC that the samples were collected from.

A copy of the analytical laboratory certificates of analysis, is presented in **Appendix B.**

The sample analytical results were tabulated and presented in the attached **Table LAR1**

9. DATA QUALITY INDICATOR ASSESSMENT

9.1. Completeness

An assessment of the completeness of data collected was undertaken, and the results presented in **Table 9.1**.

Table 9.1 Completeness DQI

Field Considerations	Target	Actual	Comment
Critical locations sampled	9	9	Performance against indicator considered acceptable.
Critical samples collected	9	9	Performance against indicator considered acceptable.
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Field documentation complete	All sampling point logs, calibration logs and chain of custody forms	All sampling point logs, calibration logs and chain of custody forms	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Critical samples analysed according to DQO	9	100%	Performance against indicator considered acceptable.
Analytes analysed according to DQO	100%	100%	Performance against indicator considered acceptable.
Appropriate laboratory analytical methods and LORs	100%	100%	Performance against indicator considered acceptable.
Sample documentation complete	All sample receipt advices, all certificates of analysis	100%	Performance against indicator considered acceptable.
Sample extraction and holding times complied with	100%	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately complete within the objectives and constraints of the project.

9.2. Comparability

An assessment of the comparability of data collected was undertaken, and the results presented in **Table 9.2.**

Table 9.2 Comparability DQI

Field Considerations	Target	Actual	Comment
Same SOPs used on each occasion	100%	100%	Performance against indicator considered acceptable.
Climatic conditions	Samples stored in insulated containers with ice, immediately after collection	100%	Performance against indicator considered acceptable.
Same types of samples collected, and handled/preserved in same manner	All soil samples same size, all stored in insulated containers with ice	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Same analytical methods used by primary laboratory	100%	100%	Performance against indicator considered acceptable.
Same LORs at primary laboratory	100%	100%	Performance against indicator considered acceptable.
Same laboratory for primary sample analysis	All primary samples to SGS Environmental	100%	Performance against indicator considered acceptable.
Same analytical measurement units	100%	100%	Performance against indicator considered acceptable.

The data collected is considered to be adequately comparable.

9.3. Representativeness

An assessment of the representativeness of data collected was undertaken, and the results presented in **Table 9.3**.

Table 9.3 Representativeness DQI

Field Considerations	Target	Actual	Comment
Appropriate media sampled according to DQO	100%	100%	Performance against indicator considered acceptable.
Media identified in DQO sampled	100%	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Samples analysed according to DQO	100%	Refer comments	Performance against indicator considered acceptable.

The data collected is considered to be adequately representative within the objectives and constraints of the project.

9.4. Precision

An assessment of the precision of data collected was undertaken, and the results presented in **Table 9.4**.

Table 9.4 Precision DQI

Field Considerations	Target	Actual	Comment
Field duplicate RPD	Minimum 5% duplicates	11% duplicates	Performance against indicator considered acceptable.
	No limit for analytical results <10 times LOR	Nil	
	50% for analytical results 10-20 times LOR	Nil	
	30% for analytical results >20 times LOR	Nil	
SOPs appropriate and complied with	100%	100%	Performance against indicator considered acceptable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory duplicates	No exceedances of laboratory acceptance criteria	Nil	RPD failed acceptance criteria due to sample heterogeneity.
			Performance against indicator considered acceptable.

The data collected is considered to be adequately precise.

9.5. Accuracy

An assessment of the precision of data collected was undertaken, and the results presented in **Table 9.5**.

Table 9.5 Accuracy DQI

Field Considerations	Target	Actual	Comment
Rinsate blanks	Less than laboratory limit of reporting	Not applicable.	Not applicable.
Field trip spikes	Recoveries between 60% and 140%	Not applicable.	Not applicable.

Field trip blanks	Analyte concentration <LOR	Not applicable.	Not applicable.
Laboratory Considerations	**Target**	**Actual**	**Comment**
Laboratory method blank	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.
Matrix spike recovery	No exceedances of laboratory acceptance criteria	Four exceedances	Performance against indicator considered acceptable.
Surrogate spike recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.
Laboratory control sample recovery	No exceedances of laboratory acceptance criteria	Nil	Performance against indicator considered acceptable.

The data collected is considered to be adequately accurate

10. DISCUSSION

A discussion on comparison of laboratory analytical results and field observations, in the context of the assessment criteria adopted for this project, is presented in **Sections 10.1.**

10.1. Human Health - Direct Contact

10.1.1. PAH

The concentrations of naphthalene, benzo(a)pyrene TEQ and total PAH in the soil samples analysed, were less than the applicable adopted direct contact human health exposure criteria.

10.1.2. Asbestos

There was no visual evidence observed of potential asbestos containing materials on the surface of the footprints of former stockpiles SP02 (AEC02) and SP03 to SP11 (AEC03).

11. CONCLUSIONS

Based on a review of the historical contamination assessment reports provided, observations made on site by AG, and an assessment of validation laboratory analytical data in the context of the proposed low density residential land use setting, AG makes the following conclusions:

- **the contamination status of the broader site is considered unlikely to have materially changed** since the issue of a site audit statement in 1999;
- stockpiles SP02 and SP03 to SP11 have been adequately removed from site;
- the site is suitable for the proposed land use setting (in the context of land contamination), subject to ongoing implementation of the URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287, as recommended in the site audit statement issued for the site.

This report must be read in conjunction with the limitations set out in This report must be read in conjunction with the limitations set out in **Section 12.**

12. STATEMENT OF LIMITATIONS

The findings presented in this report are based on specific searches of relevant, government historical databases and anecdotal information that were made available during the course of this investigation. To the best of our knowledge, these observations represent a reasonable interpretation of the general condition of the site at the time of report completion.

This report has been prepared solely for the use of the client to whom it is addressed and no other party is entitled to rely on its findings.

No warranties are made as to the information provided in this report. All conclusions and recommendations made in this report are of the professional opinions of personnel involved with the project and while normal checking of the accuracy of data has been conducted, any circumstances outside the scope of this report or which are not made known to personnel and which may impact on those opinions is not the responsibility of Alliance Geotechnical Pty Ltd. Should information become available regarding conditions at the site including previously unknown sources of contamination, AG reserves the right to review the report in the context of the additional information.

This report must be reviewed in its entirety and in conjunction with the objectives, scope and terms applicable to AG's engagement. The report must not be used for any purpose other than the purpose specified at the time AG was engaged to prepare the report.

Logs, figures, and drawings are generated for this report based on individual AG consultant interpretations of nominated data, as well as observations made at the time site walkover/s were completed.

Data and/or information presented in this report must not be redrawn for its inclusion in other reports, plans or documents, nor should that data and/or information be separated from this report in any way.

Should additional information that may impact on the findings of this report be encountered or site conditions change, AG reserves the right to review and amend this report.

13. REFERENCES

URS 2008, 'Contamination Management Plan, Western Precinct Development Phase' dated 7 July 2008, ref: 4321 7287.

Douglas Partners 2017, 'Site Walkover Contamination Report, Proposed Lots 3989, 3990 and 3991, DP1190132, Jordan Springs, NSW', dated 21 September 2017, ref: 92245.00.

AG 2018a, 'Supplementary Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 20 April 2018, ref: 7161-ER-1-3.

AG 2018b, 'Stockpile Contamination Assessment, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 17 May 2018, ref: 7161-ER-1-4.

AG 2018c, 'Waste Classification, Stockpiles SP02 to SP11, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW', dated 22 May 2018, ref: 7161-ER-1-5.

National Environment Protection Council (NEPC) 1999a, 'Schedule B(1) Guideline on Investigation Levels for Soil and Groundwater, National Environment Protection (Assessment of Site Contamination) Measure (NEPM) as amended in May 2013'.


National Environment Protection Council (NEPC) 1999b, 'Schedule B(2) Guideline on Site Characterisation, National Environment Protection (Assessment of Site Contamination) Measure (NEPM) as amended in May 2013'.

NSW EPA 2017, 'Contaminated Sites: Guidelines for the NSW Site Auditor Scheme (3rd edition)'.

NSW EPA 1995, 'Contaminated Sites: Sampling Design Guidelines'.


NSW OEH 2011, 'Contaminated Sites: Guidelines for Consultants Reporting on Contaminated Sites'.

FIGURES

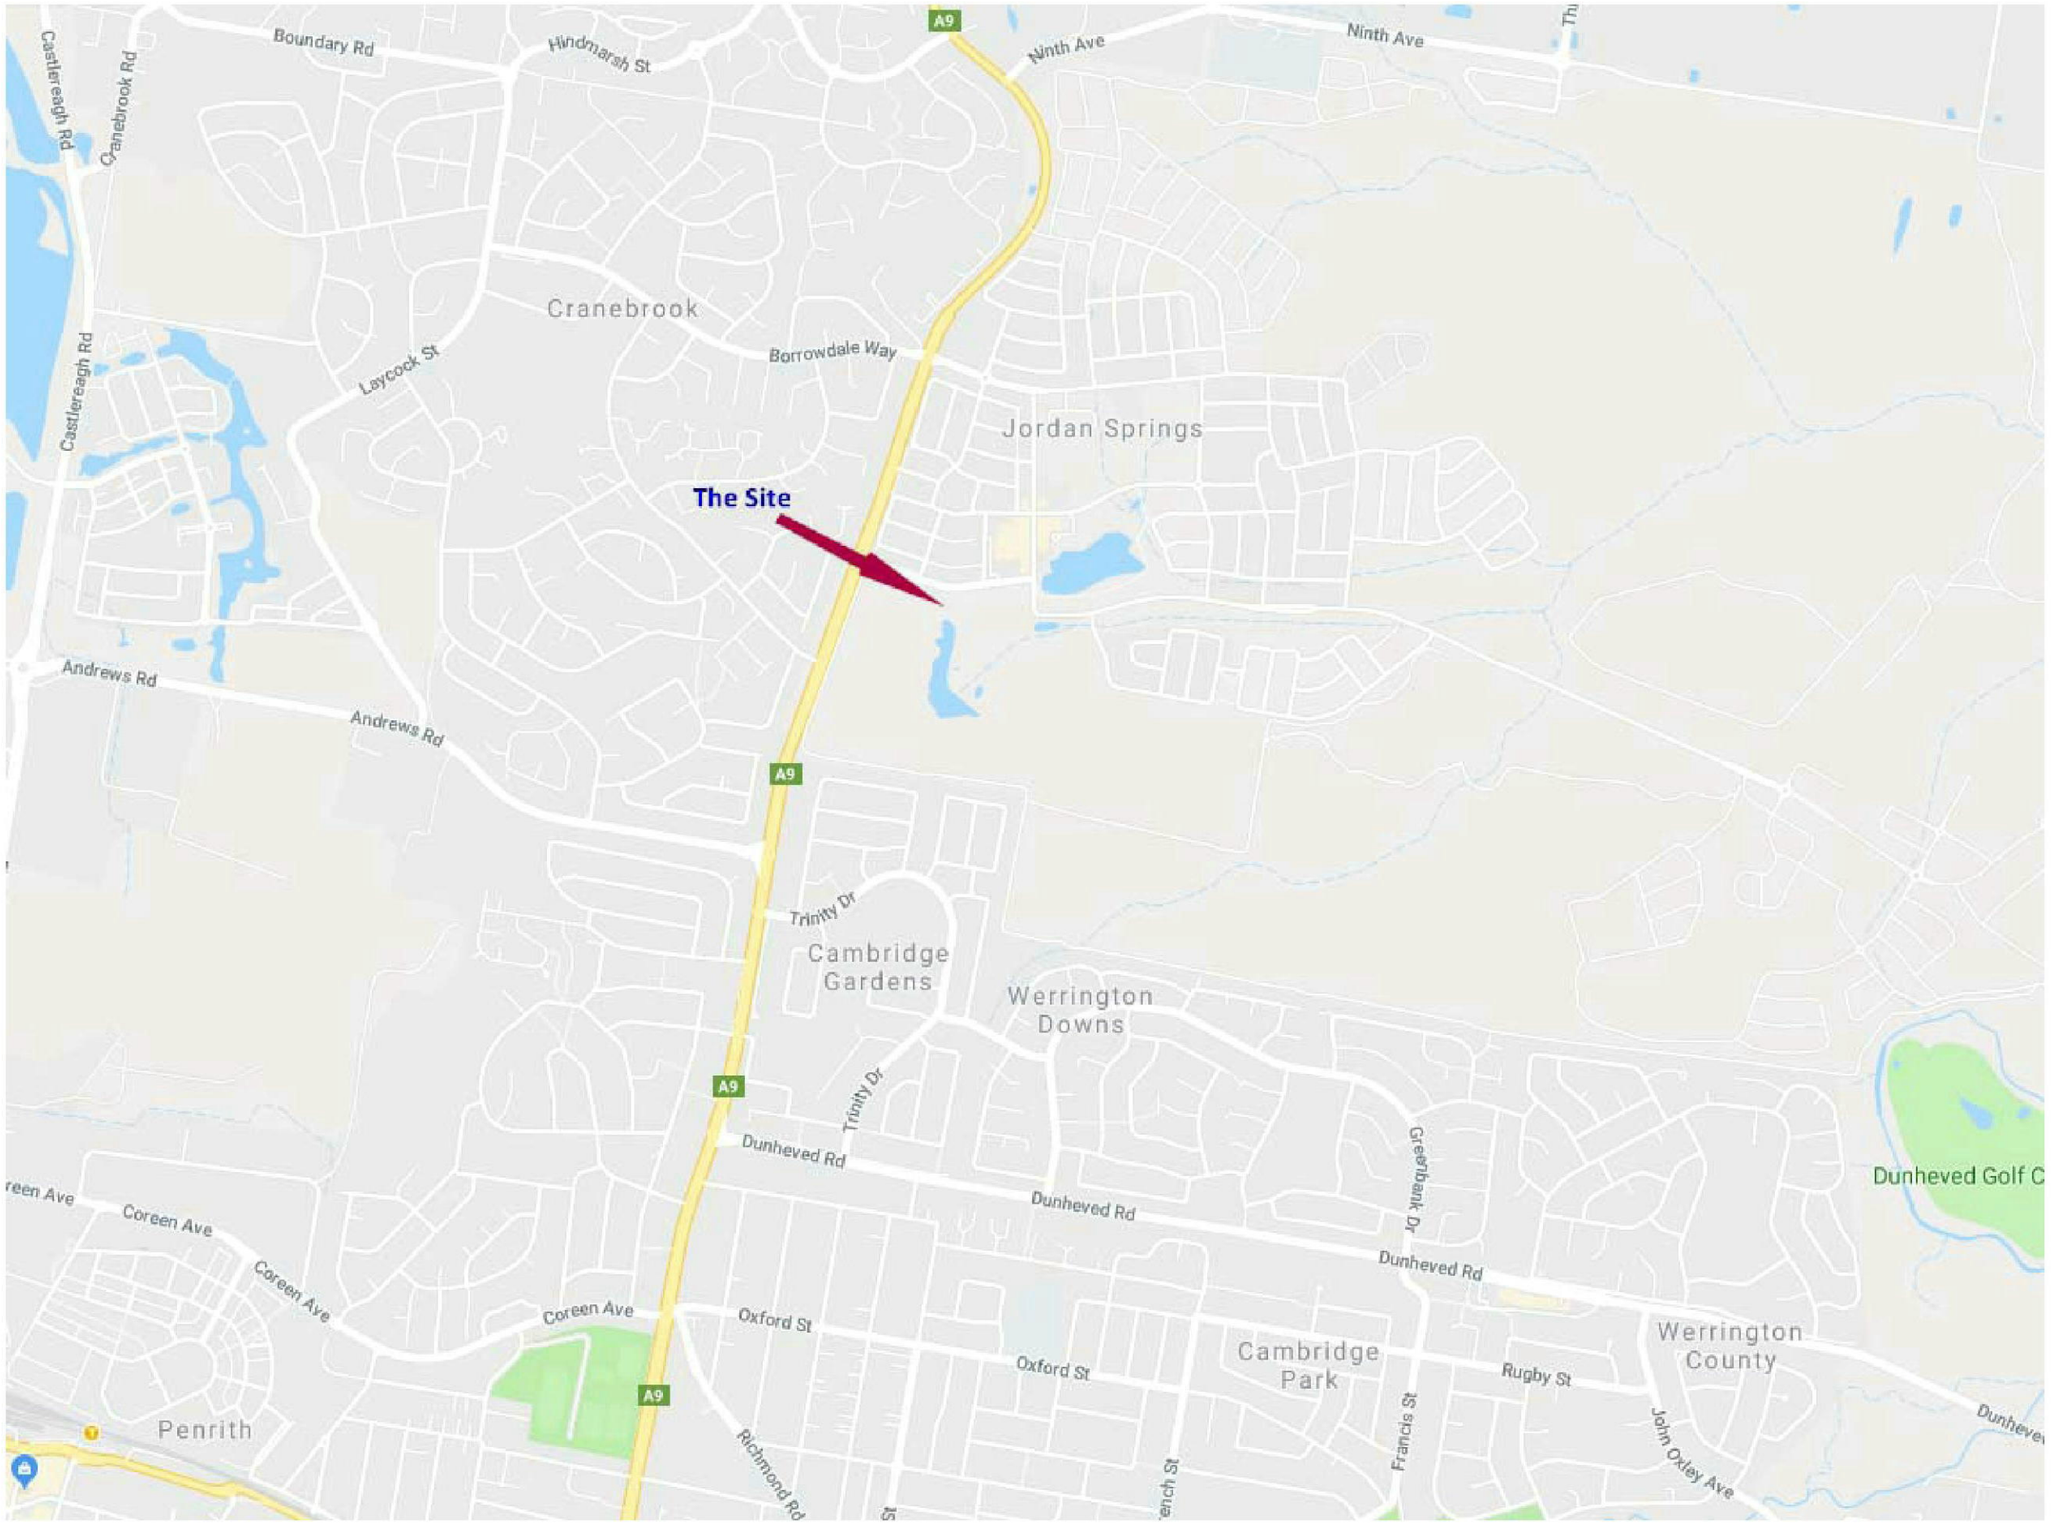


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING **10 Welder Road, Seven Hills, NSW** **T: 1800 288 188 E: enviro@allgeo.com.au**	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Site Validation Report	**Report No:** 7161-ER-1-6 **Figure Date:** 10 July 2018	N	**Figure No:** 1	**Figure Title:** Site Locality Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

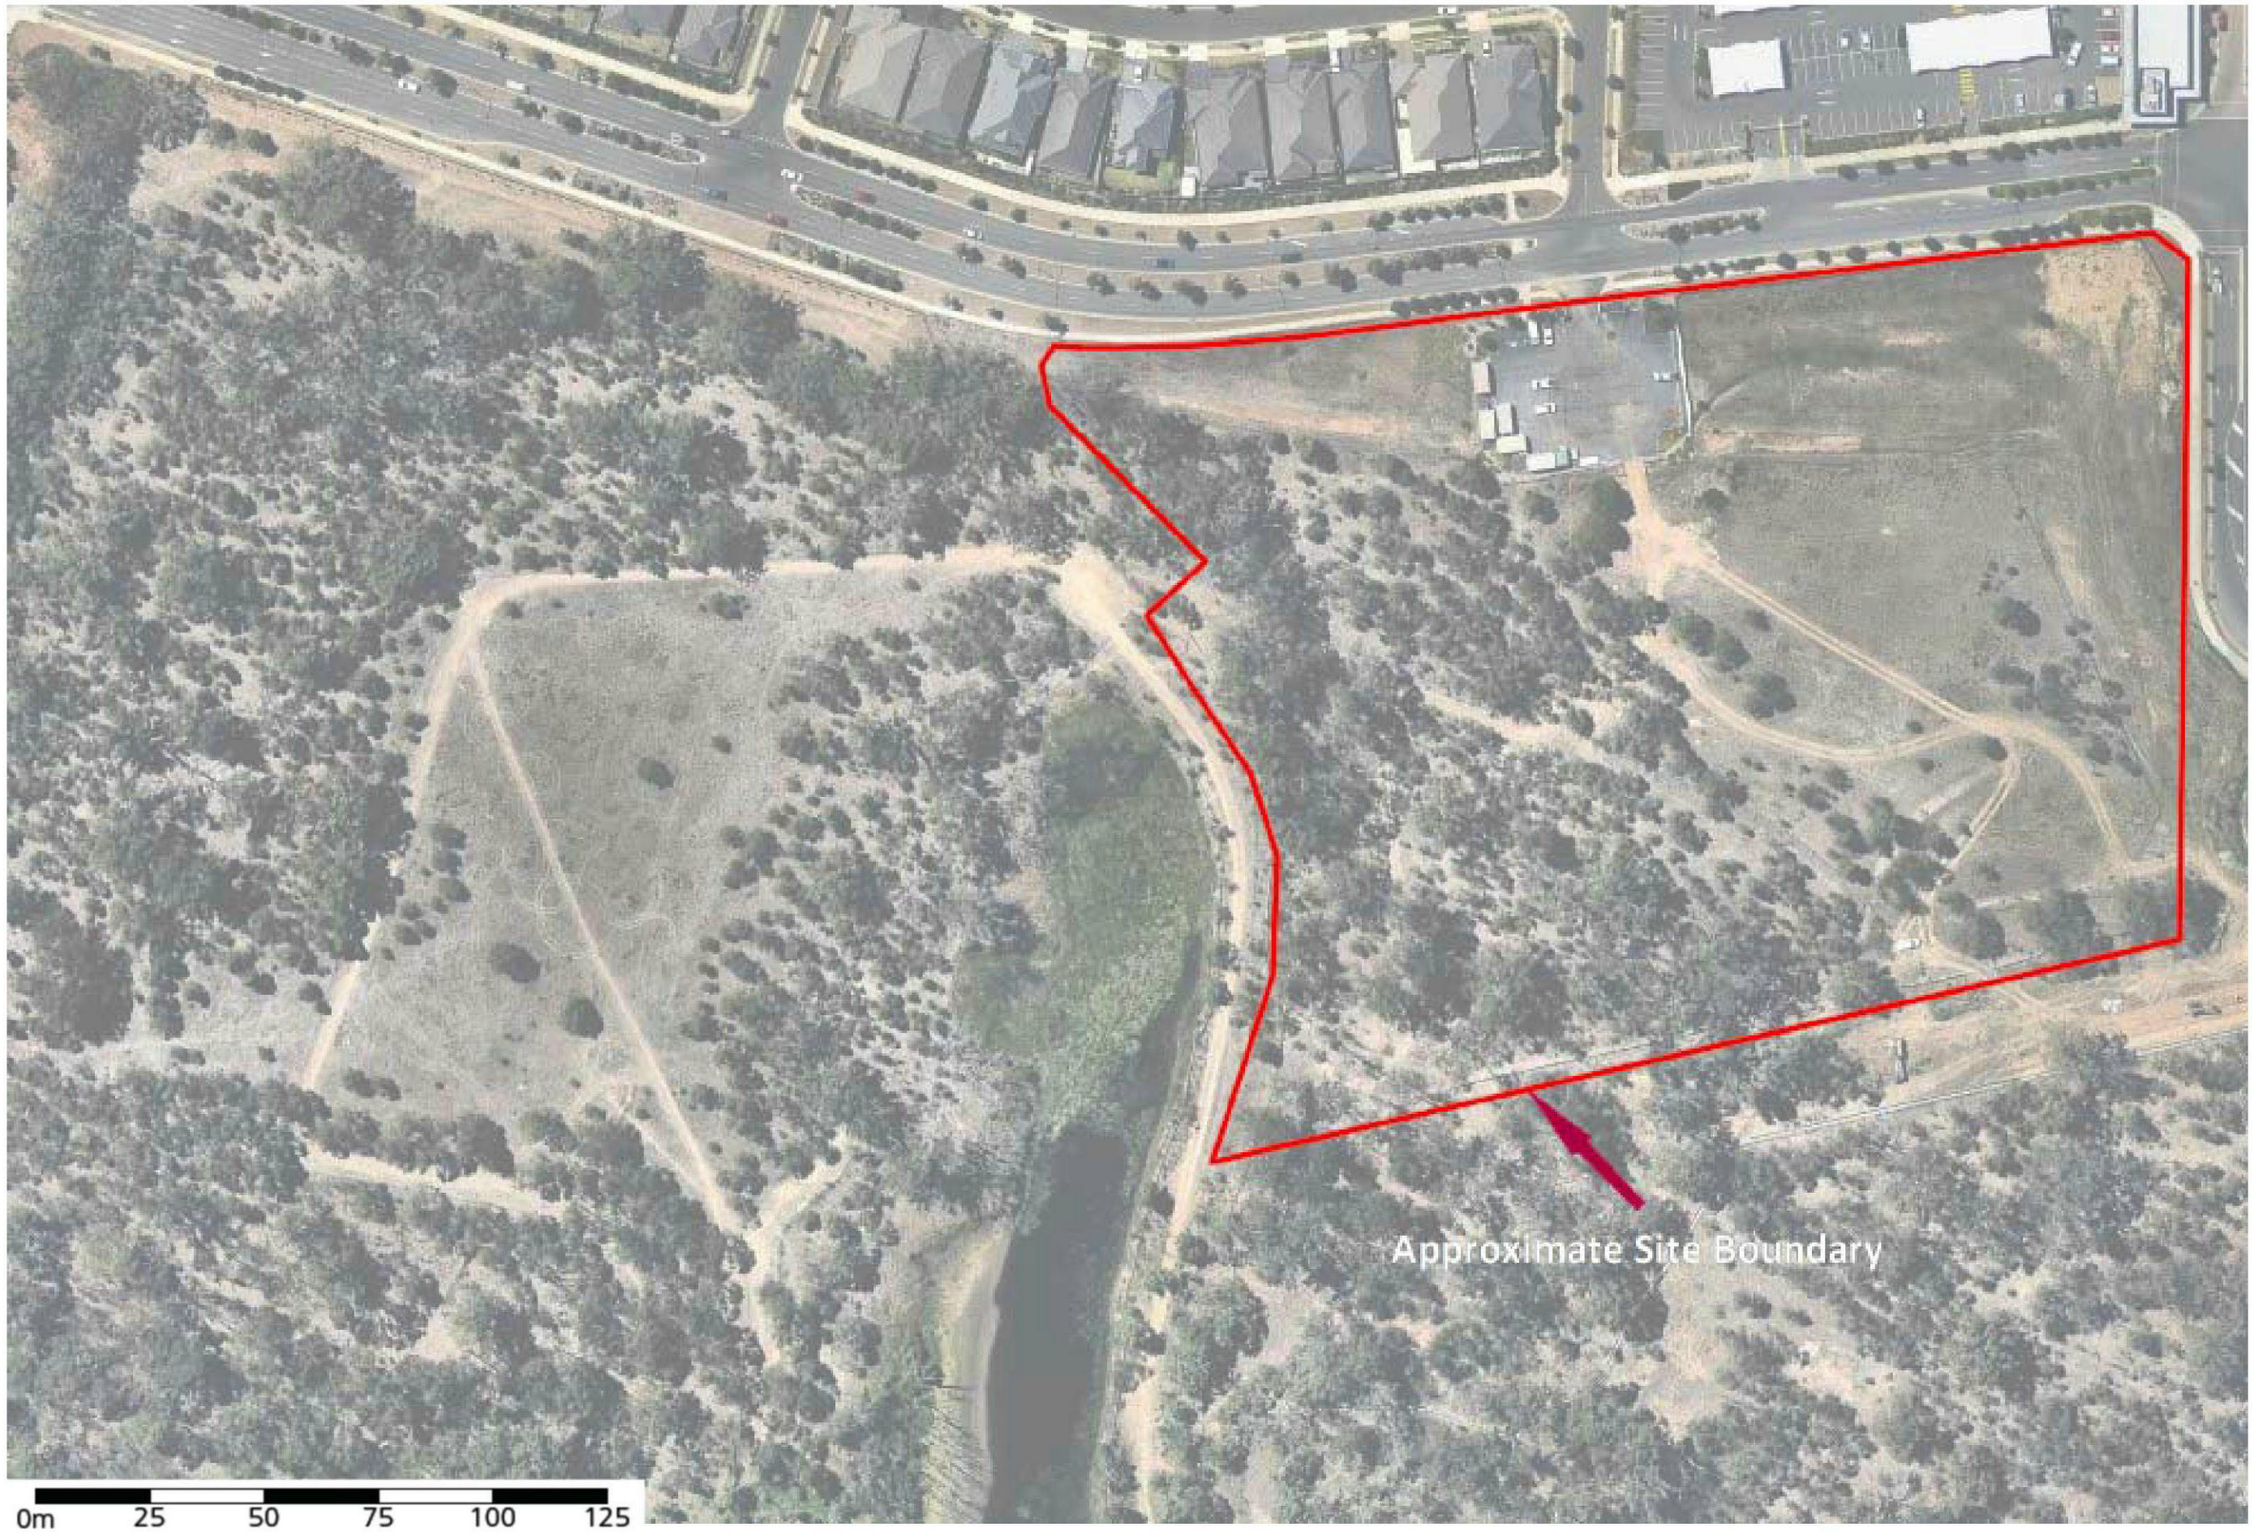


Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Site Validation Report	**Report No:** 7161-ER-1-6 **Figure Date:** 10 July 2018	N	**Figure No:** 2	**Figure Title:** Site Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

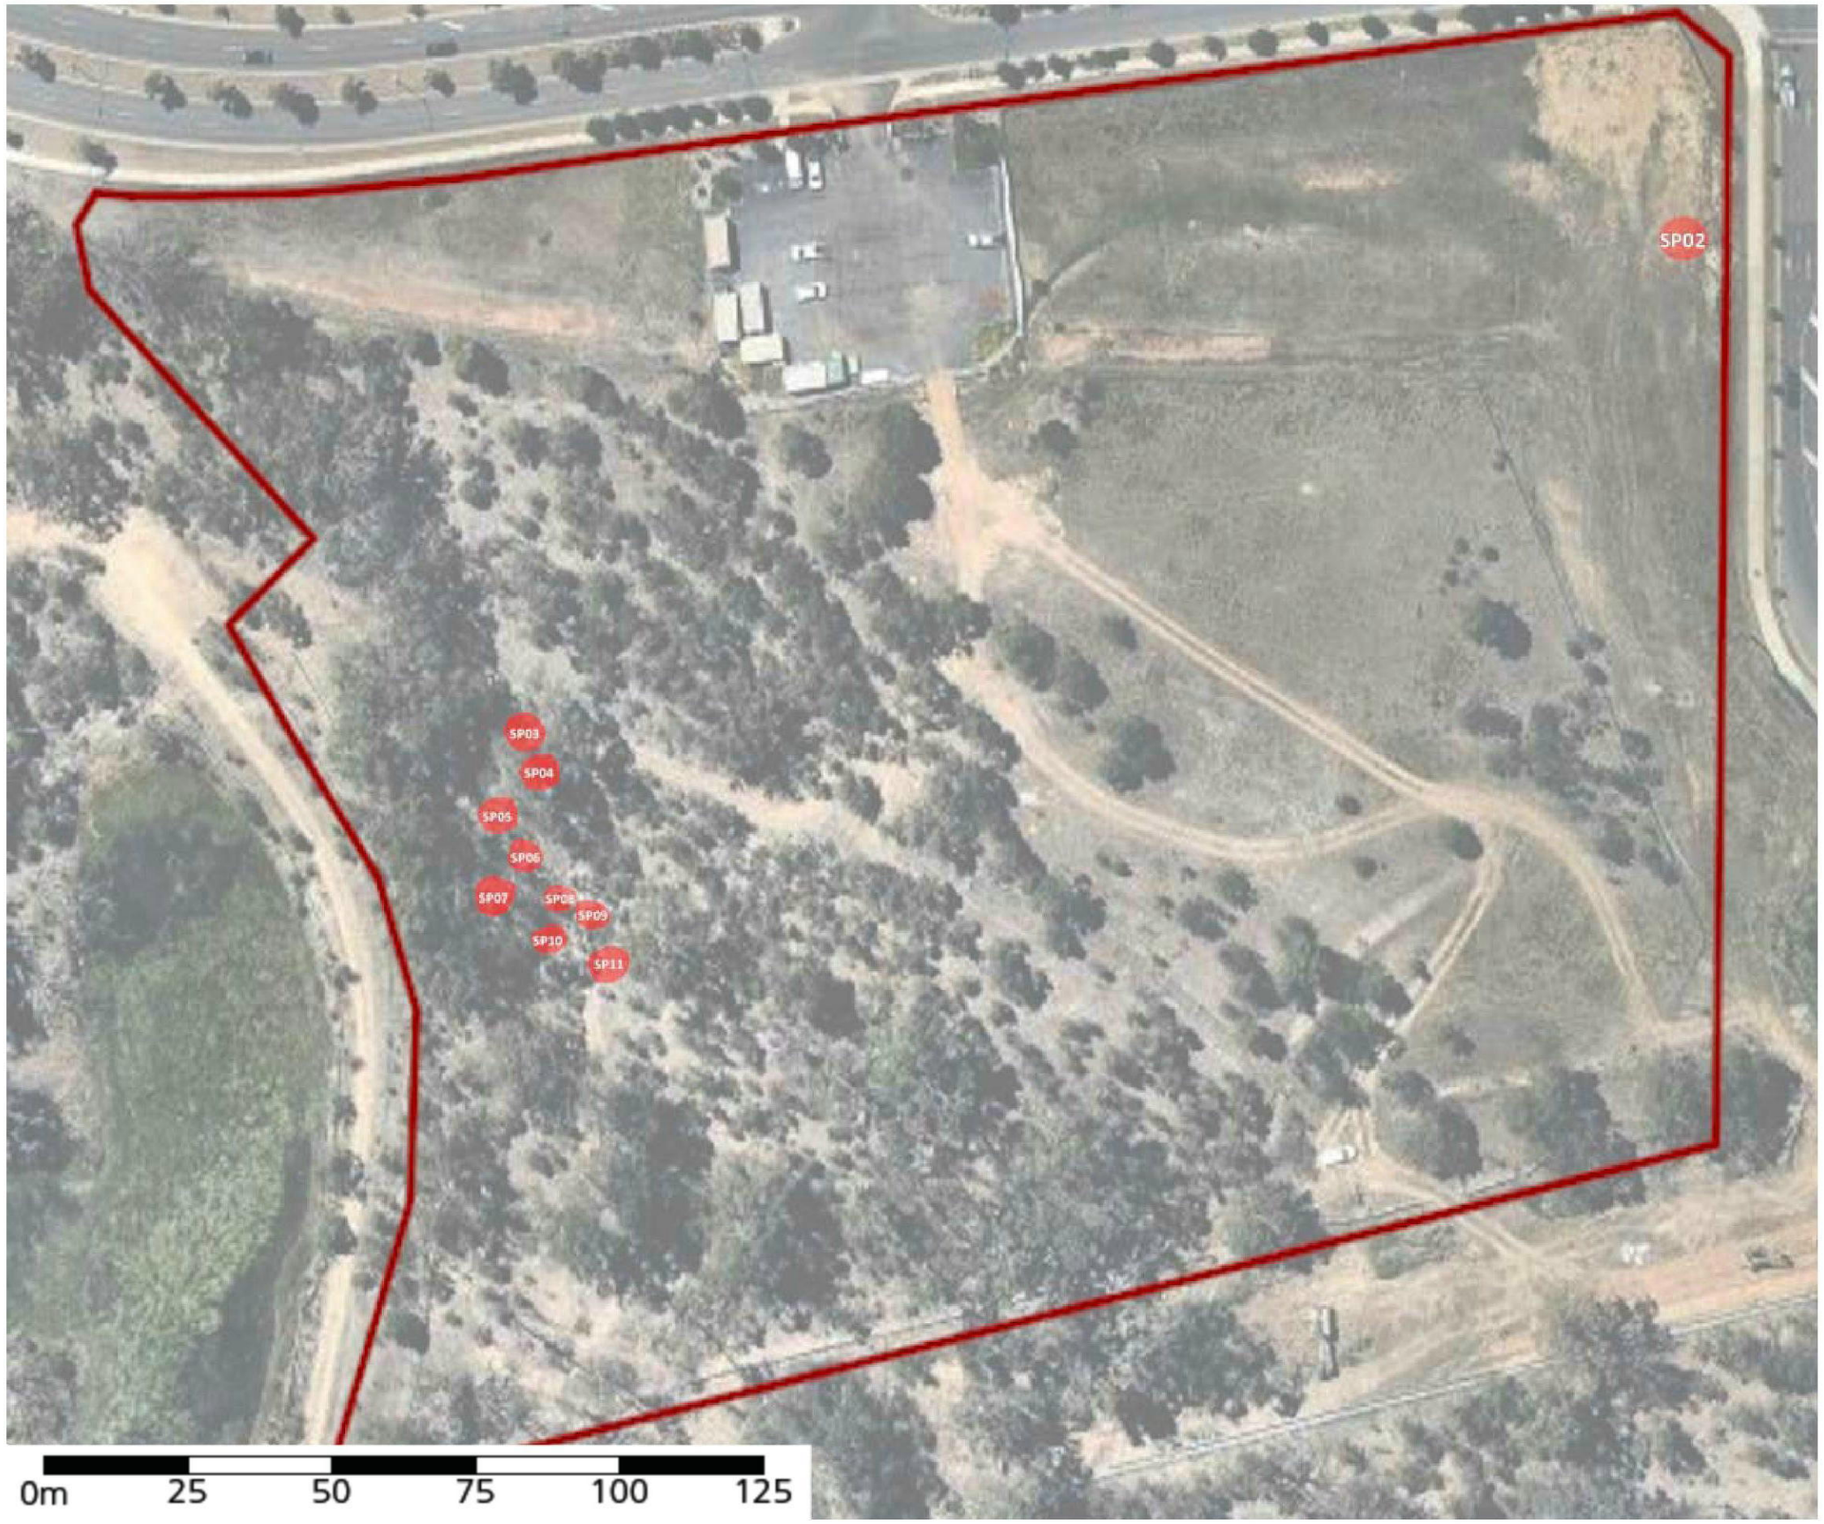

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	**Project Address:** Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	**Client:** LLRL Management Services as Trustee of LLRL Management Services Trust	**Project Name:** Site Validation Report	**Report No:** 7161-ER-1-6 **Figure Date:** 10 July 2018	N	**Figure No:** 3	**Figure Title:** Stockpile Locations Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

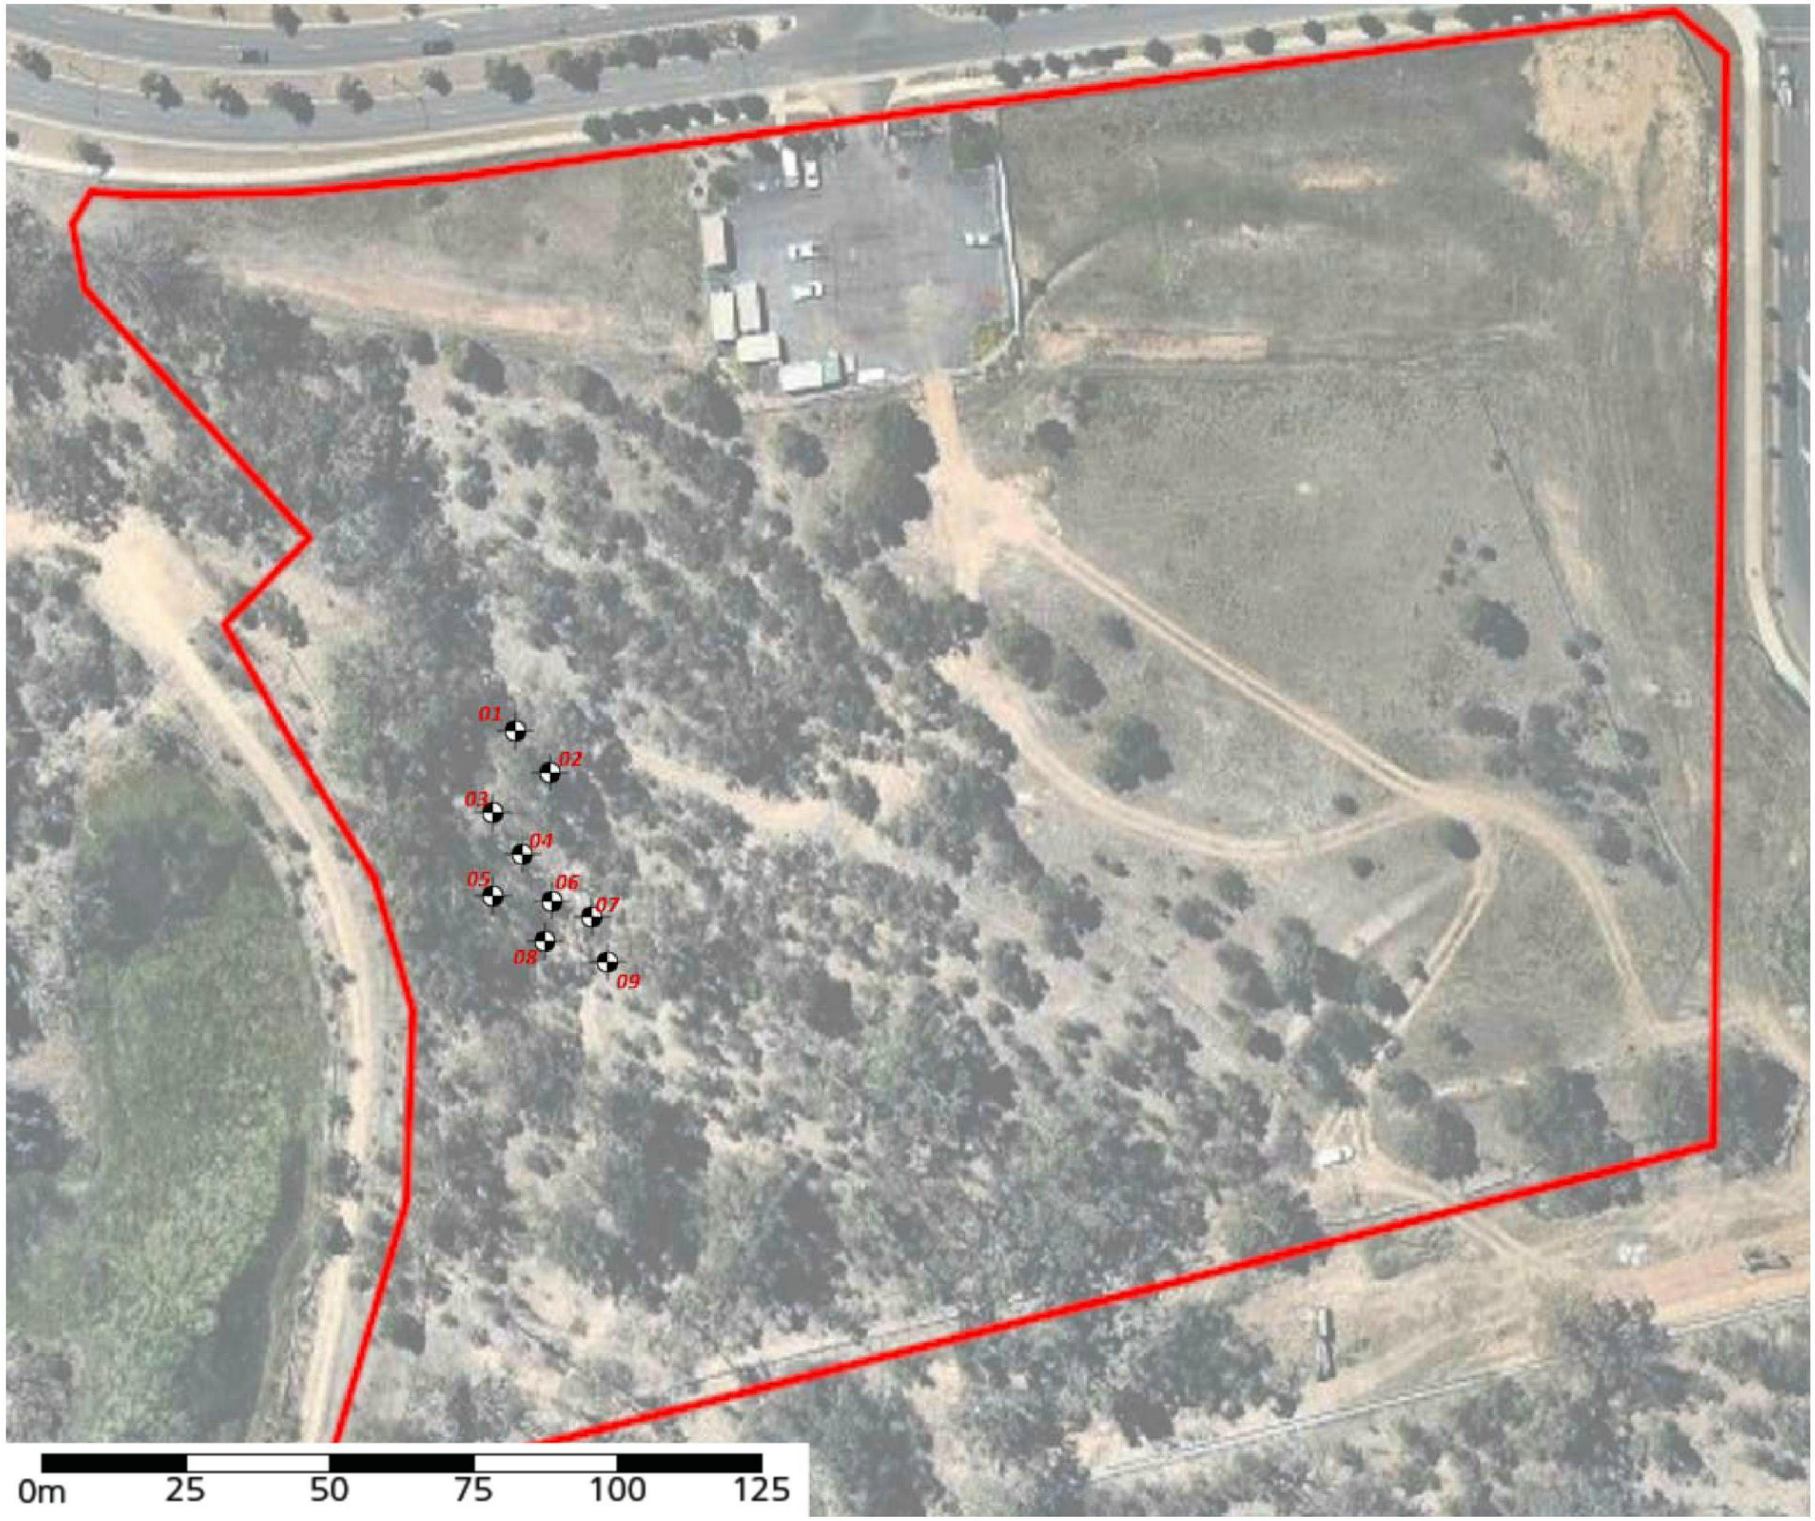

Alliance Geotechnical Pty Ltd ENGINEERING | ENVIRONMENTAL | TESTING 10 Welder Road, Seven Hills, NSW T: 1800 288 188 E: enviro@allgeo.com.au	Project Address: Lot 3991 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW	Client: LLRL Management Services as Trustee of LLRL Management Services Trust	Project Name: Site Validation Report	Report No: 7161-ER-1-6 Figure Date: 10 July 2018	N	Figure No: 4	Figure Title: Sampling Point Layout Plan

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

TABLES

7161 Lot 3991, Jordan Springs Boulevard, Jordan Springs, NSW
7161-ER-1-6
Table LAR1 - Laboratory Analitical Results - Soils

Analyte Name	Units	Direct Contact HIL-A & HSL-A Residential (mg/kg)	Reporting Limit	SE181230.001	SE181230.002	SE181230.003	SE181230.004	SE181230.005	SE181230.006	SE181230.007	SE181230.008	SE181230.009	SE181230.010
Sample Name				SE181230.001	SE181230.002	SE181230.003	SE181230.004	SE181230.005	SE181230.006	SE181230.007	SE181230.008	SE181230.009	SE181230.010
Description				SP03-11/01	SP03-11/02	SP03-11/03	SP03-11/04	SP03-11/05	SP03-11/06	SP03-11/07	SP03-11/08	SP03-11/09	DUP01
Sample Date				9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018	9/7/2018
Matrix				Soil	Soil	Soil	Soil	Soil	Soil	Soil	Soil	Soil	Soil
PAH in Soil													
Naphthalene	mg/kg	1400	0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Phenanthrene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Anthracene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Fluoranthene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Pyrene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Chrysene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg		0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)		0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	3	0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)		0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2
Total PAH (18)	mg/kg		0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	300	0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8	<0.8

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX A

WASTE



SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket


Ticket No: ED310506503.0
Time In: 5/07/2018 10:58:20 AM
Time Out: 5/07/2018 11:10:55 AM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref:

Contaminated Asbestos Soil - 8032

7.46t@
Source: External
Dest: Elizabeth Drive General Waste

GROSS	19.26t
TARE	11.80t
NET Weight:	7.46t
Chargeable Weight:	7.46t
Each Item Weight:	0.00t

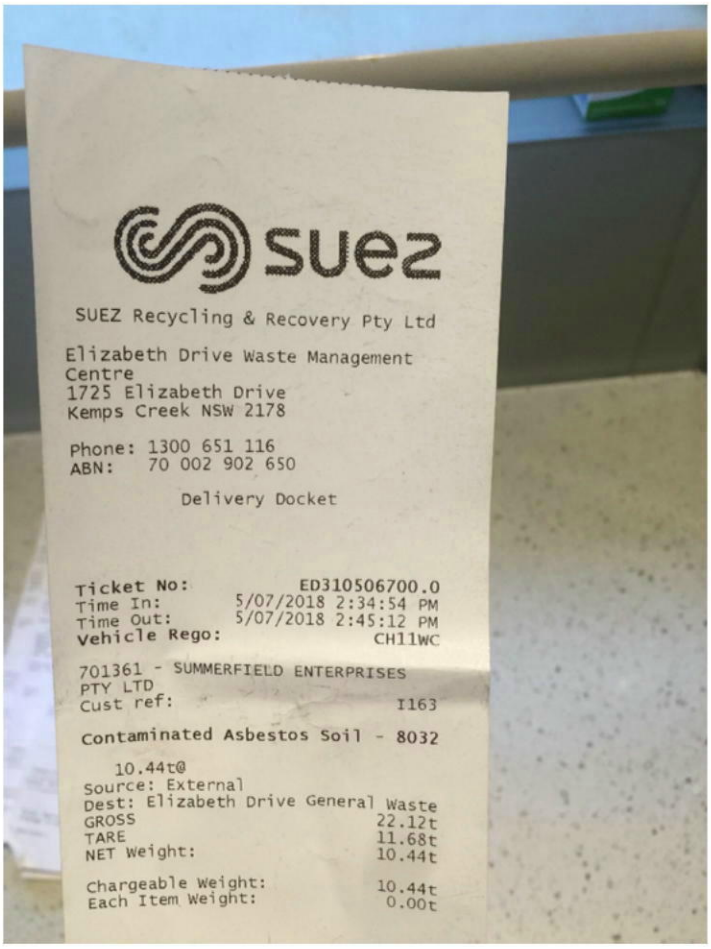

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket


Ticket No: ED310506700.0
Time In: 5/07/2018 2:34:54 PM
Time Out: 5/07/2018 2:45:12 PM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

10.44t@
Source: External
Dest: Elizabeth Drive General Waste

GROSS	22.12t
TARE	11.68t
NET Weight:	10.44t
Chargeable Weight:	10.44t
Each Item Weight:	0.00t

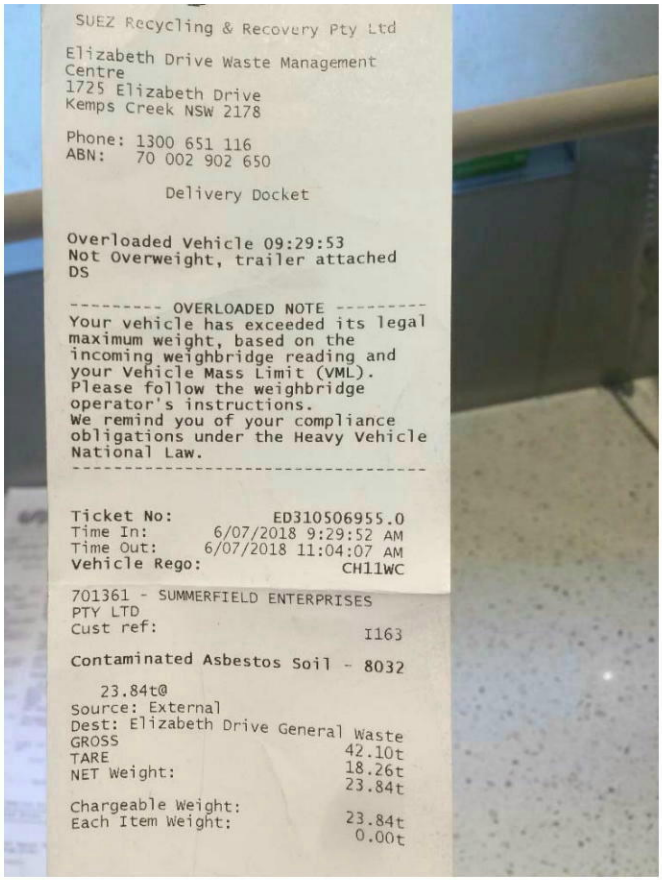

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 09:29:53
Not Overweight, trailer attached
DS

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.


Ticket No: ED310506955.0
Time In: 6/07/2018 9:29:52 AM
Time Out: 6/07/2018 11:04:07 AM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

23.84t@
Source: External
Dest: Elizabeth Drive General Waste

GROSS	42.10t
TARE	18.26t
NET Weight:	23.84t
Chargeable Weight:	23.84t
Each Item Weight:	0.00t

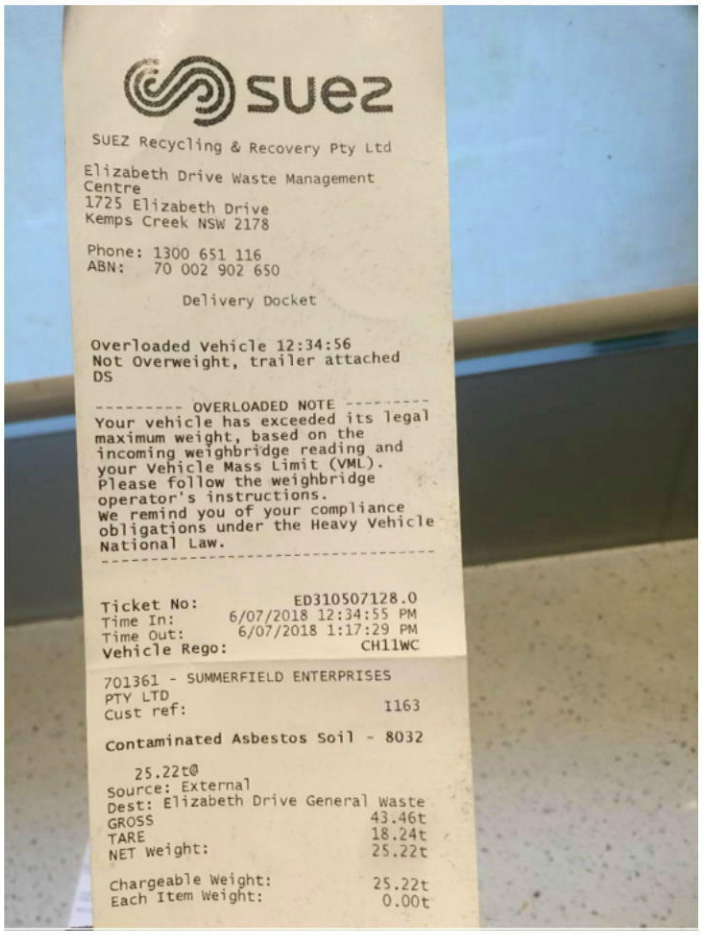

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 12:34:56
Not Overweight, trailer attached
DS

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.


Ticket No: ED310507128.0
Time In: 6/07/2018 12:34:55 PM
Time Out: 6/07/2018 1:17:29 PM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: 1163

Contaminated Asbestos Soil - 8032

25.22t@
Source: External
Dest: Elizabeth Drive General Waste

GROSS	43.46t
TARE	18.24t
NET Weight:	25.22t
Chargeable Weight:	25.22t
Each Item Weight:	0.00t

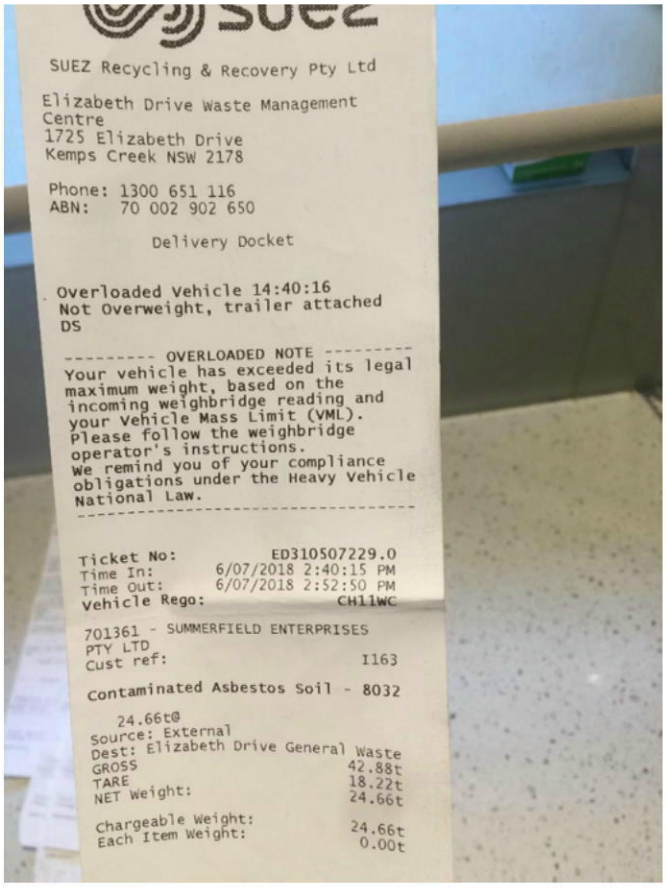

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 14:40:16
Not Overweight, trailer attached
DS

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.


Ticket No: ED310507229.0
Time In: 6/07/2018 2:40:15 PM
Time Out: 6/07/2018 2:52:50 PM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

24.66t@
Source: External
Dest: Elizabeth Drive General Waste
GROSS 42.88t
TARE 18.22t
NET Weight: 24.66t

Chargeable Weight: 24.66t
Each Item Weight: 0.00t

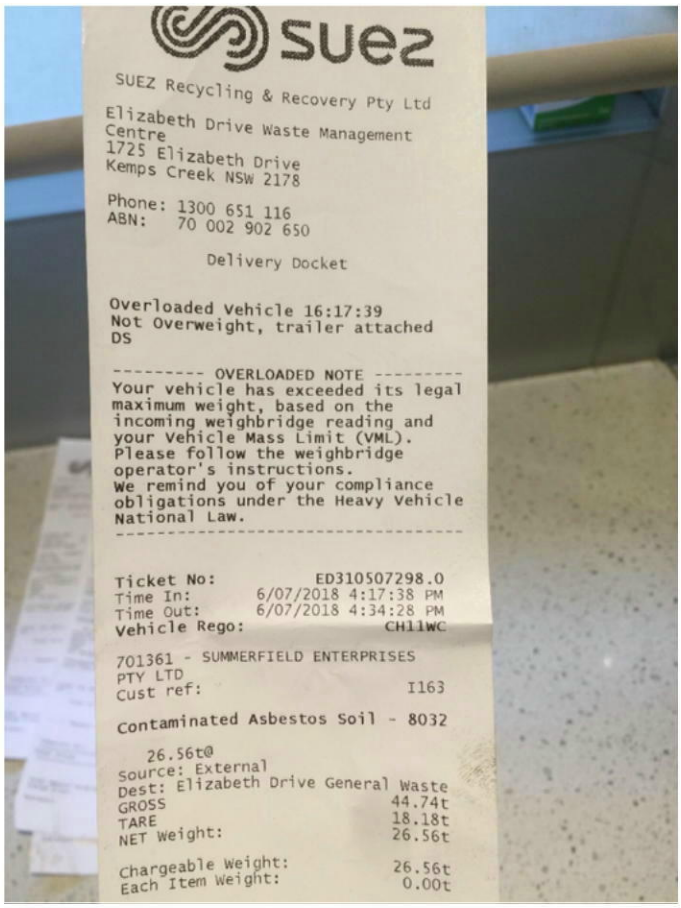

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 16:17:39
Not Overweight, trailer attached
DS

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.


Ticket No: ED310507298.0
Time In: 6/07/2018 4:17:38 PM
Time Out: 6/07/2018 4:34:28 PM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

26.56t@
Source: External
Dest: Elizabeth Drive General Waste
GROSS 44.74t
TARE 18.18t
NET Weight: 26.56t

Chargeable Weight: 26.56t
Each Item Weight: 0.00t

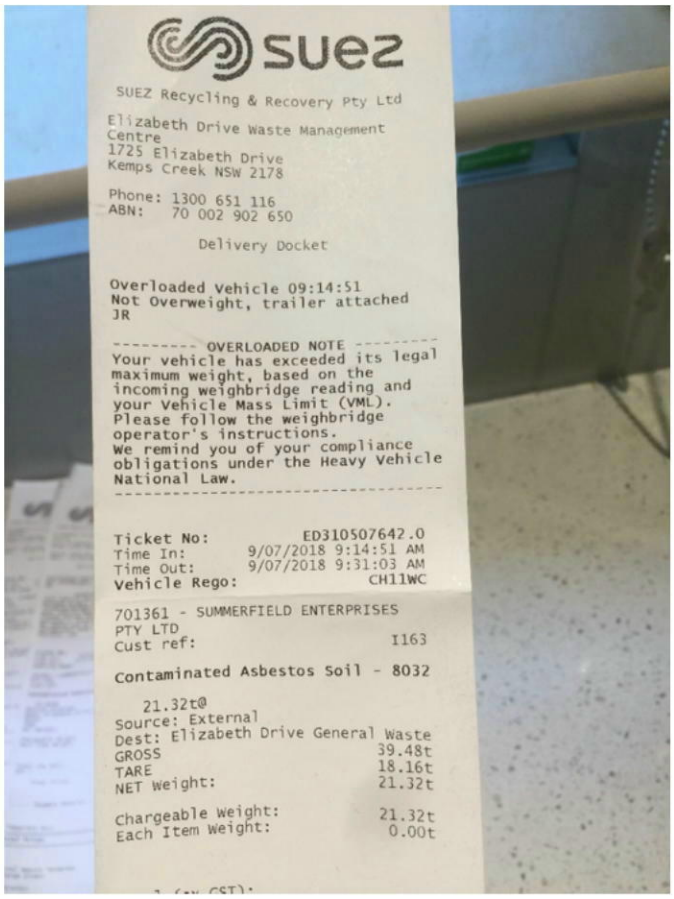

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 09:14:51
Not Overweight, trailer attached
JR

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.


Ticket No: ED310507642.0
Time In: 9/07/2018 9:14:51 AM
Time Out: 9/07/2018 9:31:03 AM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

21.32t@
Source: External
Dest: Elizabeth Drive General Waste
GROSS 39.48t
TARE 18.16t
NET Weight: 21.32t

Chargeable Weight: 21.32t
Each Item Weight: 0.00t

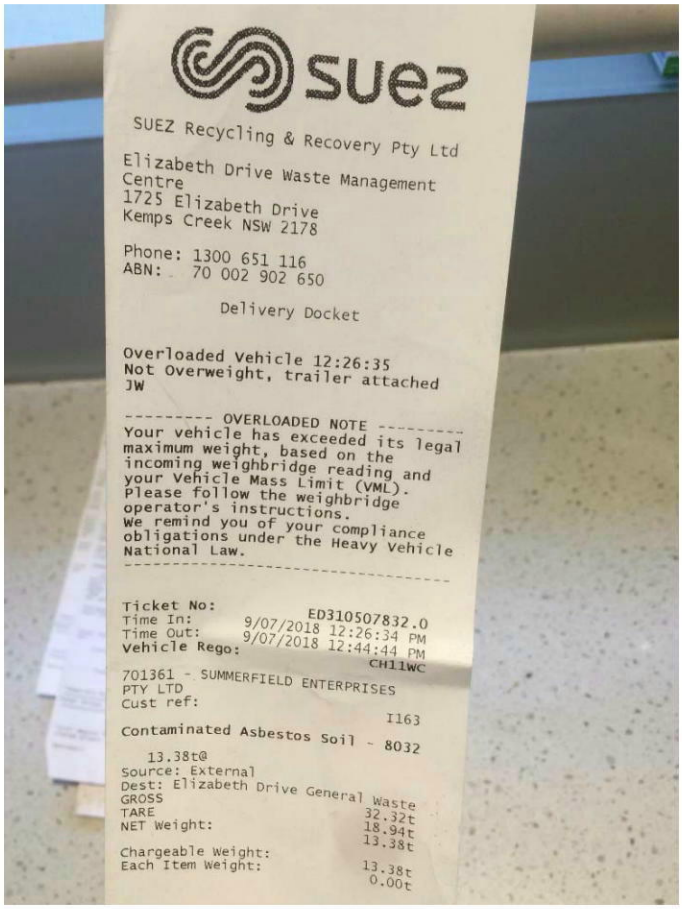

SUEZ Recycling & Recovery Pty Ltd

Elizabeth Drive Waste Management Centre
1725 Elizabeth Drive
Kemps Creek NSW 2178

Phone: 1300 651 116
ABN: 70 002 902 650

Delivery Docket

Overloaded Vehicle 12:26:35
Not Overweight, trailer attached
JW

--------- OVERLOADED NOTE ---------
Your vehicle has exceeded its legal maximum weight, based on the incoming weighbridge reading and your Vehicle Mass Limit (VML).
Please follow the weighbridge operator's instructions.
We remind you of your compliance obligations under the Heavy Vehicle National Law.

Ticket No: ED310507832.0
Time In: 9/07/2018 12:26:34 PM
Time Out: 9/07/2018 12:44:44 PM
Vehicle Rego: CH11WC

701361 - SUMMERFIELD ENTERPRISES PTY LTD
Cust ref: I163

Contaminated Asbestos Soil - 8032

13.38t@
Source: External
Dest: Elizabeth Drive General Waste
GROSS 32.32t
TARE 18.94t
NET Weight: 13.38t

Chargeable Weight: 13.38t
Each Item Weight: 0.00t

APPENDIX B

LABORATORY

ANALYTICAL REPORT

Accreditation No. 2562

CLIENT DETAILS		LABORATORY DETAILS	
Contact	Craig Cowper	Manager	Huong Crawford
Client	ALLIANCE GEOTECHNICAL PTY LTD	Laboratory	SGS Alexandria Environmental
Address	10 Welder Road Seven Hills NSW 2147	Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	0407 989 885	Telephone	+61 2 8594 0400
Facsimile	02 9675 1888	Facsimile	+61 2 8594 0499
Email	c.cowper@allgeo.com.au	Email	au.environmental.sydney@sgs.com
Project	**7161 Jordan Springs**	SGS Reference	**SE181230 R0**
Order Number	**P1501**	Date Received	09 Jul 2018
Samples	10	Date Reported	10 Jul 2018

COMMENTS

Accredited for compliance with ISO/IEC 17025 - Testing. NATA accredited laboratory 2562(4354).

SIGNATORIES

Ly Kim Ha
Organic Section Head

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE181230.001 Sample Matrix: Soil Sample Date: 09 Jul 2018 Sample Name: SP03-11/01	SE181230.002 Soil 09 Jul 2018 SP03-11/02	SE181230.003 Soil 09 Jul 2018 SP03-11/03	SE181230.004 Soil 09 Jul 2018 SP03-11/04
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 10/7/2018						
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Phenanthrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Chrysene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Total PAH (18)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	84	96	90	96
2-fluorobiphenyl (Surrogate)	%	-	82	92	88	88
d14-p-terphenyl (Surrogate)	%	-	74	86	84	86
Moisture Content Method: AN002 Tested: 9/7/2018						
% Moisture	%w/w	0.5	8.7	12	7.8	11

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Parameter	Units	LOR	Sample Number: SE181230.005 Sample Matrix: Soil Sample Date: 09 Jul 2018 Sample Name: SP03-11/05	SE181230.006 Soil 09 Jul 2018 SP03-11/06	SE181230.007 Soil 09 Jul 2018 SP03-11/07	SE181230.008 Soil 09 Jul 2018 SP03-11/08
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 10/7/2018						
Naphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Acenaphthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Phenanthrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Chrysene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2	<0.2	<0.2
Total PAH (18)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	0.8	<0.8	<0.8	<0.8	<0.8
Surrogates						
d5-nitrobenzene (Surrogate)	%	-	92	92	96	88
2-fluorobiphenyl (Surrogate)	%	-	90	94	90	88
d14-p-terphenyl (Surrogate)	%	-	88	84	86	80
Moisture Content Method: AN002 Tested: 9/7/2018						
% Moisture	%w/w	0.5	6.2	8.3	7.5	11

Parameter	Units	LOR	Sample Number: SE181230.009 Sample Matrix: Soil Sample Date: 09 Jul 2018 Sample Name: SP03-11/09	Sample Number: SE181230.010 Sample Matrix: Soil Sample Date: 09 Jul 2018 Sample Name: DUP01
PAH (Polynuclear Aromatic Hydrocarbons) in Soil Method: AN420 Tested: 10/7/2018				
Naphthalene	mg/kg	0.1	<0.1	<0.1
2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1
1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1
Acenaphthylene	mg/kg	0.1	<0.1	<0.1
Acenaphthene	mg/kg	0.1	<0.1	<0.1
Fluorene	mg/kg	0.1	<0.1	<0.1
Phenanthrene	mg/kg	0.1	<0.1	<0.1
Anthracene	mg/kg	0.1	<0.1	<0.1
Fluoranthene	mg/kg	0.1	<0.1	<0.1
Pyrene	mg/kg	0.1	<0.1	<0.1
Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1
Chrysene	mg/kg	0.1	<0.1	<0.1
Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1
Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1
Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1
Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1
Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1
Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1
Carcinogenic PAHs, BaP TEQ <LOR=0	TEQ (mg/kg)	0.2	<0.2	<0.2
Carcinogenic PAHs, BaP TEQ <LOR=LOR	TEQ (mg/kg)	0.3	<0.3	<0.3
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	TEQ (mg/kg)	0.2	<0.2	<0.2
Total PAH (18)	mg/kg	0.8	<0.8	<0.8
Total PAH (NEPM/WHO 16)	mg/kg	0.8	<0.8	<0.8
Surrogates				
d5-nitrobenzene (Surrogate)	%	-	86	90
2-fluorobiphenyl (Surrogate)	%	-	84	84
d14-p-terphenyl (Surrogate)	%	-	82	84
Moisture Content Method: AN002 Tested: 9/7/2018				
% Moisture	%w/w	0.5	6.1	7.2

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

QC SUMMARY

MB blank results are compared to the Limit of Reporting
LCS and MS spike recoveries are measured as the percentage of analyte recovered from the sample compared the the amount of analyte spiked into the sample.
DUP and MSD relative percent differences are measured against their original counterpart samples according to the formula : *the absolute difference of the two results divided by the average of the two results as a percentage.* Where the DUP RPD is 'NA' , the results are less than the LOR and thus the RPD is not applicable.

Moisture Content **Method: ME-(AU)-[ENV]AN002**

Parameter	QC Reference	Units	LOR	DUP %RPD
% Moisture	LB151547	%w/w	0.5	8 - 14%

PAH (Polynuclear Aromatic Hydrocarbons) in Soil **Method: ME-(AU)-[ENV]AN420**

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
Naphthalene	LB151576	mg/kg	0.1	<0.1	0%	99%
2-methylnaphthalene	LB151576	mg/kg	0.1	<0.1	0%	NA
1-methylnaphthalene	LB151576	mg/kg	0.1	<0.1	0%	NA
Acenaphthylene	LB151576	mg/kg	0.1	<0.1	0%	100%
Acenaphthene	LB151576	mg/kg	0.1	<0.1	0%	98%
Fluorene	LB151576	mg/kg	0.1	<0.1	0%	NA
Phenanthrene	LB151576	mg/kg	0.1	<0.1	0 - 79%	94%
Anthracene	LB151576	mg/kg	0.1	<0.1	0%	107%
Fluoranthene	LB151576	mg/kg	0.1	<0.1	0 - 81%	97%
Pyrene	LB151576	mg/kg	0.1	<0.1	0 - 79%	91%
Benzo(a)anthracene	LB151576	mg/kg	0.1	<0.1	0 - 18%	NA
Chrysene	LB151576	mg/kg	0.1	<0.1	0 - 18%	NA
Benzo(b&j)fluoranthene	LB151576	mg/kg	0.1	<0.1	0 - 18%	NA
Benzo(k)fluoranthene	LB151576	mg/kg	0.1	<0.1	0%	NA
Benzo(a)pyrene	LB151576	mg/kg	0.1	<0.1	0%	115%
Indeno(1,2,3-cd)pyrene	LB151576	mg/kg	0.1	<0.1	0%	NA
Dibenzo(ah)anthracene	LB151576	mg/kg	0.1	<0.1	0%	NA
Benzo(ghi)perylene	LB151576	mg/kg	0.1	<0.1	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=0	LB151576	TEQ (mg/kg)	0.2	<0.2	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR	LB151576	TEQ (mg/kg)	0.3	<0.3	0%	NA
Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	LB151576	TEQ (mg/kg)	0.2	<0.2	0%	NA
Total PAH (18)	LB151576	mg/kg	0.8	<0.8	0 - 37%	NA
Total PAH (NEPM/WHO 16)	LB151576	mg/kg	0.8	<0.8		

Surrogates

Parameter	QC Reference	Units	LOR	MB	DUP %RPD	LCS %Recovery
d5-nitrobenzene (Surrogate)	LB151576	%	-	92%	2 - 8%	102%
2-fluorobiphenyl (Surrogate)	LB151576	%	-	90%	7 - 25%	102%
d14-p-terphenyl (Surrogate)	LB151576	%	-	90%	5 - 15%	102%

METHOD SUMMARY

METHOD	METHODOLOGY SUMMARY
AN002	The test is carried out by drying (at either 40°C or 105°C) a known mass of sample in a weighed evaporating basin. After fully dry the sample is re-weighed. Samples such as sludge and sediment having high percentages of moisture will take some time in a drying oven for complete removal of water.
AN420	(SVOCs) including OC, OP, PCB, Herbicides, PAH, Phthalates and Speciated Phenols (etc) in soils, sediments and waters are determined by GCMS/ECD technique following appropriate solvent extraction process (Based on USEPA 3500C and 8270D).
AN420	Carcinogenic PAHs may be expressed as Benzo(a)pyrene equivalents by applying the BaP toxicity equivalence factor (NEPM 1999, June 2013, B7). These can be reported as the individual PAHs and as a sum of carcinogenic PAHs. The sum is reported three ways, the first assuming all <LOR results are zero, the second assuming all < LOR results are half the LOR and the third assuming all <LOR results are the LOR.

FOOTNOTES

IS	Insufficient sample for analysis.	LOR	Limit of Reporting
LNR	Sample listed, but not received.	↑↓	Raised or Lowered Limit of Reporting
*	NATA accreditation does not cover the performance of this service.	QFH	QC result is above the upper tolerance
**	Indicative data, theoretical holding time exceeded.	QFL	QC result is below the lower tolerance
		-	The sample was not analysed for this analyte
		NVL	Not Validated

Samples analysed as received.
Solid samples expressed on a dry weight basis.

Where "Total" analyte groups are reported (for example, Total PAHs, Total OC Pesticides) the total will be calculated as the sum of the individual analytes, with those analytes that are reported as <LOR being assumed to be zero. The summed (Total) limit of reporting is calcuated by summing the individual analyte LORs and dividing by two. For example, where 16 individual analytes are being summed and each has an LOR of 0.1 mg/kg, the "Totals" LOR will be 1.6 / 2 (0.8 mg/kg). Where only 2 analytes are being summed, the "Total" LOR will be the sum of those two LORs.

Some totals may not appear to add up because the total is rounded after adding up the raw values.

If reported, measurement uncertainty follow the ± sign after the analytical result and is expressed as the expanded uncertainty calculated using a coverage factor of 2, providing a level of confidence of approximately 95%, unless stated otherwise in the comments section of this report.

Results reported for samples tested under test methods with codes starting with ARS-SOP, radionuclide or gross radioactivity concentrations are expressed in becquerel (Bq) per unit of mass or volume or per wipe as stated on the report. Becquerel is the SI unit for activity and equals one nuclear transformation per second.
Note that in terms of units of radioactivity:

a. 1 Bq is equivalent to 27 pCi
b. 37 MBq is equivalent to 1 mCi

For results reported for samples tested under test methods with codes starting with ARS-SOP, less than (<) values indicate the detection limit for each radionuclide or parameter for the measurement system used. The respective detection limits have been calculated in accordance with ISO 11929.

The QC criteria are subject to internal review according to the SGS QAQC plan and may be provided on request or alternatively can be found here : http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical%20Documents/MP-AU-ENV-QU-022%20QA%20QC%20Plan.pdf

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law .

This report must not be reproduced, except in full.

STATEMENT OF QA/QC PERFORMANCE

SE181230 R0

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1501**
Samples	10

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
SGS Reference	**SE181230 R0**
Date Received	09 Jul 2018
Date Reported	10 Jul 2018

COMMENTS

All the laboratory data for each environmental matrix was compared to SGS' stated Data Quality Objectives (DQO). Comments arising from the comparison were made and are reported below.

The data relating to sampling was taken from the Chain of Custody document and was supplied by the Client.
This QA/QC Statement must be read in conjunction with the referenced Analytical Report.
The Statement and the Analytical Report must not be reproduced except in full.

All Data Quality Objectives were met (within the SGS Alexandria Environmental laboratory).

SAMPLE SUMMARY

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	10 Soil
Date documentation received	9/7/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	9.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Next Day		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

HOLDING TIME SUMMARY

SE181230 R0

SGS holding time criteria are drawn from current regulations and are highly dependent on sample container preservation as specified in the SGS "Field Sampling Guide for Containers and Holding Time" (ref: GU-(AU)-ENV.001). Soil samples guidelines are derived from NEPM "Schedule B(3) Guideline on Laboratory Analysis of Potentially Contaminated Soils". Water sample guidelines are derived from "AS/NZS 5667.1 : 1998 Water Quality - sampling part 1" and APHA "Standard Methods for the Examination of Water and Wastewater" 21st edition 2005.

Extraction and analysis holding time due dates listed are calculated from the date sampled, although holding times may be extended after laboratory extraction for some analytes. The due dates are the suggested dates that samples may be held before extraction or analysis and still be considered valid.

Extraction and analysis dates are shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria. If the sampled date is not supplied then compliance with criteria cannot be determined. If the received date is after one or both due dates then holding time will fail by default.

Moisture Content — Method: ME-(AU)-[ENV]AN002

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-11/01	SE181230.001	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/02	SE181230.002	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/03	SE181230.003	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/04	SE181230.004	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/05	SE181230.005	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/06	SE181230.006	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/07	SE181230.007	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/08	SE181230.008	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
SP03-11/09	SE181230.009	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018
DUP01	SE181230.010	LB151547	09 Jul 2018	09 Jul 2018	23 Jul 2018	09 Jul 2018	14 Jul 2018	10 Jul 2018

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN420

Sample Name	Sample No.	QC Ref	Sampled	Received	Extraction Due	Extracted	Analysis Due	Analysed
SP03-11/01	SE181230.001	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/02	SE181230.002	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/03	SE181230.003	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/04	SE181230.004	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/05	SE181230.005	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/06	SE181230.006	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/07	SE181230.007	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/08	SE181230.008	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
SP03-11/09	SE181230.009	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018
DUP01	SE181230.010	LB151576	09 Jul 2018	09 Jul 2018	23 Jul 2018	10 Jul 2018	19 Aug 2018	10 Jul 2018

Surrogate results are evaluated against upper and lower limit criteria established in the SGS QA/QC plan (Ref: MP-(AU)-[ENV]QU-022). At least two of three routine level soil sample surrogate spike recoveries for BTEX/VOC are to be within 70-130% where control charts have not been developed and within the established control limits for charted surrogates. Matrix effects may void this as an acceptance criterion. Water sample surrogate spike recoveries are to be within 40-130%. The presence of emulsions, surfactants and particulates may void this as an acceptance criterion.

Result is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — **Method: ME-(AU)-[ENV]AN420**

Parameter	Sample Name	Sample Number	Units	Criteria	Recovery %
2-fluorobiphenyl (Surrogate)	SP03-11/01	SE181230.001	%	70 - 130%	82
	SP03-11/02	SE181230.002	%	70 - 130%	92
	SP03-11/03	SE181230.003	%	70 - 130%	88
	SP03-11/04	SE181230.004	%	70 - 130%	88
	SP03-11/05	SE181230.005	%	70 - 130%	90
	SP03-11/06	SE181230.006	%	70 - 130%	94
	SP03-11/07	SE181230.007	%	70 - 130%	90
	SP03-11/08	SE181230.008	%	70 - 130%	86
	SP03-11/09	SE181230.009	%	70 - 130%	84
	DUP01	SE181230.010	%	70 - 130%	84
d14-p-terphenyl (Surrogate)	SP03-11/01	SE181230.001	%	70 - 130%	74
	SP03-11/02	SE181230.002	%	70 - 130%	86
	SP03-11/03	SE181230.003	%	70 - 130%	84
	SP03-11/04	SE181230.004	%	70 - 130%	86
	SP03-11/05	SE181230.005	%	70 - 130%	88
	SP03-11/06	SE181230.006	%	70 - 130%	84
	SP03-11/07	SE181230.007	%	70 - 130%	86
	SP03-11/08	SE181230.008	%	70 - 130%	80
	SP03-11/09	SE181230.009	%	70 - 130%	82
	DUP01	SE181230.010	%	70 - 130%	84
d5-nitrobenzene (Surrogate)	SP03-11/01	SE181230.001	%	70 - 130%	84
	SP03-11/02	SE181230.002	%	70 - 130%	98
	SP03-11/03	SE181230.003	%	70 - 130%	90
	SP03-11/04	SE181230.004	%	70 - 130%	96
	SP03-11/05	SE181230.005	%	70 - 130%	92
	SP03-11/06	SE181230.006	%	70 - 130%	92
	SP03-11/07	SE181230.007	%	70 - 130%	96
	SP03-11/08	SE181230.008	%	70 - 130%	86
	SP03-11/09	SE181230.009	%	70 - 130%	86
	DUP01	SE181230.010	%	70 - 130%	90

Blank results are evaluated against the limit of reporting (LOR), for the chosen method and its associated instrumentation, typically 2.5 times the statistically determined method detection limit (MDL).

Result is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result
LB151576.001		Naphthalene	mg/kg	0.1	<0.1
		2-methylnaphthalene	mg/kg	0.1	<0.1
		1-methylnaphthalene	mg/kg	0.1	<0.1
		Acenaphthylene	mg/kg	0.1	<0.1
		Acenaphthene	mg/kg	0.1	<0.1
		Fluorene	mg/kg	0.1	<0.1
		Phenanthrene	mg/kg	0.1	<0.1
		Anthracene	mg/kg	0.1	<0.1
		Fluoranthene	mg/kg	0.1	<0.1
		Pyrene	mg/kg	0.1	<0.1
		Benzo(a)anthracene	mg/kg	0.1	<0.1
		Chrysene	mg/kg	0.1	<0.1
		Benzo(a)pyrene	mg/kg	0.1	<0.1
		Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1
		Dibenzo(ah)anthracene	mg/kg	0.1	<0.1
		Benzo(ghi)perylene	mg/kg	0.1	<0.1
		Total PAH (18)	mg/kg	0.8	<0.8
	Surrogates	d5-nitrobenzene (Surrogate)	%	-	92
		2-fluorobiphenyl (Surrogate)	%	-	90
		d14-p-terphenyl (Surrogate)	%	-	90

Duplicates are calculated as Relative Percentage Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

Moisture Content

Method: ME-(AU)-[ENV]AN002

Original	Duplicate	Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE181229A.021	LB151547.011	% Moisture	%w/w	0.5	5.1	4.4	51	14
SE181230.009	LB151547.022	% Moisture	%w/w	0.5	8.1	8.7	42	8
SE181233.004	LB151547.028	% Moisture	%w/w	0.5	7.82190132379	9.0445859872	42	14

PAH (Polynuclear Aromatic Hydrocarbons) in Soil

Method: ME-(AU)-[ENV]AN420

Original	Duplicate		Parameter	Units	LOR	Original	Duplicate	Criteria %	RPD %
SE181230.010	LB151576.014		Naphthalene	mg/kg	0.1	<0.1	<0.1	200	0
			2-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
			1-methylnaphthalene	mg/kg	0.1	<0.1	<0.1	200	0
			Acenaphthylene	mg/kg	0.1	<0.1	<0.1	200	0
			Acenaphthene	mg/kg	0.1	<0.1	<0.1	200	0
			Fluorene	mg/kg	0.1	<0.1	<0.1	200	0
			Phenanthrene	mg/kg	0.1	<0.1	<0.1	200	0
			Anthracene	mg/kg	0.1	<0.1	<0.1	200	0
			Fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
			Pyrene	mg/kg	0.1	<0.1	<0.1	200	0
			Benzo(a)anthracene	mg/kg	0.1	<0.1	<0.1	200	0
			Chrysene	mg/kg	0.1	<0.1	<0.1	200	0
			Benzo(b&j)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
			Benzo(k)fluoranthene	mg/kg	0.1	<0.1	<0.1	200	0
			Benzo(a)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
			Indeno(1,2,3-cd)pyrene	mg/kg	0.1	<0.1	<0.1	200	0
			Dibenzo(ah)anthracene	mg/kg	0.1	<0.1	<0.1	200	0
			Benzo(ghi)perylene	mg/kg	0.1	<0.1	<0.1	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=0	mg/kg	0.2	<0.2	<0.2	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	mg/kg	0.3	<0.3	<0.3	134	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	mg/kg	0.2	<0.2	<0.2	175	0
			Total PAH (18)	mg/kg	0.8	<0.8	<0.8	200	0
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.5	0.5	30	2
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.4	0.5	30	7
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.4	0.4	30	5
SE181233.004	LB151576.019		Naphthalene	mg/kg	0.1	0.01	0.01	200	0
			2-methylnaphthalene	mg/kg	0.1	0.02	0.01	200	0
			1-methylnaphthalene	mg/kg	0.1	0.01	0.01	200	0
			Acenaphthylene	mg/kg	0.1	0.01	0.04	200	0
			Acenaphthene	mg/kg	0.1	0	0	200	0
			Fluorene	mg/kg	0.1	0	0.03	200	0
			Phenanthrene	mg/kg	0.1	0.09	0.23	93	79
			Anthracene	mg/kg	0.1	0.01	0.06	200	0
			Fluoranthene	mg/kg	0.1	0.11	0.26	84	81
			Pyrene	mg/kg	0.1	0.1	0.23	91	79
			Benzo(a)anthracene	mg/kg	0.1	0.06	0.12	141	18
			Chrysene	mg/kg	0.1	0.07	0.12	135	18
			Benzo(b&j)fluoranthene	mg/kg	0.1	0.08	0.12	130	18
			Benzo(k)fluoranthene	mg/kg	0.1	0.04	0.07	200	0
			Benzo(a)pyrene	mg/kg	0.1	0.05	0.09	173	0
			Indeno(1,2,3-cd)pyrene	mg/kg	0.1	0.05	0.09	173	0
			Dibenzo(ah)anthracene	mg/kg	0.1	0.01	0.01	200	0
			Benzo(ghi)perylene	mg/kg	0.1	0.05	0.08	184	0
			Carcinogenic PAHs, BaP TEQ <LOR=0	mg/kg	0.2	0	0.0332	200	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR	mg/kg	0.3	0.242	0.2442	133	0
			Carcinogenic PAHs, BaP TEQ <LOR=LOR/2	mg/kg	0.2	0.121	0.1387	164	0
			Total PAH (18)	mg/kg	0.8	0.21	1.16	147	37
		Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.38	0.41	30	8
			2-fluorobiphenyl (Surrogate)	mg/kg	-	0.45	0.35	30	25
			d14-p-terphenyl (Surrogate)	mg/kg	-	0.49	0.42	30	15

Laboratory Control Standard (LCS) results are evaluated against an expected result, typically the concentration of analyte spiked into the control during the sample preparation stage, producing a percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA /QC plan (Ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended dagger symbol (†) when outside suggested criteria.

PAH (Polynuclear Aromatic Hydrocarbons) in Soil — Method: ME-(AU)-[ENV]AN420

Sample Number		Parameter	Units	LOR	Result	Expected	Criteria %	Recovery %
LB151576.002		Naphthalene	mg/kg	0.1	4.0	4	60 - 140	99
		Acenaphthylene	mg/kg	0.1	4.0	4	60 - 140	100
		Acenaphthene	mg/kg	0.1	3.9	4	60 - 140	98
		Phenanthrene	mg/kg	0.1	3.8	4	60 - 140	94
		Anthracene	mg/kg	0.1	4.3	4	60 - 140	107
		Fluoranthene	mg/kg	0.1	3.9	4	60 - 140	97
		Pyrene	mg/kg	0.1	3.7	4	60 - 140	91
		Benzo(a)pyrene	mg/kg	0.1	4.6	4	60 - 140	115
	Surrogates	d5-nitrobenzene (Surrogate)	mg/kg	-	0.5	0.5	40 - 130	102
		2-fluorobiphenyl (Surrogate)	mg/kg	-	0.5	0.5	40 - 130	102
		d14-p-terphenyl (Surrogate)	mg/kg	-	0.5	0.5	40 - 130	102

MATRIX SPIKES

SE181230 R0

Matrix Spike (MS) results are evaluated as the percentage recovery of an expected result, typically the concentration of analyte spiked into a field sub -sample during the sample preparation stage. The original sample's result is subtracted from the sub-sample result before determining the percentage recovery. The criteria applied to the percentage recovery is established in the SGS QA/QC plan (ref: MP-(AU)-[ENV]QU-022). For more information refer to the footnotes in the concluding page of this report.

Recovery is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spikes were required for this job.

MATRIX SPIKE DUPLICATES

SE181230 R0

Matrix spike duplicates are calculated as Relative Percent Difference (RPD) using the formula: RPD = | OriginalResult - ReplicateResult | x 100 / Mean

The original result is the analyte concentration of the matrix spike. The Duplicate result is the analyte concentration of the matrix spike duplicate.

The RPD is evaluated against the Maximum Allowable Difference (MAD) criteria and can be graphically represented by a curve calculated from the Statistical Detection Limit (SDL) and Limiting Repeatability (LR) using the formula: MAD = 100 x SDL / Mean + LR

Where the Maximum Allowable Difference evaluates to a number larger than 200 it is displayed as 200.

RPD is shown in **Green** when within suggested criteria or **Red** with an appended reason identifer when outside suggested criteria. Refer to the footnotes section at the end of this report for failure reasons.

No matrix spike duplicates were required for this job.

Samples analysed as received.

Solid samples expressed on a dry weight basis.

QC criteria are subject to internal review according to the SGS QA/QC plan and may be provided on request or alternatively can be found here: http://www.sgs.com.au/~/media/Local/Australia/Documents/Technical Documents/MP-AU-ENV-QU-022 QA QC Plan.pdf

*	NATA accreditation does not cover the performance of this service.
**	Indicative data, theoretical holding time exceeded.
-	Sample not analysed for this analyte.
IS	Insufficient sample for analysis.
LNR	Sample listed, but not received.
LOR	Limit of reporting.
QFH	QC result is above the upper tolerance.
QFL	QC result is below the lower tolerance.

①	At least 2 of 3 surrogates are within acceptance criteria.
②	RPD failed acceptance criteria due to sample heterogeneity.
③	Results less than 5 times LOR preclude acceptance criteria for RPD.
④	Recovery failed acceptance criteria due to matrix interference.
⑤	Recovery failed acceptance criteria due to the presence of significant concentration of analyte (i.e. the concentration of analyte exceeds the spike level).
⑥	LOR was raised due to sample matrix interference.
⑦	LOR was raised due to dilution of significantly high concentration of analyte in sample.
⑧	Reanalysis of sample in duplicate confirmed sample heterogeneity and inconsistency of results.
⑨	Recovery failed acceptance criteria due to sample heterogeneity.
⑩	LOR was raised due to high conductivity of the sample (required dilution).
†	Refer to Analytical Report comments for further information.

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client only. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

This test report shall not be reproduced, except in full.

SAMPLE RECEIPT ADVICE

SE181230

CLIENT DETAILS

Contact	Craig Cowper
Client	ALLIANCE GEOTECHNICAL PTY LTD
Address	10 Welder Road Seven Hills NSW 2147
Telephone	0407 989 885
Facsimile	02 9675 1888
Email	c.cowper@allgeo.com.au
Project	**7161 Jordan Springs**
Order Number	**P1501**
Samples	10

LABORATORY DETAILS

Manager	Huong Crawford
Laboratory	SGS Alexandria Environmental
Address	Unit 16, 33 Maddox St Alexandria NSW 2015
Telephone	+61 2 8594 0400
Facsimile	+61 2 8594 0499
Email	au.environmental.sydney@sgs.com
Samples Received	Mon 9/7/2018
Report Due	Tue 10/7/2018
SGS Reference	**SE181230**

SUBMISSION DETAILS

This is to confirm that 10 samples were received on Monday 9/7/2018. Results are expected to be ready by COB Tuesday 10/7/2018. Please quote SGS reference SE181230 when making enquiries. Refer below for details relating to sample integrity upon receipt.

Samples clearly labelled	Yes	Complete documentation received	Yes
Sample container provider	SGS	Sample cooling method	Ice Bricks
Samples received in correct containers	Yes	Sample counts by matrix	10 Soil
Date documentation received	9/7/2018	Type of documentation received	COC
Samples received in good order	Yes	Samples received without headspace	Yes
Sample temperature upon receipt	9.3°C	Sufficient sample for analysis	Yes
Turnaround time requested	Next Day		

Unless otherwise instructed, water and bulk samples will be held for one month from date of report, and soil samples will be held for two months.

COMMENTS

1 Sample on hold

This document is issued by the Company under its General Conditions of Service accessible at www.sgs.com/en/Terms-and-Conditions.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

SAMPLE RECEIPT ADVICE

SE181230

CLIENT DETAILS

Client ALLIANCE GEOTECHNICAL PTY LTD

Project 7161 Jordan Springs

SUMMARY OF ANALYSIS

No.	Sample ID	Moisture Content	PAH (Polynuclear Aromatic Hydrocarbons) In Soil
001	SP03-11/01	1	26
002	SP03-11/02	1	26
003	SP03-11/03	1	26
004	SP03-11/04	1	26
005	SP03-11/05	1	26
006	SP03-11/06	1	26
007	SP03-11/07	1	26
008	SP03-11/08	1	26
009	SP03-11/09	1	26
010	DUP01	1	26

The above table represents SGS' interpretation of the client-supplied Chain Of Custody document.
The numbers shown in the table indicate the number of results requested in each package.
Please indicate as soon as possible should your request differ from these details .
Testing as per this table shall commence immediately unless the client intervenes with a correction .

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

source: [Untitled].pdf page: 1 SGS Ref: SE181230_COC

CHAIN OF CUSTODY & ANALYSIS REQUEST

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	P1501
	Seven Hills NSW	Results Required By:	24 Hour T/A
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	envro@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	WATER	SOIL	PRESERVATIVE	NO OF CONTAINERS	Sulfates	Chlorides	pH	Resistivity	Exchangeable Sodium %	Conductivity	PAH
SP03-11/01	09/07/18	1		X	ICE	1							X
SP03-11/02		2		X		1							X
SP03-11/03		3		X		1							X
SP03-11/04		4		X		1							X
SP03-11/05		5		X		1							X
SP03-11/06		6		X		1							X
SP03-11/07		7		X		1							X
SP03-11/08		8		X		1							X
SP03-11/09		9		X		1							X
DUP01		10		X		1							X

SGS EHS Alexandria Laboratory

SE181230 COC
Received: 09 – Jul – 2018

Relinquished By:	Date/Time: 09/07/12 @ 1230	Received By: Ness	Date/Time 9/7/18 2:50
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

CHAIN OF CUSTODY & ANALYSIS REQUEST

Page 2 of 2

SGS Environmental Services
Unit 16, 33 Maddox Street
Alexandria NSW 2015
Telephone No: (02) 85940400
Facsimile No: (02) 85940499
Email: au.samplereceipt.sydney@sgs.com

Company Name:	Alliance Geotechnical Pty Ltd	Project Name/No:	7161 - Jordan Springs
Address:	10 Welder Road,	Purchase Order No:	P1501
	Seven Hills NSW	Results Required By:	24 HOUR T/A
		Telephone:	0407 989 885
Contact Name:	Craig Cowper	Facsimile:	
		Email Results:	enviro@allgeo.com.au

Client Sample ID	Date Sampled	Lab Sample ID	WATER	SOIL	PRESERVATIVE	NO OF CONTAINERS	Sulfates	Chlorides	pH	Resistivity	Exchangeable Sodium %	Conductivity	PAH								
DUP01A	09/07/18			X	ICE	1															HOLD

Relinquished By:	Date/Time: 09/07/12 @ 1230	Received By: Nesse	Date/Time 9/7/18 2:50
Relinquished By:	Date/Time:	Received By:	Date/Time
Samples Intact: Yes/ No	Temperature: Ambient / Chilled	Sample Cooler Sealed: Yes/ No	Laboratory Quotation No:
	Comments:		

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

APPENDIX C

PREVIOUS REPORTS

Contamination Management Plan
Western Precinct
Development Phase

Prepared for

Maryland Development Company

Private Road
Off Forrester Road
St Marys 2760

JULY 2008

URS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Project Director:

Seth Molinari
Senior Principal

URS Australia Pty Ltd
Level 3, 116 Miller Street
North Sydney, NSW 2060 Australia
Tel: 61 2 8925 5500
Fax: 61 2 8925 5555

Author:

David Smith
Principal

Date: **7th July 2008**
Reference: 4321 7287
Status: Final

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Contents

Glossary of Abbreviations and Terms ii

1 Introduction ---------- 1-1

1.1 General Introduction 1-1
1.2 Introduction to the Contamination Management Plan 1-4
1.3 Contamination Management Plan Objectives 1-4

2 Contamination Management Plan ---------- 2-1

2.1 Potential Chemical Contamination 2-1
Extensive Contamination 2-2
2.2 Potential Explosive Ordnance Materials 2-2
Further Explosive Ordnance Surveys 2-3
2.3 Temporary Stockpiling of Materials 2-4
2.4 Contaminated Management Plan Flowchart 2-4

3 Summary of Roles & Responsibilities ---------- 3-1

4 Limitations ---------- 4-1

FIGURES

Figure 1 Aerial photograph of the St Marys Property 1-1
Figure 2 Western Precinct (with other developable areas) 1-3
Figure 3 Contamination Management Process 2-4

APPENDICES

Appendix A Site Audit Statements

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Glossary of Abbreviations and Terms

Abbreviation	Term	Definition
Ammunition	Ammunition	A device charged with explosives, propellants, pyrotechnics, initiating composition, or nuclear, biological or chemical material for use in connection with defence or offence including demolitions. Certain ammunition can be used for training, ceremonial or other non-operational purposes.
Category A	Category A ordnance items	An item clearly of a military nature and which might readily be recognised by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and containing explosive filling, but excluding small arms ammunition.
Category B	Category B ordnance items -	An item clearly of a military nature and which might readily be recognised by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and not containing explosive filling, but excluding small arms ammunition.
CMP (2003)	Contamination Management Plan for the Eastern Precinct	The Contamination Management Plan prepared in 2003 and submitted to Blacktown City Council and other authorities as required by the Site Audit Statements issued in the Stage 2 Decontamination Audit of ADI St Marys Munitions Factory, dated 7th June 1999.
CMP	Contamination Management Plan	The Contamination Management Plan issued to support Precinct Plan(s).
DPP	Dunheved Precinct Plan	The Dunheved Precinct Plans set out the future pattern of development for the Dunheved Precinct. The Plan was adopted by Penrith City Council on 11 December 2006 and by Blacktown City Council on 12 January 2007.
DUXOP	Defence Unexploded Ordnance Panel	The panel of contractors and consultants from whom the Department of Defence selects members for UXO related tasks.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Abbreviation	Term	Definition
EPP	Eastern Precinct Plan	The Eastern Precinct Plan sets out the future pattern of development for the Eastern Precinct. The Plan was adopted by Blacktown City Council on 4 February 2004.
Induction	Site Specific Induction	Section 8(2) of the OHS Act requires employers to ensure that persons other than their workers are not exposed to risks while in the employer's workplace. These persons include contractors, customers and visitors. If there are significant risks in the workplace, there may be a need for site induction training and procedures for managing people while on the premises.[1]
Property	Property	The whole of the landholding by St Marys Land Limited and which is sometimes called the St Marys Property for the purposes of its rezoning and redevelopment.
Site	Site	The subject area, where potential contamination has been found.
UXO	Unexploded Ordnance	Explosive ordnance that has been primed, fused, armed or otherwise prepared for action and which has been fired, dropped, launched, projected or placed in such a manner as to constitute a hazard to operations, installations, personnel or material but remains unexploded either by malfunction or design or for any cause. UXO includes items of military ammunition or explosives removed from their original resting-place for any reason, including souveniring.

[1] "http://www.workcover.nsw.gov.au/Employers/LegalResponsibility/default.htm" WorkCover's webpage on 18th September 2006

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

1.1 General Introduction

The former Australian Defence Industries (ADI) Property (the Property) at St Marys was endorsed by the NSW Government for inclusion on the Urban Development Program in 1993. The Property was seen to present an opportunity to provide housing for Sydney's growing population within an environmentally sustainable framework.

The Property is located approximately 45km west of the Sydney CBD, 5km north-east of the Penrith City Centre and 12km west of the Blacktown City Centre. The main western railway is located approximately 2.5km south of the Property. The Great Western Highway is located another 1 km south and the M4 Motorway a further 1.5km south.

The Property has an area of 1,545ha, and stretches roughly 7 kilometres from east to west and nearly 3 kilometres from north to south, from Forrester Road, St Marys in the east to The Northern Road, Cranebrook in the west, and is bounded by Llandilo and Willmot in the north and Cambridge Gardens / Werrington County and the Dunheved Industrial Area in the south. Figure 1, following, illustrates the location of the Property.

Figure 1 Aerial photograph of the St Marys Property



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Given that the Property straddles the boundary between two local government areas (Blacktown and Penrith), the NSW Government decided that a regional environmental plan should be prepared covering development of the Property. Technical investigations into the environmental values and development capability of the land were commenced in 1994, and the Regional Environmental Plan for St Marys (Sydney Regional Environmental Plan No. 30 (SREP 30)) was gazetted in January, 2001. SREP 30 zoned the land for a combination of "urban", "employment", "regional open space", and "regional park" uses.

A package of documents was prepared to guide and control development comprising SREP 30 (maps and a written instrument) and an Environmental Planning Strategy (EPS) which sets out performance objectives and strategies to address key constraints associated with the Property, including: conservation, cultural heritage, water and soils, transport, urban form, energy and waste, human services, employment and land contamination.

In December 2002, a Deed of Agreement was entered into between the landowner and developers of the land (a Joint Venture comprising ComLand and Lend Lease Development) and the NSW Government setting out the developer's and State Government's responsibilities in providing services and infrastructure.


SREP 30 identified six development "precincts" (known as the Western Precinct, Central Precinct, North and South Dunheved Precincts, Ropes Creek Precinct and Eastern Precinct) within the Property.

SREP 30 requires that a Precinct Plan, addressing the issues in SREP 30 and the EPS (including preparation of management plans for a range of key issues), be adopted by Council prior to any development taking place.

In March 2002, the Commonwealth Government advised that those areas of the Property listed on the Register of the National Estate should be excluded from urban development. This had the effect of changing the boundaries of the areas to be set aside for conservation. SREP 30 was subsequently amended in April 2006 to reflect these boundary changes. The precincts available for development are shown in Figure 2 below.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Figure 2 Western Precinct (with other developable areas)

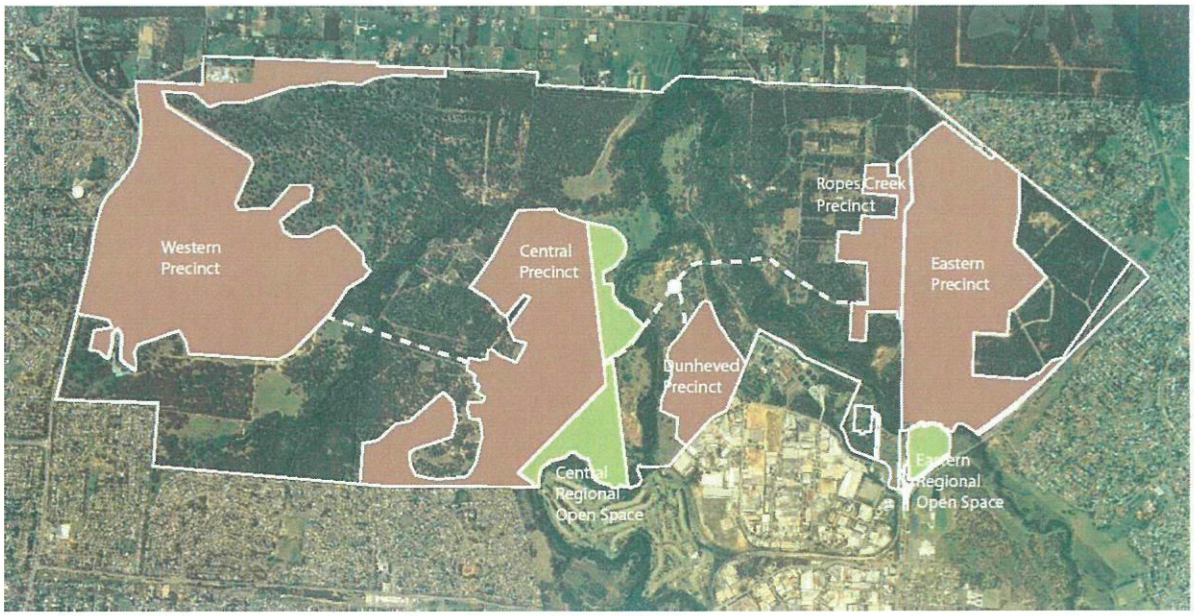

On 29 September 2006, the Minister for Planning declared the Western Precinct a Release Area, paving the way for the preparation of a Precinct Plan for this area. The Western Precinct, the subject of this CMP, occupies an area of approximately 229 hectares. Although currently zoned under SREP 30 for both Urban and Employment uses, there is a draft amendment to SREP 30 currently being prepared under which the entire Western Precinct is zoned Urban.

A Precinct Plan for the Eastern Precinct (FPP) was adopted by Blacktown City Council (BCC) on 4 February 2004. The EPP incorporated a Contamination Management Plan (CMP) prepared by URS in 2003, and other management plans, and an accompanying Development Control Strategy (DCS). The Dunheved Precinct Plans have since been adopted by Penrith City Council and Blacktown City Council.

Since completion of the CMP (2003), development of the Eastern Precinct Release Area has progressed and additional site investigations have been completed as required by Site Audit Statements.

In addition, the Department of Environment and Conservation (DEC) (incorporating the NSW Environment Protection Authority and now known as the NSW Department of Environment and Climate Change (DECC)) has provided advice to Site Auditors that "*auditors should be able to rely on expert opinion* [Department of Defence Unexploded Ordnance panel (DUXOP) consultants] *to form a view about site suitability*" when assessing a site for munitions contamination. Further deliberations by the DEC and Site Auditors have determined that the presence of munitions items on a site is not likely to be within the ambit purview of a Site Auditor accredited under the Contaminated Land Management Act (1997) – but rather a suitably qualified expert in procedures for the location, handling and disposal of munitions items. Such experts can be found in, but are not limited to, the DUXOP.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Notwithstanding this change in process, the 1999 Site Audit Statements for the St Marys property have addressed the issue of potential UXO contamination.

Bulk earthworks commenced in the Eastern Precinct on 8 December 2004. Development applications for the construction of the Ropes Creek Bridge and the Southern Entry Road into the site have been submitted to BCC and Penrith City Council.

Subsequently, CMPs have been prepared by URS for the North and South Dunheved Precincts (2004), Ropes Creek and Eastern Precincts (2006) and the Eastern Regional Park (2006).

This CMP (Western Precinct Contamination Management Plan) has been prepared to support the lodgement of the Western Precinct Plan and takes into account current site knowledge including and DECC guidance relating to the reliance on specialist consultants for use in the development phase prior to sub-division.

1.2 Introduction to the Contamination Management Plan

The Western Precinct was the subject of extensive investigation during the 1990s. The investigation work was undertaken with the full involvement of the EPA and subsequently an independent NSW EPA accredited Site Auditor who produced and issued Site Audit Statements for the whole of the St Marys Property (*Stage 2 Decontamination Audit of ADI St Marys Munitions Factory*, dated 7 June 1999).

The investigation and remediation programme for the Property commenced in 1990, with the objective of assessing the nature, degree of chemical contamination and remediating to a level suitable for redevelopment for a variety of land uses including residential. For the purposes of the remediation and validation, the Property was divided into nine sectors. The Western Precinct covers part of the following sectors as follows:

- Part Western Sector — Covered by SAS CHK001/1.
- Part Southern West Sector — Covered by SASs CHK001/1, CHK001/6 and CHK001/7.

The information presented in the remediation and validation reports for these sectors has been considered, along with other relevant information for the Property, to develop this CMP (Western Precinct).

The majority of the Western Precinct was assessed by the Site Auditor to pose a negligible risk to the public or the environment with regard to chemical contamination and/or explosive ordnance (See SASs as listed above in Appendix A). Conditions on the SASs required investigation and assessment of areas underlying roadways which had not been investigated at the date of the SASs.

1.3 Contamination Management Plan Objectives

The objective of this CMP is to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the natural environment.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Unexpected finds may occur in areas which, although searched extensively, contain remnant materials which were obscured by the local topography, the type of surface cover (e.g. building) or at a depth preventing detection. The Site Auditor considered that, while explosive ordnance may be uncovered during earthworks, it is unlikely that these will present an unacceptable risk provided appropriate procedures for the safe handling and disposal of such material are adopted.

The successful implementation of the CMP requires the appropriate briefing and Site Specific OHS Induction of Site Operatives who may uncover potential chemical contamination (including potential asbestos containing materials) and/or explosive ordnance. It is proposed this briefing will include the review of this CMP and the associated flow chart (Figure 3 on p2-4).

This CMP describes reporting procedures and lines of responsibility (See Section 3). These experts should include those with detailed knowledge of the remediation which has been undertaken at the Property and details on the location of, and access to, the supporting documents related to the assessment and remediation of the Western Precinct.

The Property has been remediated, audited and declared suitable for its intended land uses, and remnant contamination, if present, is most likely to be discovered during the development earthworks which will occur prior to subdivision.

The approaches included in this CMP are intended for use only during the site preparation phase of development, during which structures may be demolished and disposed of, land levels may be altered and redundant infrastructure is removed and new infrastructure is installed.

Subsequent plans, if required, will be administered through the relevant local government authority.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

The operation of the CMP is described in the attached flow-chart (Figure 3).

The objective of the CMP is to provide clear guidance on the safe and appropriate actions in the event of encountering potential chemical or explosive ordnance contamination during site development works. Where such material is uncovered the CMP prescribes the quarantining of the relevant area of concern, allowing other site works to proceed unhindered, while the area of concern is assessed and, if necessary, remediated and validated.

Where required, reference should be made to the extensive library of documents containing information on the historic assessment and remediation of the site. This library provides a valuable source of information which can be drawn on to provide support for development of remedial and/or assessment approaches.

Two classes of potential contamination are discussed separately below: chemical (including potential asbestos containing materials) and ordnance.

2.1 Potential Chemical Contamination

Potential chemical contamination may be indicated in the field by:

- Discoloured soils;
- Odorous soils;
- Potentially asbestos containing sheeting, fragments or insulation materials; or
- The presence of other foreign materials, such as drums, waste dumps or building rubble which could be a source of contamination.

If the Site Manager considers material to be potential chemical contamination the area will be quarantined and a suitably qualified Environmental Consultant will be contacted. The Environmental Consultant will be responsible for assessing the findings, taking samples to characterise and delineate the extent of the potential contamination and defining appropriate remedial actions, if required.

Suspected asbestos containing materials should be managed in accordance with relevant WorkCover requirements and a site specific Asbestos Management Plan.

If deemed necessary by the Environmental Consultant, the contamination will be removed for disposal at a suitably licensed facility in accordance with *Waste Classification Guidelines* (NSW DECC, April 2008). The resultant excavation will be validated by the Environmental Consultant and a report on the remediation and subsequent validation will be completed and, if appropriate, be reviewed and approved by an independent NSW EPA accredited Site Auditor. The quarantine barriers can be removed and the earthworks continued upon receipt of advice from the Environmental Consultant, issue of an SAS, or preliminary advice from the Site Auditor.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

If the area is determined by the Environmental Consultant to not be contaminated or the analyses meet the relevant site validation criteria, the Environmental Consultant should notify the Site Manager that the quarantine restrictions on the area can be lifted and the works in that area may resume. The Environmental Consultant will prepare a report on the investigation and the conclusions drawn.

Extensive Contamination

In the event that assessment by the Environmental Consultant identifies that the contamination is extensive[2] in its lateral and/or vertical extent, then the Environmental Consultant will prepare a sampling and analysis plan to delineate the contamination and assess the extent of any remediation required. The sampling and analysis plan must be reviewed by the independent Site Auditor, who would be engaged to review the works and issue a new SAS, on successful completion of the works.

2.2 Potential Explosive Ordnance Materials

Potential explosive ordnance material may be indicated in the field by:

- Munitions shells;
- Flares;
- Ammunition packaging;
- Grenade components; or
- Metal debris not identifiable as non-munitions or of uncertain origin.

Should potential ordnance material be uncovered, the earthworks will cease immediately and the Site Manager informed. The area should be quarantined, by means of some appropriate barrier to prevent access to the area to protect the workforce from potential injury.

The Site Manager will make a preliminary assessment of the find and determine whether it is some miscellaneous debris, a fragment of ordnance or a potentially explosive device.

Where the Site Manager can identify the item as non-ordnance debris or a minor harmless fragment of ordnance debris, the material should be removed from the excavation and disposed of appropriately.

Where it is considered to be a potentially explosive device, the Site Manager shall contact an appropriately qualified Ordnance Contractor, to assess the item and the area.

Should the Ordnance Contractor consider the object(s) to be non-ordnance or harmless fragments of ordnance, the object(s) can be removed and disposed of appropriately. The quarantine restrictions can be lifted and the earthworks continued.

[2] When the area is sufficiently large to warrant audit of the remediation and issue of a replacement Site Audit Statement, the Environmental Consultant will advise when to engage an Auditor reflecting contemporary industry practise. Less than 1000 m^2 would not immediately qualify.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

If the Ordnance Contractor identifies the object(s) as potential explosive ordnance, the Ordnance Contractor shall inform the Site Manager, and arrange disposal.

Based on the nature of find, it may be recommended that a geophysical survey of the area be undertaken to establish whether the item was an individual piece, one of a number of pieces or a disposal pit. The survey would be undertaken by the Ordnance Contractor using appropriate equipment. Further surveys are mandatory if the explosive ordnance is considered a Category A item or more than three readily identifiable Category B items are found at one location.

- **Category A** - An item clearly of a military nature and which might readily be recognized by a member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and containing explosive filling, but excluding small arms ammunition.

- **Category B - An item clearly of a military nature and which might readily be recognized by a** member of the public as such (e.g. in effect complete in appearance as a projectile of 20 mm calibre or greater, hand grenade, mortar, bomb, etc) and not containing explosive filling, but excluding small arms ammunition.

This is in accordance with the validation procedures for the earlier site assessments, remediation and audit, and maintains the same level of confidence for the whole Property.

The Ordnance Contractor will prepare a report on the investigations undertaken, remediation works undertaken and validation surveys completed. Subject to review of the Ordnance Contractor's report by a suitably qualified consultant, the quarantine restrictions on the area can be removed and the earthworks resumed. The Site Auditor will be provided with a copy of the Clearance Report for the area issued by the Ordnance Consultant.

Further Explosive Ordnance Surveys

Any additional ordnance surveys should be designed to characterise the extent and character of the ordnance contamination and then (or concurrently) to remove the contaminant so that the area is safe for the development activities to resume. These surveys should be undertaken by an Ordnance Contractor, with the objective of characterising and delineating the extent of the explosive ordnance contamination. Such surveys may, as appropriate, utilise magnetic, electromagnetic or other diagnostic techniques.

In the event that further explosive ordnance is discovered the search area may need to be extended to ensure a suitable buffer zone is searched. A remediation and sampling strategy for the area is to be developed in consultation with the Ordnance Consultant.

All additional finds should be logged and disposed of appropriately. Once the investigation is complete a report on the scope of the investigation, remedial work and results should be produced by the Ordnance Contractor, approved by the Ordnance Consultant and provided to the independent Site Auditor. The quarantine restrictions on the area can be removed and the earthworks resumed.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

2.3 Temporary Stockpiling of Materials

Earthworks in the development phase are likely to, temporarily, generate excess material which may be stockpiled for re-use. Unless some event or observation indicates that the material excavated and placed into the stockpile is potentially contaminated, no particular treatment is required other than normal dust suppression, and erosion controls in accordance with relevant Council requirements.

If assessment by the Environmental Consultant or the Ordnance Contractor identifies contamination that is extensive in its lateral and/or vertical extent, or a stockpile is observed to be contaminated, then the Environmental Consultant will prepare a sampling and analysis or survey plan to delineate the contamination and assess the extent of remediation required. The sampling and analysis plan or survey plan should, as appropriate, be reviewed by the Site Auditor or the Ordnance Consultant.

Subject to the agreement of the relevant Consultant, it may be possible to move and stockpile the affected material. Where temporary stockpiling is permitted such stockpiles shall be installed and maintained to eliminate risk to workers and other people due to exposure to contaminants in dust or vapours and risk to the environment as a result of silt or contamination of stormwater.


Validation sampling or surveying of the contaminated area or stockpile would be required before earthworks continue in that area.

2.4 Contaminated Management Plan Flowchart

Figure 3, following, describes the decision processes in the implementation of this CMP.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

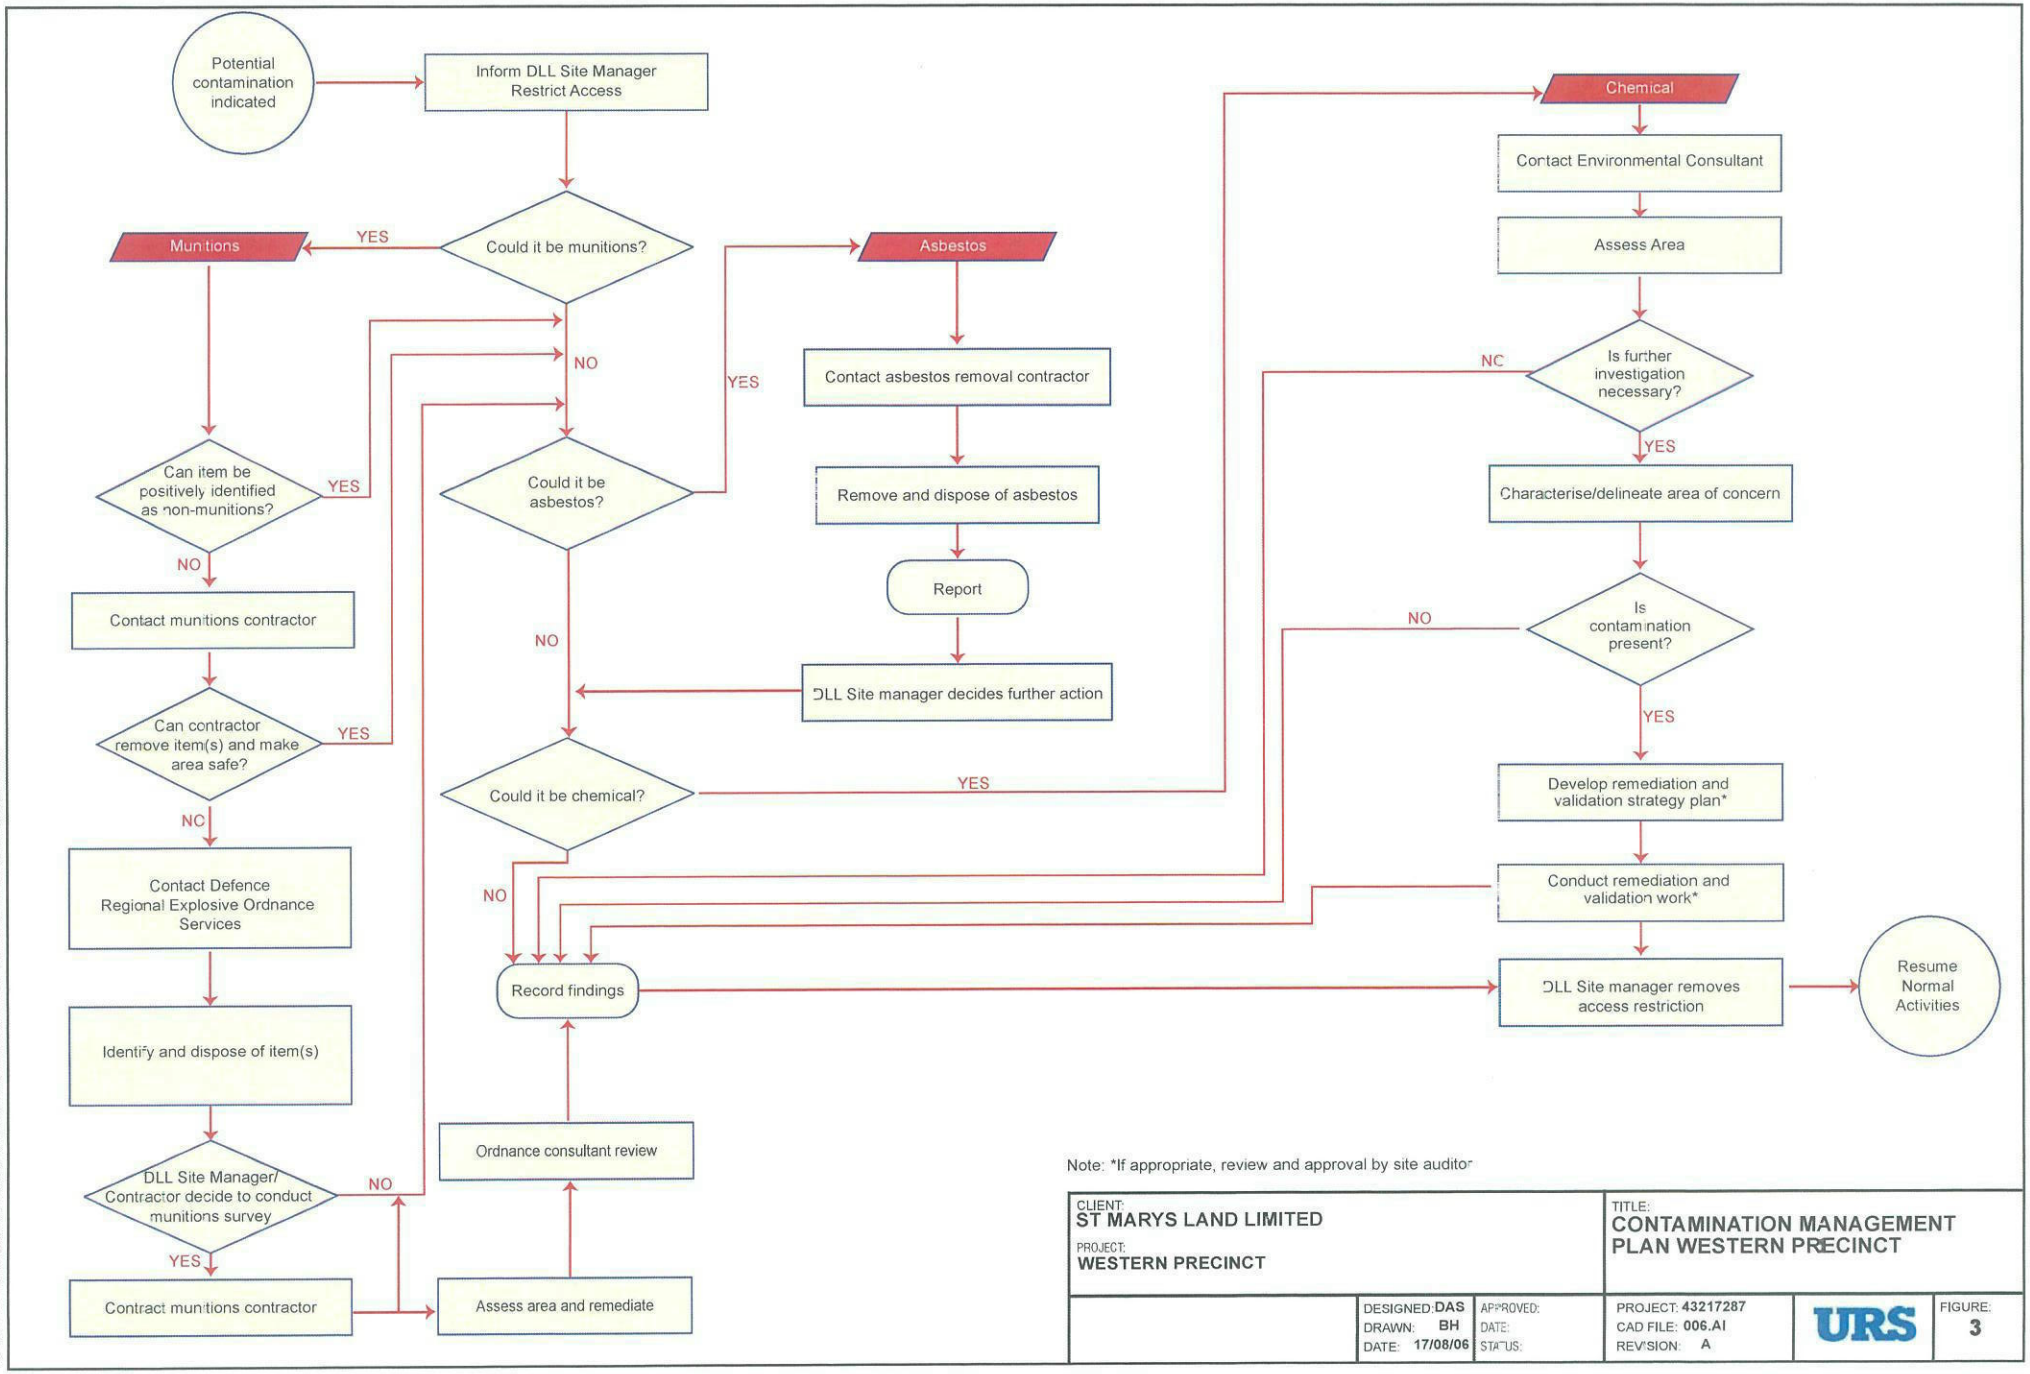

COPYRIGHT © This drawing remains the property of URS Australia Pty Ltd and may not be copied in any way, without prior written approval from URS Australia Pty Ltd.

TWOBSI43217287

Summary of Roles & Responsibilities

SECTION 3

The key roles[3] and responsibilities with respect to this CMP are as follows:

Title	Role
Asbestos Consultant	Responsible for reviewing the assessment of areas contaminated by potential asbestos containing materials. The Asbestos Consultant will provide a brief report which certifies the subject area is free of asbestos and suitable for residential development.
Asbestos or Environmental Contractor	Responsible for removal or treatment of contaminated material in accordance with this procedure and direction by the Environmental Consultant and the Site Manager.
Environmental Consultant	Once called to the site, the Environmental Consultant will be responsible for assessing the potential chemical contamination find, undertaking any necessary sampling and delineation, if required, developing a remedial scope and validating remediation to render the site suitable for residential development. The Environmental Consultant may, as appropriate, have expertise in environmental assessment and/or asbestos assessment. All findings and conclusions will be reported, as appropriate, to the satisfaction of the Site Manager and/or the Site Auditor or asbestos consultant if a Site Audit is not required.
Site Manager:	Responsible for the preliminary assessment of potential contamination and/or ordnance materials discovered and assessing whether further action is required. The Site Manager is responsible for ensuring the induction of Site Operatives, assessing the adequacy of quarantine measures and contacting the relevant Consultant and/or Ordnance Contractors and Site Auditor where appropriate. Once an area is declared free of the contamination, the Site Manager's role will be to remove the quarantine and allow site works to proceed.
Ordnance Consultant	Responsible for reviewing the survey and assessment of areas contaminated by suspected ordnance which is undertaken either as a consequence of discovery of suspect materials or as a requirement of the Site Audit Statements. The Ordnance Consultant, who will be independent of the Ordnance Contractor and be a member of DUXOP, will, when satisfied with information provided by the Ordnance Contractor, provide a letter which confirms the site is suitable for recommencement of development activities.

[3] Contact details are updated as required and can be seen in Appendix A

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Title	Role
Ordnance Contractor	Once called to the site, the Ordnance Contractor will be responsible for assessing the ordnance find, undertaking any surveying sampling and delineation, developing any necessary remedial scope and validating any remediation necessary to render the site suitable for residential development. The Ordnance Contractor shall complete a clearance report on each area investigated and/or remediated and provide a copy for review by the Ordnance Consultant. As necessary, the Ordnance Contractor will conduct surveys of the site and complete reports to validate the remediation of areas where ordnance is discovered for review by the Ordnance Consultant.
Site Auditor	Responsible for reviewing the remediation and assessment of areas contaminated by chemicals which is undertaken either as a consequence of discovery of suspect materials or as a requirement of the Site Audit Statements. The Site Auditor, who will be independent of the Environmental Consultant and accredited by the NSW EPA, will then, when satisfied by the information provided and relying on clearance reports provided by the Ordnance Consultant, issue further Site Audit Statements which certify the site is suitable for residential development.
Site Operatives:	During the works, the Site Operative will be vigilant for potential contamination and/or ordnance. Where potential contamination and/or ordnance is identified, Site Operatives will quarantine the area and inform the Site Manager

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Limitations

SECTION 4

URS Australia Pty Ltd (URS) has prepared this report for the use of Maryland Development Company in accordance with the usual care and thoroughness of the consulting profession. It is based on generally accepted practices and standards at the time it was prepared. No other warranty, expressed or implied, is made as to the professional advice included in this report. It is prepared in accordance with the scope of work and for the purpose outlined in the Proposal dated 12 July 2007.

The methodology adopted and sources of Information used by URS are outlined in this report. URS has made no independent verification of this information beyond the agreed scope of works and URS assumes no responsibility for any inaccuracies or omissions. No indications were found during our investigations that information contained in this report as provided to URS was false.

This report was prepared in the period up to 7th 2008 and is based on the information reviewed at the time of preparation. URS disclaims responsibility for any changes that may have occurred after this time.

This report should be read in full. No responsibility is accepted for use of any part of this report in any other context or for any other purpose or by third parties. This report does not purport to give legal vice. Legal advice can only be given by qualified legal practitioners.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Appendix A
SITE AUDIT STATEMENTS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

NSW Environment Protection Authority
SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/1

Site Auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Envirosciences Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property – excluding Eastern Sector, QEL, Site 6 and Site 23, buildings and concrete stockpile.

Address: Forrester Road, St. Marys	Postcode: 2760
Lot and DP Number:	Lot 2 in DP803832 Lot 2 and 3 in DP223888 (part of) Lot 3 in DP789196 Lot 3 in DP598653 (see attached map for excluded areas)
Local Government Area:	Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton	Company: Department of Urban Affairs and Planning
Address:	Sydney Region West Level 8, Signature Tower 2-10 Wentworth Street Parramatta NSW 2150 Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

• ADI Limited	Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990 - 1999
• Mackie Martin & Associates	Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

1. Historical Report – St Marys Property, ADI Limited, 1996,
2. Validation Report for the Western Sector, ADI St Marys Facility, ADI Limited November 1994;
3. Validation Report for the North Western Sector of the ADI St Marys Facility, Report No. 498800, ADI Limited 1995;
4. Validation Report for the Southern Sector West of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

5. Validation Report for the Southern Sector East of the St Marys Property, Report No. 498810, ADI Limited 1996;
6. Validation Report for the Northern Sector of the ADI St Marys Property, Report No. 498820, ADI Limited 1996;
7. Validation Report for the Cental Sector East of the ADI St Marys Property, Report No. 498840, ADI Limited 1997;
8. Validation Report for the Central Sector West of the ADI St Marys Property, Report No 498840, ADI Limited 1996,
9. Validation Report for the North Eastern Sector of the ADI St Marys Property, Report No. 498850, ADI Limited 1996;
10. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Other Information reviewed:

1. Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
2. Remediation Action Plan for the Northern Sector, ADI St Marys Facility, Report No. 498820, ADI Limited 1996;
3. Remediation Action Plan for Central Eastern Sector, ADI St Marys Facility, Report No. 498840, ADI Limited 1996;
4. Remediation Action Plan for the Eastern Sector of the ADI St Marys Property, Report No. 498830, ADI Limited 1996;
5. Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick **all** appropriate boxes)

(a) **is suitable for the following use(s):**

- ✓ residential, including substantial vegetable garden and poultry;
- ~~☐ residential, including substantial vegetable garden, excluding poultry;~~
- ~~☐ residential with accessible soil, including garden (minimal home-grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ✓ residential with minimal opportunity for soil access including units;
- ✓ daycare centre, preschool, primary school;
- ✓ secondary school;
- ✓ park, recreational open space, playing field;
- ✓ commercial/industrial use;
- ~~☐ Other~~

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

subject to

✓ Conditions

1. Excludes Eastern Sector, QEL, Site 6 and Site 23 which are covered by separate site audit statements, namely CHK001/2, CHK001/3, CHK001/4 and CHK001/5.
2. Excludes areas not yet investigated including the footprint of original buildings, car parks and roads, mainly around former Administration Centre Buildings CHK001/6) and the concrete stockpile in Central Sector West. (Stockpile CHK001/7)
3. An appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, should be lodged prior to the commencement of development earthworks. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).

~~(b) is not suitable for any beneficial use due to risk of harm from contamination~~

~~☐ (comments):~~

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a site auditor (Accreditation No. 9813).

I Certify that:

(a) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and

(b) this statement is to the best of my knowledge, true, accurate and complete. and


(c) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

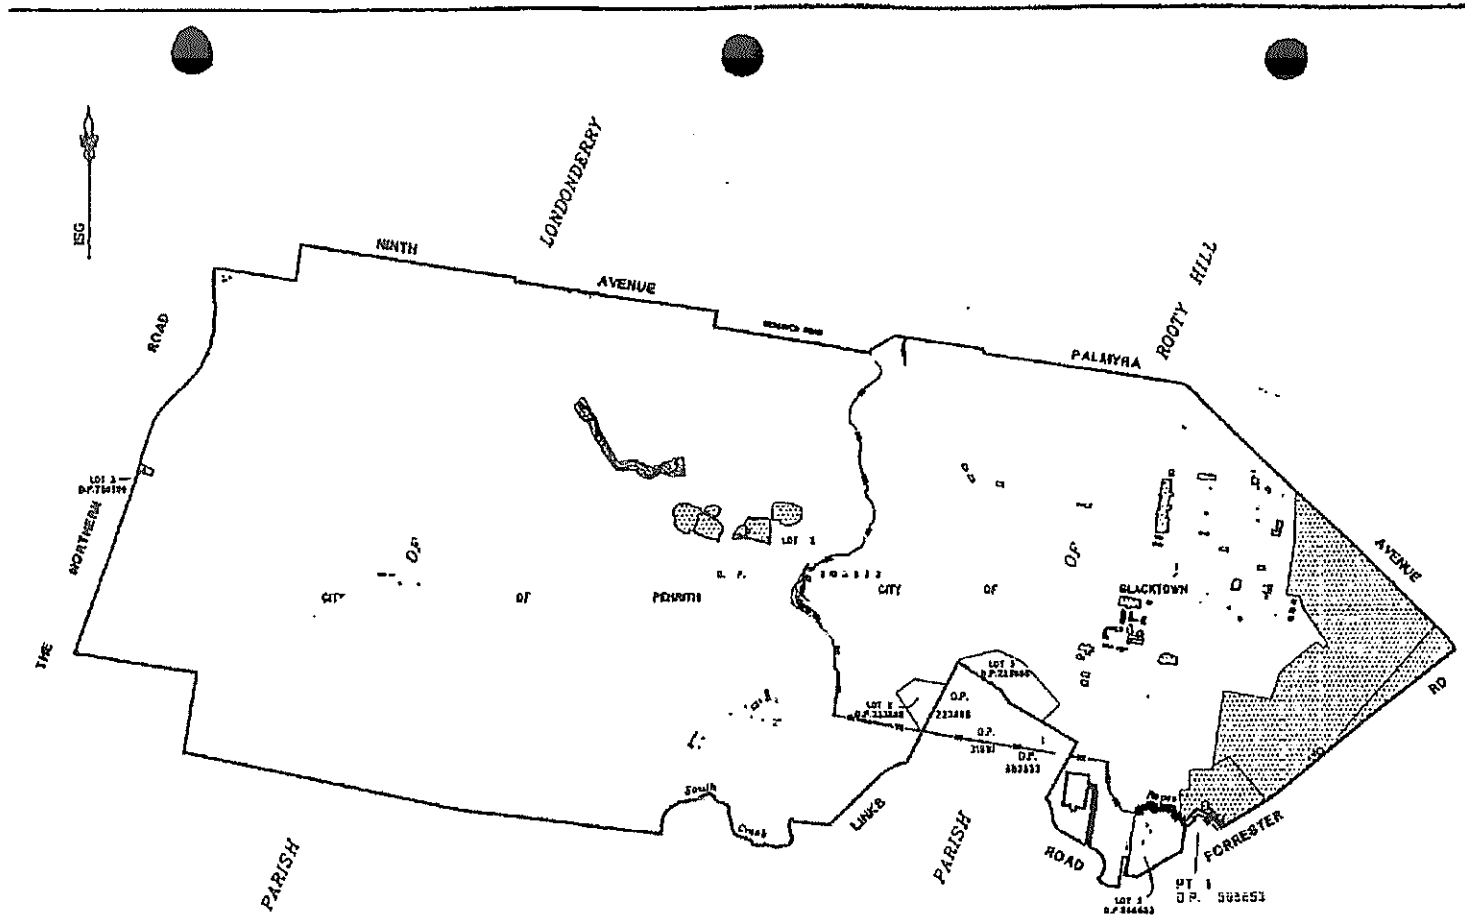

NOTE :

GEOMETRY SHOWN AS SUPPLIED BY ADI LIMITED TO DRW OFFICE 18.5.1999

FOR SITE DETAILS ON EXCLUDED AREAS PLEASE REFER TO DRAWINGS

5467-123
5467-125
5467-126
5467-127
5467-128
5467-129
5467-130
5467-131
5467-132
5467-133
5467-134
5467-135

SHADED AREAS ARE EXCLUDED FROM AUDIT STATEMENT CHK001/1

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans Surveyors Planners Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI Property

ADI ST MARYS PROPERTY PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/1

ORIGINAL SIZE:	A3		
SCALE HOR:	1 : 25 000	VERT:	-
CO-ORDS:	ISG	DATUM:	-
DATE OF SURVEY		DATE OF PLAN:	11 May 1999
SURVEY	-	DRAWN	Acad/MTB
CHECKED:	MTB	DATE	24.5.1999
APPROVED:	PW	DATE	24.5.1999
JOB REF:	8662		
CAD REF:	5467-122.DWG	SHEET 1	OF 13 SHEETS

NSW Environment Protection Authority
SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/6

Site Auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Envirosciences Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property – existing buildings and paved areas scattered about the site.
Address: Forrester Road, St. Marys Postcode: 2760
Lot and DP Number: Lot 2 in DP803832
Lot 2 and 3 in DP223888 (part of)
Lot 3 in DP789196
Lot 3 in DP598653
(see attached 7 maps)
Local Government Area: Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton Company: Department of Urban Affairs and Planning
Address: Sydney Region West
Level 8, Signature Tower
2-10 Wentworth Street
Parramatta NSW 2150
Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

- ADI Limited — Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990 - 1999
- Mackie Martin & Associates — Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

11. Historical Report St Marys Property, ADI Limited, 1996;
12. Validation Report for the Western Sector, ADI St Marys Facility, ADI Limited November 1994;
13. Validation Report for the North Western Sector of the ADI St Marys Facility, Report No. 498800, ADI Limited 1995;
14. Validation Report for the Southern Sector West of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

15. Validation Report for the Southern Sector East of the St Marys Property, Report No. 498810, ADI Limited 1996;
16. Validation Report for the Northern Sector of the ADI St Marys Property, Report No. 498820, ADI Limited 1996;
17. Validation Report for the Cental Sector East of the ADI St Marys Property, Report No. 498840, ADI Limited 1997;
18. Validation Report for the Central Sector West of the ADI St Marys Property, Report No. 498840, ADI Limited 1996;
19. Validation Report for the North Eastern Sector of the ADI St Marys Property, Report No. 498850, ADI Limited 1996;
20. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Other Information reviewed:

6. Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
7. Remediation Action Plan for the Northern Sector, ADI St Marys Facility, Report No. 498820, ADI Limited 1996;
8. Remediation Action Plan for Central Eastern Sector, ADI St Marys Facility, Report No. 498840, ADI Limited 1996;
9. Remediation Action Plan for the Eastern Sector of the ADI St Marys Property, Report No. 498830, ADI Limited 1996;
10. Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys.

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick all appropriate boxes)

(a) is suitable for the following use(s):

- ☐ ~~residential, including substantial vegetable garden and poultry;~~
- ☐ ~~residential, including substantial vegetable garden, excluding poultry;~~
- ☐ ~~residential with accessible soil, including garden (minimal home grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ☐ ~~residential with minimal opportunity for soil access including units;~~
- ☐ ~~daycare centre, preschool, primary school;~~
- ☐ ~~secondary school;~~
- ☐ ~~park, recreational open space, playing field;~~
- ✓ commercial/industrial use;
- ✓ Other – May continue to be used for existing commercial use and carparks, but underlying soils need to be tested for chemical and ordnance contamination after demolition.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

subject to

✓ Conditions

1. Soils under existing buildings, car parks, roads and the concrete stockpile shall be tested for ordnance and/or chemical contamination when these facilities are removed; site audits statements for these areas will also be required.
2. An appropriate management plan, including procedures for the safe handling and disposal of any items of ordnance that may be found during earthworks, should be lodged prior to the commencement of development earthworks. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).

~~(b) is not suitable for any beneficial use due to risk of harm from contamination~~ ☐ ~~(comments):~~

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a Site Auditor (Accreditation No. 9813).

I Certify that:

(a) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and


(b) this statement is to the best of my knowledge, true, accurate and complete, and

(c) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

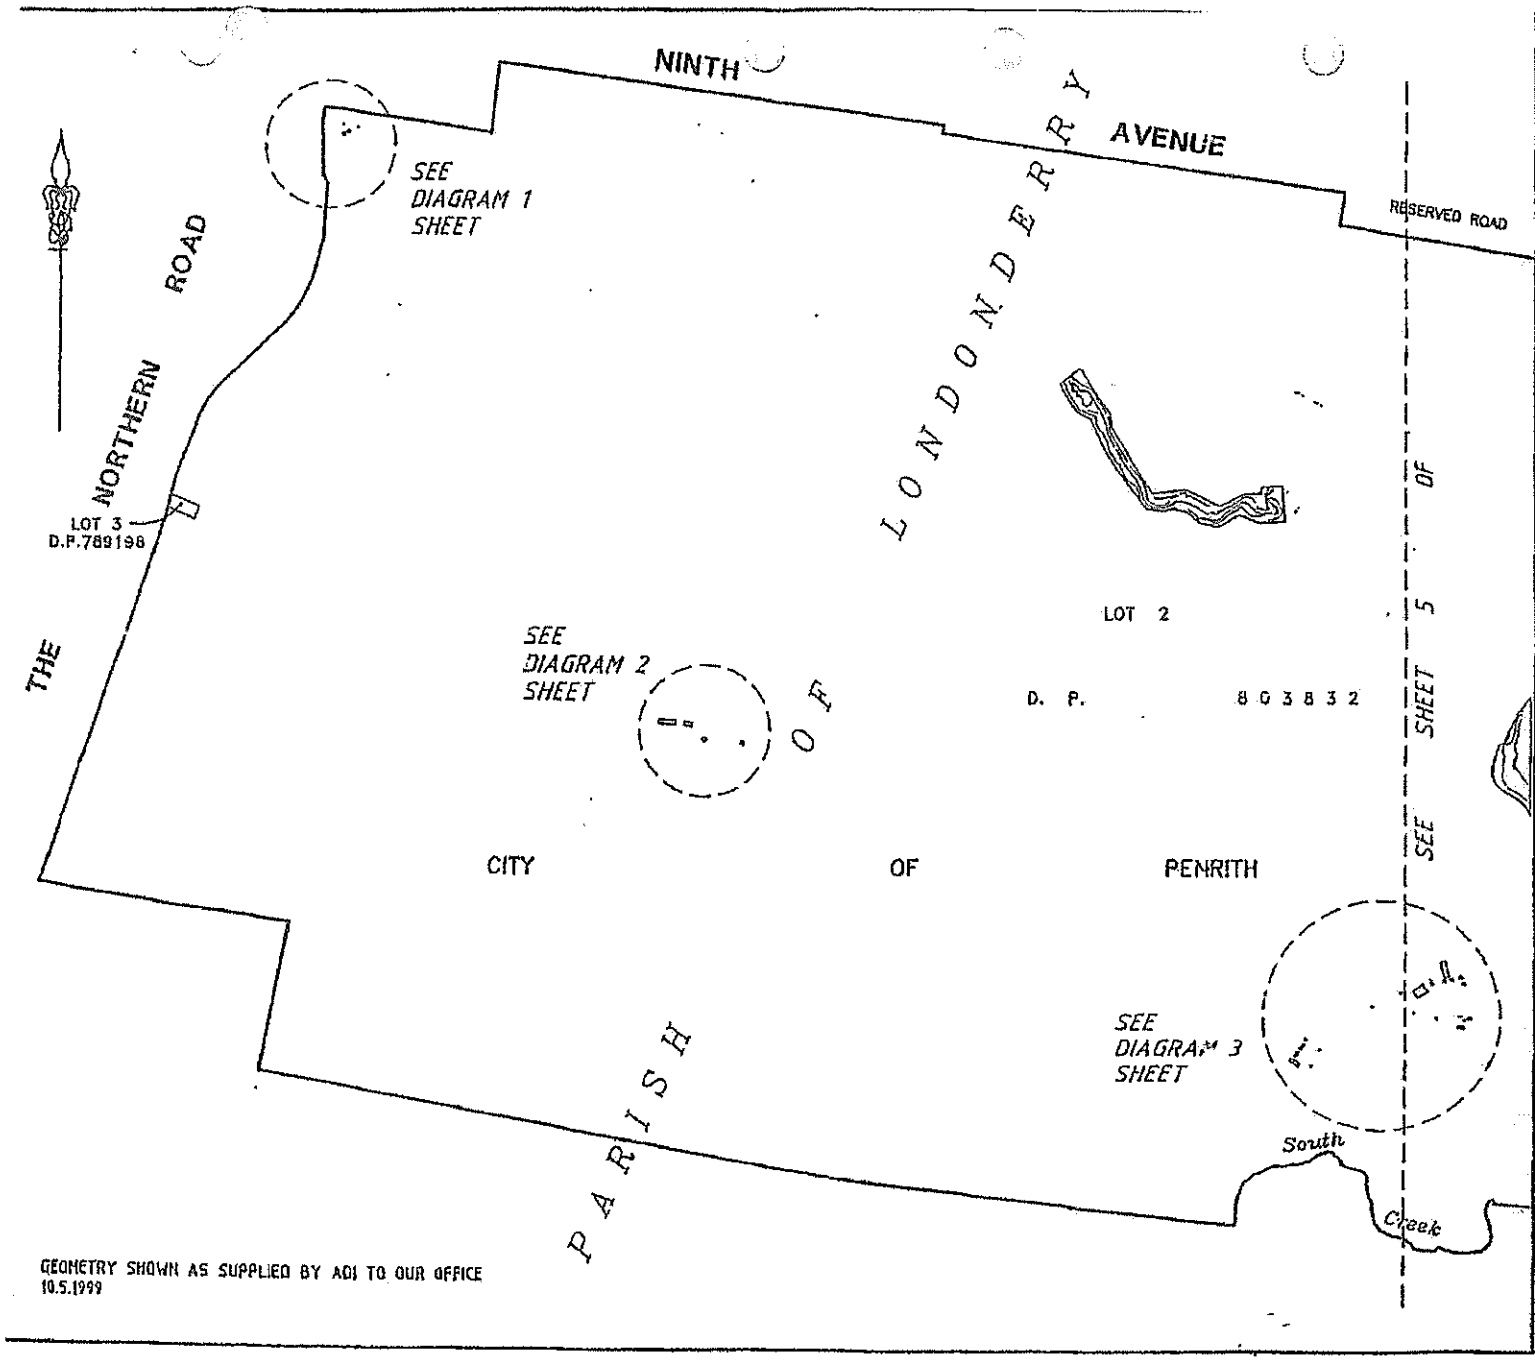

NOTES:

COPYRIGHT © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4133
Facsimile 02) 9630 4699

PREPARED FOR:


ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 1:2500	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: 10 MAY 1999
SURVEY	DRAWN ODW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 8467-126	SHEET 7 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

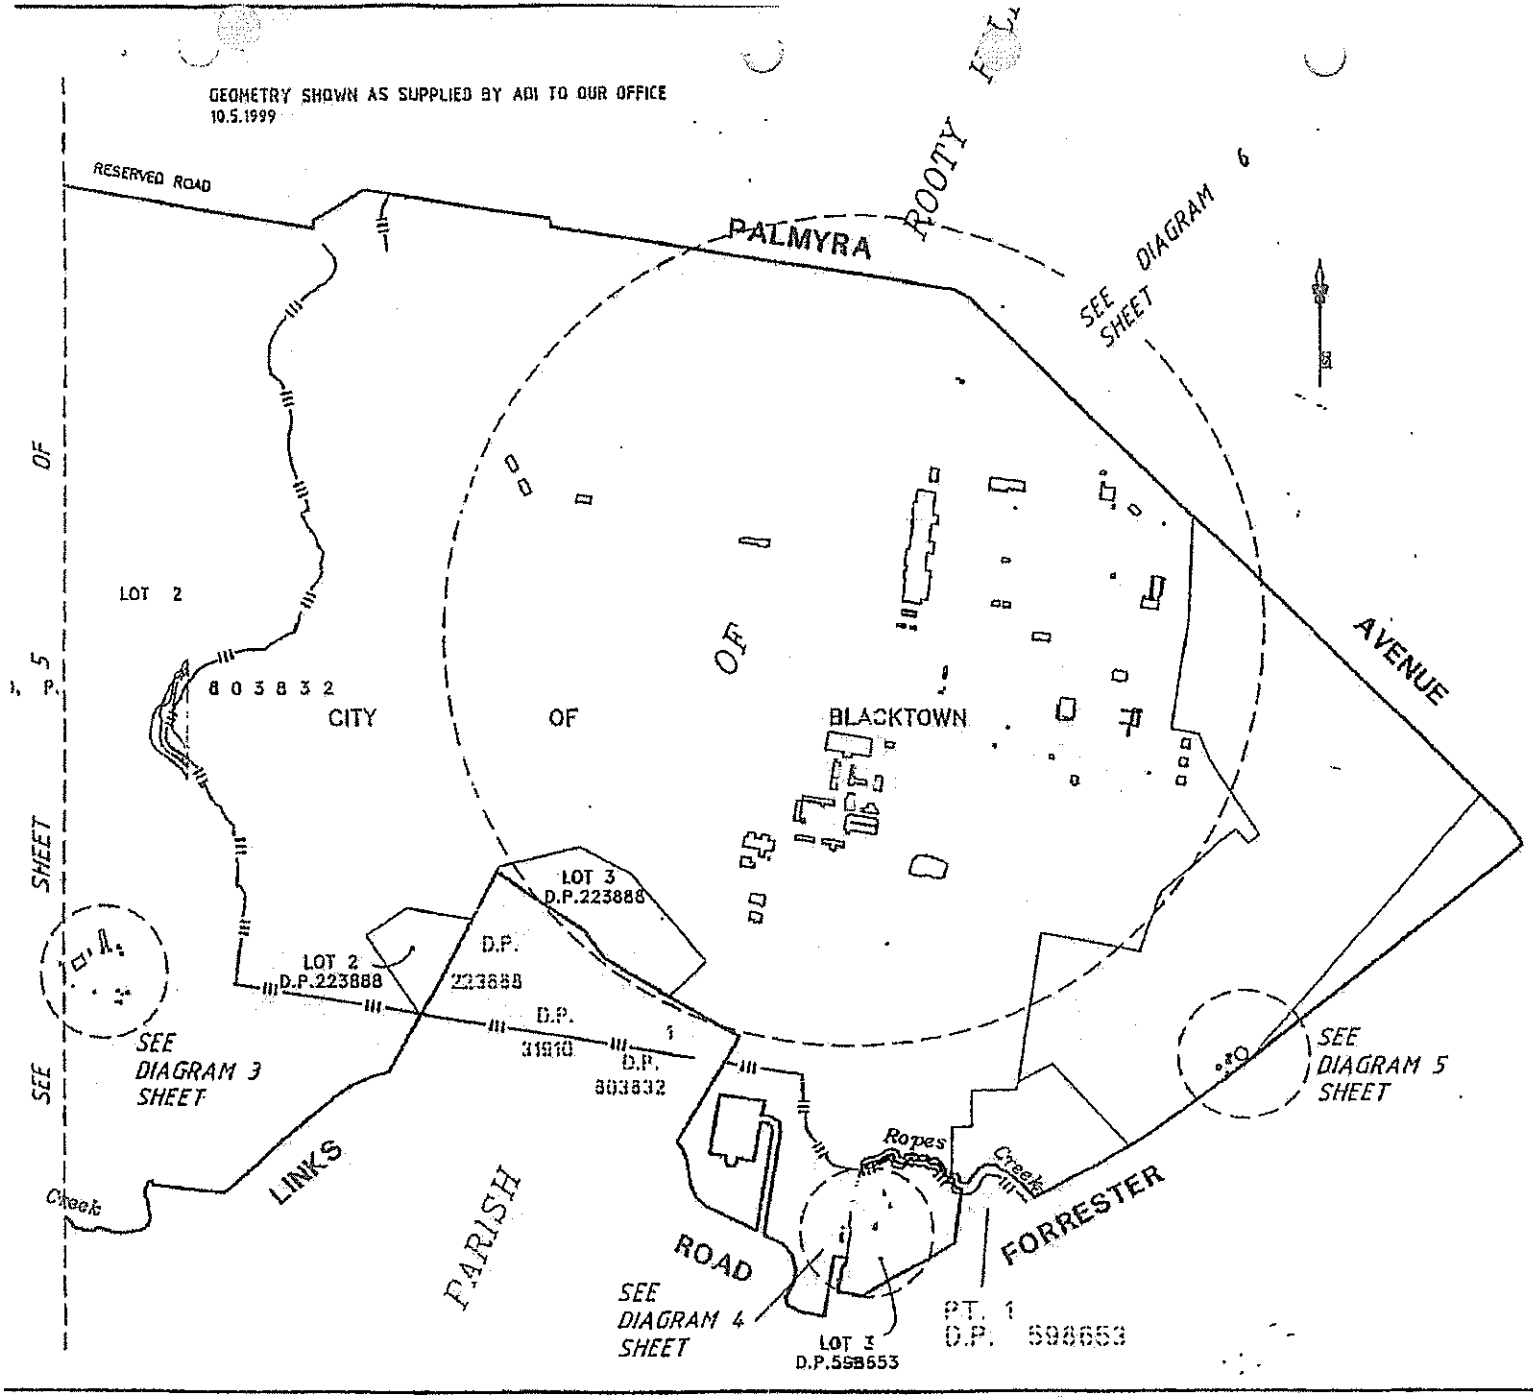

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans
Surveyors
Planners
Geomatic Engineers
Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 1:2500	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: 19 MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 0502	
CAD REF: 5467-125	SHEET 6 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

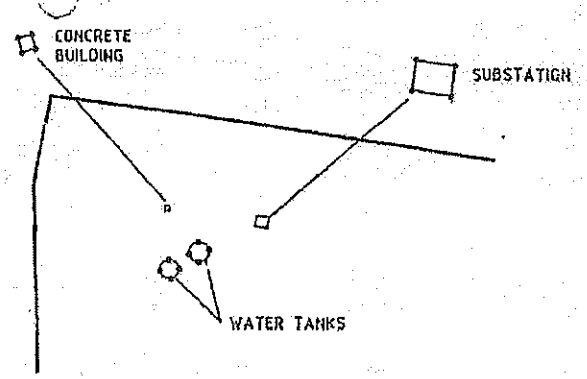


DIAGRAM 1

CONCRETE BUILDING	274588 1267987 274590 1267987 274590 1267985 274588 1267985
SUBSTATION	274625 1267979 274626 1267983 274631 1267982 274630 1267978
WATERTANK	274606 1267968 274603 1267964 274598 1267968 274602 1267972.
WATERTANK	274589 1267965 274586 1267960 274591 1267957 274594 1267960
K6	275465 1266407 275425 1266410 275426 1266422 275466 1266419
K2	275507 1266403 275487 1266407 275488 1266416 275508 1266413
CARETAKERS SHED	275532 1266368 275537 1266377 275546 1266373 275541 1266364
K4	275642 1266357 275635 1266360 275637 1266367 275645 1266364

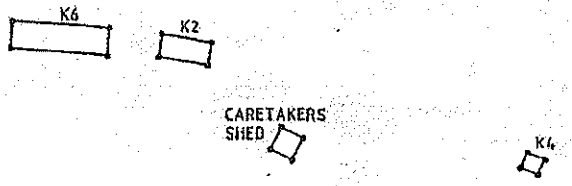


DIAGRAM 2

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

NOTES:

COPYRIGHT © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatics Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3

SCALE HOR: 2000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 5467-127	SHEET 9 OF 13 SHEETS


Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

BOG No	EASTING	NORTHING
X7	277113	1265596
	277111	1265594
	277105	1265598
	277107	1265601
X6	277106	1265581
	277101	1265585
	277091	1265570
	277096	1265566
X4	277076	1265549
	277082	1265545
	277091	1265559
	277086	1265563
X3	277067	1265535
	277072	1265542
	277094	1265527
	277089	1265520
X9	277127	1265521
	277125	1265518
	277122	1265520
	277124	1265523
X5	277142	1265565
	277145	1265563
	277150	1265568
	277145	1265571

BOG No	EASTING	NORTHING
W01	277452	1265655
	277456	1265654
	277457	1265658
	277453	1265658
W04	277475	1265762
	277481	1265760
	277479	1265755
	277474	1265756
W05	277493	1265765
	277500	1265764
	277499	1265759
	277492	1265760
	277433	1265729
	277407	1265712
	277395	1265731
	277418	1265746
	277444	1265749
	277440	1265755
	277444	1265758
	277448	1265751
	277399	1265671
	277397	1265674
	277395	1265672
	277396	1265670
	277360	1265728
	277365	1265731
	277368	1265726
	277363	1265723

BOG No	EASTING	NORTHING
TOILET	277519	1265773
	277521	1265766
	277516	1265765
	277514	1265772
POWER	277283	1265688
	277285	1265686
	277287	1265689
	277286	1265691
W11	277477	1265767
	277468	1265809
	277480	1265811
	277489	1265770
SHED	277439	1265759
	277437	1265763
	277439	1265764
	277441	1265761
CONTROL TOWER	277453	1265658
	277511	1265634
	277527	1265632
	277526	1265626

BOG No	EASTING	NORTHING
W09	277529	1265648
	277530	1265651
	277524	1265652
	277524	1265650
W02	277513	1265658
	277513	1265661
	277520	1265662
	277520	1265659
	277453	1265658
	277511	1265634
	277527	1265632
	277526	1265626
	277536	1265658
	277536	1265652
	277546	1265653
	277546	1265659

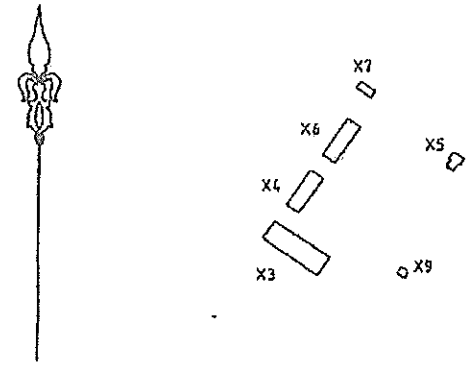

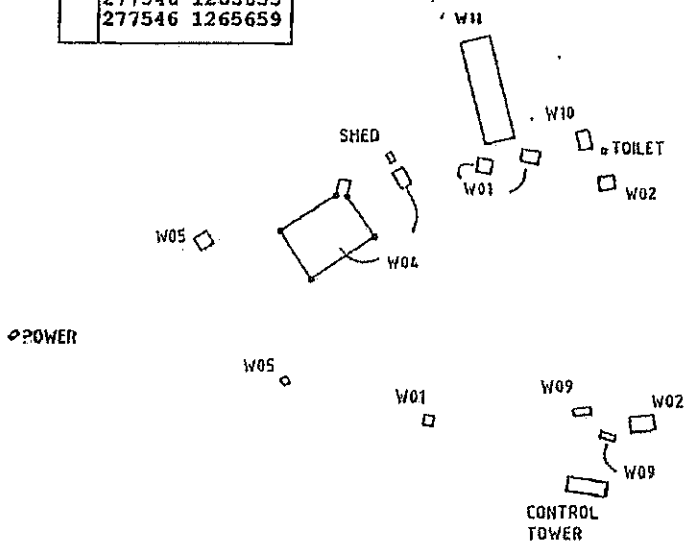


DIAGRAM 3

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Cromatia Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:
ADI PROPERTY

ADI ST MARYS PROPPERTY
RETAINED BUILDINGS & PAVED AREA
PLAN TO ACCOMPANY SITE
AUDIT STATEMENT CHK001/6 [illegible]

ORIGINAL SIZE: A3	
SCALE HOR: 2000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN DDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 5467-128	SHEET 10 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

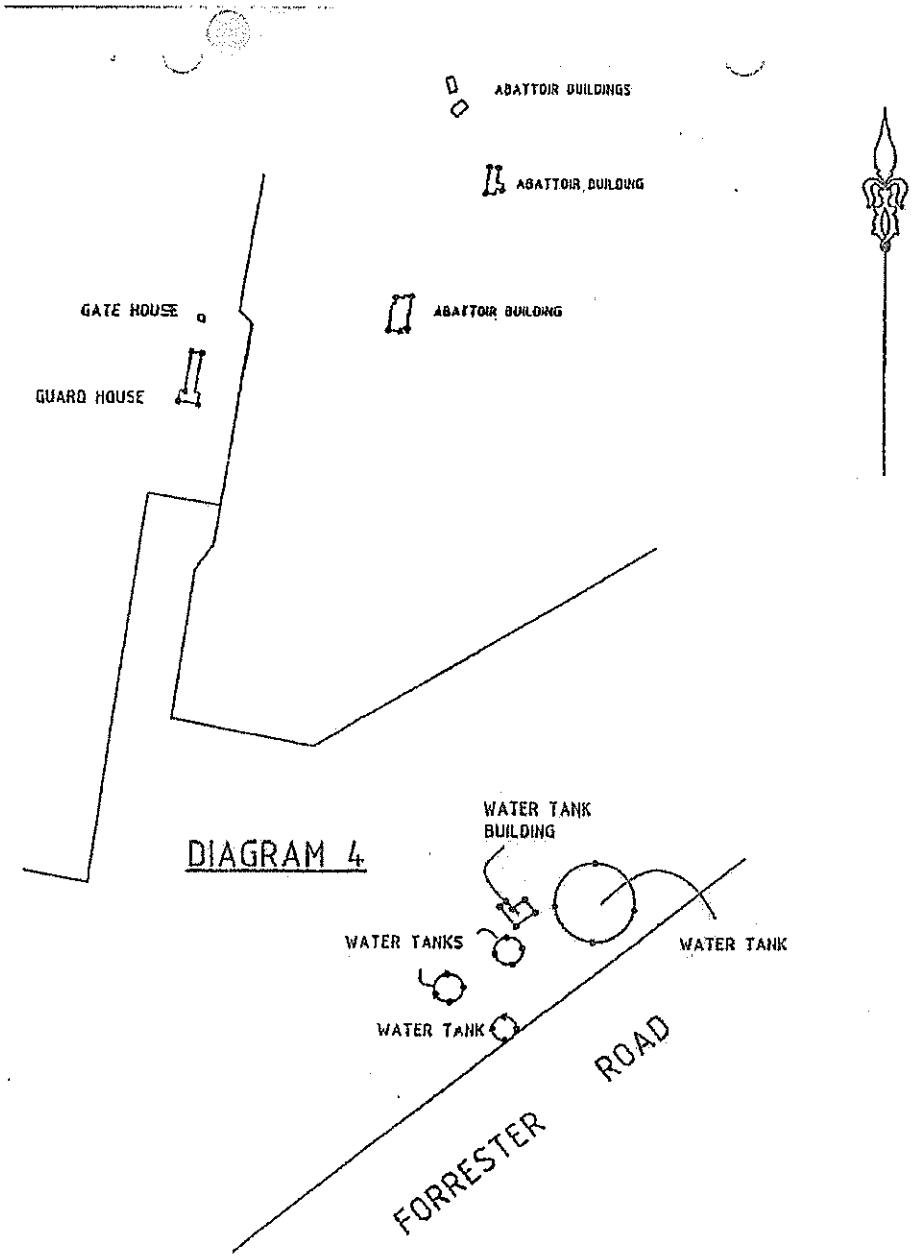


DIAGRAM 4

DIAGRAM 5

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

BDG No	EASTING	NORTHING
WATER TANK BUILDING	280345	1265484
	280349	1265492
	280351	1265494
	280354	1265491
	280359	1265495
WATER TANKS	280389	1265510
	280403	1265494
	280385	1265477
	280371	1265496
	280357	1265477
	280358	1265474
	280350	1265468
	280347	1265475
	280326	1265452
	280322	1265458
	280334	1265459
	280330	1265464
	280354	1265445
	280356	1265441
	280347	1265444
	280349	1265436
GATE HOUSE	279372	1265033
	279375	1265032
	279372	1265030
	279374	1265030
GUARD HOUSE	279369	1265017
	279374	1265016
	279372	1264995
	279364	1264997
	279366	1265001
ABATTOIR BUILDINGS	279459	1265041
	279453	1265040
	279450	1265027
	279454	1265026
	279457	1265027
	279491	1265094
	279495	1265093
	279489	1265083
	279496	1265084
	279473	1265130
	279476	1265131
	279478	1265125
	279475	1265124
	279475	1265117
	279480	1265121
	279482	1265118
	279478	1265114

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Cremalia Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 6, 141 Elizabeth Street
Sydney, New South Wales,
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:


Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE:	A3		
SCALE HOR:	2000	VERT:	
CO-ORDS:		DATUM:	
DATE OF SURVEY		DATE OF PLAN:	MAY 1999
SURVEY		DRAWN	ACAD/DDW
CHECKED:	DDW	DATE	21.6.1999
APPROVED:	PW	DATE	21.6.1999
JOB REF:	0662		
CAD REF:	5407-129	SHEET 11 OF 13 SHEETS	

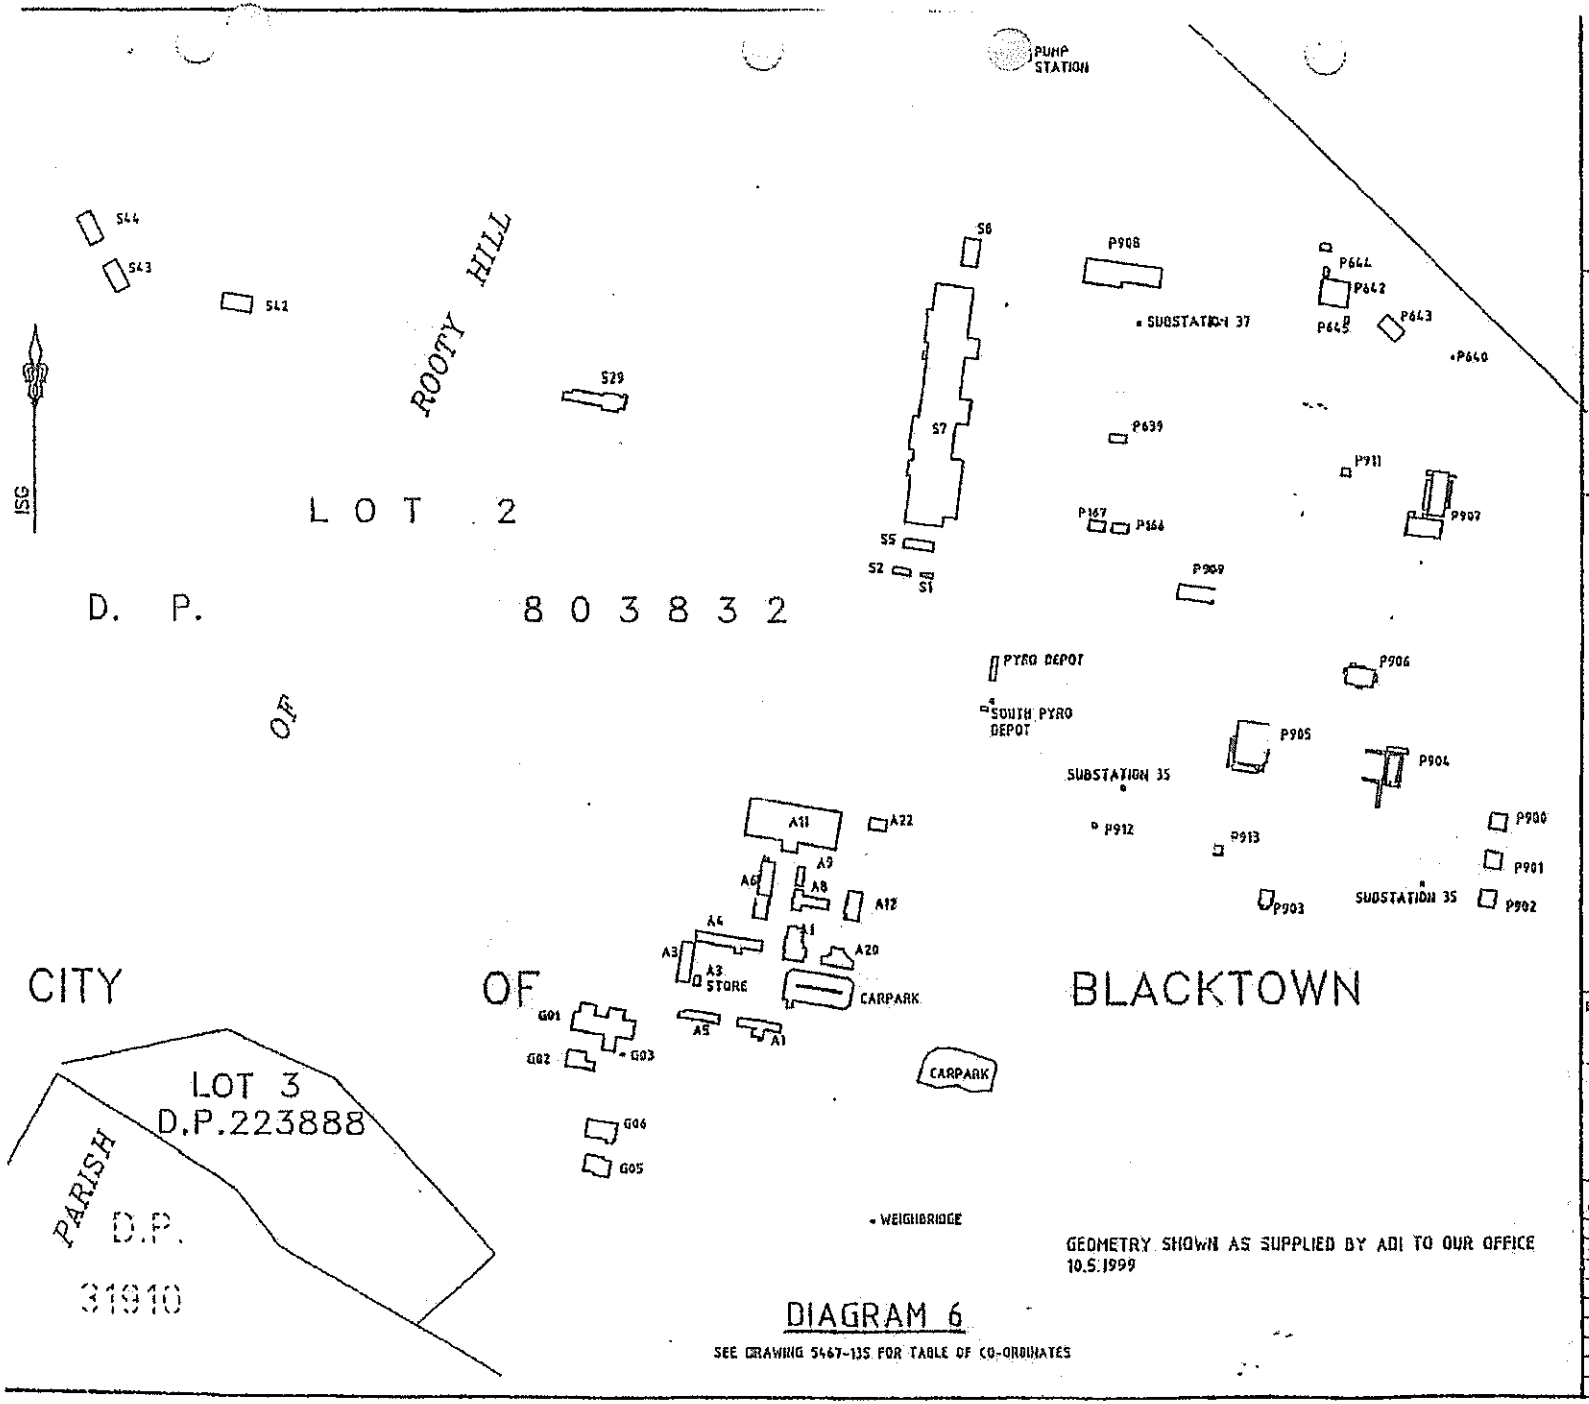

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

DIAGRAM 6

SEE DRAWING 5467-13S FOR TABLE OF CO-ORDINATES

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD.
INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 6, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY
RETAINED BUILDINGS/PAVED AREA
PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE: A3	
SCALE HOR: 6000	VERT:
CO-ORDS:	DATUM:
DATE OF SURVEY	DATE OF PLAN: MAY 1999
SURVEY	DRAWN ACAD/CDW
CHECKED: DDW	DATE 24.5.1999
APPROVED: PW	DATE 24.5.1999
JOB REF: 8662	
CAD REF: 5467-13A	SHEET 12 OF 13 SHEETS

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

BDG NO	EASTING NORTHING
A11	279334 1266254 279340 1266297 279449 1266279 279442 1266237
A22	279484 1266274 279505 1266270 279503 1266258 279482 1266261
A9	279398 1266217 279406 1266215 279403 1266194 279394 1266195
A8	279394 1266191 279435 1266178 279402 1266172 279390 1266168
A6	279344 1266158 279359 1266155 279370 1266222 279354 1266224
A4	279276 1266141 279274 1266129 279353 1266117 279355 1266128
A3	279260 1266128 279274 1266126 279266 1266077 279252 1266079
A3 STORE	279273 1266086 279271 1266074 279281 1266085 279279 1266073
A5	279302 1266026 279304 1266037 279262 1266043 279254 1266033
A1	279324 1266023 279326 1266033 279377 1266025 279357 1266017 279342 1266010
A7	279380 1266107 279404 1266108 279405 1266143 279387 1266146
A22	279454 1266162 279455 1266155 279470 1266153 279475 1266187
A12	279425 1266100 279462 1266094 279453 1266119 279437 1266113

BDG NO	EASTING NORTHING
CAR/ PARK	279567 1265995 279556 1265990 279542 1265953 279567 1265945 279606 1265940 279631 1265942 279640 1265975 279609 1265990
CAR/ PARK	279391 1266093 279384 1266089 279379 1266056 279383 1266046 279453 1266044 279464 1266076
G01	279203 1266029 279200 1266006 279178 1265991 279126 1266018 279138 1266052
G02	279144 1265979 279145 1265989 279122 1265993 279119 1265972 279153 1265966
G06	279142 1265881 279146 1265903 279182 1265897 279177 1265871
G05	279174 1265850 279171 1265829 279141 1265838 279144 1265854
S42	278527 1267007 278511 1266998 278529 1266966 278545 1266974
S43	278570 1266916 278560 1266949 278544 1266939 278562 1266907
S44	278729 1266884 278732 1266983 278696 1266909 278693 1266890
S29	279324 1266023 279326 1266033 279377 1266025 279376 1266015
S8	279618 1266979 279614 1266941 279595 1266944 279600 1266976
S7	279564 1266923 279611 1266916 279524 1266631 279588 1266635

BDG NO	EASTING NORTHING
S5	279525 1266609 279523 1266598 279560 1266592 279561 1266604
S2	279533 1266570 279511 1266573 279510 1266565 279531 1266562
S1	279192 1266788 279189 1266769 279114 1266781 279115 1266791
RAIL/ WAY	279599 1266565 279580 1266465 279575 1266466 279605 1266652
P908	279750 1266952 279746 1266923 279837 1266917 279840 1266939
SUB/ ST 37	279010 1266872 279014 1266872 279814 1266876 279814 1266876
P639	279593 1266784 279608 1266782 279604 1266752 279589 1266753
P167	279772 1266631 279770 1266618 279752 1266621 279753 1266634
P166	279799 1266627 279798 1266615 279779 1266617 279781 1266630
P909	279860 1266592 279858 1266533 279900 1266528 279902 1266546
P900	280258 1266276 280239 1266278 280236 1266259 280255 1266257
P901	280251 1266231 280232 1266234 280229 1266215 280248 1266212
P902	280245 1266186 280242 1266167 280223 1266170 280226 1266189
P903	279973 1266187 279959 1266189 279971 1266170 279957 1266172

NO	EASTING NORTHING
SUBSTATION 35	280151 1266194 280155 1266193 280156 1266197 280152 1266198 279792 1266307 279792 1266311 279796 1266310 279796 1266306
P913	279910 1266231 279902 1266231 279903 1266241 279913 1266240
P912	279763 1266268 279763 1266262 279757 1266263 279758 1266268
P904	280136 1266352 280111 1266355 280105 1266311 280125 1266309
P905	279931 1266385 279967 1266380 279924 1266329 279960 1266327
P906	280063 1266452 280096 1266448 280093 1266427 280060 1266431
P907	280186 1266690 280135 1266636 280178 1266637 280178 1266637 280135 1266636 280177 1266631 280174 1266609 280165 1266681
P911	280056 1266698 280066 1266697 280065 1266687 280055 1266689
P640	280192 1266831 280190 1266832 280189 1266831 280190 1266829
P642	280063 1266923 280032 1266927 280028 1266896 280058 1266892
P643	280111 1266883 280133 1266862 280120 1266850 280099 1266870
P644	280039 1266929 280032 1266930 280034 1266940 280040 1266939 280041 1266958 280029 1266960 280030 1266966 280031 1266966

NO	EASTING NORTHING
P645	280059 1266871 280060 1266881 280065 1266880 279799 1266627
PYRO DEPOT	279634 1266465 279630 1266436 279637 1266435 279641 1266464
SOUTH PYRO DEPOT	279634 1266408 279631 1266408 279631 1266413 279635 1266412 279619 1266399 279628 1266398 279629 1266402 279619 1266404
WEIGH/ BRIDGE	279487 1265773 279484 1265774 279485 1265777 279488 1265776

TABLE OF CO-ORDINATES OF RETAINED BUILDINGS AND PAVED AREA

COORDINATES ARE APPROXIMATE ONLY

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans — Surveyors, Planners, Civil & Structural Engineers

Whelans Australia Pty Ltd

Head Office:
Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:
Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4139
Facsimile 02) 9630 4599

PREPARED FOR:

ADI PROPERTY

ADI ST MARYS PROPERTY RETAINED BUILDINGS/PAVED AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/6

ORIGINAL SIZE:	A3		
SCALE HOR:		VERT:	
CO-ORDS:		DATUM:	
DATE OF SURVEY		DATE OF PLAN: MAY 1999	
SURVEY		DRAWN ACAD/DDW	
CHECKED: DDW		DATE 24.5.1999	
APPROVED: PW		DATE 24.5.1999	
JOB REF: 8002			
CAD REF: 5467-13S		SHEET 13 OF 13 SHEETS	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

NSW Environment Protection Authority

SITE AUDIT STATEMENT (SAS)

Site Audit Statement No.: CHK001/7

Site auditor (accredited under NSW Contaminated Land Management Act 1997):

Name: Christopher H Kidd Company: HLA-Enviroscience Pty Limited
Address: 55-65 Grandview Street, Pymble, NSW Postcode: 2076
Phone: (02) 9988 4422 Fax: (02) 9988 4441

Site Details

ADI St. Marys Property –Concrete Stockpile
Address: Forrester Road, St. Marys Postcode: 2760
Lot and DP Number: Lot 2 in DP803832 (part of)
(see attached map)
Local Government Area: Penrith and Blacktown

Site Audit requested by:

Name: Mr P Newton Company: Department of Urban Affairs and Planning
Address: Sydney Region West
Level 8, Signature Tower
2-10 Wentworth Street
Parramatta NSW 2150
Phone: (02) 9895 7142 - Fax: (02) 9895 6270

Name of contact person (if different from above:

Consultancy(ies) who conducted the site investigation(s) and/or remediation:

- ADI Limited — Chemical and Explosives Ordnance Investigations, Remediation and Validation 1990-1999
- Mackie Martin & Associates — Groundwater Investigations, 1991

Title(s) of Report(s) reviewed:

4. Historical Report – St Marys Property, ADI Limited, 1996;
5. Validation Report for the Central Sector West of the ADI St Marys Property, Report No. 498840, ADI Limited 1996;
6. QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited, 1999.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Other Information reviewed:

3 Site Investigation Report of St Marys Facility Ammunition and Missiles Division, Volume 4 – Discussions and Conclusions, ADI, June 1991.
4 Stage I Decontamination Audit, ADI St Marys CMPS&F, 1997.

Summary Site Audit Report Title:

Stage 2 Decontamination Audit Report for ADI Site, St Marys.

I have completed a site audit (as defined in the Contaminated Land Management Act 1997) and reviewed the reports and information referred to above with due regard to relevant laws and guidelines. I certify that the site (tick all appropriate boxes)

(a) is suitable for the following use(s):

- ~~☐ residential, including substantial vegetable garden and poultry;~~
- ~~☐ residential, including substantial vegetable garden, excluding poultry;~~
- ~~☐ residential with accessible soil, including garden (minimal home-grown produce contributing less than 10% fruit and vegetable intake), excluding poultry;~~
- ~~☐ residential with minimal opportunity for soil access including units;~~
- ~~☐ daycare centre, preschool, primary school;~~
- ~~☐ secondary school;~~
- ~~☐ parks, recreational open space, playing field;~~
- ~~☐ commercial/industrial use;~~
- ✓ Other – May continue to be used as stockpile for crushed concrete, but underlying soils need to be tested for chemical and ordnance contamination after stockpile removed.

subject to

- ✓ Conditions

1. On removal of all or part of the stockpile the underlying ground should be tested for both chemical and ordnance contamination. The testing should follow similar methods and levels of quality assurance as other parts of the ADI St Marys site. Appropriate remediation and validation should be performed (if necessary) the work reviewed by a site auitor.
3. Appropriate management plan including procedures for the safe handling and disposal of any items of explosive ordnance, shall be in place before development earthworks commences and shall remain in place to cover any excavation on the site during its ongoing use. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI (see Appendix E of the Site Audit Report).
4. The final surface of any earthworks in areas which are to be used for active recreational land uses, e.g. sports grounds, school grounds and picnic areas, or low density residential use, should, on completion of the earthworks, be surveyed with a metal detector by appropriately qualified and experienced personnel and the work reviewed by an independent site auditor.

~~(c) is not suitable for any beneficial use due to risk of harm from contamination~~

~~☐ (comments): ...~~

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

I am accredited by the NSW Environment Protection Authority under the Contaminated Land Management Act, 1997 as a Site Auditor (Accreditation No. 9813).

I Certify that:

(g) I have personally examined and am familiar with the information contained in this statement, including the reports and information referred to in this statement, and


(h) this statement is to the best of my knowledge, true, accurate and complete, and

(i) on the basis of my inquiries made to those individuals immediately responsible for making the reports, and obtaining the information, referred to in this statement, those reports and that information are, to the best of my knowledge, true, accurate and complete.

I am aware that there are penalties for wilfully submitting false, inaccurate or incomplete information.

Signed: _____ Date: 7/6/99

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

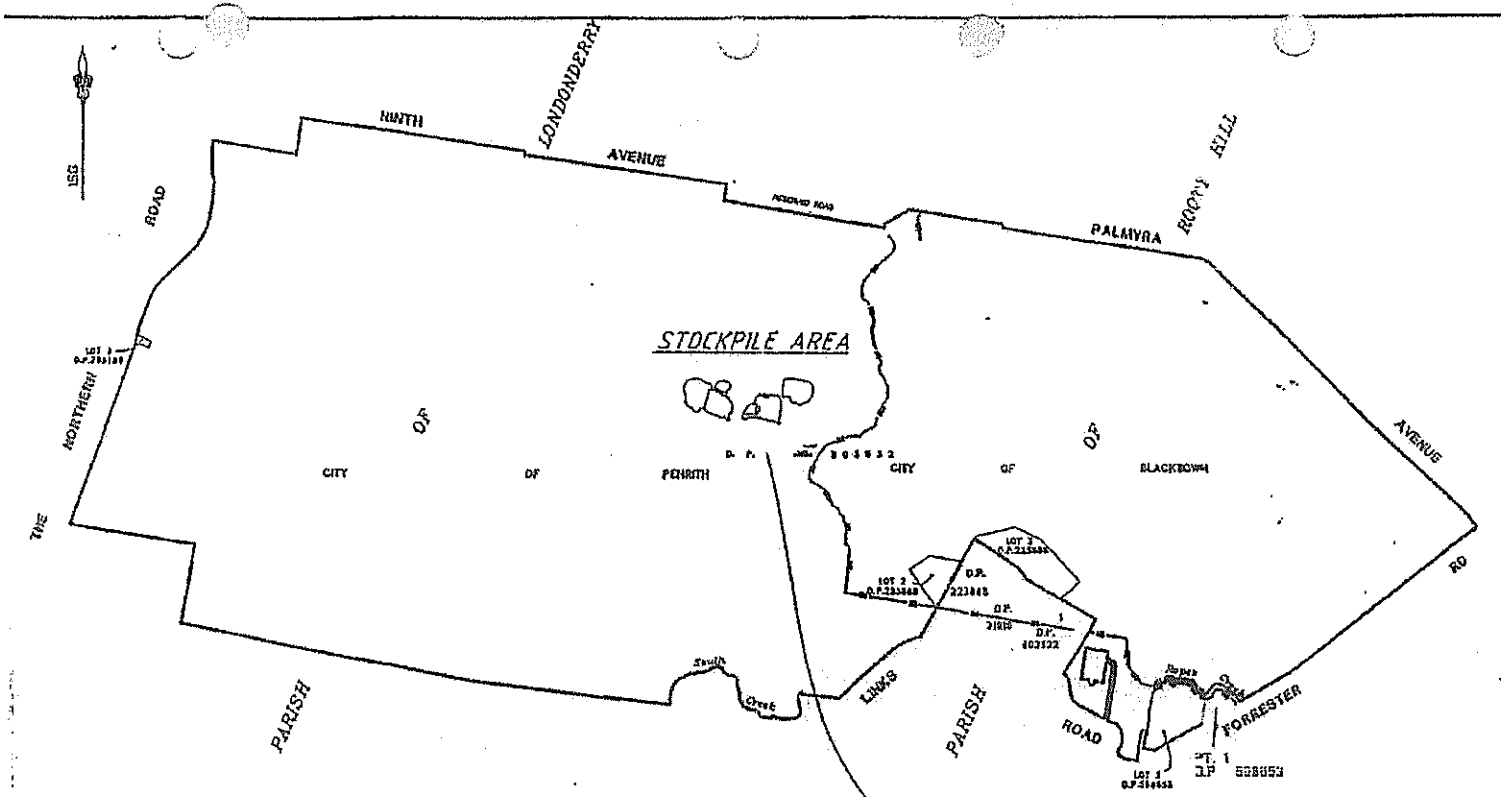


No	EASTING	NORTHING
	277 000	1 266 663
	277 000	1 266 664
	277 003	1 266 687
	276 991	1 266 727
	277 005	1 266 779
	277 056	1 266 793
	277 098	1 266 775
	277 133	1 266 759
	277 140	1 266 738
	277 127	1 266 730
	277 101	1 266 639
	277 078	1 266 639
	277 060	1 266 624
	277 039	1 266 635
	277 151	1 266 751
	277 184	1 266 744
	277 208	1 266 715
	277 220	1 266 733
	277 235	1 266 764
	277 222	1 266 744
	277 188	1 266 780
	277 123	1 266 730
	277 201	1 266 704
	277 245	1 266 656
	277 254	1 266 602
	277 254	1 266 602
	277 219	1 266 583
	277 204	1 266 589
	277 186	1 266 595
	277 115	1 266 627

No	EASTING	NORTHING
31	277 099	1 266 642
32	277 109	1 266 632
33	277 126	1 266 657
34	277 144	1 266 668
35	277 158	1 266 664
36	277 168	1 266 647
37	277 162	1 266 636
38	277 171	1 266 661
39	277 171	1 266 613
40	277 212	1 266 614
41	277 299	1 266 620
42	277 298	1 266 624
43	277 315	1 266 709
44	277 385	1 266 709
45	277 447	1 266 711
46	277 456	1 266 711
47	277 479	1 266 706
48	277 493	1 266 691
49	277 492	1 266 664
50	277 484	1 266 562
51	277 456	1 266 501
52	277 410	1 266 588
53	277 324	1 266 600
54	277 315	1 266 590
55	277 303	1 266 591
56	277 297	1 266 599
57	277 321	1 266 613
58	277 385	1 266 650
59	277 356	1 266 670
60	277 480	1 266 703

No	EASTING	NORTHING
61	277 504	1 266 725
62	277 504	1 266 257
63	277 514	1 266 193
64	277 523	1 266 797
65	277 530	1 266 793
66	277 528	1 266 791
67	277 652	1 266 766
68	277 655	1 266 717
69	277 603	1 266 670
70	277 598	1 266 664
71	277 544	1 266 691
72	277 536	1 266 700
73	277 528	1 266 701
74	277 506	1 266 699
75	277 499	1 266 716

COORDINATES ARE APPROXIMATE ONLY

GEOMETRY SHOWN AS SUPPLIED BY ADI TO OUR OFFICE 10.5.1999

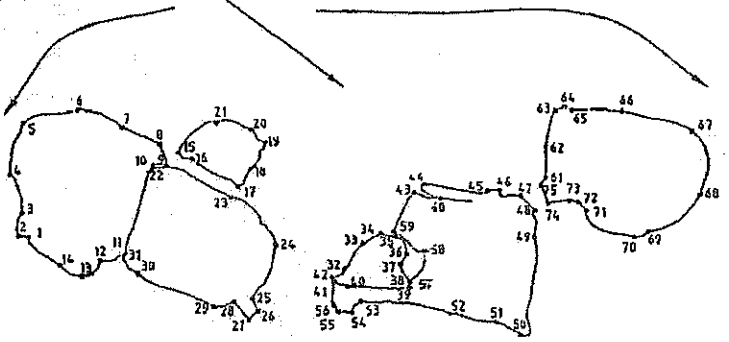

STOCKPILE AREA
NOT TO SCALE

NOTES:

COPYRIGHT: © WHELANS AUSTRALIA PTY LTD. INFORMATION CONTAINED IN THIS DRAWING / FILE IS THE COPYRIGHT OF WHELANS AUSTRALIA PTY LTD. COPYING OR USING THIS DATA IN WHOLE OR PART, IN ANY FORMAT, WITHOUT PERMISSION INFRINGES COPYRIGHT. ©

THIS DOCUMENT IN BOTH ELECTRONIC AND HARDCOPY FORMAT IS AND SHALL REMAIN THE PROPERTY OF WHELANS AUSTRALIA PTY LTD. THE INFORMATION MAY ONLY BE USED FOR THE PURPOSE FOR WHICH IT WAS COMMISSIONED AND IN ACCORDANCE WITH THE TERMS OF ENGAGEMENT FOR THE COMMISSION. UNAUTHORISED USE OF THIS INFORMATION IN ANY FORM WHATSOEVER IS PROHIBITED.

PREPARED BY:

Whelans Surveyors Planners Geomatic Engineers

Whelans Australia Pty Ltd

Head Office:

Whelans Australia Pty Ltd
Level 5, 141 Elizabeth Street
Sydney, New South Wales.
2000 Australia
Telephone 02) 9283 2400
Facsimile 02) 9261 5012

Parramatta Office:

Level 1, Suite 2
12 Victoria Road, Parramatta.
NSW 2150
Telephone 02) 9630 4199
Facsimile 02) 9630 4599

PREPARED FOR:

ADI Property

ADI ST MARYS PROPERTY STOCKPILE AREA PLAN TO ACCOMPANY SITE AUDIT STATEMENT CHK001/7

ORIGINAL SIZE:	A3		
SCALE HOR:	1 : 25,000	VERT:	–
CO-ORDS:	ISG	DATUM:	–
DATE OF SURVEY		DATE OF PLAN:	11 May 1999
SURVEY	–	DRAWN	Acad/DW
CHECKED:	DDW	DATE	24.5.1999
APPROVED:	PW	DATE	24.5.1999
JOB REF:	8662		
CAD REF:	8687-133.DWG	SHEET 6 OF 13 SHEETS	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Douglas Partners
Geotechnics / Environment / Groundwater

Douglas Partners Pty Ltd
ABN 75 053 980 117
www.douglaspartners.com.au
18 Waler Crescent
Smeaton Grange NSW 2567
Phone (02) 4647 0075
Fax (02) 4646 1886

Lend Lease Communities (Australia) Pty Ltd
Level 2, 88 Phillip Street
PARRAMATTA NSW 21254

Project 92245.00
21 September 2017
R.001.Rev0
GAR

Attention: Mr Paul Thomspon

Email: paul.thompson@lendlease.com

Dear Sirs

Site Walkover Contamination Report
Proposed Residential Subdivision
Proposed Lots 3989, 3990 and 3991, DP 1190132, Jordan Springs, NSW

1. Introduction

Douglas Partners Pty Ltd (DP) was commissioned by Lend Lease Communities (Australia) Pty Ltd (LLC) to complete a Site Walkover Contamination Report for the property comprising Lots 3989, 3990 and 3991 in Deposited Plan (DP) 1190132 at Jordan Springs NSW (the site). It is understood that the site, part of the Western Precinct of the former Australian Defence Industries (ADI) property, was subject to extensive investigations during the 1990s which included assessing the suitability of the land for residential redevelopment. A site audit statement produced in 1999 considered that the majority of the western precinct posed a negligible risk to the public with regard to contamination and /or explosive ordinance.

It is also understood that having previously developed and then sold the site in June 2013 to another developer, LLC are considering re-purchasing the site. A site walkover was required as part of due diligence investigations to identify additional activities or sources that have occurred/appeared on site since the sale of the property with the potential for land contamination. DP have not undertaken review of works associated with land whilst in LLC's ownership.

A plan of showing the subject site is attached.

2. Scope of Works

The scope completed for site walkover was as follows:

- Review of a Contamination Management Plan (CMP) produced by URS Australia Pty Ltd in 2008. The report was provided by LLC. The CMP included the 1999 Site Audit Statement. The review of CMP was completed to ascertain the contamination status of the site at time of site audit;
- Limited review of historical aerial imagery (from 2013) to identify additional areas on site where potential contamination may have occurred since the sale of the property;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

- Inspection of the site to assess the potential for contamination;
- Photographing of the site for recording purposes;
- Preparation of this Site Walkover Contamination report.

3. Summary of Reviewed Documentation

3.1 URS (2008) Contamination Management Plan

A CMP was completed for the Western Precinct, which included the site, by URS Australia Pty Ltd in July 2008 to support lodgement of the Western Precinct Plan. The objective of the CMP was to provide a framework for identifying and addressing any discovery of chemical contamination or potentially explosive ordnance so as to ensure a safe working environment for workers during development and to avoid unacceptable impact on the natural environment.

The CMP described that the site had been subject to extensive investigations during the 1990s which included a site audit statement issued in 1999 for the western precinct. The investigation and remediation programs for the property were undertaken with the objective of assessing the nature, degree of chemical contamination and remediation to a level suitable for redevelopment for a variety of land uses including residential. The majority of the western precinct was assessed by the site auditor to pose a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance.

3.2 Other Documents

DP are aware that there is a large body of pre-existing work on the site. DP were not provided any other documents to review and due to the timeframe were unable to obtain any further documents for review.

4. Limited Historical Aerial Review

A limited review of recent Nearmap Aerial Photography (from May 2013 onwards) was undertaken to identify areas onsite where potential for site contamination may have occurred in recent years. A summary of the review of historical aerial photography is detailed below.

May 2013 – The site appears to be vacant land which is partially covered by remnant bushland. A large grass covered area cleared of native vegetation is evident in the western portion of the site (Lot 3990) and another grass covered cleared area evident in the north eastern portion of the site (Lot 3989). An asphalt sealed car park has been developed in the central northern portion (Lot 3991) of the site adjacent to the site's northern boundary. An unsealed track runs from the carpark through the central portion of the site in a north - south. A long soil stockpile of limited height is located in the south eastern portion of the site that appears to be used for erosion control and likely created from reworked natural soils. The central portion of the site is generally covered by bushland. A large dam is located in the eastern portion of the site (Lot 3989). Areas in the far north eastern and eastern portions of the site appear to be used as a compound for nearby subdivision works on adjacent properties to the east of the site.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Areas to the north and northeast of the site beyond Jordan Springs Boulevard appear to be undergoing residential development. Areas to the south and immediate west of the site appear to be covered by bushland. A large wetland is evident to the immediate south of the central portion of the site. Areas to the far west of the site have been developed as residential.

June 2014 – The site and immediate surrounds appear similar to the previous aerial image.

March 2015 – The site and immediate surrounds appear similar to the previous aerial image.

May 2016 – The site and immediate surrounds appear similar to the previous aerial image.

February 2016 – An unsealed track running diagonally from the central northern portion of the site towards the south eastern portion of the site appears. The remainder of the site and immediate surrounds appear similar to the previous aerial image.

May 2017 – The unsealed track running diagonally through the site to the south eastern portion appears to have been increased in size and there appears to have been increased disturbance to sites soils in the central eastern portion of the site. The dam in the eastern portion (Lot 3989) of the site appears to have been filled. Bulk earthworks are occurring to the immediate south of the site which appear to be for a drainage system associated with the nearby developments to the east of the site and wetlands to the immediate south of the site. The unsealed track in the central eastern portion of the site appears to have been used as an access track for the bulk earthworks occurring for the drainage system.

September 2017 – The drainage system to the immediate south of the site appears to have been completed. The remainder of the site and immediate surrounds appear similar to the previous aerial image.

6. Site Walkover

The following site description is based on a site walkover completed on 19 September 2017. Photographs taken during the Site walkover and field works are presented in attached Photographic Plates 1 to 4.

The site is an irregular shaped property. At the time of inspection the site was vacant and partially covered with bushland and unsealed dirt tracks. The site is accessed via an asphalt sealed driveway in the central northern portion of Lot 3991 that leads from Jordan Springs Boulevard to the north of the site. The driveway leads to an asphalt/spray sealed carpark in the central northern portion of Lot 3991. An unsealed dirt track leads from the southern portion of the carpark towards the central and southern portions of the site. Five small stockpiles of soil were observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark. The stockpiles, with an approximate total volume of 15 - 20 m^3, were partially grass covered and appeared to be comprised of soil and small amounts of crushed sandstone and concrete.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

The unsealed driveway branches to the immediate south of the stockpiles with one arm of the driveway heading towards the western portion of the site (Lot 3990) and the other heading towards the eastern portion (Lot 3989). The western track leads through bushland to a grass covered cleared area in the western portion of the site (Lot 3990). Minor refuse was noted (an abandoned shopping trolley was observed half way along the track and a several abandoned beer bottles were observed beneath a tree in the mostly cleared area). No other visible signs of anthropogenic material were observed in the western portion of the site.

The eastern track leads to a large cleared area in the eastern portion of the site (Lot 3989). A long soil stockpile of limited height was observed in the south eastern portion of the site that appeared to be comprised of reworked natural material. The stockpile appeared to be used for former erosion control by diverting water. To the east of the stockpile was an area of filling which covered an approximate area of 3000 m^2. The filling was observed to contain sand, clay, crushed sandstone and minor fragments of crushed concrete. With the exception crushed concrete no further anthropogenic material was observed within the fill.

6. Potential Sources of Contamination

Area of Filling in the Eastern Portion of the site (Lot 3989)

An area of filling was identified during site inspection in the eastern portion of the site. The filling covered an approximate area of 3000 m^2. The surface of the filling was observed to contain sand, clay, crushed sandstone and minor fragments of crushed concrete. Review of Nearmap Imagery indicates that the filling arrived on site to fill a dam in the eastern portion of the site sometime between November 2016 and May 2017. Correspondence (attached) with representatives of LLC has identified that the source of the material is the result of bulk earthworks associated with the drainage system located to the immediate south of the site. Given the site audit statement that the site and immediate surrounds pose a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance the potential for contamination to filling in the eastern portion of the site is considered to be low.

Small Soil Stockpiles in the central Northern Portion of the Site (Lot 3991)

Five small stockpiles of soil were observed during site walkover on the unsealed area immediately adjacent to the south eastern corner of the asphalt carpark which were partially grass covered and appeared to be comprised of soil and small amounts of crushed sandstone and concrete. The stockpiles had an approximate total volume of 15 - 20 m^3. Review of Nearmap imagery indicates that the stockpiles arrived on site sometime between August and December 2012 at a similar time as the construction of the carpark.

Whilst the stockpiles were likely created by earthworks associated with the car park the potential that the stockpiles were created as a result of illegal dumping or flytipping cannot be ruled out. Although potential for contamination of the soil within stockpiles exists given the volume the potential for widespread gross contamination of the site is considered to be low.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

7. Conclusions and Recommendations

The previous 1999 site audit statement produced for the western precinct, which included the site, considered the area poses a negligible risk to the public or the environment with regards to chemical contamination and/or explosive ordnance. Limited review of historical aerial imagery and site walkover completed on 19 September 2017 has identified the following potential sources appearing onsite in recent years that have the potential for contamination of the site:

- An area of filling identified on Lot 3989 which covered an approximate total area of 3000 m^2 in the location of a former dam. Given correspondence with LLC stating that the material was sourced from nearby bulk earth works for the drainage basin to the south of the site the potential for contamination is therefore considered to be low; and
- Five small stockpiles of soil observed on the unsealed area immediately adjacent to the south eastern corner of the asphalt car park on Lot 3991. Given the small volume (15 - 20 m^3) of the stockpiles, likely origins from bulk earthworks associated with the nearby carpark and observed contents the soil within the stockpile poses a low contamination risk to the site.

It is recommended that further investigations be completed in due course of the filling on Lot 3989 and within the soil stockpiles on Lot 3991 to confirm the absence/presence of contaminants of potential concern associated with fill of an unknown origin.

With respect to site contamination the recommended further assessment should build on the information provided in this report with reference to National Environment Protection Council (NEPC, 1999) National Environment Protection Council (Assessment of Site Contamination) Measure 1999 (amended 2013) (NEPC, 2013). Further assessment should include intrusive investigations, sampling, analysis and assessment to determine land use suitability.

We trust that this meets your present requirements, please do not hesitate to contact the undersigned should you have any further enquiries.

Based on our walkover assessment the identified potential sources present a low risk of contamination and no significant source of contamination have been identified on the site since the sale of the property in June 2013. DP have not undertaken review of works associated with land whilst in LLC's ownership.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

8. Limitations

Douglas Partners Pty Ltd (DP) has prepared this report for this project at Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW in accordance with DP's proposal dated 15 September 2017 and acceptance received from Paul Thompson dated 15 September 2017. The work was carried out under DP's Conditions of Engagement. This report is provided for the exclusive use of Lend Lease Communities Ltd for this project only and for the purposes as described in the report. It should not be used by or relied upon for other projects or purposes on the same or other site or by a third party. Any party so relying upon this report beyond its exclusive use and purpose as stated above, and without the express written consent of DP, does so entirely at its own risk and without recourse to DP for any loss or damage. In preparing this report DP has necessarily relied upon information provided by the client and/or their agents.

The results provided in the report are indicative of the conditions on the site only at the time of works carried out. Conditions can change abruptly due to variable geological processes and also as a result of human influences. Such changes may occur after DP's field testing has been completed.

DP's advice is based upon the conditions encountered during the reviewed investigations. The accuracy of the advice provided by DP in this report may be affected by undetected variations in ground conditions across the site between and beyond the sampling and/or testing locations. The advice may also be limited by budget constraints imposed by others or by site accessibility.

This report must be read in conjunction with all of the attached and should be kept in its entirety without separation of individual pages or sections. DP cannot be held responsible for interpretations or conclusions made by others unless they are supported by an expressed statement, interpretation, outcome or conclusion stated in this report.

The limitations and notes included in the previous investigations are also relevant to this review.

Please contact the undersigned if you have any questions on this matter

Yours faithfully
Douglas Partners Pty Ltd

Grant Russell
Environmental Scientist

Reviewed by

Christopher Kline
Principal

Attachments: Subject Site Plan
Photographic Plates
Correspondence with Lend Lease Communities

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Subject site:

Lot 3989
5,026m2

Lot 3990
2.345ha

Lot 3991
3.6ha

DP 1190132

Jordans Springs, (Penrith)



Photograph 1 - Asphalt sealed carpark in northern portion of site



Photograph 2 - Small soil stockpiles adjacent to south east corner of carpark

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW	PROJECT: 92245.00 PLATE No. 1 REV: A
	CLIENT: Lend Lease Communities Pty Ltd	DATE: Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 3 - Native bushland covering central portion of site



Photograph 4 - Cleared grassed area in western portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW CLIENT: Lend Lease Communities Pty Ltd	PROJECT: PLATE No. REV: DATE:	92245.00 2 A Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 5 - Engineered drainage system located to the south of the site



Photograph 6 - Central eastern portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW CLIENT: Lend Lease Communities Pty Ltd	PROJECT:	92245.00
		PLATE No:	3
		REV:	A
		DATE:	Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



Photograph 7 - Filling in eastern portion of site



Photograph 8 - Filling observed in eastern portion of site

Douglas Partners Geotechnics / Environment / Groundwater	Site Photographs Site Walkover Lots 3989, 3990 and 3991 DP 1190132, Jordan Springs NSW	PROJECT:	92245.00
		PLATE No:	4
		REV:	A
	CLIENT: Lend Lease Communities Pty Ltd	DATE:	Sep-17

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Grant Russell

From: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Sent: Thursday, 21 September 2017 1:23 PM
To: Grant Russell
Subject: RE: [EXT]:RE: Jordan Springs -

Grant,

Burton for Lendlease.

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

From: Grant Russell [mailto:Grant.Russell@douglaspartners.com.au]
Sent: Thursday, 21 September 2017 1:21 PM
To: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Subject: RE: [EXT]:RE: Jordan Springs -

Nirmal,
Was the work undertaken by Burton for lend lease or previous owners CID?
Regards
Grant

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Grant Russell | Environmental Scientist
Douglas Partners Pty Ltd | ABN 75 053 980 117 | www.douglaspartners.com.au
18 Waler Crescent Smeaton Grange NSW 2567
P: 02 4647 0075 | F: 02 4646 1886 | E: Grant.Russell@douglaspartners.com.au


FINANCIAL REVIEW
CLIENT CHOICE AWARDS 2017
WINNER beaton

This email is confidential. If you are not the intended recipient, please notify us immediately and be aware that any disclosure, copying, distribution or use of the contents of this information is prohibited. Please note that the company does not make any commitment through emails not confirmed by fax or letter.

From: Srinivas, Nirmal [mailto:Nirmal.Srinivas@lendlease.com]
Sent: Thursday, 21 September 2017 1:12 PM
To: Grant Russell
Cc: Chris Kline
Subject: RE: [EXT]:RE: Jordan Springs -

Hi Grant,

The basin was filled up using cut and fill material on site and the works were carried out by Burton Contractor. Basically when new channel was built, soil from there was used for filling up the basin – see image below.

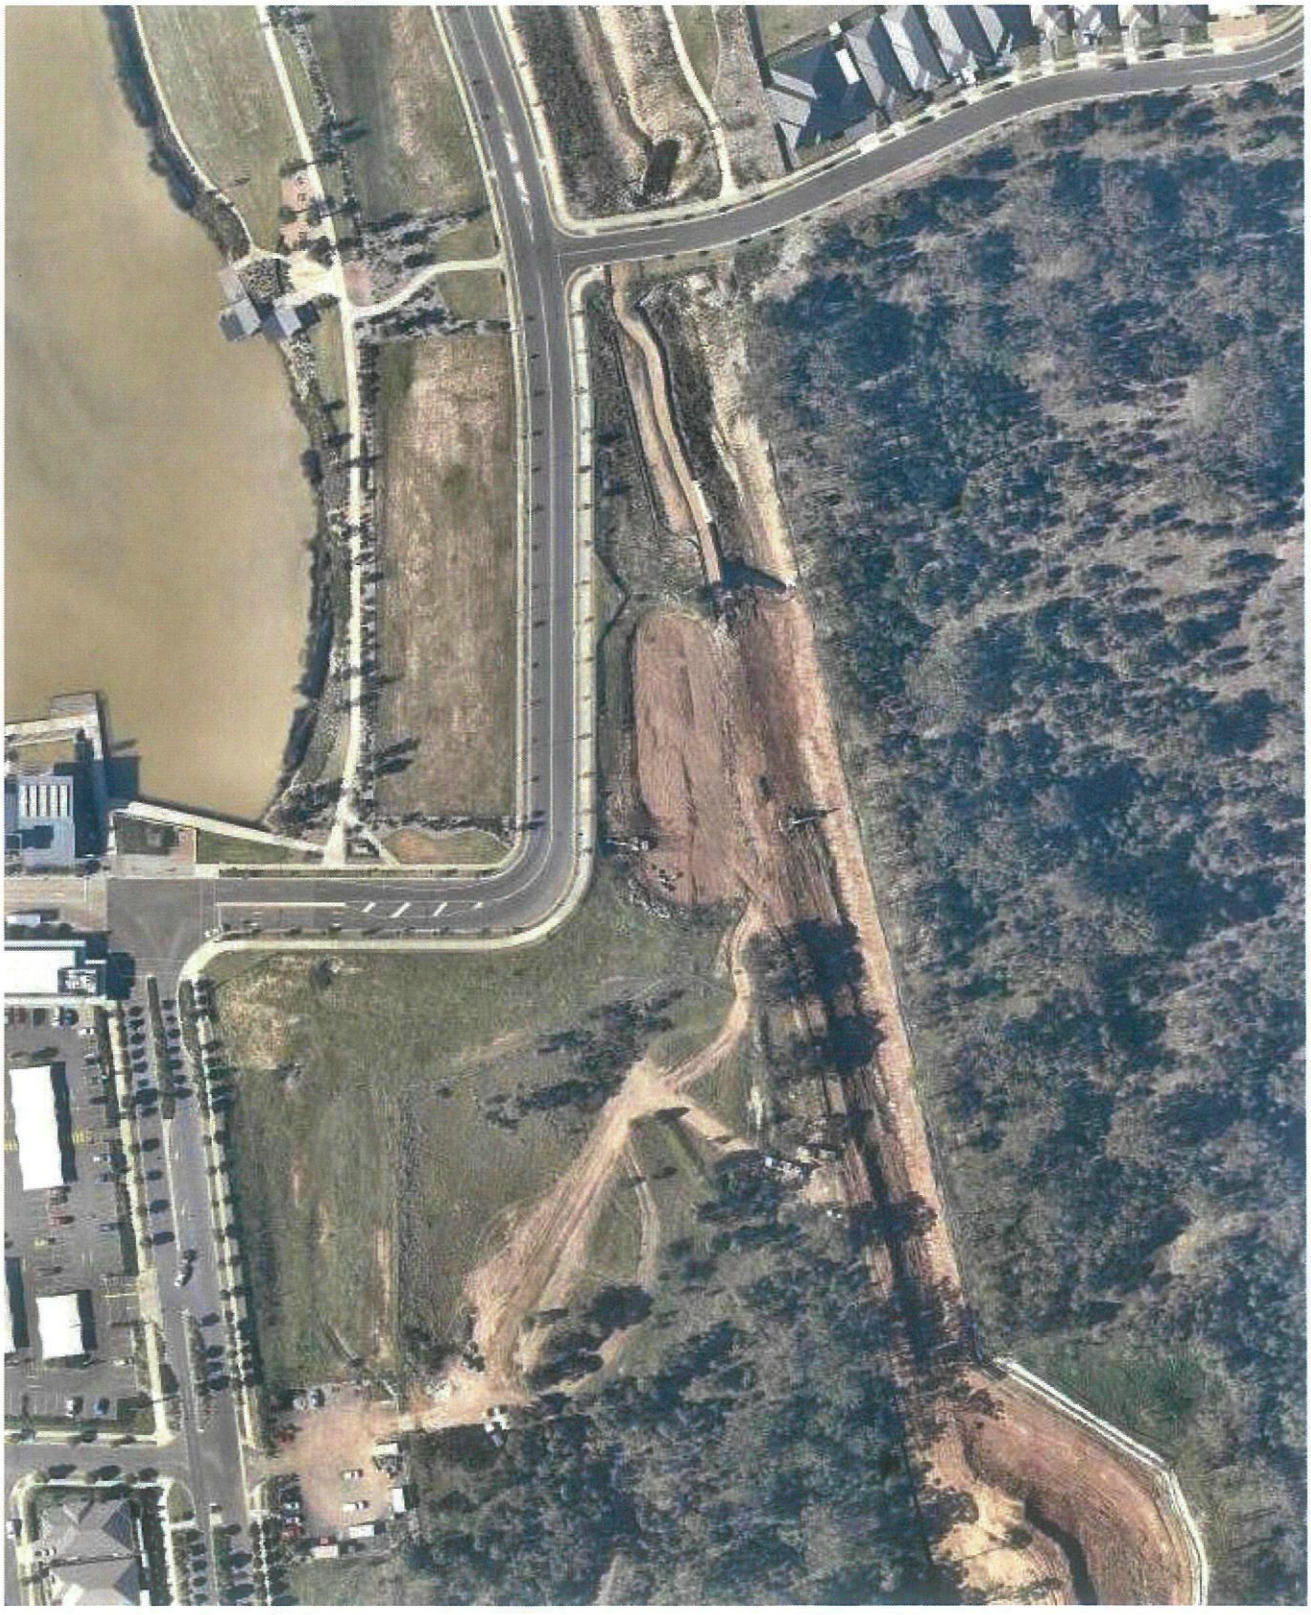

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

From: Grant Russell [mailto:Grant.Russell@douglaspartners.com.au]
Sent: Thursday, 21 September 2017 10:58 AM
To: Srinivas, Nirmal <Nirmal.Srinivas@lendlease.com>
Cc: Chris Kline <Chris.Kline@douglaspartners.com.au>
Subject: [EXT]:RE: Jordan Springs -

Hi Nirmal,
Yes that is dam Im talking about that has recently been filled. We neec to find out who filled the dam and with what materials?
Regards
Grant

Grant Russell | Environmental Scientist
Douglas Partners Pty Ltd | ABN 75 053 980 117 | www.douglaspartners.com.au
18 Waler Crescent Smeaton Grange NSW 2567
P: 02 4647 0075 | F: 02 4646 1886 | E: Grant.Russell@douglaspartners.com.au

FINANCIAL REVIEW
CLIENT CHOICE AWARDS 2017
WINNER beaton

This email is confidential. If you are not the intended recipient, please notify us immediately and be aware that any disclosure, copying, distribution or use of the contents of this information is prohibited. Please note that the company does not make any commitment through emails not confirmed by fax or letter.

From: Srinivas, Nirmal [mailto:Nirmal.Srinivas@lendlease.com]
Sent: Thursday, 21 September 2017 10:54 AM

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

To: Grant Russell
Subject: RE: Jordan Springs -

Hi Grant,

Are you talking about this portion of land – see image below?



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

From: Srinivas, Nirmal
Sent: Tuesday, 19 September 2017 3:58 PM
To: 'grant.russell@douglaspartners.com.au' <grant.russell@douglaspartners.com.au>
Cc: Chris Kline <Chris.Kline@douglaspartners.com.au>
Subject: Jordan Springs - Site Audit Statements/CMP

Hi Grant,

As requested please see attached information relating to contamination.

Thanks,

Nirmal Srinivas
Assistant Development Manager, Communities
Level 2, 88 Phillip Street, Parramatta NSW 2150 Australia
T +61 2 9277 2688 M 0438 488 037
nirmal.srinivas@lendlease.com | www.lendlease.com

"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000""> This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

Disclaimer

The information contained in this communication from the sender is confidential. It is intended solely for use by the recipient and others authorized to receive it. If you are not the recipient, you are hereby notified that any disclosure, copying, distribution or taking action in relation of the contents of this information is strictly prohibited and may be unlawful.

This email has been scanned for viruses and malware, and may have been automatically archived by **Mimecast Ltd**, an innovator in Software as a Service (SaaS) for business. Providing a **safer** and **more useful** place for your human generated data. Specializing in: Security, archiving and compliance. To find out more Click Here.

"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000""> This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

Disclaimer

The information contained in this communication from the sender is confidential. It is intended solely for use by the recipient and others authorized to receive it. If you are not the recipient, you are hereby notified that any disclosure, copying, distribution or taking action in relation of the contents of this information is strictly prohibited and may be unlawful.


This email has been scanned for viruses and malware, and may have been automatically archived by **Mimecast Ltd**, an innovator in Software as a Service (SaaS) for business. Providing a **safer** and **more useful** place for your human generated data. Specializing in: Security, archiving and compliance. To find out more Click Here.

"Arial","sans-serif";color:#7F7F7F;mso-themecolor:text1;mso-themetint:128; mso-style-textfill-fill-color:#7F7F7F;mso-style-textfill-fill-themecolor:text1; mso-style-textfill-fill-alpha:100.0%;mso-style-textfill-fill-colortransforms: "lumm=50000 lumo=50000""> This email and any attachments are confidential and may also contain copyright material of the Lendlease Group. If you are not the intended recipient, please notify us immediately and delete all copies of this message. You must not copy, use, disclose, distribute or rely on the information contained in it. Copying or use of this communication or information in it is strictly prohibited and may be unlawful. Contracts cannot be concluded with the Lendlease Group nor service effected by email. None of the staff of the Lendlease Group are authorised to enter into contracts on behalf of any member of the Lendlease Group in this manner. The fact that this communication is in electronic form does not constitute our consent to **conduct transactions by electronic means or to use or accept electronic records or electronic signatures. Confidentiality and legal privilege attached to this communication are not waived or lost by reason of mistaken delivery to you. Lendlease does not guarantee that this email or the attachment(s) are unaffected by computer virus, corruption or other defects and accepts no liability for any damage caused by this email or its attachments due to viruses, interception, corruption or unauthorised** access. Lendlease Group may monitor email traffic data and also the content of email for the purposes of security and staff training. Please note that our servers may not be located in your country. A list of Lendlease Group entities can be found here.

APPENDIX D

WORKCOVER NSW



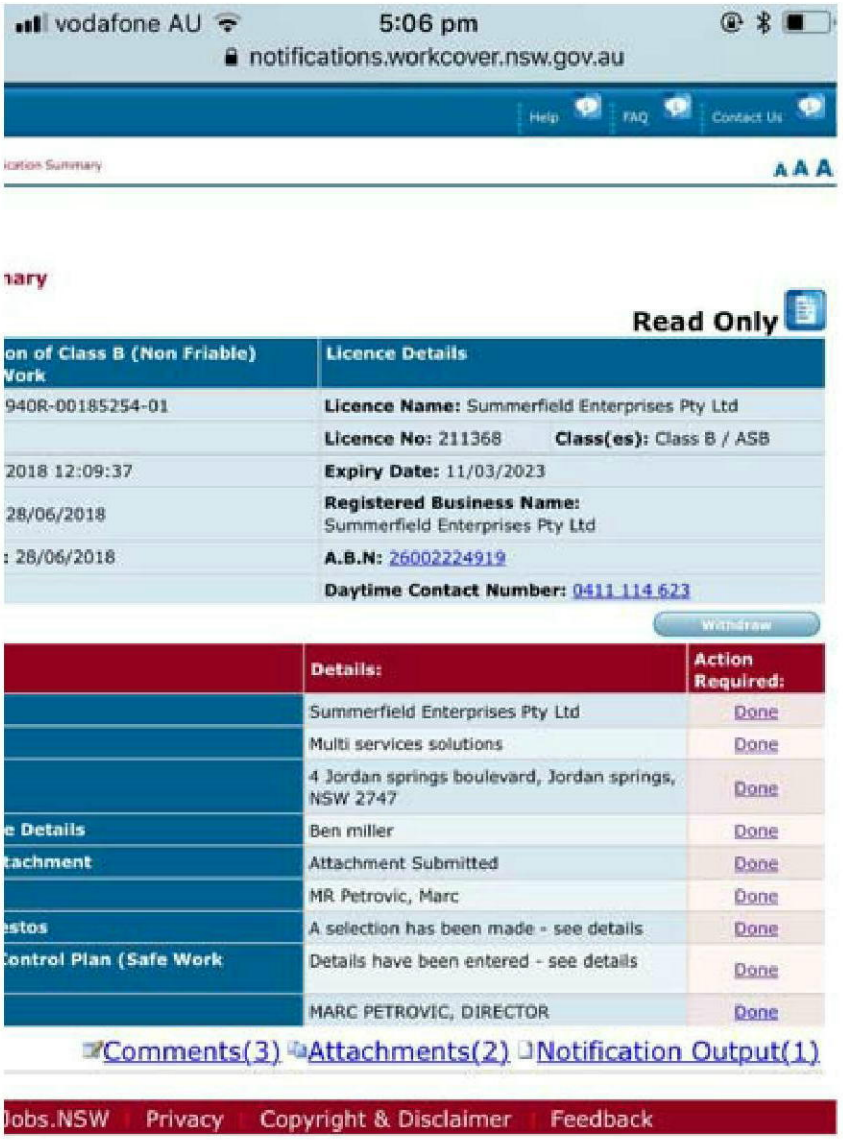

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
ENGINEERING | ENVIRONMENTAL | TESTING
Your On-Site Geotechnical & Environmental Specialists

T: 1800 288 188
E: office@allgeo.com.au
W: www.allgeo.com.au
P: PO Box 275
Seven Hills NSW, 1730

17 October 2018

Penrith City Council
PO Box 60
Penrith NSW 2751

Attention: Jane Hetherington

Subject: Site Validation Report, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW

1. Introduction

Alliance Geotechnical Pty Ltd (AG) was engaged by LLRL Management Services Pty Ltd as Trustee of LLRL Management Services Trust, to provide a site validation report for Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW (the site). That report was prepared and submitted as AG 2018, 'Site Validation Report, Lot 3991 in DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW' dated 11 July 2018, ref: 7161-ER-1-6.

Subsequent to submission of AG (2018) to Penrith City Council (Council), we understand that Council correspondence to the applicant on 11 September 2018 indicated a new Site Audit Statement may be required to inform a development application decision for the site. AG understands that Council advised in a meeting with the applicant on 2 October 2018, that this requirement would be reviewed based on further information and justification being provided to Council, including the following:

- clarification round the size of the stockpile removal footprint and the validation sampling density and methodology; and
- a copy of the asbestos removal control plan prepared for the stockpile removal works undertaken on the site.

The purpose of this letter is to provide commentary on the two action items arising from the meeting with Council on 2 October 2018.

2. Amendments to AG (2018)

AG (2018) has been amended to include:

- information regarding the footprint of the stockpile removal area;
- cross references to relevant NSW EPA endorsed guidance used to support the overall validation strategy of the stockpile removal works, including sampling densities and sampling methodologies;
- information on the basis used to determine the decision making around the nature and extent of laboratory analysis of validation samples;
- clarification on validation works being undertaken in accordance with the validation strategy (that was based on NSW EPA endorsed guidance)
- clarification on whether further assessment of chemical contamination within the stockpile footprint was warranted; and
- clarification on whether further assessment of the two areas of environmental concern (AEC02 and AEC03) was warranted.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

The amendments to AG (2018b) are presented in the following sections:

- Executive Summary;
- Section 6.7.1;
- Section 6.7.2;
- Section 6.7.6;
- Section 7.2;
- Section 7.3;
- Section 8;
- Section 10.1.1; and
- Section 11.

3. Asbestos Removal Control Plan

AG understands that a copy of the asbestos removal control plan for the removal works will be provided to Council by the applicant.

4. Concluding Remarks

On the basis that AG (2018) has been amended to include the information requested by Council, and that a copy of the asbestos removal control plan is being provided to Council, AG considers that:

- Council's request for further information and justification has been addressed; and
- contamination assessment works undertaken have concluded that the site is suitable for the proposed land use setting (subject to the conditions set out in AG (2018)).

On this basis, and on behalf of the applicant, AG respectfully seeks Council's confirmation that a new Site Audit Statement is not required to inform the development application decision for the site.

Should Council require anything further on this matter, we would ask that Council directs its queries to the applicant's key contacts for the development application, Mr Murray Robertson (0431 683 465) or Karen Armstrong (0409 990 172).

For and on behalf of Alliance Geotechnical Pty Ltd



Craig Cowper
Principal Environmental Scientist

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Alliance Geotechnical
ENGINEERING | ENVIRONMENTAL | TESTING
Your On-Site Geotechnical & Environmental Specialists

T: 1800 288 188
F: 02 9838 8022
E: office@allgeo.com.au
W: www.allgeo.com.au
P: PO Box 275
Seven Hills NSW 1730

Attn: Jane Hetherington

Penrith City Council
PO BOX 60
PENRITH NSW 2751

15 November 2019

RE: Jordan Springs – ILA Development Application (Stage 3)

Dear Jane

I write in relation to the current staged developments being undertaken at Jordan Springs by Lendlease (our client). Alliance Geotechnical (AG) have been involved in works on the site to date including civil works on the residential portion of the site, Lot 3, DP1248137 and the civil works for the Villa portion of the site on Lot 1, DP1248137.

From a contamination assessment perspective, AG have undertaken various sitewide investigations and have prepared the following reports in 2018 for DA18/0678 (approved in March 2019), and subsequently modified as DA18/0678.01 (approved in September 2019):

a. Supplementary Contamination Assessment (ref: 7161-ER-1-3);
b. Stockpile Contamination Assessment (ref: 7161-ER-1-4);
c. Waste Classification Report (ref: 7161-ER-1-5);
d. Site Validation Report (ref: 7161-ER-1-6); and
e. Letter to Penrith City Council (ref: 7161-ER-1-7).

The above referenced reports relate to the whole of Lot 1, DP1248137 (formerly Lot 3991), therefore, the reports are relevant to the development application (DA_ to be submitted for 3 x ILA buildings).

The following references are to be noted throughout the AG reports:

- Any reference to Lot 3991, DP1190132 is referring to Lot 1, DP1248137. Lot 3991 was subdivided in June, 2019; and
- The proposed yield of the ILA Development is 139 ILAs across 3 x 6 storey buildings.

From a contamination perspective, the Site Validation Report (ref: 7161-ER-1-6) concluded that, the site had been validated, from a contamination perspective, and that it was suitable for the proposed land use setting. It is understood that this information remains true and that only verified Virgin Excavated Natural Material (VENM) has been imported to site under the guidance and approval of JK Williams, Alliance Geotechnical and Penrith City Council.

Given the location of the proposed Stage 3 area, adjacent to the Stage 2 area, AG have reviewed the following imported material reports that were provided by the client:

- 4Pillars Environmental Consulting, February 2019 (4Pillars 2019), *Waste analysis and classification report, 1 Zoe Place, Mount Druitt, NSW* (Document reference: 20181029CIV-01);

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

- eiaustralia, July 2019 (eiaustralia 2019), *Waste classification certificate, 159 Queen Street, St Marys NSW* (Document reference: E24285.E05.001.Rev0);
- JBS&G, April 2019, *L006 – Virgin Excavated Natural Material Assessment – Main Works Redevelopment, Nepean Hospital, Kingswood NSW 2747* (Document reference: 54777-117471;
- Alliance Geotechnical, April 2019 (AG, 2019), *Waste classification report, WestConnex M4-M5 Tunnels, 79 Pyrmont Bridge Road, Annandale NSW* (Document reference: 8272-ER-1-12);
- JM Environments, April 2019, *JME18057-69 M4-M5 Link Tunnel Spoil Order Assessment Wattle Street Haberfield* (Document reference: JME18057-69); and
- ERM, October 2019, *Material Classification – W04, 191-205 Caddens Road, Caddens NSW 2747 (*Document reference: S009948).

To date, a quantity of 8,346m^3 is adjudged to have been imported onto Stage 2 from five (5) separate sources, as detailed above, comprising a mixture of Clay/ Shale, Sandstone and Clay.

AG have verified the VENM reports, associated material transport dockets and imported fill tracking register and are satisfied that the Stage 2 imported material is verified as clean natural materials and suitable for the proposed land use. It is also noted that Penrith City Council have been included in the imported material approval process and have also verified this material.

Given the information assessed and the site constraints, in reference to the contamination status of the Stage 3 area, AG can confirm that the site condition in this location, from a contamination perspective, has not changed since the validation of the site was conducted and the subsequent findings and information presented remains true.

Should you require any further information in respect of the above information, please do not hesitate to contact me.

Yours sincerely,



Aidan Rooney
BSc. (Hons) Environmental Science & Technology
Principal Environmental Scientist

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Maryland Development Company

Imported Fill Protocol

Lot 3990 and 3991 DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW

8 June 2018

55064/115858 (Rev A)

JBS&G

www.jbsg.com.au

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Maryland Development Company

Imported Fill Protocol

Lot 3990 and 3991 DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW

8 June 2018

55064/115858 (Rev A)
JBS&G

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Table of Contents

Appendices iv

Abbreviations iv

1. Introduction and Background 1
   - 1.1 Background 1
   - 1.2 Objective 2
   - 1.3 Scope of Works 2
2. Background Information and Previous Reports 3
   - 2.1 Site Audit Statement – Stage 2 Decontamination Audit Report for ADI Site, St Marys, CHK001/01 (HLA 1999) 3
   - 2.2 Contamination Management Plan (URS 2008) 4
   - 2.3 Site Walkover Contamination Report – Proposed Residential Subdivision Proposed Lots 3989, 3990 and 3991 DP1190132, Jordan Springs, NSW (DP 2017) 4
   - 2.4 Supplementary Contamination Assessment Lot 3990 in DP1190132 – Jordan Springs Boulevard, Jordan Springs, NSW. Alliance Geotechnical (2018) 4
3. Regulatory Guidelines 6
4. Source Site Requirements 7
   - 4.1 Virgin Excavated Natural Material (VENM) 7
     - 4.1.1 VENM Assessment 7
   - 4.2 Excavated Natural Material 8
     - 4.2.1 ENM Assessment 8
   - 4.3 Timing 8
   - 4.4 Non- Conformances 8
   - 4.5 Approval Prior to Importation 8
   - 4.6 Random Audits/Material Inspections 9
5. Transport Requirements 10
   - 5.1 Chain of Responsibility 10
   - 5.2 Truck Specifications 10
   - 5.3 Transport Rules 10
   - 5.4 Transport Contractor Requirements 10
   - 5.5 Wet Weather Protocol 11
6. Fill Site Requirements 12
   - 6.1 Material Tracking Overview 12
   - 6.2 Roles and Responsibilities 12
   - 6.3 Fill Site Entry Requirements 13
   - 6.4 Fill Placement/Tipping Location 14

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

6.5 Non-Conformances 14
7. Onsite Material Re-Use 15
8. Limitations 16

List of Tables

Table 5.1 Responsibility Matrix 13

List of Figures

Figure 1: Site Location

Figure 2: Site Layout

Appendices

Appendix A: Fact Sheet: Virgin Excavated Natural Material

Appendix B: The Excavated Natural Material Order 2014

Appendix C: Site Entry Material Compliance Checklist

Appendix D: Material Compliance Checklist

Abbreviations

Term	Definition
ACM	Asbestos Containing Material
AF	Asbestos Fines
AEC	Areas of Environmental Concern
ASS	Acid Sulphate Soils
Bgs	Below Ground Surface
COPC	Contaminants of Potential Concern
CMP	Contamination Management Plan
DP	Deposited Plan
EPA	NSW Environmental Protection Authority
ENM	Excavated Natural Material
FA	Friable Asbestos
HHERA	Human Health and Ecological Risk Assessment
LOR	Limit of Reporting
MCF	Material Classification Form
NEPC	National Environmental Pretention Measure
OEH	NSW Office of Environment and Heritage
PASS	Potential Acid Sulphate Soils
PCC	Penrith City Council

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Term	Definition
POEO	Protection of the Environment Operations Act
SAS	Site Audit Statement
VENM	Virgin Excavated Natural Material

Definitions

Principal - The principal as defined in the Fill Supply Agreement or as novated under the Fill Supply Agreement
Supplier - The Supplier as novated under the Fill Supply Agreement

Environmental Consultant – The Principal's nominated Environmental Consultant (JBS&G)

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

1. Introduction and Background

1.1 Background

JBS&G Australia Pty Ltd (JBS&G) was engaged by Maryland Development Company Pty Ltd (the client, MDC) to prepare an Imported Fill Protocol (IFP) for Lots 3990 and 3991 DP1190132, Jordan Springs Boulevard, Jordan Springs, NSW (the site). The site is located on the southern side of Jordan Springs Boulevard and occupies an approximate area of 5.978 ha. The location of the site is provided on **Figure 1**, the site layout is provided on **Figure 2**.

It is understood that the site is proposed to be developed into a residential area, and as part of the development application process Penrith City Council (PCC) has requested that a fill management protocol be developed for the site.

The site is located within the former St Marys ADI site (the property) which covered an area of approximately 1,545 ha and included the current suburbs of Ropes Crossing, Jordan Springs, Llandilo and St Mary's. The former ADI site comprised various uses, but was predominantly utilised as a bomb filling and munitions factory from 1941 to the early 1990's.

Various demolition works, unexploded ordnance clearances and environmental investigation works were conducted within the property during the mid 1990's which ultimately led to the property being declared suitable for residential landuse with substantial vegetable gardens and poultry in a Site Audit Statement (SAS) CH001/1 prepared by Christopher Kidd of HLA Envirosciences Pty Ltd (HLA 1999[1]). It is noted that the SAS contained some exclusions which are not relevant to the site, and was subject to the ongoing implementation of a contamination management plan.

A Contamination Management Plan (CMP) was prepared for the Western Precinct of the property by URS (2008[2]). The plan outlines a framework to identify and address any discovery of chemical contamination or potential unexploded ordnance (UXO) to ensure safe working environments for workers during development, and to avoid unacceptable impact to the natural environment.

Given the period of time since the SAS (HLA 1999), a Supplementary Contamination Assessment was conducted by Alliance Geotechnical (AG 2018[3]). The assessment aimed to determine whether contamination was present at the site as a result of past or current landuses, provide advice on the suitability of the site for the intended landuse, and to provide recommendations for further investigation, management and/or remediation based on the findings.

Based on the finding of the AG investigation it was concluded that the site conditions are unlikely to have changed since the SAS in 1999 and the site was considered (by AG) suitable for the proposed landuse (in its current condition) on the basis that the Contamination Management Plan (URS 2008) continued to be implemented.

This document outlines the procedures to be followed for assessing soil and/or rock materials imported to the site during development works, and to ensure contaminated materials are not imported to the site in contravention of the Protection of the Environment Operations Act and Regulations (POEO 1997). For the purposes of this report:

- The source site refers to any site approved to provide material for filling; and
- The fill site refers to Lots 3990 and 3991 DP1190132 (the site).

---

1 *NSW Environment Protection Authority Site Audit Statement (SAS) CHK001/1 ADI St Mary's Property – excluding Eastern Sector, QEL, Site 6 and Site 23, Buildings and concrete stockpile*. HLA Envirosciences Pty Ltd (HLA 1999)

2 *Contamination Management Plan Western Precinct Development Phase – Off Forresters Road St Marys*. URS Pty Ltd. July 2008 (URS 2008)

3 *Supplementary Contamination Assessment Lot 3990 in DP1190132 Jordan Springs Boulevard, Jordan Springs, NSW*. Alliance Geotechnical Pty Ltd 20 April 2018 (AG 2018)

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

1.2 Objective

The objectives of this IFP is to outline the procedures/requirements to be followed by the supplier and Principal to ensure that fill materials received onto the site comply with relevant environmental regulatory requirements and site suitability.

It is a further objective to prevent unsuitable materials being inadvertently brought onto the site.

1.3 Scope of Works

The procedures described in this IFP relate to the importation of virgin excavated natural material (VENM) and excavated natural material (ENM) only, onto the site.

Additionally, the IFP outlines the procedures to be followed prior to and during importation for:

- the source site;
- the transportation of materials between the source site and fill site; and
- the fill site.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

2. Background Information and Previous Reports

The site was historically part of the former St Mary's ADI site, which was predominantly used for bomb filling and munitions production. As discussed in **Section 1**, operations of the ADI facility ceased by the 1990's and various investigation works were conducted ultimately leading to the site being declared suitable for residential landuse including substantial vegetable garden and poultry(HLA 1999). Discussion of previous reports is provided below.

2.1 Site Audit Statement – Stage 2 Decontamination Audit Report for ADI Site, St Marys, CHK001/01 (HLA 1999)

An SAS was completed in 1999 by Christopher Kidd of HLA-Envirosciences of the ADI St. Marys Property – Excluding the historical Eastern Sector, QEL, Site 6 and Site 23, buildings and Concrete Stockpile. As part of the Site Audit Statement the following reports were reviewed:

- Historical Reports – St Marys Property, ADI Limited, 1996;
- Validation Report for the western Sector, ADI St Marys Facility, ADI Limited November 1994;
- Validation Report for the North Western Sector of the ADI St Marys Facility, Report No. 498800, ADI Limited 1995;
- Validation Report for the Southern Sector West of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;
- Validation Report for the Southern Sector East of the ADI St Marys Property, Report No. 498810, ADI Limited 1996;
- Validation Report for the Northern Sector West of the ADI St Marys Property, Report No. 498820, ADI Limited 1996;
- Validation Report for the Central Sector East of the ADI St Marys Property, Report No. 498840, ADI Limited 1997;
- Validation Report for the Central Sector West of the ADI St Marys Property, Report No. 498840, ADI Limited 1996;
- Validation Report for the North Eastern Sector of the ADI St Marys Property, Report No. 498850, ADI Limited 1996; and
- QA/Verification Survey Results, ADI St Marys Property, Report No. PG980323da ADI Limited. 1999.

On review of the abovementioned reports, the auditor concluded the property (i.e. the greater Maryland development site, including the current site area) was suitable for residential, including substantial vegetable gardens and poultry subject to the following conditions:

- Excludes the historical Eastern Sector, QEL, Site 6 and Site 23 which are covered by separate site audit statements, namely CHK001/2, CHK001/4 and CHK001/5.
- Excludes areas not yet investigated including the footprint of original buildings (including the W series buildings), car parks and roads, mainly around former Administration Centre Buildings (CHK001/6) and the concrete stockpile in the Central Sector West.
- An appropriate management plan, including procedures for the safe handling and disposal of any items of ordinance that may be found during earthworks, should be lodged prior to the commencement of development earthworks. This plan should be similar to the "Remnant Contamination Management Plan" submitted by ADI.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

2.2 Contamination Management Plan (URS 2008)

Based on the conditions of the SAS discussed in **Section 2.1**, a contamination management plan (CMP) was prepared by URS for the Western Precinct of the property in 2008.

The CMP provides a framework to identify and address any discovery of chemical contamination or potentially explosive ordnance items to ensure safe working environments for workers during development, and to avoid unacceptable impact to the natural environment.

Details and description of potential chemical contamination such as discoloured or odorous soils, potential asbestos containing materials and presence of foreign materials including drums or other waste were outlined in the document. Procedures in the form of a contamination management flowchart was developed to action items if discovered.

Implementation of this CMP should be adhered to during development works at the site, including while material importation takes place.

2.3 Site Walkover Contamination Report – Proposed Residential Subdivision Proposed Lots 3989, 3990 and 3991 DP1190132, Jordan Springs, NSW (DP 2017[4])

Douglas Partners (DP) conducted a site walkover of Lots 3989, 3990 and 3991 DP1190132 in 2017 during a site walkover and limited historical review at Jordan Springs.

The works were conducted as part of a due diligence procedure to identify whether any additional activities or sources of potential contamination had occurred at the site since the sale of the property in June 2013. Generally, the site was observed as being vacant and free of additional activities and contamination sources based on the limited historical review and site inspection conducted. Potential sources of contamination associated with filling within the eastern portion of Lot 3989, and small stockpiles in the central northern portion of Lot 3991 were identified.

Based on the results of the works conducted it was identified that no significant source of contamination was identified since the sale of the property in June 2013. It was recommended that fill materials in Lot 3989 and the five small stockpiles in Lot 3991 be investigated further.

2.4 Supplementary Contamination Assessment Lot 3990 in DP1190132 – Jordan Springs Boulevard, Jordan Springs, NSW. Alliance Geotechnical (2018)

AG conducted a supplementary contamination assessment on Lot 3990 DP1190132 at Jordan Springs Boulevard, Jordan Springs, NSW. The assessment was required to provide updated information on the site regarding its suitability for the proposed low to medium density residential landuse.

The assessment included a limited desktop review and site inspection. Ultimately it was confirmed that no new areas of environmental concern (AEC) or contaminants of potential concern (COPCs) were identified that would warrant further assessment.

The site was identified as mostly vacant with no observed land use activities. Visual evidence of vehicle tracks were observed at a number of locations. No evidence of wide spread filling was observed at the site, it was noted that earth bund-wall features were observed in the southern portion of the site. No staining or odours were observed.

Review of EPA records was undertaken which did not identify any notifications, records or notices that related to the site.

Review of aerial photography was conducted for the period between 2002 and 2017, no significant change to the site layout or notable observations were made from the photographs reviewed.

---

[4] *Site Walkover Contamination Report – Proposed Residential Subdivision Proposed Lots 3989, 3990 and 3991, DP1190132, Jordan Springs, NSW*. Douglas Partners Pty Ltd. 21 September 2017 (DP 2017)

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Based on the information obtained from the desktop review and site inspection it was concluded that;

- The contamination status of the site was considered unlikely to have changed since HLA (1999); and
- The site was considered suitable for the proposed use, provided ongoing implementation of the URS 2008 CMP occurs.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

3. Regulatory Guidelines

The importation of materials to the site is regulated by the Protection of the Environment Operations Act 1997.

The following regulatory instruments and NSW EPA endorsed guidelines applying to imported materials were considered in preparation of this IFP:

- NSW EPA Waste Classification Guidelines. Part 1: Classifying Waste (EPA 2014).
- Protection of the Environment Operations (Waste) Regulation 2014.
- National Environment Protection (Assessment of Site Contamination) Measure, National Environment Protection Council, 1999, amended 2013 (NEPC 2013).
- NSW EPA Contaminated Sites Guidelines for the NSW Site Auditor Scheme, 2nd Edition (EPA 2017).
- NSW EPA Sampling Design Guidelines – Contaminated Sites (EPA 1995).

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

4. Source Site Requirements

The following sections outline the possible sources and types of fill material that can be brought to site.

Imported materials will only be accepted to the site if they:

- Meet the definition of VENM as defined in relevant legislation (**Section 4.1**); or
- Meet the definition of ENM as defined in relevant regulations (**Section 4.2**).

If the material is approved, transport of material must meet the requirements specified in **Section 5** with the movement and placement of imported material to be undertaken in accordance with procedures documented in **Section 6**.

4.1 Virgin Excavated Natural Material (VENM)

The Protection of the Environment Operations Act 1997 defines VENM as:

'Natural material (such as clay, gravel, sand, soil or rock fines):

- That has been excavated or quarried from areas that are not contaminated with manufactured chemicals or process residues, as a result of industrial, commercial, mining or agricultural activities, and
- That does not contain any sulfidic ores or soils or any other waste.'

Material imported to the fill site as VENM must meet this definition.

Please refer to the Fact Sheet: Virgin Excavated Natural Material provided in **Appendix A** for additional information.

4.1.1 VENM Assessment

Assessment of VENM materials shall be undertaken in accordance with the requirements of EPA 1995 and incorporate a review of the source site history and inspection of materials prior to/during/after importation onto the site. A Virgin Excavated Natural Materials Assessment Report prepared by a suitably qualified environmental consultant must be provided prior to importation of any VENM.

The VENM assessment sampling and reporting will consist of the following:

- Details of the source site history, source site address, and characteristics of the material (such as colour, soil type, odours).
- A minimum of 1 sample per 1000 m^3, plus QA/QC samples as appropriate and a maximum requirement of 10 samples per source site.
- Samples should be analysed for the following parameters: pH, 8 metals consisting of total arsenic, cadmium, chromium, copper, lead, mercury, nickel and zinc, total petroleum hydrocarbons (TPH), benzene, toluene, ethylbenzene, xylenes (BTEX), polycyclic aromatic hydrocarbons (PAHs), organochlorine pesticides (OCPs), polychlorinated biphenyls (PCBs), electrical conductivity (EC) and asbestos. Please note this list is not exhaustive and additional parameters may require analysis depending on the source site history.
- Sample analytical results must not be detectable at levels above laboratory limits of reporting, with the exception of metals and EC.
- Metals detections must be at levels within published background ranges, such as background ranges provided in the National Environment Protection (Assessment of Site Contamination) Measure Schedule B1 (NEPC 1999).

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

- EC detections must comply with the chemical concentrations listed in **Column 2** and **Column 3** of **Table 2** of The Excavated Natural Material order 2014 (refer to **Appendix B** for additional information).
- Laboratory report(s) from a NATA accredited laboratory and chain of custody documentation, in addition to other QA/QC documentation to demonstrate the samples were obtained using appropriate procedures by suitably qualified personnel and that samples were analysed within relevant holding times.

Potential VENM will also be assessed to ensure it does not contain acid sulphate soils (ASS) or potential acid sulphate soils (PASS).

4.2 Excavated Natural Material

All ENM to be imported to the fill site must be assessed in accordance with The Excavated Natural Material Order 2014 (**Appendix B**).

ENM is defined as "naturally occurring rock and soil (including but not limited to materials such as sandstone, shale, clay and soil) that has:

a) Been excavated from the ground, and

b) Contains at least 98% (by weight) natural material, and

c) Does not meet the definition of Virgin Excavated Natural Material.

ENM does not include material that has been processed or contains acid sulphate soils (ASS) or potential acid sulphate soils (PASS)."

4.2.1 ENM Assessment

The requirements of ENM assessment are provided in The Excavated Natural Material Order 2014 (**Appendix B**).

A minimum of 10 composite samples per 4,000 tonnes of material are required, and must meet the criteria presented in **Table 2** of **Appendix B**.

An Excavated Natural Materials Assessment Report prepared by a suitably qualified environmental consultant (which must include laboratory reports from a NATA accredited laboratory) must be provided prior to importation of any ENM.

4.3 Timing

The following times must be allowed for testing of materials prior to approvals being granted:

- 10 days for VENM assessment; and
- 15 days for ENM assessment;

4.4 Non- Conformances

In the event materials do not meet the requirements detailed above, materials will not be approved for importation to the fill site and an alternative source site will need to be provided by the Supplier and be investigated to confirm conformance.

4.5 Approval Prior to Importation

All imported materials must meet the approval of the client or their appointed representative/environmental consultant. Documentation as outlined above (such as the Virgin Excavated Natural Materials Assessment Report) must be provided to the client for review and approval prior to importation of any materials to the site.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

MDC reserves the right to refuse material at their discretion or if supporting documentation does not meet the requirements outlined in this IFP document or legislative guideline requirements, or if material brought to the fill site is not consistent with the supporting documentation.

It is noted that Geotechnical requirements for imported materials are not included in this IFP. If Geotechnical requirements need to be confirmed, advice from a Geotechnical Engineer should be sought.

4.6 Random Audits/Material Inspections

The Principal, or Principal's Representative, must have the ability to conduct random source site inspections during importation of material to the fill site. In the event that material being excavated is not consistent with that originally investigated and approved, importation will cease until a revised approval is granted.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

5. Transport Requirements

5.1 Chain of Responsibility

The road transport heavy vehicle "Chain of Responsibility" (CoR) recognises that a number of different participants in each road transport 'Chain' can influence and direct a driver's on-road behavior, and the state of the heavy vehicle being driven. For this reason, under the Heavy Vehicle National Law, a number of the parties in the road transport 'Chain' are given responsibility for either:

- Complying with their specific obligations under the laws; or
- Taking all reasonable steps to ensure that *other* parties in the road transport 'Chain' achieve compliance and are not encouraged or incentivised to break the law.

Generally speaking, CoR compliance requires duty-holders to address the following four main areas:

- **The load:** ensuring the load is not in excess of the heavy vehicle's capacity, and that it is properly restrained;
- **The vehicle:** ensuring that the heavy vehicle is properly maintained and roadworthy;
- **The driver:** ensuring that the driver is not fatigued when driving the heavy vehicle; and
- **The public:** ensuring that the heavy vehicle is not induced or encouraged to speed while on the road, endangering the driver and other members of the public.

Under this Procedure, and through the project-specific 'CoR Compliance Plans' described in this Procedure, the Principal Contractor will manage any specific obligations it owes and take reasonable steps to ensure broader CoR compliance in a particular transport 'Chain'.

5.2 Truck Specifications

Any truck used to transport material onto the fill site must comply with the following specifications:

- No semi-trailers.
- Truck registration details to be provided to the Principal Contractor the day before delivery.
- Truck registration details to be provided when arriving on site, on a daily basis, prior to being accepted onto the fill site.
- All loads must be covered with automatic tarp covers.

In addition, tracking devices such as site specific stickers, bar codes or smart phones may be required on all trucks prior to being accepted onto the fill site.

5.3 Transport Rules

Approved and appropriate routes must be used between source and fill sites and must comply with any and all traffic control measures required by the Principal and source site Developer requirements.

5.4 Transport Contractor Requirements

Prior to being an accepted transport contractor it must be demonstrated that they are a Fleet Owner.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

5.5 Wet Weather Protocol

Wet weather communication protocol (i.e. if inclement weather) must be clear and regular in relation to conditions at source and receiving fill sites to minimise risk of rejecting access at gatehouse.

If a truck containing imported material arrives at the fill site after notification of site shutdown, the principal contractor has the right to deny access to the fill site. It is then the supplier's responsibility to ensure that any rejected material is disposed of legally and must provide certification to the Principal to confirm this. Any material rejected due to fill site closure may be re-accepted at the fill site if the supplier can certify that the material is fit for purpose and can provide (at the suppliers cost) the necessary testing certificates and evidence to warrant this. Acceptance of this material will still however remain at the full discretion of the Principal.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

6. Fill Site Requirements

6.1 Material Tracking Overview

Approximately 40 000 m^3 of material is required to be imported to the fill site to raise the site grade associated with the residential development. Materials must be characterised as per **Section 4** prior to importation to the site.

The approach for the management and tracking of fill material for reuse within the site is documented below. The system is designed to track the quantity and quality of materials from their arrival on the fill site, through temporary storage to placement.

The system comprises the following elements:

- Definition of Roles and Responsibilities;
- Material quality information;
- Material movement tracking;
- Material emplacement;
- Documentation required;
- Dealing with non-conformance; and
- Dealing with expected and unexpected finds

6.2 Roles and Responsibilities

The roles of the Principal Contractor, the supplier and the Environmental Consultant are detailed below with a responsibility matrix provided as **Table 6.1**.

The Principal Contractor will be responsible for the following:

- Approving the movement and placement of materials intended for onsite use;
- Ensuring all subcontractors and consultants involved in the material classification, generation, movement and placement are adequately briefed in the requirements of this IFP; and
- Ensure clear lines of communication are maintained between all relevant responsible parties.

The supplier will be responsible for the following:

- Implementation and overall management of onsite procedures and protocols;
- The movement and placement of materials intended for onsite use;
- Liaising with suppliers in sourcing of materials from offsite, whether imported VENM or ENM;
- Ensuring materials proposed to be imported to the fill site are acquiescent with requirements of the IFP and
- Ensuring the IFP is operated effectively in conjunction with other relevant documents such as the CMP (URS 2008).

The Environmental Consultant will be responsible for the following:

- Undertaking sampling and characterisation works of materials and/or review of characterisation reports provided by the supplier, as required, for potential beneficial reuse within the site, as per the requirements of the IFP;

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

- Identification of AF/FA (asbestos fines and friable asbestos) impacted materials;
- Liaising with the supplier with regards to the importation of materials which does not meet the definition of VENM to ensure materials meet the project requirements and to prevent unsuitable materials being inadvertently brought onto the fill site;
- Undertaking a minimum of two weekly inspections, or a minimum of 1 inspection/10,000 m^3 of imported VENM or 1 inspection/5000 m^3 for imported ENM, to confirm materials sampled are consistent with those being imported;
- Review materials tracking documents submitted by the supplier and investigate/resolve any discrepancies;
- Cross check inspection findings with materials tracking sheets; and
- Prepare an Imported Material Summary Letter including material tracking documentation on the completion of the importation works.

Table 6.1 Responsibility Matrix

Scope	The Principal	The Supplier
VENM or ENM Assessment Reports for materials proposed for importation to the fill site		X[1]
All Weather Haul Road at the Delivery Address	X	
Delivery Access (in and out)	X	
Traffic Control at the Delivery Address in accordance with the applicable Traffic Management Plan	X	
Security of and responsibility of imported material until the material is accepted by the Principal in accordance with this Agreement		X
Acceptance of material if it meets the requirements of ENM/VENM	X[2]	
Maintenance and management of Delivery Trucks		X
Safety Performance and Professional Conduct of Truck Drivers in Transit		X
Provision for truck and material entry fill site approvals as per **Section 6.3**	X	
Provision for Spotter at Tip Location		X
Provision for spotter at the Tip Location	X	

1. To be reviewed for approval by JBS&G prior to importation to site.
2. Twice weekly checks to be undertaken by the Environmental Consultant during material import

6.3 Fill Site Entry Requirements

The Principal will review the legitimacy of any truck/vehicle entering the site. The Principal will have the authority to reject any vehicle in line with the contractual obligations and performance requirements of this protocol.

Truck Requirements

Upon each trucks arrival, the Principal will document and ensure the following requirements are met:

- Truck registrations;
- Coding systems and vehicle tracking systems;
- Visual inspections of all trucks to ensure they are approved to enter the site;
- All trucks must retract automatic tarps upon approach to the inspection point;
- A full time spotter will be provided by the supplier at the site entry to ensure the quality of material meets the requirements of this protocol and the contractual requirements; and
- Material will be visually checked by the suppliers spotter and by the Principal for sizing of material and inclusions such as ACM (asbestos containing material), bricks or concrete as well as odours or staining and for general compliance with the contractual provisions and

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

quality provisions outlined in this protocol document and detailed on the Site Entry Material Compliance Check List (**Appendix C**).

Rejection Criteria

Trucks may be rejected for a range of reasons including but not limited to:

- Not being an approved truck, or meeting the Truck Specifications;
- For carrying non-conforming or contaminated material; and/or
- If the site is closed or unable to accept material for whatever reason.

Any truck rejected will be required to turn back using the nominated turning bay/road. If material is rejected at the entry, the supplier must be notified immediately and Site Entry Material Compliance Checklist, detailing the rejection criteria, must be completed and signed by both the supplier and principal's representatives outlining the reasons for rejection. A copy of the Check List is provided in **Appendix C**.

The supplier must ensure that any rejected material is disposed of legally and must provide certification to the Principal to confirm this. Any material rejected due to site closure or for any other reason may be re-accepted at the site if the supplier can certify that the material is fit for purpose and can provide (at the suppliers cost) the necessary testing certificates and evidence to warrant this. Acceptance of this material will still however remain at the full discretion of the Principal.

6.4 Fill Placement/Tipping Location

Spotters will be supplied by the Principal at the tipping site. Material will be visually checked by supplier and Principal for sizing of material and inclusions such as ACM, bricks or concrete as well as odours or staining and for general compliance with the contractual provisions and quality provisions outlined in this protocol document. Non-conforming or contaminated material will be rejected and will be removed and disposed of legally (at the suppliers cost) by the supplier. The supplier shall provide documented evidence of the legal disposal of rejected material (i.e. tipping dockets from a licenced landfill facility) and a validation inspection and sampling will be undertaken by the Environmental Consultant if required.

The following must be undertaken at the tipping site for every truck load of imported material brought onto site:

- A visual inspection on placement of every load by the Principal to confirm compliance (see checklist provided in **Appendix D**);
- Random spot checks by Environmental Consultant; and
- Additional check samples if required (i.e. if the material appears inconsistent with the Material Classification Form (MCF)).

6.5 Non-Conformances

In the event materials are received which do not conform to this IFP, then the CMP (URS 2008) for the site/s shall be implemented.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

7. Onsite Material Re-Use

Insitu material generated during civil works across the site, which are required to be re-used, should be assessed using the Material Compliance Checklist in **Appendix D** and tracked from source to placement location. Potential for chemically impacted materials or UXO items exists within insitu soils at the site and therefore diligent implementation of the CMP (URS 2008) is required.

Whilst noting insitu materials are considered suitable under the existing SAS (CHK001/1, HLA 1999), additional characterisation sampling to confirm suitability may be required.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

8. Limitations

This report has been prepared for use by the client who has commissioned the works in accordance with the project brief only, and has been based in part on information obtained from the client and other parties.

The advice herein relates only to this project and all results conclusions and recommendations made should be reviewed by a competent person with experience in environmental investigations, before being used for any other purpose.

JBS&G accepts no liability for use or interpretation by any person or body other than the client who commissioned the works. This report should not be reproduced without prior approval by the client, or amended in any way without prior approval by JBS&G, and should not be relied upon by other parties, who should make their own enquires.

Sampling and chemical analysis of environmental media is based on appropriate guidance documents made and approved by the relevant regulatory authorities. Conclusions arising from the review and assessment of environmental data are based on the sampling and analysis considered appropriate based on the regulatory requirements.

Limited sampling and laboratory analyses were undertaken as part of the investigations undertaken, as described herein. Ground conditions between sampling locations and media may vary, and this should be considered when extrapolating between sampling points. Chemical analytes are based on the information detailed in the site history. Further chemicals or categories of chemicals may exist at the site, which were not identified in the site history and which may not be expected at the site.

Changes to the subsurface conditions may occur subsequent to the investigations described herein, through natural processes or through the intentional or accidental addition of contaminants. The conclusions and recommendations reached in this report are based on the information obtained at the time of the investigations.

This report does not provide a complete assessment of the environmental status of the site, and it is limited to the scope defined herein. Should information become available regarding conditions at the site including previously unknown sources of contamination, JBS&G reserves the right to review the report in the context of the additional information.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Figures

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



© 2018 JBS&G

0 400 800 1,600 m

Scale:1:40,000

Datum: GDA 1994 MGA Zone 56 - AHD

Legend:

Site boundary

Rev	Description	Dm.	Date:
A4			
A	Original Issue - R01	FH	04-06-2018

JBS&G

Figure 1: Site Location

Client: Maryland Development Company

Project: Lot 3990

Job No: 55064 File Name: 55064_01

Document Path: N:\Projects\Maryland Development Company Pty Ltd_Lend Lease\55064 Lot 3990 Jordan Springs Imported Fill Protocol\GIS\Maps\R01\55064_01.mxd

Document Set ID: 9828849
Version: 1, Version Date: 25/11/2019



© 2018 JBS&G

0 25 50 100 m

Scale:1:2,500

Datum: GDA 1994 MGA Zone 56 - AHD

A4			
A	Original Issue - R01	FH	05-06-2018
Rev	Description	Dm.	Date:

Legend:

- Site boundary
- Lot boundary

JBS&G

Figure 2: Site Layout

Client: Maryland Development Company

Project: Lot 3990

Job No: 55064 File Name: 55064_02

Document Path: \\Jbs.aust\Company Folder\JBS Environmental\Projects\Maryland Development Company Pty Ltd_Lend Lease\55064 Lot 3990 Jordan Springs Imported Fill Protocol\GIS\Maps\R01\55064_02.mxd

Document Set ID: 8928880
Version: 1, Version Date: 25/11/2019

Appendix A Fact Sheet: Virgin Excavated Natural Material

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Fact sheet: Virgin excavated natural material

Who should use this fact sheet?

This fact sheet is designed to help those who use, supply or generate excavated natural materials to correctly classify these materials. In particular, it provides information on the factors to consider when assessing whether material excavated from a site is able to be classified as 'virgin excavated natural material' (VENM).

This fact sheet should be read in conjunction with the following Department of Environment and Climate Change (DECC) publications:

- *Waste Classification Guidelines: Part 1 – Classifying waste* (available at www.environment.nsw.gov.au/waste/envguidlns)
- *Avoiding the dangers of accepting fill on your land* (available at www.environment.nsw.gov.au/waste/factsheets).

Virgin excavated natural material

The *Protection of the Environment Operations Act 1997* defines VENM as:

'natural material (such as clay, gravel, sand, soil or rock fines):

- that has been excavated or quarried from areas that are not contaminated with manufactured chemicals or process residues, as a result of industrial, commercial, mining or agricultural activities, and
- that does not contain any sulfidic ores or soils or any other waste.'

No other criteria for VENM have been approved. By definition, VENM cannot be 'made' from processed soils. Excavated material that has been stored or processed in any way **cannot** be classified as VENM.

Are manufactured chemicals or process residues likely to be present?

A material can only be classified as VENM if it has been excavated from an area that is **not** contaminated with other waste materials or manufactured chemicals.

Past land uses are a useful first indicator of likely contamination. The possibility that a previous land use has caused contamination of a site must be considered when assessing whether an excavated material is VENM.

Land uses that could result in contaminants being present in an excavated material are listed overleaf. The list is not exhaustive and an excavated natural material may still be contaminated even where none of these activities have previously occurred on a site. Also activities not directly related to a site may lead to contamination: examples include diffuse sources of pollution, such as contaminated groundwater, that migrates under a site or dust settling out from industrial emissions.



Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Land uses that could result in contaminants being present in an excavated material include:

- acid/alkali plant and formulation
- agricultural/horticultural activities
- airports
- asbestos production and disposal
- chemicals manufacture and formulation
- defence works
- drum re-conditioning works
- dry cleaning establishments
- electrical manufacturing (transformers)
- electroplating and heat treatment premises
- engine works
- explosives industry
- gas works
- iron and steel works
- landfill sites
- metal treatment
- mining and extractive industries
- oil production and storage
- paint formulation and manufacture
- pesticide manufacture and formulation
- power stations
- railway yards
- scrap yards
- service stations
- sheep and cattle dips
- smelting and refining
- tanning and associated trades
- waste storage and treatment
- wood preservation

Is chemical assessment necessary?

Classification as VENM requires certainty that the material concerned is not contaminated.

Where it is uncertain whether an excavated material can be classified as VENM, a chemical assessment can determine if the material is contaminated.

Note that the term 'clean fill' has no legal standing under the *Protection of the Environment Operations Act 1997* or the Protection of the Environment Operations (Waste) Regulation 2005. Where an excavated material cannot be classified as VENM, it may be eligible for reuse under the 'excavated natural material exemption 2008'. Further information on this option is available on the DECC website at www.environment.nsw.gov.au/waste/RRecoveryExemptions.htm

Penalties apply

Under the *Protection of the Environment Operations Act 1997*, it is an offence to supply false or misleading information to another person, including information about the **type, classification, characteristics, composition or quantity of a waste**. Significant penalties apply.

More information

Contact DECC's Waste Management Section on (02) 9995 5000.

Published by:
Department of Environment and Climate Change NSW
59–61 Goulburn Street, Sydney
PO Box A290, Sydney South 1232
Phone: (02) 9995 5000 (switchboard)
Phone: 131 555 (environment information and publications requests)
Phone: 1300 361 967 (national parks information and publications requests)
Fax: (02) 9995 5999
TTY: (02) 9211 4723
Email: info@environment.nsw.gov.au
Website: www.environment.nsw.gov.au

ISBN 978 1 74122 937 0
DECC 2008/447
August 2008

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Appendix B: The Excavated Natural Material Order 2014

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Resource Recovery Order under Part 9, Clause 93 of the Protection of the Environment Operations (Waste) Regulation 2014

The excavated natural material order 2014

Introduction

This order, issued by the Environment Protection Authority (EPA) under clause 93 of the Protection of the Environment Operations (Waste) Regulation 2014 (Waste Regulation), imposes the requirements that must be met by suppliers of excavated natural material to which 'the excavated natural material exemption 2014' applies. The requirements in this order apply in relation to the supply of excavated natural material for application to land as engineering fill or for use in earthworks.

1. Waste to which this order applies

1.1. This order applies to excavated natural material. In this order, excavated natural material means naturally occurring rock and soil (including but not limited to materials such as sandstone, shale, clay and soil) that has:

a) been excavated from the ground, and
b) contains at least 98% (by weight) natural material, and
c) does not meet the definition of Virgin Excavated Natural Material in the Act.

Excavated natural material does not include material located in a hotspot; that has been processed; or that contains asbestos, Acid Sulfate Soils (ASS), Potential Acid Sulfate soils (PASS) or sulfidic ores.

2. Persons to whom this order applies

2.1. The requirements in this order apply, as relevant, to any person who supplies excavated natural material, that has been generated, processed or recovered by the person.

2.2. This order does not apply to the supply of excavated natural material to a consumer for land application at a premises for which the consumer holds a licence under the POEO Act that authorises the carrying out of the scheduled activities on the premises under clause 39 'waste disposal (application to land)' or clause 40 'waste disposal (thermal treatment)' of Schedule 1 of the POEO Act.

3. Duration

3.1. This order commences on 24 November 2014 and is valid until revoked by the EPA by notice published in the Government Gazette.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

4. Generator requirements

The EPA imposes the following requirements on any generator who supplies excavated natural material.

Sampling requirements

4.1. On or before supplying excavated natural material, the generator must:

4.1.1. Prepare a written sampling plan which includes a description of sample preparation and storage procedures for the excavated natural material.

4.1.2. Undertake sampling and testing of the excavated natural material as required under clauses 4.2, 4.3, and 4.4 below. The sampling must be carried out in accordance with the written sampling plan.

4.2. The generator must undertake sampling and analysis of the material for ASS and PASS, in accordance with the NSW Acid Sulfate Soil Manual, Acid Sulfate Soils Management Advisory Council, 1998 and the updated Laboratory Methods Guidelines version 2.1 – June 2004 where:

4.2.1. the pH measured in the material is below 5, and/or

4.2.2. the review of the applicable Acid Sulfate Soil Risk Maps (published by the former Department of Land and Water Conservation and available at http://www.environment.nsw.gov.au/acidsulfatesoil/riskmaps.htm) indicates the potential presence of ASS.

4.3. For stockpiled material, the generator must:

4.3.1. undertake sampling in accordance with Australian Standard 1141.3.1-2012 Methods for sampling and testing aggregates – Sampling – Aggregates (or equivalent);

4.3.2. undertake characterisation sampling by collecting the number of samples listed in Column 2 of Table 1 with respect to the quantity of the waste listed in Column 1 of Table 1 and testing each sample for the chemicals and other attributes listed in Column 1 of Table 4. For the purposes of characterisation sampling the generator must collect:

4.3.2.1. composite samples for attributes 1 to 10 and 18 in Column 1 of Table 4.

4.3.2.2. discrete samples for attributes 11 to 17 in Column 1 of Table 4.

4.3.2.3. The generator must carry out sampling in a way that ensures that the samples taken are representative of the material from the entire stockpile. All parts of the stockpile must be equally accessible for sampling.

4.3.2.4. for stockpiles greater than 4,000 tonnes the number of samples described in Table 1 must be repeated.

4.3.3. store the excavated natural material appropriately until the characterisation test results are validated as compliant with the maximum average concentration or other value listed in Column 2 of Table 4 and the absolute maximum concentration or other value listed in Column 3 of Table 4.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Table 1

Sampling of Stockpiled Material		
Column 1	**Column 2**	**Column 3**
Quantity (tonnes)	**Number of samples**	**Validation**
<500	3	Required
500 – 1,000	4	
1,000 – 2,000	5	
2,000 – 3,000	7	
3,000 – 4,000	10	

4.4. For in situ material, the generator must:

4.4.1. undertake sampling by collecting discrete samples. Compositing of samples is not permitted for in-situ materials.

4.4.2. undertake characterisation sampling for the range of chemicals and other attributes listed in Column 1 of Table 4 according to the requirements listed in Columns 1, 2 and 3 of Table 2. When the ground surface is not comprised of soil (e.g. concrete slab), samples must be taken at the depth at which the soil commences.

4.4.3. undertake sampling at depth according to Column 1 of Table 3.

4.4.4. collect additional soil samples (and analyse them for the range of chemicals and other attributes listed in Column 1 of Table 4), at any depth exhibiting discolouration, staining, odour or other indicators of contamination inconsistent with soil samples collected at the depth intervals indicated in Table 3.

4.4.5. segregate and exclude hotspots identified in accordance with Table 2, from material excavated for reuse.

4.4.6. subdivide sites larger than 50,000 m² into smaller areas and sample each area as per Table 2.

4.4.7. store the excavated natural material appropriately until the characterisation test results are validated as compliant with the maximum average concentration or other value listed in Column 2 of Table 4 and the absolute maximum concentration or other value listed in Column 3 of Table 4.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Table 2

In Situ Sampling at surface				
Column 1	**Column 2**	**Column 3**	**Column 4**	**Column 5**
Size of *in situ* area (m^2)	**Number of systematic sampling points recommended**	**Distance between two sampling points** (m)	**Diameter of the hot spot that can be detected with 95% confidence** (m)	**Validation**
500	5	10.0	11.8	Required
1000	6	12.9	15.2	
2000	7	16.9	19.9	
3000	9	18.2	21.5	
4000	11	19.1	22.5	
5000	13	19.6	23.1	
6000	15	20.0	23.6	
7000	17	20.3	23.9	
8000	19	20.5	24.2	
9000	20	21.2	25.0	
10,000	21	21.8	25.7	
15,000	25	25.0	28.9	
20,000	30	25.8	30.5	
25,000	35	26.7	31.5	
30,000	40	27.5	32.4	
35,000	45	27.9	32.9	
40,000	50	28.3	33.4	
45,000	52	29.3	34.6	
50,000	55	30.2	35.6	

Table 2 has been taken from NSW EPA 1995, *Contaminated Sites Sampling Design Guidelines*, NSW Environment Protection Authority.

Table 3

In Situ Sampling at Depth	
Column 1	**Column 2**
Sampling Requirements *	**Validation**
1 soil sample at 1.0 m bgl from each surface sampling point followed by 1 soil sample for every metre thereafter. From 1.0 m bgl, sample at the next metre interval until the proposed depth of excavation of the material is reached. If the proposed depth of excavation is between 0.5 to 0.9 m after the last metre interval, sample at the base of the proposed depth of excavation.	Required if the depth of excavation is equal to or greater than 1.0 m bgl

* Refer to Notes for examples

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Chemical and other material requirements

4.5. The generator must not supply excavated natural material waste to any person if, in relation to any of the chemical and other attributes of the excavated natural material:

4.5.1. The chemical concentration or other attribute of any sample collected and tested as part of the characterisation of the excavated natural material exceeds the absolute maximum concentration or other value listed in Column 3 of Table 4:

4.5.2. The average concentration or other value of that attribute from the characterisation of the excavated natural material (based on the arithmetic mean) exceeds the maximum average concentration or other value listed in Column 2 of Table 4.

4.6. The absolute maximum concentration or other value of that attribute in any excavated natural material supplied under this order must not exceed the absolute maximum concentration or other value listed in Column 3 of Table 4.

Table 4

Column 1	Column 2	Column 3
Chemicals and other attributes	**Maximum average concentration for characterisation** (mg/kg 'dry weight' unless otherwise specified)	**Absolute maximum concentration** (mg/kg 'dry weight' unless otherwise specified)
1. Mercury	0.5	1
2. Cadmium	0.5	1
3. Lead	50	100
4. Arsenic	20	40
5. Chromium (total)	75	150
6. Copper	100	200
7. Nickel	30	60
8. Zinc	150	300
9. Electrical Conductivity	1.5 dS/m	3 dS/m
10. pH *	5 to 9	4.5 to 10
11. Total Polycyclic Aromatic Hydrocarbons (PAHs)	20	40
12. Benzo(a)pyrene	0.5	1
13. Benzene	NA	0.5
14. Toluene	NA	65
15. Ethyl-benzene	NA	25
16. Xylene	NA	15
17. Total Petroleum Hydrocarbons C_{10}-C_{36}	250	500
18. Rubber, plastic, bitumen, paper, cloth, paint and wood	0.05%	0.10%

* The ranges given for pH are for the minimum and maximum acceptable pH values in the excavated natural material.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Test methods

4.7. The generator must ensure that any testing of samples required by this order is undertaken by analytical laboratories accredited by the National Association of Testing Authorities (NATA), or equivalent.

4.8. The generator must ensure that the chemicals and other attributes (listed in Column 1 of Table 4) in the excavated natural material it supplies are tested in accordance with the test methods specified below or other equivalent analytical methods. Where an equivalent analytical method is used the detection limit must be equal to or less than that nominated for the given method below.

4.8.1. Test methods for measuring the mercury concentration.

4.8.1.1. Analysis using USEPA SW-846 Method 7471B Mercury in solid or semisolid waste (manual cold vapour technique), or an equivalent analytical method with a detection limit < 20% of the stated absolute maximum concentration in Column 3 of Table 2 (i.e. < 0.20 mg/kg dry weight).

4.8.1.2. Report as mg/kg dry weight.

4.8.2. Test methods for measuring chemicals 2 to 8.

4.8.2.1. Sample preparation by digesting using USEPA SW-846 Method 3051A Microwave assisted acid digestion of sediments, sludges, soils, and oils (or an equivalent analytical method).

4.8.2.2. Analysis using USEPA SW-846 Method 6010C Inductively coupled plasma - atomic emission spectrometry, or an equivalent analytical method with a detection limit < 10% of the stated absolute maximum concentration in Column 3 of Table 2, (e.g. 10 mg/kg dry weight for lead).

4.8.2.3. Report as mg/kg dry weight.

4.8.3. Test methods for measuring electrical conductivity and pH.

4.8.3.1. Sample preparation by mixing 1 part excavated natural material with 5 parts distilled water.

4.8.3.2. Analysis using Method 103 (pH) and 104 (Electrical Conductivity) in Schedule B (3): Guideline on Laboratory Analysis of Potentially Contaminated Soils, National Environment Protection (Assessment of Site Contamination) Measure 1999 (or an equivalent analytical method).

4.8.3.3. Report electrical conductivity in deciSiemens per metre (dS/m).

4.8.4. Test method for measuring Polynuclear Aromatic Hydrocarbons (PAHs) and benzo(a)pyrene.

4.8.4.1. Analysis using USEPA SW-846 Method 8100 Polynuclear Aromatic Hydrocarbons (or an equivalent analytical method).

4.8.4.2. Calculate the sum of all 16 PAHs for total PAHs.

4.8.4.3. Report total PAHs as mg/kg dry weight.

4.8.4.4. Report benzo(a)pyrene as mg/kg.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

4.8.5. Test method for measuring benzene, toluene, ethylbenzene and xylenes (BTEX).

4.8.5.1. Method 501 (Volatile Alkanes and Monocyclic Aromatic Hydrocarbons) in Schedule B (3): Guideline on Laboratory Analysis of Potentially Contaminated Soils, National Environment Protection (Assessment of Site Contamination) Measure 1999 (or an equivalent analytical method).

4.8.5.2. Report BTEX as mg/kg.

4.8.6. Test method for measuring Total Petroleum Hydrocarbons (TPH).

4.8.6.1. Method 506 (Petroleum Hydrocarbons) in Schedule B (3): Guideline on Laboratory Analysis of Potentially Contaminated Soils, National Environment Protection (Assessment of Site Contamination) Measure 1999 (or an equivalent analytical method).

4.8.6.2. Report as mg/kg dry weight.

4.8.7. Test method for measuring rubber, plastic, bitumen, paper, cloth, paint and wood.

4.8.7.1. NSW Roads & Traffic Authority Test Method T276 Foreign Materials Content of Recycled Crushed Concrete (or an equivalent method).

4.8.7.2. Report as percent.

Notification

4.9. On or before each transaction, the generator must provide the following to each person to whom the generator supplies the excavated natural material:

- a written statement of compliance certifying that all the requirements set out in this order have been met;
- a copy of the excavated natural material exemption, or a link to the EPA website where the excavated natural material exemption can be found; and
- a copy of the excavated natural material order, or a link to the EPA website where the excavated natural material order can be found.

Record keeping and reporting

4.10. The generator must keep a written record of the following for a period of six years:

- the sampling plan required to be prepared under clause 4.1.1;
- all characterisation sampling results in relation to the excavated natural material supplied;
- the volume of detected hotspot material and the location;
- the quantity of the excavated natural material supplied; and
- the name and address of each person to whom the generator supplied the excavated natural material.

4.11. The generator must provide, on request, the characterisation and sampling results for that excavated natural material supplied to the consumer of the excavated natural material.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

5. Definitions

In this order:

application or apply to land means applying to land by:

- spraying, spreading or depositing on the land; or
- ploughing, injecting or mixing into the land; or
- filling, raising, reclaiming or contouring the land.

Bgl means below ground level, referring to soil at depth beneath the ground surface.

composite sample means a sample that combines five discrete sub-samples of equal size into a single sample for the purpose of analysis.

consumer means a person who applies, or intends to apply excavated natural material to land.

discrete sample means a sample collected and analysed individually that will not be composited.

generator means a person who generates excavated natural material for supply to a consumer.

hotspot means a cylindrical volume which extends through the soil profile from the ground surface to the proposed depth of excavation, where the level of any contaminant listed in Column 1 of Table 2 is greater than the absolute maximum concentration in Column 3 of Table 2.

***in situ* material** means material that exists on or below the ground level. It does not include stockpiled material.

***in situ* sampling** means sampling undertaken on *in situ* material.

N/A means not applicable.

stockpiled material means material that has been excavated from the ground and temporarily stored on the ground prior to use.

systematic sampling means sampling at points that are selected at even intervals and are statistically unbiased.

transaction means:

- in the case of a one-off supply, the supply of a batch, truckload or stockpile of excavated natural material that is not repeated.
- in the case where the supplier has an arrangement with the recipient for more than one supply of excavated natural material, the first supply of excavated natural material as required under the arrangement.

Manager Waste Strategy and Innovation

Environment Protection Authority

(by delegation)

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Notes

The EPA may amend or revoke this order at any time. It is the responsibility of each of the generator and processor to ensure it complies with all relevant requirements of the most current order. The current version of this order will be available on ' www.epa.nsw.gov.au

In gazetting or otherwise issuing this order, the EPA is not in any way endorsing the supply or use of this substance or guaranteeing that the substance will confer benefit.

The conditions set out in this order are designed to minimise the risk of potential harm to the environment, human health or agriculture, although neither this order nor the accompanying exemption guarantee that the environment, human health or agriculture will not be harmed.

Any person or entity which supplies excavated natural material should assess whether the material is fit for the purpose the material is proposed to be used for, and whether this use may cause harm. The supplier may need to seek expert engineering or technical advice.

Regardless of any exemption or order provided by the EPA, the person who causes or permits the application of the substance to land must ensure that the action is lawful and consistent with any other legislative requirements including, if applicable, any development consent(s) for managing operations on the site(s).

The supply of excavated natural material remains subject to other relevant environmental regulations in the POEO Act and Waste Regulation. For example, a person who pollutes land (s. 142A) or water (s. 120), or causes air pollution through the emission of odours (s. 126), or does not meet the special requirements for asbestos waste (Part 7 of the Waste Regulation), regardless of this order, is guilty of an offence and subject to prosecution.

This order does not alter the requirements of any other relevant legislation that must be met in supplying this material, including for example, the need to prepare a Safety Data Sheet. Failure to comply with the conditions of this order constitutes an offence under clause 93 of the Waste Regulation.

Examples

In situ sampling at depth

Example 1.

If the proposed depth of ENM excavation is between 1 m bgl and 1.4 m bgl, then:

- 1 sample on surface (as per the requirements of Table 2).
- 1 sample at 1 m bgl.
- No further depth sampling after 1 m bgl, unless required under section 4.4.4.

Example 2.

If the proposed depth of ENM excavation is at 1.75 m bgl, then:

- 1 sample on surface (as per the requirements of Table 2).
- 1 sample at 1 m bgl.
- 1 sample at 1.75 m bgl.
- No further depth sampling after 1.75 m bgl, unless required under section 4.4.4.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Example 3.

If the proposed depth of ENM excavation is at 2.25 m bgl, then:

- 1 sample on surface (as per the requirements of Table 2).
- 1 sample at 1 m bgl.
- 1 sample at 2 m bgl.
- No further depth sampling after 2 m bgl, unless required under section 4.4.4.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Appendix C: Site Entry Material Compliance Checklist

Site Entry Material Compliance Checklist

Prior to any truck entering the site, the following conditions must be met.

1. The truck registration number must be on the list of approved registration numbers for the day's activities.
2. The truck must not be a semi-trailer.
3. The load must be covered with an automatic tarp cover.
4. The material must not contain anthropogenic material (i.e. ACM, bricks, concrete, staining or odours).

If any of the above detailed requirements are not met, the truck must not be granted access to site. In the event that a truck is rejected the following must immediately be undertaken:

- The truck must be turned back using the nominated turning bay/road.
- The supplier must be notified.
- This form, detailing the cause of the rejection, must be completed and signed by both the supplier and principal's representatives and outline the reasons for rejection.

Suppliers representative	Principal Contractor representative
Cause of rejection:	
Signatures:	

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

Appendix D: Material Compliance Checklist

Material Compliance Checklist:

JBS&G Material Characterisation Form (MCF) number:

Is the material VENM or ENM (please circle).

For every load of material imported and placed on the site, the following compliance checklist provided must be completed.

Table E. Compliance Checklist

Compliance Criteria	Yes (√/x)	No (√/x)	Outcome
Does material appear consistent with that described in the corresponding MCF?			If no, the area must be isolated and the Environmental Consultant notified.
Does the material contain any anthropogenic inclusions (e.g. potential ACM, bricks, concrete, staining or odours)			If Yes, the area must be isolated and the Environmental Consultant notified.
Does material visually meet the geotechnical requirements?			If no, the area must be isolated and the Geotechnician notified.
Has a random spot check been undertaken by the Environmental Consultant?			Random spot checks will be undertaken however are not a requirement for every load.

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019

© JBS&G

This document is and shall remain the property of JBS&G. The document may only be used for the purposes for which it was commissioned and in accordance with the Terms of Engagement for the commission. Unauthorised use of this document in any form whatsoever is prohibited

Document Distribution

Rev No.	Copies	Recipient	Date
A	1 x Electronic Copies	Murray Robertson Lend Lease Communities	08/06/2018

Document Status

Rev No.	Author	Reviewer	Approved for Issue		
		Name	Name	Signature	Date
A	George Black	Greg Dasey	DRAFT - Issue for Client Review		08/06/2018

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019



www.jbsg.com.au

Document Set ID: 8938849
Version: 1, Version Date: 25/11/2019