

Job No: 7824/4
Our Ref: 7824/4-ABR
3 September 2012

Landcom
c/- Craig & Rhodes Pty Ltd
PO Box 233
EPPING NSW 2121

Attention: Mr A Cameron

Dear Sir

re: **Proposed Residential Subdivision
North Penrith Defence Lands – Stage 1.2
Coreen Avenue, Penrith
Site Classification**

Please find herewith our site classification report for proposed dwellings to be located at the above subdivision. This report covers thirty six (36) lots, as follows;

- Lots 1201 to 1217 & Lot 1220 (18 lots)
- Reserve Lots 1218, 1219 (2 lots)
- Reserve Lot 1221, which has been subdivided into Lots 1221-1 to 1221-16, (16 lots)

This report contains information on surface and sub-surface conditions encountered at the site, together with an assessment of the site classifications in accordance with Australian Standard AS2870-2011 "Residential slabs and footings".

If you have any questions, please do not hesitate to contact the undersigned.

Yours faithfully
GEOTECH TESTING PTY LTD



JOSEPH KEANE
Geotechnical Engineer

Reviewed by



EMGED RIZKALLA
Director

LANDCOM
c/- CRAIG & RHODES PTY LTD

PROPOSED RESIDENTIAL SUBDIVISION
NORTH PENRITH DEFENCE LANDS – STAGE 1.2
COREEN AVENUE, PENRITH

SITE CLASSIFICATION

REPORT 7824/4-ABR 3 SEPTEMBER 2012

Head Office:
34 Borec Road, Penrith NSW 2750
P O Box 880 Penrith NSW 2751
Telephone: (02) 4722 2744 Facsimile: (02) 4722 2777
email: info@geotech.com.au

Prestons Laboratory:
Unit 4, 18-20 Whyalla Place, Prestons NSW 2170
Telephone: (02) 9607 6111 Facsimile: (02) 9607 6200

www.geotech.com.au

TABLE OF CONTENTS

| | Page |
|--|------|
| 1.0 INTRODUCTION ----- | 1 |
| 2.0 FIELD WORK ----- | 1 |
| 3.0 LABORATORY TESTING ----- | 1 |
| 4.0 SITE CONDITIONS ----- | 2 |
| 4.1 Surface Conditions ----- | 2 |
| 4.2 Sub-Surface Conditions ----- | 2 |
| 5.0 DISCUSSION & RECOMMENDATIONS ----- | 2 |
| 5.1 Fill Assessment ----- | 2 |
| 5.2 Site Classification ----- | 2 |

APPENDICES

| | |
|------------|--|
| APPENDIX A | <i>Table A – Summary of Test Pits Drawing No 7824/4-AB1 (Test Pit Location Plan)</i> |
| APPENDIX B | <i>Summary of Lot Classifications</i> |
| APPENDIX C | <i>Laboratory Test Results</i> |

1.0 INTRODUCTION

This report describes a geotechnical investigation for proposed dwellings to be constructed at Stage 1.2 North Penrith Defence Lands, Coreen Avenue, Penrith.

The following thirty six (36) lots are covered in this report.

- Lots 1201 to 1217 & Lot 1220 (18 lots)
- Reserve Lots 1218, 1219 (2 lots)
- Reserve Lot 1221, which has been subdivided into Lots 1221-1 to 1221-16, (16 lots)

Site classification in accordance with Australian Standard AS2870-2011 “Residential Slabs and Footings” is only applicable for the design of footing systems for a single dwelling, house, townhouse or similar structure that would be detached or separated by a party wall or common wall. AS2870-2011 is not suitable for dwellings situated vertically above or below another dwelling, including buildings classified as Class 1 and Class 10a in the Building Code of Australia (BCA). Therefore, a geotechnical investigation would be required for other dwellings to be classified in accordance with the BCA.

It is understood that the proposed dwellings are to be of brick veneer construction and wall loadings are expected to be in the range of 15kN/m to 50kN/m. The maximum working load (safe bearing pressure) would be in the order of 50kPa for ground supported floor slabs and 100kPa for strip and pad footings (AS2870-2011).

2.0 FIELD WORK

Field work for the investigation was carried out on 8 May and 25 August 2012 and consisted of excavation of seventeen test pits (TP1 to TP6 and TP24 to TP34) to a depth of 1.5m, using a rubber-tyred backhoe. The test pit logs are summarised and presented in Appendix A.

A geotechnical engineer supervised test pit excavation, recovered representative undisturbed samples and prepared the field logs.

The test pit locations are indicated on Drawing No 7824/4-AB1 in Appendix A.

3.0 LABORATORY TESTING

During the course of the investigation, three undisturbed (U50) samples of natural and fill materials were recovered for laboratory testing aimed at determining the reactivity of the materials to variations in moisture changes. The tests conducted were Shrink/Swell Index Determination (Iss), in accordance with Australian Standard AS1289.7.1.1. The laboratory test results are presented in Appendix C and summarised below.

| TP | Depth (m) | Iss (% _{pF}) | Summary Description |
|----|------------|------------------------|--|
| 8 | 0.4 – 0.55 | 0.7 | Fill: Clay, low plasticity, grey-brown |
| 26 | 0.4 – 0.6 | 1.9 | FILL: Silty Clay, medium plasticity, dark grey, trace of fine to medium gravel |
| 34 | 0.3 – 0.45 | 1.4 | FILL: Silty Clay, low plasticity, grey, trace of fine to medium gravel |

4.0 SITE CONDITIONS

4.1 Surface Conditions

The site comprises part of the North Penrith Defence Lands. The present investigation was carried out on lots located on the western, northern and north-eastern sides of the site. The lots were prepared by filling and devoid of grass and trees. The general slope of the site is towards the north-east. The site is bound to the north by Coreen Avenue, to the south by future development and Penrith Station, to the east by residential properties and to the west by future development and an unnamed road.

4.2 Sub-Surface Conditions

The test pit investigation revealed the following generalised sub-surface profile.

| | |
|----------------|--|
| Fill | Silty Clay, low to medium plasticity, orange-brown, with traces of shale gravel Clay, medium plasticity, grey, with traces of fine to medium grained red sand Clayey Sand, medium plasticity, yellow-brown Silty Sand, fine to medium grained, orange-brown |
| Natural | (CL-CI) Silty Clay, low to medium plasticity, dark grey, grey, orange-brown (CL-CI) Gravelly Silty Clay, low to medium plasticity, brown (CI) Clay, medium plasticity, grey |

Groundwater was not observed in the test pits during the short time they remained open. It must be noted that fluctuations in the level of groundwater might occur due to variations in rainfall, temperature and/or other factors not evident during investigation.

5.0 DISCUSSION & RECOMMENDATIONS

5.1 Fill Assessment

We have not received a fill plan for the Lots classified in this report. The test pits generally indicated that fill has been placed on almost all Lots.

Geotech Testing Pty Ltd carried out a number of compaction tests across the site in 2012 (Project Reference 7824/2). Based on test pit excavations and compaction tests results the fill is assessed to be "Controlled".

5.2 Site Classification

Based on the above information the classifications to AS2870-2011 are summarised in Appendix B. It should be noted that lots containing more than 400mm of clay fill (assessed as controlled fill) would originally be classified as Class P in accordance with AS2870-2011. However, based on the results of this investigation, which included laboratory testing, the lots are classified as detailed in Appendix B.

It is recommended that footings for proposed dwellings are founded on the same stratum, below any topsoil or deleterious material, to minimise the potential for differential movement.

The above recommendations are applicable to the Lots at the date of conducting the investigation, being 25 August 2012 and are made on the following assumptions;

7824/4-ABR

North Penrith Defence Lands - Stage 1.2

- The design and construction requirements of AS2870 must be followed.
- The recommendations for foundation performance and site maintenance set out in Appendix B of AS2870-2011 must be followed.
- The proposed dwellings must be in accordance with AS2870-2011. A detailed geotechnical investigation will be required for other dwellings that would be classified in accordance with the BCA.

It is recommended that house owners are made aware of recommendations in the CSIRO publication, "Guide to Home Owners on Foundation Maintenance and Footing Performance" and Appendix H of AS2871-2011.

GEOTECHNIQUE PTY LTD



APPENDIX A

TABLE A - TEST PIT LOGS
DRAWING NO 7824/4-AB1 - TEST PIT LOCATION PLAN

TABLE A

Job No: 7824/4
Our Ref: 7824/4-ABR

| TEST PIT NUMBER | DEPTH (m) | SAMPLE DEPTH (m) | MATERIAL DESCRIPTION |
|-----------------|-----------|------------------|--|
| 1 | 0.0-0.7 | - | (SG) Sandy GRAVEL, fine to medium grain, brown-grey, traces of medium plasticity clay, (M) |
| | 0.7-1.5 | - | (CI) Silty CLAY, medium plasticity, grey, orange-brown, M=PL |
| 2 | 0.0-0.3 | - | FILL; Silty Clay, low to medium plasticity, brown |
| | 0.3-0.9 | 0.4-0.55 | (CL-CI) Silty CLAY, low to medium plasticity, dark grey |
| | 0.9-1.5 | - | (CI) Silty CLAY, medium plasticity, grey, orange-brown |
| 3 | 0.0-0.7 | - | FILL; Sandy Clay, medium plasticity, yellow-brown |
| | 0.7-1.5 | - | (CI) CLAY, medium plasticity, grey-brown |
| 4 | 0.0-0.6 | - | (CL-CI) Silty CLAY, low to medium plasticity, dark grey |
| | 0.6-1.5 | - | (CI) Silty CLAY, medium plasticity, grey, orange-brown, M>PL |
| 5 | 0.0-0.7 | - | FILL; Clay, medium plasticity, grey, with traces of fine to medium grained red sand |
| | 0.7-1.5 | - | (CL-CI) Silty CLAY, low to medium plasticity, grey |
| 6 | 0.0-0.7 | - | FILL; Silty Sand, fine to medium grained, orange |
| | 0.7-1.1 | - | FILL; Silty Clay, low to medium plasticity, grey, traces of shale fragments |
| | 1.1-1.5 | - | (CL-CI) Silty CLAY, low to medium plasticity, grey, M≥PL |

TABLE A


Job No: 7824/4
Our Ref: 7824/4-ABR

| TEST PIT NUMBER | DEPTH (m) | SAMPLE DEPTH (m) | MATERIAL DESCRIPTION |
|-----------------|-----------|------------------|--|
| 24 | 0.0-0.4 | - | FILL; Silty Clay, low to medium plasticity, orange-brown |
| | 0.4-1.1 | - | FILL; Silty Sand, fine to medium grained, brown-orange, grey, with medium plasticity clay |
| | 1.1-1.5 | - | FILL; Clay, medium plasticity, grey, with orange-brown, fine to medium grained sand |
| 25 | 0.0-0.15 | - | FILL; Silty Clay, low to medium plasticity, grey-brown |
| | 0.15-1.1 | - | FILL; Silty Sand, fine to medium grained, orange, traces of low to medium plasticity clay |
| | 1.1-1.5 | - | (CI-CH) CLAY, medium to high plasticity, grey |
| 26 | 0.0-1.1 | 0.4-0.6 | FILL; Silty Clay, low to medium plasticity, grey-brown, traces of shale fragments |
| | 1.1-1.5 | - | (CL) Silty CLAY, low plasticity, grey-brown |
| 27 | 0.0-0.1 | - | FILL; Silty Clay, low to medium plasticity, grey |
| | 0.1-0.5 | - | FILL; Silty Clay, medium plasticity, grey, yellow-brown |
| | 0.5-1.5 | - | FILL; Silty Clay, low to medium plasticity, grey, brown, traces of fine to medium grained sand |
| 28 | 0.0-1.0 | - | FILL; Silty Clay, low to medium plasticity, brown-grey |
| | 1.0-1.5 | - | (CL-CI) Gravelly Silty CLAY, low to medium plasticity, brown |
| 29 | 0.0-0.6 | - | FILL; Silty Clay, low to medium plasticity, brown |
| | 0.6-1.1 | - | FILL; Silty Shaley Clay, low to medium plasticity, grey |
| | 1.1-1.5 | - | (CL-CI) Silty CLAY, low to medium plasticity, grey |
| 30 | 0.0-0.9 | - | FILL; Silty Clay, low to medium plasticity, dark grey |
| | 0.9-1.5 | - | FILL; Silty Clay, low to medium plasticity, grey, with shale fragments and gravel |

TABLE A

Job No: 7824/4
Our Ref: 7824/4-ABR

| TEST PIT NUMBER | DEPTH (m) | SAMPLE DEPTH (m) | MATERIAL DESCRIPTION |
|-----------------|-----------|------------------|--|
| 31 | 0.0-0.2 | - | FILL; Silty Clay, low to medium plasticity, brown |
| | 0.2-0.4 | - | FILL; Clay, medium plasticity, brown, grey |
| | 0.4-0.8 | - | (SM) Silty SAND, fine to medium grained, orange |
| | 0.8-1.2 | - | (CL-CI) Silty CLAY, low to medium plasticity, grey, traces of shale |
| | 1.2-1.5 | - | (CL) Silty CLAY, low plasticity, grey-brown |
| 32 | 0.0-0.2 | - | FILL; Clay, medium plasticity, grey |
| | 0.2-1.1 | - | FILL; Silty Clay, low to medium plasticity, grey, traces of shale fragments |
| | 1.1-1.5 | - | (CI) CLAY, medium plasticity, pale brown-orange |
| 33 | 0.0-0.3 | - | FILL; Silty Clay, low to medium plasticity, grey-brown, with shale fragments |
| | 0.3-0.6 | - | (SM) Silty SAND, fine to medium grained, dark grey |
| | 0.6-1.1 | - | (CL-CI) Silty CLAY, low to medium plasticity, grey |
| | 1.1-1.5 | - | (CL-CI) Silty CLAY, low to medium plasticity, brown-orange |
| 34 | 0.0-0.2 | - | FILL; Silty Clay, low to medium plasticity, brown, traces of gravel |
| | 0.2-0.9 | 0.3-0.45 | FILL; Silty Clay, low to medium plasticity, grey, traces of shale fragments |
| | 0.9-1.5 | - | (CL-CI) Silty CLAY, low to medium plasticity, brown |

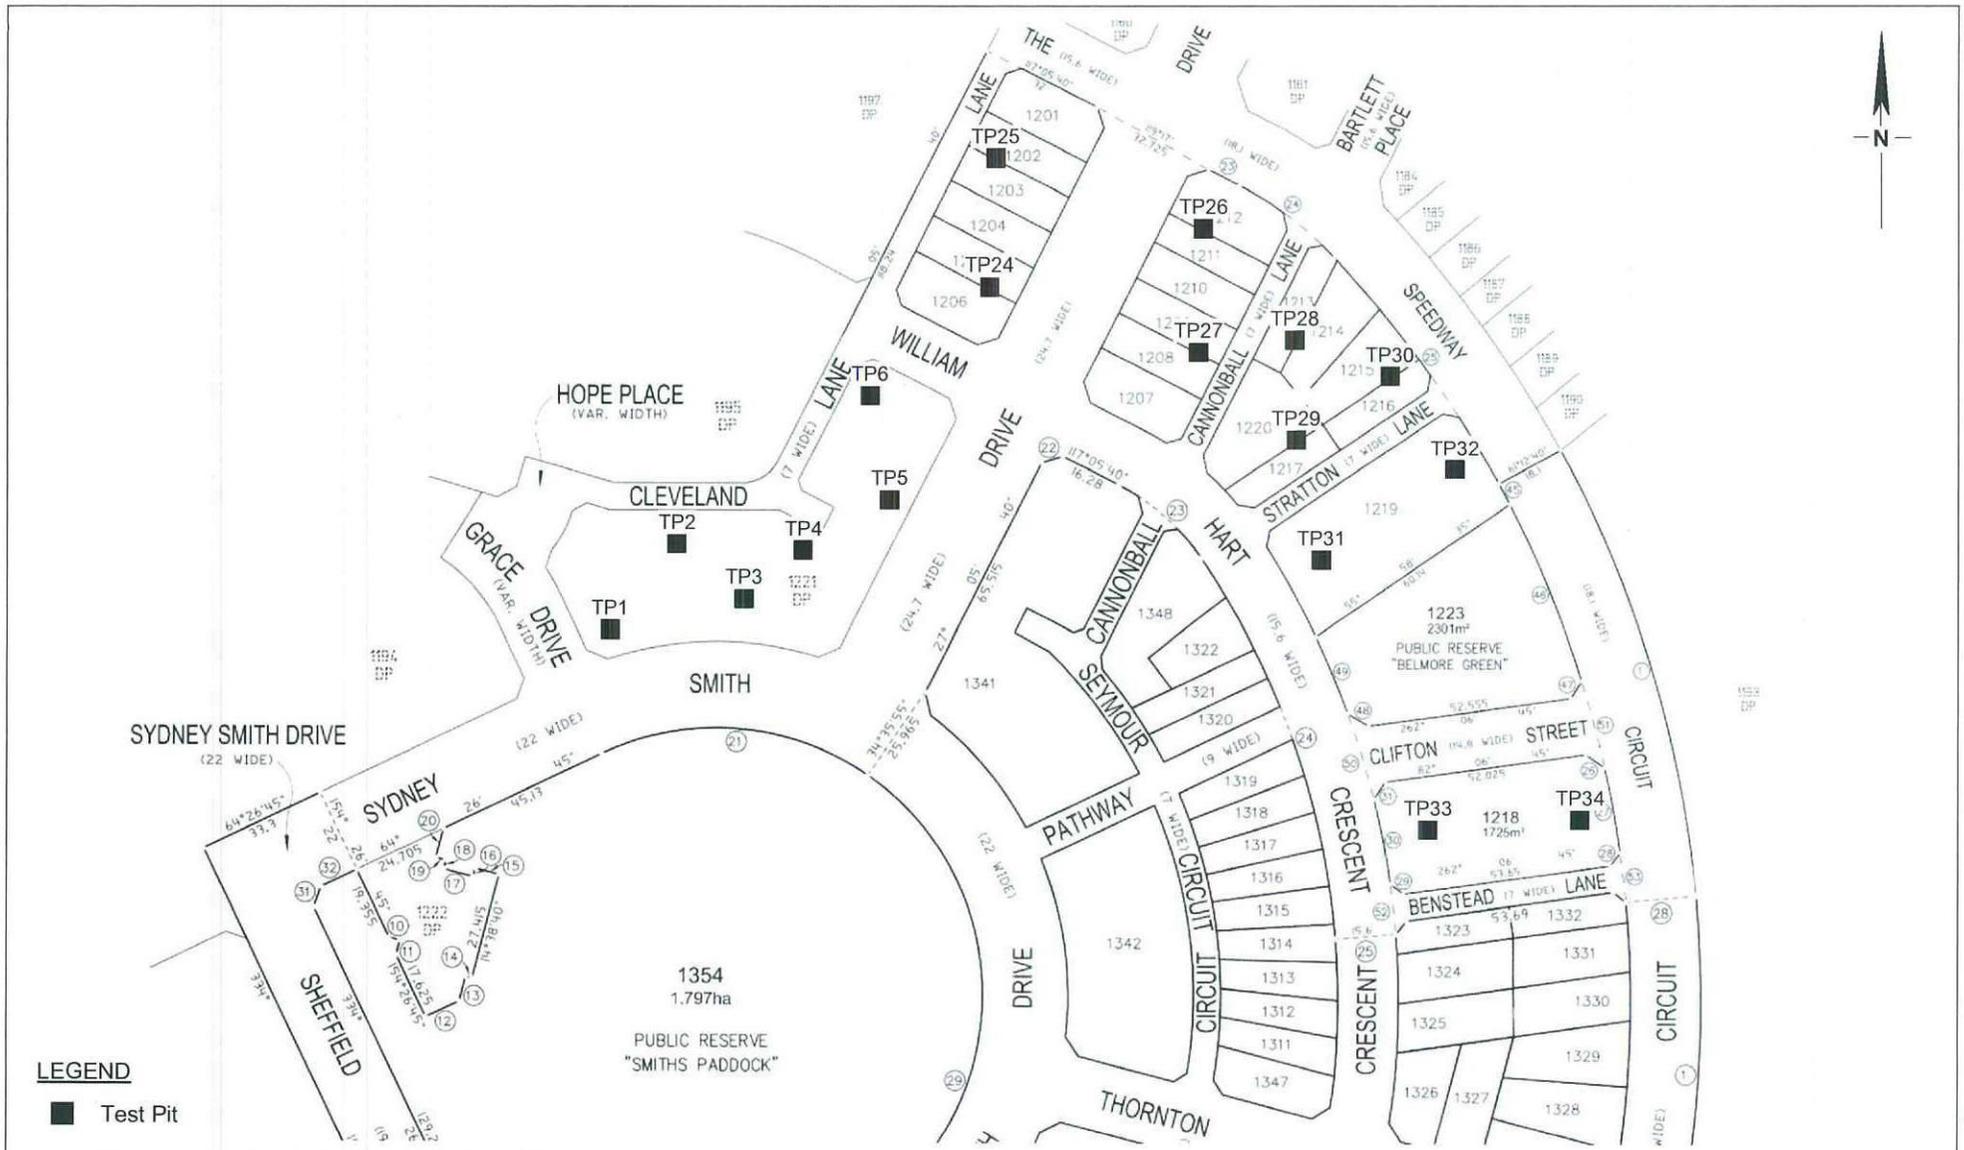

LEGEND

■ Test Pit



34 Borec Road
Penrith
NSW 2750
ABN 71 076 676 321

Ph: 02 4722 2744
Fx: 02 4722 2777
www.geotech.com.au
e-mail: info@geotech.com.au

NOTES

1. Site features are indicative and are not to scale.
2. This drawing has been produced using a base plan provided by others to which additional information e.g test pits, borehole locations or notes have been added. Some or all of the plan may not be relevant at the time of producing this drawing

Landcom
North Penrith Defence Lands
Stage 1.2

Test Pit Locations

Drawing No: 7824/4-AB1
Job No: 7842/4
Drawn By: MH
Date: 3 September 2012
Checked By: JK

File No: 7842-4
Layers: 0, AB1

APPENDIX B

**TABLE B
SUMMARY OF LOT CLASSIFICATIONS**

Job No: 7824/4
Our Ref: 7824/4-ABR

TABLE B

**PROPOSED RESIDENTIAL SUBDIVISION
NORTH PENRITH DEFENCE LANDS – STAGE 1.2
COREEN AVENUE, PENRITH**

| Lot Number | Classification | Lot Number | Classification |
|-------------------------------|----------------|------------|----------------|
| 1201 | M | 1221-1 | M |
| 1202 | M | 1221-2 | M |
| 1203 | M | 1221-3 | M |
| 1204 | M | 1221-4 | M |
| 1205 | M | 1221-5 | M |
| 1206 | M | 1221-6 | M |
| 1207 | M | 1221-7 | M |
| 1208 | M | 1221-8 | M |
| 1209 | M | 1221-9 | M |
| 1210 | M | 1221-10 | M |
| 1211 | M | 1221-11 | M |
| 1212 | M | 1221-12 | M |
| 1213 | M | 1221-13 | M |
| 1214 | M | 1221-14 | M |
| 1215 | M | 1221-15 | M |
| 1216 | M | 1221-16 | M |
| 1217 | M | | |
| 1218 (Reserve lot) | M | | |
| 1219 (Reserve lot) | M | | |
| 1220 | M | | |
| Class M (Moderately Reactive) | | | |

Australian Standard AS2870-2011 "Residential Slabs and Footings"

APPENDIX C

LABORATORY TEST RESULTS

CRAIG & RHODES PTY LTD
PO BOX 233
EPPING NSW 2121

Job No: 7824/4
Tested By: AN
Checked By: AK
Date Tested: 09/05/2012
Laboratory: Penrith

SITE CLASSIFICATION
NORTH PENRITH - STAGE 1 - COREEN AVENUE, PENRITH

TEST RESULTS - SHRINK / SWELL INDEX

| | | | | |
|-------------------------------|---|--|--|--|
| Test Procedure: AS 1289 7.1.1 | | | | |
| Sample Identification | Test Pit 2 | | | |
| Depth (m) | 0.4 - 0.55 | | | |
| Laboratory Number | 7824/4-1 | | | |
| Test Description | | | | |
| Moisture Content | | | | |
| Initial % | 18.9 | | | |
| Final % | 19.0 | | | |
| Swell % | Nil | | | |
| Shrinkage % | 3.5 | | | |
| Shrink/Swell Index %/pF | 1.9 | | | |
| Material Description | (CL-CI) Silty CLAY, low to medium plasticity, grey & orange-brown | | | |

Form No R007 Version 11/06/11



NATA Accreditation Number 2734
Corporate Site Number 2727

This document is issued in accordance with NATA's accreditation requirements. Accredited for compliance with ISO/IEC 17025. This document shall not be reproduced except in full.

A Kench

14/05/2012

Approved Signatory



Head Office:
34 Borec Road, Penrith NSW 2750
P O Box 880 Penrith NSW 2751
Telephone: (02) 4722 2744 Facsimile: (02) 4722 2777

Prestons Laboratory:
Unit 4, 18-20 Whyalla Place, Prestons NSW 2170
Telephone: (02) 9607 6111 Facsimile: (02) 9607 6200

email: info@geotech.com.au www.geotech.com.au

CRAIG & RHODES PTY LTD
PO BOX 233
EPPING NSW 2121

Job No: 7824/4
Tested By: AJP
Checked By: AK
Date Tested: 28/08/2012
Laboratory: Penrith

SITE CLASSIFICATION
NORTH PENRITH - STAGE 1 - COREEN AVENUE, PENRITH

TEST RESULTS - SHRINK / SWELL INDEX

| Test Procedure: AS 1289 7.1.1 | | | | |
|-------------------------------|--|--|--|--|
| Sample Identification | Test Pit 26 | Test Pit 34 | | |
| Depth (m) | 0.4 - 0.6 | 0.3 - 0.45 | | |
| Laboratory Number | 7824/4-5 | 7824/4-6 | | |
| Test Description | | | | |
| Moisture Content | | | | |
| Initial % | 14.7 | 12.8 | | |
| Final % | 18.2 | 15.9 | | |
| Swell % | 1.8 | 2.5 | | |
| Shrinkage % | 2.5 | 1.3 | | |
| Shrink/Swell Index %/pF | 1.9 | 1.4 | | |
| Material Description | FILL: Silty Clay, medium plasticity, dark grey, trace of fine to medium gravel | FILL: Silty Clay, low plasticity, grey, trace of fine to medium gravel | | |

Form No R007 Version 11/06/11



NATA Accredited for
TECHNICAL
COMPETENCE
NATA Accreditation Number 2734
Corporate Site Number 2727

This document is issued in accordance with NATA's accreditation requirements. Accredited for compliance with ISO/IEC 17025. This document shall not be reproduced except in full.

A Kench

28/08/2012

Approved Signatory



Head Office:
34 Borec Road, Penrith NSW 2750
P O Box 880 Penrith NSW 2751
Telephone: (02) 4722 2744 Facsimile: (02) 4722 2777

Prestons Laboratory:
Unit 4, 18-20 Whyalla Place, Prestons NSW 2170
Telephone: (02) 9607 6111 Facsimile: (02) 9607 6200

email: info@geotech.com.au www.geotech.com.au

LANDCOM
c/- CRAIG & RHODES PTY LTD

PROPOSED RESIDENTIAL SUBDIVISION
NORTH PENRITH DEFENCE LANDS – STAGE 1.2
COREEN AVENUE, PENRITH

SITE CLASSIFICATION

REPORT 7824/4-ABR 3 SEPTEMBER 2012

Head Office:
34 Borec Road, Penrith NSW 2750
P O Box 880 Penrith NSW 2751
Telephone: (02) 4722 2744 Facsimile: (02) 4722 2777

Prestons Laboratory:
Unit 4, 18-20 Whyalla Place, Prestons NSW 2170
Telephone: (02) 9607 6111 Facsimile: (02) 9607 6200

email: info@geotech.com.au www.geotech.com.au